

June 18, 2025, 1:59 AM GMT-2:30

REPAIR ESTIMATE PARTS \$2,792.00
LABOR \$1,740.00**TOTAL** **\$4,532.00**

2015

HYUNDAI SONATA 2.4L - CYLINDER

VIN

5NPE34AF6FH041882

ODO

194,000 km

ARB RISK

YES



STATUS

Bad



CHECK ENGINE

Off - Recently Cleared



ACTIVE CODES

4

**INSPECTION & MAINTENANCE MONITORS**

Misfire

Fuel

Catalyst

Oxygen Sensor

Components

Egr

Evaporative

Oxygen Sensor Heater

When the Check Engine Light is cleared, all of these Monitors are reset. Once the vehicle completes its drive cycles, it will report a checkmark for each Monitor and store an Active Code if a related problem exists.

SCAN SUMMARY

Emissions

Airbag (SRS)

Body Control Module (BCM)

Anti-lock Brake / Electronic Stability Control (ABSESP)

Powertrain Control Unit (EMS)

Transmission Control Unit (TCU)

Occupant Detection System (ODS)

The Scan Summary shows the state of each system that was diagnosed during the scan. A system is considered good if there are no codes, bad if there are active codes, or will show a warning if there are any non-active codes stored.

LEGEND

Good Warning Bad

CODES

6 Active

3 AIRBAG (SRS) CODES

TOTAL \$3572.00

B1102-00 Battery Voltage Low : No Sub Type Information

STATUS CONFIRMED

MOST LIKELY REPAIR Replaced Restraint Control Module
Repaired Restraint Control Module Wiring Harness

IMPACT SAFETY

ARB RISK YES

PART

Alternator, Battery, Airbag control module

PART	\$992.00
LABOR	\$540.00
TOTAL	\$1,532.00

B1493-00 PODS (Passenger Occupant Detecting System) Communication error : No Sub Type Information

STATUS CONFIRMED

MOST LIKELY REPAIR Replaced Occupant Detection Sensor

IMPACT SAFETY

ARB RISK YES

PART

Seat cushion, clock spring

PART	\$700.00
LABOR	\$420.00
TOTAL	\$1,120.00

B2500-00 Warning Lamp Fault - Short to Battery, Bulb, or Ground : No Sub Type Information

STATUS CONFIRMED

MOST LIKELY REPAIR Replaced Air Bag Indicator Lamp
Repaired Air Bag Indicator Lamp Connector

IMPACT SAFETY

ARB RISK YES

PART

fuse or bulb, siring harness and connector components

PART	\$560.00
LABOR	\$360.00
TOTAL	\$920.00

3 OCCUPANT DETECTION SYSTEM (ODS) CODES

TOTAL \$960.00

B1697-87 ACU Communication error : Missing Message

STATUS CONFIRMED

MOST LIKELY REPAIR Replace Airbag Control Unit (ACU) and wiring

IMPACT SAFETY

ARB RISK YES

PART

Seat ACU Module, Wiring repair kit

PART	\$540.00
LABOR	\$420.00
TOTAL	\$960.00