

**OWNER:** AEROPARTNER A.S.  
**ADDRESS:** K LETISTI / HANGAR C  
 PRAGUE 161 00  
**PHONE:**  
**FAX:**

**OPERATOR:** AEROPARTNER A.S.  
**ADDRESS:** K LETISTI / HANGAR C  
 PRAGUE 161 00  
**PHONE:**  
**FAX:**

**ANALYST:** GUILLAUME DUCLOS +33-1.55.93.45.84 (DIRECT)  
**EMAIL:** GUILLAUME.DUCLOS@CAMPSYSTEMS.EU +33 (0) 1.55.93.45.80 (OFFICE)  
 WWW.CAMPSYSTEMS.COM

PLEASE RECORD CHANGES TO ADDRESS, LAST ACTUALS (IF ANY) AND FAX THIS SHEET BACK TO CAMP.

**Filter Criteria:** Task Type In: ('AD','ADP','SB','SBP'); Group by Profile or Bulletin: Profile Type; Mode: With Compliance or Next Due; For: Airframe, Engine, APU Etc;

AIRCRAFT	SERIAL/REGNO:	525B-0220/OK-UMO	MODEL:	525B - CJ3	MANUFACTURER:	TEXTRON AVIATION INC.
			DATES	LAST ACTUALS	CURRENT ACTUAL	
			CERTIFICATION DATE: 20-FEB-2008	3036 A/C HRS as of 28-JUL-2025	_____ A/C HRS	as of ____/____/____
				2457 AFL as of 28-JUL-2025	_____ AFL	as of ____/____/____
				1228:48 ACH as of 10-MAY-2024	_____ ACH	as of ____/____/____
<b>ENGINE NO. 1</b>	<b>SERIAL/PART:</b>	141453/67000-200	<b>MODEL:</b>	FJ44-3A	<b>MANUFACTURER:</b>	WILLIAMS INTERNATIONAL
			INSTALLED ON 20-FEB-2008	LAST ACTUALS	CURRENT ACTUAL	
			1 ENG. HRS	1 A/C HRS	3036 ENG. HRS as of 28-JUL-2025	_____ ENG. HRS as of ____/____/____
			ENC		2462 ENC as of 28-JUL-2025	_____ ENC as of ____/____/____
<b>ENGINE NO. 2</b>	<b>SERIAL/PART:</b>	141454/67000-200	<b>MODEL:</b>	FJ44-3A	<b>MANUFACTURER:</b>	WILLIAMS INTERNATIONAL
			INSTALLED ON 20-FEB-2008	LAST ACTUALS	CURRENT ACTUAL	
			1 ENG. HRS	1 A/C HRS	3036 ENG. HRS as of 28-JUL-2025	_____ ENG. HRS as of ____/____/____
			ENC		2462 ENC as of 28-JUL-2025	_____ ENC as of ____/____/____

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
<b>AIRFRAME - AD - 525B-0220/OK-UMO</b>							
EASA 2019-0086 R01	FLIGHT CONTROLS – ACTIVE TECHNOLOGY LOAD ALLEVIATING SYSTEM – DEACTIVATION / MODIFICATION - AIRPLANE FLIGHT MANUAL SUPPLEMENT – AMENDMENT					MANDATORY	NOT APPLICABLE - EASA AD Rev.01 Checked. Tamarack ATLAS Winglets not Installed, No further action required
23-AUG-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2019-0086 R01 PARA (1)	DEACTIVATE THE ATLAS AND MODIFY THE TACS TO RESTRICT THEIR MOVEMENT, AMEND THE APPLICABLE AFMS, AMEND ITEM 27-60-01 "ATLAS INOPERATIVE" OF THE MMEL SUPPLEMENT TO REMOVE THE 10 FLIGHT HOURS (FH) TIME LIMIT,INFORM ALL FLIGHT CREWS AND, THEREAFTER, OPERATE THE AEROPLANE ACCORDINGLY					MANDATORY	NOT APPLICABLE - EASA AD Rev.01 Checked. Tamarack ATLAS Winglets not Installed, No further action required
23-AUG-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2019-0086 R01 PARA (4)	MODIFY THE AEROPLANE IN ACCORDANCE WITH THE INSTRUCTIONS OF SECTION 7 OF THE MODIFICATION SB.					MANDATORY	NOT APPLICABLE - EASA AD Rev.01 Checked. Tamarack ATLAS Winglets not Installed, No further action required
23-AUG-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2019-0086 R01 PARA (5)	MODIFICATION OF AN AEROPLANE AS REQUIRED BY PARAGRAPH (4) OF THIS AD CONSTITUTES TERMINATING ACTION FOR THE DEACTIVATION, LIMITATIONS AND REPETITIVE PRE-FLIGHT INSPECTIONS AS REQUIRED BY THIS AD FOR THAT AEROPLANE.					MANDATORY	NOT APPLICABLE - EASA AD Rev.01 Checked. Tamarack ATLAS Winglets not Installed, No further action required
23-AUG-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2019-0235 PARA (1) THRU (4)	CONCURRENTLY ACCOMPLISH PARAS (1.1) AND (1.2) OF THIS AD AND ACCOMPLISH APPLICABLE CORRECTIVE ACTION(S) (IF, DISCREPANCIES ARE DETECTED, AS IDENTIFIED IN THE SIL); OPERATORS MAY CONTINUE TO USE ELTS WITH THE ORIGINAL G-SWITCHES BY REDUCING THE INTERVAL OF THE G-SWITCH TESTING, AS REQUIRED BY PARA (1.1)					MANDATORY	NOT APPLICABLE - ELT PN: 453-5060 SN: 04225, UNIT INSTALLED IN NEW CONDITION DURING PRODUCTION, NEVER INSTALLED IN A HELICOPTER BEFORE / CAMO / JHA / 24.09.2019
	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2019-0235 PARA (5)	REMOVE THE AFFECTED PART FROM SERVICE IAW THE INSTRUCTIONS OF SECTION 7 OF THE SB FOR THE PURPOSE OF IN-SHOP MODIFICATION					MANDATORY	NOT APPLICABLE - ELT PN: 453-5060 SN: 04225, UNIT INSTALLED IN NEW CONDITION DURING PRODUCTION, NEVER INSTALLED IN A HELICOPTER BEFORE / CAMO / JHA / 24.09.2019
	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2021-0003	PLACARDS AND MARKINGS - EMERGENCY EXIT LABELS - INSTALLATION					MANDATORY	NOT APPLICABLE - AS PER P/N
	MOS HRS/MSC - AFL			21-SEP-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2021-0004	DOORS - COCKPIT ESCAPE HATCHES - REPLACEMENT					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		21-SEP-2022			
		HRS/MSC	-				
		AFL					
EASA 2021-0004 PARA (1)	REPLACE EACH AFFECTED PART WITH A SERVICEABLE PART					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		21-SEP-2022			
		HRS/MSC	-				
		AFL					
EASA 2021-0004 PARA (2)	DO NOT INSTALL AN AFFECTED PART ON ANY AEROPLANE, AS REQUIRED AFTER MODIFICATION OF THE AEROPLANE AS REQUIRED BY PARA (1) OR FROM THE EFFECTIVE DATE OF THIS AD					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		21-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2005-17-11	PREVENT INCORRECT INSTALLATION OF WIRES TO THE ENGINE FIRE EXTINGUISHER BOTTLES					MANDATORY	NOT APPLICABLE - AS PER EFFECTIVITY
		MOS		20-FEB-2008			
		HRS/MSC	A/R	0			
		AFL		0			
FAA 2010-04-16	TYPE H1-10 AIR HALON 1211 (BCF) PORTABLE FIRE EXTINGUISHERS MANUFACTURED BY SICLI					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		30-SEP-2022			
		HRS/MSC	A/R				
		AFL					
FAA 2012-11-09 R01	OXYGEN - INSTALLING A SUPPLEMENTAL OXYGEN SYSTEM IN AFFECTED LAVATORIES					MANDATORY	NOT APPLICABLE
27-JUL-2015		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2012-11-09 R01 PARA (G)	ACTIVATE ALL CHEMICAL OXYGEN GENERATORS IN THE LAVATORIES UNTIL THE GENERATOR OXYGEN SUPPLY IS EXPENDED OR REMOVE THE OXYGEN GENERATOR (S) AND REMOVE OR RE-STOW THE OXYGEN MASKS AND CLOSE THE MASK DISPENSER DOOR (FOR EACH CHEMICAL OXYGEN GENERATOR, AFTER THE GENERATOR IS EXPENDED (OR REMOVED))					MANDATORY	NOT APPLICABLE
27-JUL-2015		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2012-11-09 R01 PARA (L)	INSTALL A SUPPLEMENTAL OXYGEN SYSTEM THAT MEETS ALL APPLICABLE SECTIONS OF PARTS 25 AND 121 OF THE FEDERAL AVIATION REGULATIONS (14 CFR PART 25 AND 14 CFR PART 121) IN EACH LAVATORY					MANDATORY	NOT APPLICABLE
27-JUL-2015		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2014-18-01	NAVIGATION - ROCKWELL COLLINS, INC. MODE S TRANSPONDERS - INSPECTION / MODIFICATION					MANDATORY	NOT APPLICABLE - AFFECTED P/N NOT INSTALLED
14-OCT-2014		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2019-08-13	FLIGHT CONTROLS - MODELS 525, 525A, AND 525B AIRPLANES WITH TAMARACK ACTIVE LOAD ALLEViation SYSTEM (ATLAS) WINGLETS INSTALLED IN ACCORDANCE WITH SUPPLEMENTAL TYPE CERTIFICATE (STC) SA03842NY - REVISE THE OPERATING LIMITATIONS SECTION OF THE AIRPLANE FLIGHT MANUAL (AFM) TO PROHIBIT FURTHER FLIGHT (SUPERSEDED BY 2020-24-06)					SUPERSEDED	NOT APPLICABLE - TAMARACK ATLAS WINGLETS NOT INSTALLED, NO FURTHER ACTION REQUIRED. SUPERSEDED BY FAA AD 2020-24-06
24-MAY-2019		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
FAA 2020-24-06	FLIGHT CONTROLS - ACTIVE TECHNOLOGY LOAD ALLEVIATING SYSTEM – DEACTIVATION / MODIFICATION - AIRPLANE FLIGHT MANUAL SUPPLEMENT - AMENDMENT					MANDATORY	NOT APPLICABLE - AS ATLAS WINGLETS NOT INSTALLED
28-DEC-2020		MOS		21-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2023-10-02 PARA (I)	REVISE THE LIMITATIONS SECTION AND REMOVE THE AFM REVISION REQUIRED BY PARA (H) (AFTER 30 JUN 2023)					MANDATORY	- NOT ADOPTED BY EASA - NO FURTHER ACTION REQUIRED
		MOS		22-JUN-2023			
		HRS/MSC	BF/F				
		AFL					
FAA 2023-13-11 PARA (J)	REPORT THE RESULTS OF THE INSPECTION AND RETURN PARTS (AS REQUIRED)					MANDATORY	NOT APPLICABLE - AS PER PART NUMBER
39-22496		DAYS		17-AUG-2023			
		HRS/MSC	-				
		AFL					
FAA 2024-15-09	GUST LOCK/DAMPER SYSTEM - INSTALL PLACARDS ON THE LEFT-HAND INBOARD EDGE OF THE TAMARACK ACTIVE CAMBER SURFACE (TACS) AND REVISING THE EXISTING AIRPLANE FLIGHT MANUAL (AFM) FOR YOUR AIRPLANE					MANDATORY	NOT APPLICABLE
39-22800		MOS		(EFF)			
22-OCT-2024		HRS/MSC	-				
		AFL					
FAA AD 2007-23-16	ELECTRICAL POWER RELAY CIRCUIT PROTECTION KIT (REFERENCE AD: LBA LTA D-2008-057)					N/A BY A/C SERIAL NUMBER	NOT APPLICABLE - N/A BY AIRCRAFT S/N. NO FURTHER ACTIONS REQUIRED.
		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
FAA AD 2008-03-10	LOWER WING SKIN STRUCTURE (REFERENCE AD: LBA LTA D-2008-129)					N/A BY A/C SERIAL NUMBER	NOT APPLICABLE - N/A BY AIRCRAFT S/N. NO FURTHER ACTIONS REQUIRED.
		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
LBA D-2019-103	FLIGHT CONTROLS - ACTIVE TECHNOLOGY LOAD ALLEVIATING SYSTEM - DEACTIVATION/MODIFICATION					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY LBA AD D-2019-103 R01. TAMARACK ATLAS WINGLETS NOT INSTALLED, SEE ALSO EASA EMERGENCY AD 2019-0086-E, NO FURTHER ACTION REQUIRED
23-APR-2019		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
LBA D-2019-103 R01	FLIGHT CONTROLS - ACTIVE TECHNOLOGY LOAD ALLEVIATING SYSTEM - DEACTIVATION / MODIFICATION (AFMS) AIRPLANE FLIGHT MANUAL SUPPLEMENT - AMENDMENT					MANDATORY	NOT APPLICABLE - LBA-D-2019 Rev.01 Checked. Tamarack ATLAS Winglets not Installed, No further action required
13-AUG-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
<b>APPLIANCE - 525B-0220/OK-UMO</b>							
CAA UK G-2021-0003	APPLIANCE AD - EQUIPMENT / FURNISHINGS - LIFE JACKET - INSPECTION					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		26-SEP-2022			
		HRS/MSC	-				
		AFL					
CAA UK G-2021-0004	APPLIANCE AD - EQUIPMENT / FURNISHINGS - LIFE RAFT - INSPECTION					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
		MOS		26-SEP-2022			
		HRS/MSC	-				
		AFL					
CAA UK G-2021-0004 PARA (1) & (2)	PERFORM INSPECTION AND FUNCTIONAL CHECK OF LIFE RAFT IN ACCORDANCE WITH ALERT SERVICE BULLETIN 25-197-A; IF DISCREPANCIES ARE DETECTED, REMOVE AND REPLACE THE AFFECTED PART WITH A NEW OR SERVICEABLE PART					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
		MOS		26-SEP-2022			
		HRS/MSC	-				
		AFL					
CAA UK G-2021-0004 PARA (4)	REPORT THE INSPECTION RESULTS (INCLUDING NO FINDINGS) TO SURVITEC					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
		DAYS		26-SEP-2022			
		HRS/MSC	-				
		AFL					
CAA UK G-2022-0009	APPLIANCE AD - EQUIPMENT / FURNISHINGS - LIFEJACKETS - INSPECTION					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		21-SEP-2022			
		HRS/MSC	-				
		AFL					
CAA UK G-2022-0011	APPLIANCE AD - ATA 25 - EQUIPMENT / FURNISHINGS - PILOT & CO-PILOT SEATS - INSPECTION / MODIFICATION					MANDATORY	NOT APPLICABLE - AS PER P/N
23-JUN-2022		MOS		21-SEP-2022			
		HRS/MSC	-				
		AFL					
CAA UK G-2022-0011 PARA (1)	INSPECT ANY AFFECTED SPRING OF EACH AFFECTED SEAT IN ACCORDANCE WITH THE INSTRUCTIONS OF THE INSPECTION SB (SB 063-25-14)					MANDATORY	NOT APPLICABLE - AS PER P/N
23-JUN-2022		MOS		21-SEP-2022			
		HRS/MSC	-				
		AFL					
CAA UK G-2022-0011 PARA (2)	REPLACE BOTH SPRINGS IN ACCORDANCE WITH THE INSTRUCTIONS OF THE INSPECTION SB (SB 063-25-14)					MANDATORY	NOT APPLICABLE - AS PER P/N
23-JUN-2022		MOS		21-SEP-2022			
		HRS/MSC	-				
		AFL					
CAA UK G-2022-0011 PARA (4)	MODIFY AND RE-IDENTIFY EACH AFFECTED SEAT					MANDATORY	NOT APPLICABLE - AS PER P/N
23-JUN-2022		MOS		21-SEP-2022			
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2006-0334 R1	APPLIANCE AD - COMMUNICATIONS - THALES COMMUNICATIONS VHF DATA RADIO - MODIFICATION - THALES COMMUNICATIONS					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
EASA 2007-0256-CN	APPLIANCE AD - ATA 25 – CANCELLED: EQUIPMENT / FURNISHINGS - SEAT RESTRAINT SYSTEM PLASTIC ROTARY BUCKLE HANDLE - INSPECTION / REPLACEMENT					CANCELLED	- CANCELLED
		MOS		05-DEC-2022			
		HRS/MSC	- (s)				
		AFL					
EASA 2008-0159	APPLIANCE AD - NAVIGATION SYSTEMS – MODE-S TRANSPONDER – MODIFICATION / REPLACEMENT - HONEYWELL INTERNATIONAL INC.					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
EASA 2008-0183	APPLIANCE AD - NAVIGATION – MODE-S TRANSPONDERS – REPLACEMENT - FUNKWERK AVIONICS GMBH, FILSER ELECTRONIC GMBH					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
EASA 2009-0173 R1	APPLIANCE AD - NAVIGATION – MODE S TRANSPONDER – MODIFICATION / REPLACEMENT - ROCKWELL COLLINS INC.					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
EASA 2009-0200	APPLIANCE AD - NAVIGATION - NARCO AVIONICS INC AT-150 MODE A/C TRANSPONDER -CHECK/MODIFICATION (VSB AT150 NO. 6, VAD 2004-08-16)					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
EASA 2009-0251-E	APPLIANCE/EMERGENCY AD - FIRE PROTECTION - PORTABLE FIRE EXTINGUISHERS - IDENTIFICATION / REPLACEMENT- FIRE FIGHTING ENTERPRISES LIMITED					MANDATORY	NOT APPLICABLE - AS PER P/N
		DAYS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
EASA 2009-0262 R1	APPLIANCE AD - FIRE PROTECTION - HALON 1211 FIRE EXTINGUISHERS - IDENTIFICATION/REPLACEMENT - FIRE FIGHTING ENTERPRISES LIMITED					MANDATORY	NOT APPLICABLE - AS PER P/N
		DAYS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
EASA 2009-0278	APPLIANCE AD - PORTABLE HALON 1211 FIRE EXTINGUISHERS - IDENTIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - AS PER P/N
05-JAN-2010		MOS		30-SEP-2022			
		HRS/MSC	A/R				
		AFL					
EASA 2009-0278 PARA (1)	IDENTIFY PORTABLE HALON 1211 FIRE EXTINGUISHERS - IDENTIFICATION / REPLACEMENT SERIAL NUMBER OF FIRE EXTINGUISHER					MANDATORY	NOT APPLICABLE - AS PER P/N
05-JAN-2010		MOS		30-SEP-2022			
		HRS/MSC	A/R				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2009-0278 PARA (2)	RETURN PORTABLE HALON 1211 FIRE EXTINGUISHERS - IDENTIFICATION / REPLACEMENT DEFECTIVE FIRE EXTINGUISHER					MANDATORY	NOT APPLICABLE - AS PER P/N
05-JAN-2010		MOS HRS/MSC AFL		30-SEP-2022			
EASA 2010-0003 R02	APPLIANCE AD - NAVIGATION - MODE S TRANSPONDER AIRCRAFT TYPE MODE STRAPPING - CHECK / MODIFICATION					MANDATORY	COMPLIED WITH - COMPLIED WITH; NO FURTHER ACTION REQUIRED
14-OCT-2014		MOS HRS/MSC AFL		16-FEB-2015 897 783			
EASA 2010-0003 R02 PARA (1)	VERIFY AIRCRAFT TYPE MODE STRAPPING CODE S SET TO '0' (ZERO) OR '1', AS DEFINED IN ROCKWELL-COLLINS SERVICE LETTER TDR-94( ) SIL 07-2.					MANDATORY	COMPLIED WITH - COMPLIED WITH; NO FURTHER ACTION REQUIRED
14-OCT-2014		MOS HRS/MSC AFL		16-FEB-2015 897 783			
EASA 2010-0003 R02 PARA (2)	EXEMPTIONS: DASSAULT AEROPLANES					MANDATORY	COMPLIED WITH - C/W. SEE MTR ID # 2396714. NO FURTHER ACTIONS REQUIRED.
14-OCT-2014		MOS HRS/MSC AFL		05-DEC-2022			
EASA 2010-0003 R02 PARA (3)	EXEMPTIONS: ATR 42 AND ATR 72 AEROPLANES					MANDATORY	COMPLIED WITH - C/W. SEE MTR ID # 2396714. NO FURTHER ACTIONS REQUIRED.
14-OCT-2014		MOS HRS/MSC AFL		05-DEC-2022			
EASA 2010-0003 R02 PARA (4)	EXEMPTIONS: SAAB 2000 AEROPLANES					MANDATORY	COMPLIED WITH - C/W. SEE MTR ID # 2396714. NO FURTHER ACTIONS REQUIRED.
14-OCT-2014		MOS HRS/MSC AFL		05-DEC-2022			
EASA 2010-0003 R02 PARA (5)	EXEMPTIONS: BOMBARDIER AEROSPACE (CANADAIR) AEROPLANES: CL-600-2B16 (604 VARIANT) AND CL-600-2B19 (RJ100 AND RJ200)					MANDATORY	COMPLIED WITH - C/W. SEE MTR ID # 2396714. NO FURTHER ACTIONS REQUIRED.
14-OCT-2014		MOS HRS/MSC AFL		05-DEC-2022			
EASA 2010-0003 R02 PARA (6)	EXEMPTIONS: CESSNA AIRCRAFT COMPANY AEROPLANES: CESSNA MODEL 525, 525A, 525B; AND CESSNA MODEL 525, 525A, 525B, 560; 560XL					MANDATORY	COMPLIED WITH - C/W. SEE MTR ID # 2396714. NO FURTHER ACTIONS REQUIRED.
14-OCT-2014		MOS HRS/MSC AFL		05-DEC-2022			
EASA 2010-0003 R02 PARA (7)	EXEMPTIONS: PIAGGIO AERO INDUSTRIES AEROPLANES: P.180 (AVANTI) AND P.180 (AVANTI II)					MANDATORY	COMPLIED WITH - C/W. SEE MTR ID # 2396714. NO FURTHER ACTIONS REQUIRED.
14-OCT-2014		MOS HRS/MSC AFL		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2010-0062 R1	APPLIANCE AD - FIRE PROTECTION - HALON 1211 FIRE EXTINGUISHERS - IDENTIFICATION / REPLACEMENT - FIRE FIGHTING ENTERPRISES LIMITED			MOS HRS/MSC - AFL	30-SEP-2022	MANDATORY	NOT APPLICABLE - AS PER P/N
EASA 2010-0067	APPLIANCE AD - NAVIGATION - MODE S TRANSPONDER - CHECK / MODIFICATION - ROCKWELL COLLINS INC.			MOS HRS/MSC - AFL	30-SEP-2022	MANDATORY	NOT APPLICABLE - AS PER P/N
EASA 2010-0152	APPLIANCE AD - EQUIPMENT AND FURNISHING - OXYGEN MASK REGULATOR - MODIFICATION - INTERTECHNIQUE			MOS HRS/MSC - AFL	30-SEP-2022	MANDATORY	NOT APPLICABLE - AS PER P/N
EASA 2010-0204	APPLIANCE AD - NAVIGATION SYSTEMS – MODE-S TRANSPONDER – MODIFICATION / REPLACEMENT - ROCKWELL-COLLINS INC.			MOS HRS/MSC - AFL	30-SEP-2022		NOT APPLICABLE - AS PER P/N
EASA 2011-0090 R1	APPLIANCE AD - OXYGEN – OXYGEN MASK REGULATOR INFLATABLE HARNESS – IDENTIFICATION / REPLACEMENT - INTERTECHNIQUE (PART OF ZODIAC AEROSPACE), EROS			MOS HRS/MSC - AFL	30-SEP-2022	MANDATORY	NOT APPLICABLE - AS PER P/N
EASA 2011-0103	APPLIANCE AD - EQUIPMENT / FURNISHINGS - EMERGENCY LOCATOR TRANSMITTER (ELT) ANTENNA - MODIFICATION / REPLACEMENT - CHELTON LIMITED			DAYS HRS/MSC A/R AFL	30-SEP-2022	MANDATORY	NOT APPLICABLE - AS PER P/N
EASA 2012-0037	APPLIANCE AD - FIRE PROTECTION - HAND OPERATED FIRE EXTINGUISHER - MODIFICATION - KIDDE GRAVINGER (A HAMILTON SUNDSTRAND COMPANY)			MOS HRS/MSC - AFL	30-SEP-2022		NOT APPLICABLE - AS PER P/N
EASA 2012-0254	APPLIANCE AD - OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR -IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT			MOS HRS/MSC - AFL	30-SEP-2022	SUPERSEDED	NOT APPLICABLE - NOT AFFECTED - PART- AND SERIALNUMBER NOT APPLICABLE.
13-DEC-2012				MOS HRS/MSC - AFL	10-JAN-2013 708 620		
EASA 2012-0254 PARA (1)	INSPECT/CHECK OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR -IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT OXYGEN MASK REGULATOR TO IDENTIFY THE P/N AND S/N					SUPERSEDED	NOT APPLICABLE - NOT AFFECTED - PART- AND SERIALNUMBER NOT APPLICABLE.
13-DEC-2012				DAYS HRS/MSC - AFL	10-JAN-2013 708 620		
EASA 2012-0254 PARA (2.1)	REPLACE OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR -IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT AFFECTED OXYGEN MASK REGULATOR					SUPERSEDED	NOT APPLICABLE - NOT AFFECTED - PART- AND SERIALNUMBER NOT APPLICABLE.
13-DEC-2012				MOS HRS/MSC - AFL	10-JAN-2013 708 620		

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2012-0254 PARA (2.2)	AMEND OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT AIRCRAFT FLIGHT MANUAL (AFM)					SUPERSEDED	NOT APPLICABLE - NOT Affected - PART- AND SERIALNUMBER NOT APPLICABLE.
13-DEC-2012		MOS		10-JAN-2013			
		HRS/MSC	-	708			
		AFL		620			
EASA 2012-0254 PARA (3)	REPLACE OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT EACH Affected FLIGHT CREW OXYGEN MASK REGULATOR WITH A SERVICEABLE PART					SUPERSEDED	NOT APPLICABLE - NOT Affected - PART- AND SERIALNUMBER NOT APPLICABLE.
13-DEC-2012		MOS		10-JAN-2013			
		HRS/MSC	-	708			
		AFL		620			
EASA 2012-0254 R01	APPLIANCE AD - OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT					MANDATORY	NOT APPLICABLE - NOT Affected - PART- AND SERIALNUMBER NOT APPLICABLE.
21-DEC-2012		MOS		10-JAN-2013			
		HRS/MSC	-	708			
		AFL		612			
EASA 2012-0254 R01 PARA (1)	INSPECT OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT EACH FLIGHT CREW OXYGEN MASK REGULATOR TO IDENTIFY THE P/N AND S/N					MANDATORY	NOT APPLICABLE - NOT Affected - PART- AND SERIALNUMBER NOT APPLICABLE.
21-DEC-2012		DAYs		10-JAN-2013			
		HRS/MSC	-	708			
		AFL		612			
EASA 2012-0254 R01 PARA (2.1)	REPLACE OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT EACH Affected FLIGHT CREW OXYGEN MASK REGULATOR WITH A SERVICEABLE PART					MANDATORY	NOT APPLICABLE - NOT Affected - PART- AND SERIALNUMBER NOT APPLICABLE.
21-DEC-2012		DAYs		10-JAN-2013			
		HRS/MSC	-	708			
		AFL		612			
EASA 2012-0254 R01 PARA (2.2)	AMEND OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT THE AIRCRAFT FLIGHT MANUAL (AFM) AND INSTALL A PLACARD					MANDATORY	NOT APPLICABLE - NOT Affected - PART- AND SERIALNUMBER NOT APPLICABLE.
21-DEC-2012		DAYs		10-JAN-2013			
		HRS/MSC	-	708			
		AFL		612			
EASA 2012-0254 R01 PARA (3)	REPLACE OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT EACH Affected FLIGHT CREW OXYGEN MASK REGULATOR					MANDATORY	NOT APPLICABLE - NOT Affected - PART- AND SERIALNUMBER NOT APPLICABLE.
21-DEC-2012		MOS		10-JAN-2013			
		HRS/MSC	-	708			
		AFL		612			
EASA 2013-0020	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					SUPERSEDED	COMPLIED WITH - SEE ALSO MTR ID # 2188369 EASA 2013-0020 R2. FOUND NOT Affected, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
14-FEB-2013		MOS		27-FEB-2013			
		HRS/MSC	-				
		AFL					
EASA 2013-0020 PARA (1)	INSPECT EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT THE MARKINGS OF SAFETY BELTS AND/OR TORSO RESTRAINT SYSTEMS, TO DETERMINE IF THEY HAVE BEEN MAINTAINED OR REPAIRED BY ORGANISATIONS OTHER THAN THE DESIGN APPROVAL HOLDER					SUPERSEDED	COMPLIED WITH - SEE ALSO MTR ID # 2188369 EASA 2013-0020 R2. FOUND NOT Affected, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
14-FEB-2013		MOS		27-FEB-2013			
		HRS/MSC	-	713			
		AFL		620			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2013-0020 PARA (2)	VERIFY EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT IF THE ORGANISATION IS LISTED AMONG THE AUTHORIZED MAINTENANCE OR REPAIR ORGANISATION REFERENCE DOCUMENTS QUOTED IN THE REF. PUBLICATIONS SECTION OF THIS AD					SUPERSEDED	COMPLIED WITH - SEE ALSO MTR ID # 2188369 EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
14-FEB-2013		MOS		27-FEB-2013			
		HRS/MSC	-	713			
		AFL		620			
EASA 2013-0020 PARA (3)	REMOVE EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT AND REPLACE BELTS NOT MEETING THE CERTIFICATION REQUIREMENTS OR MAKE RELEVANT SEAT INOPERATIVE					SUPERSEDED	COMPLIED WITH - SEE ALSO MTR ID # 2188369 EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
14-FEB-2013		MOS		15-FEB-2013			
		HRS/MSC	-				
		AFL					
EASA 2013-0020 R01	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					SUPERSEDED	COMPLIED WITH - SEE ALSO MTR ID # 2188369 EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
12-MAR-2013		MOS		27-FEB-2013			
		HRS/MSC	-				
		AFL					
EASA 2013-0020 R01 PARA (1)	EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT INSPECT THE MARKINGS OF SAFETY BELTS AND/OR TORSO RESTRAINT SYSTEMS, TO DETERMINE IF THEY HAVE BEEN MAINTAINED OR REPAIRED BY ORGANISATIONS OTHER THAN THE DESIGN APPROVAL HOLDER					SUPERSEDED	COMPLIED WITH - SEE ALSO MTR ID # 2188369 EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
12-MAR-2013		MOS		27-FEB-2013			
		HRS/MSC	-				
		AFL					
EASA 2013-0020 R01 PARA (2)	EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT VERIFY IF THE ORGANISATION IS LISTED AMONG THE AUTHORIZED MAINTENANCE OR REPAIR ORGANISATION REFERENCE DOCUMENTS QUOTED IN THE REF. PUBLICATIONS SECTION OF THIS AD					SUPERSEDED	COMPLIED WITH - SEE ALSO MTR ID # 2188369 EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
12-MAR-2013		MOS		27-FEB-2013			
		HRS/MSC	- (s)				
		AFL					
EASA 2013-0020 R01 PARA (3)	EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT REMOVE AND REPLACE BELTS NOT MEETING THE CERTIFICATION REQUIREMENTS OR MAKE RELEVANT SEAT INOPERATIVE					SUPERSEDED	COMPLIED WITH - PERFORMED EASA AD 2013-0020 R1 (3) , FOUND SAFETY BELTS / TORSO RESTRAINT SYSTEMS NOT MODIFIED OR REPLACED SINCE AIRCRAFT NEW.
12-MAR-2013		MOS		16-AUG-2013			
		HRS/MSC	- (s)	764			
		AFL		666			
EASA 2013-0020 R01 PARA (4)	EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT AFTER 14 FEBRUARY 2013 [THE EFFECTIVE DATE OF THE ORIGINAL ISSUE OF THIS AD], DO NOT INSTALL SAFETY BELTS OR TORSO RESTRAINT SYSTEMS ON ANY AIRCRAFT, UNLESS INSPECTED AND CORRECTED IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD.					SUPERSEDED	COMPLIED WITH - SEE ALSO MTR ID # 2188369 EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
12-MAR-2013		MOS		27-FEB-2013			
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2013-0020 R02	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					SUPERSEDED	COMPLIED WITH - PERFORMED EASA 2013-0020 R2 , FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-JUL-2013		MOS		16-AUG-2013			
		HRS/MSC	-	764			
		AFL		666			
EASA 2013-0020 R02 PARA (1)	EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT INSPECT THE MARKINGS OF SAFETY BELTS AND/OR TORSO RESTRAINT SYSTEMS, TO DETERMINE IF THEY HAVE BEEN MAINTAINED OR REPAIRED BY ORGANISATIONS OTHER THAN THE DESIGN APPROVAL HOLDER			INSPECT		SUPERSEDED	COMPLIED WITH - PERFORMED EASA 2013-0020 R2 , FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-JUL-2013		MOS		16-AUG-2013			
		HRS/MSC	-	764			
		AFL		666			
EASA 2013-0020 R02 PARA (2)	EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT VERIFY IF THE ORGANISATION IS LISTED AMONG THE AUTHORIZED MAINTENANCE OR REPAIR ORGANISATION REFERENCE DOCUMENTS QUOTED IN THE REF. PUBLICATIONS SECTION OF THIS AD			VERIFY		SUPERSEDED	COMPLIED WITH - PERFORMED EASA 2013-0020 R2 , FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-JUL-2013		MOS		16-AUG-2013			
		HRS/MSC	- (s)	764			
		AFL		666			
EASA 2013-0020 R02 PARA (3)	EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT REMOVE AND REPLACE BELTS NOT MEETING THE CERTIFICATION REQUIREMENTS OR MAKE RELEVANT SEAT INOPERATIVE			REMOVE		SUPERSEDED	COMPLIED WITH - PERFORMED EASA 2013-0020 R2 , FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-JUL-2013		MOS		16-AUG-2013			
		HRS/MSC	- (s)	764			
		AFL		666			
EASA 2013-0020 R02 PARA (4)	EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT AFTER 14 FEBRUARY 2013 [THE EFFECTIVE DATE OF THE ORIGINAL ISSUE OF THIS AD], DO NOT INSTALL SAFETY BELTS OR TORSO RESTRAINT SYSTEMS ON ANY AIRCRAFT, UNLESS INSPECTED AND CORRECTED IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD			AFTER		SUPERSEDED	COMPLIED WITH - PERFORMED EASA 2013-0020 R2 , FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-JUL-2013		MOS		16-AUG-2013			
		HRS/MSC	-	764			
		AFL		666			
EASA 2013-0020 R03	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					SUPERSEDED	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
28-MAR-2014		MOS		21-FEB-2014			
		HRS/MSC	-	812			
		AFL		708			
EASA 2013-0020 R03 PARA (1)	INSPECT THE MARKINGS OF SAFETY BELTS AND/OR TORSO RESTRAINT SYSTEMS, TO DETERMINE IF THEY HAVE BEEN MAINTAINED OR REPAIRED BY ORGANISATIONS OTHER THAN THE DESIGN APPROVAL HOLDER			INSPECT		SUPERSEDED	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
28-MAR-2014		MOS		21-FEB-2014			
		HRS/MSC	-	812			
		AFL		708			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2013-0020 R03 PARA (2)	VERIFY IF THE ORGANISATION IS LISTED AMONG THE AUTHORIZED MAINTENANCE OR REPAIR ORGANISATION REFERENCE DOCUMENTS QUOTED IN THE REF. PUBLICATIONS SECTION OF THIS AD					SUPERSEDED	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
28-MAR-2014		MOS HRS/MSC - AFL		21-FEB-2014 812 708			
EASA 2013-0020 R03 PARA (3)	REMOVE AND REPLACE BELTS NOT MEETING THE CERTIFICATION REQUIREMENTS OR MAKE RELEVANT SEAT INOPERATIVE					SUPERSEDED	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
28-MAR-2014		MOS HRS/MSC - AFL		21-FEB-2014 812 708			
EASA 2013-0020 R03 PARA (4)	AFTER 14 FEBRUARY 2013 [THE EFFECTIVE DATE OF THE ORIGINAL ISSUE OF THIS AD], DO NOT INSTALL SAFETY BELTS OR TORSO RESTRAINT SYSTEMS ON ANY AIRCRAFT, UNLESS INSPECTED AND CORRECTED IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD					SUPERSEDED	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
28-MAR-2014		MOS HRS/MSC - AFL		21-FEB-2014 812 708			
EASA 2013-0020 R04	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					MANDATORY	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-JUL-2014		MOS HRS/MSC - AFL		16-AUG-2013			
EASA 2013-0020 R04 PARA (1)	INSPECT THE MARKINGS OF SAFETY BELTS AND/OR TORSO RESTRAINT SYSTEMS, TO DETERMINE IF THEY HAVE BEEN MAINTAINED OR REPAIRED BY ORGANISATIONS OTHER THAN THE DESIGN APPROVAL HOLDER					MANDATORY	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-JUL-2014		MOS HRS/MSC DUE AFL		27-FEB-2013			
EASA 2013-0020 R04 PARA (2)	VERIFY IF THE ORGANISATION IS LISTED AMONG THE AUTHORIZED MAINTENANCE OR REPAIR ORGANISATION REFERENCE DOCUMENTS QUOTED IN THE REF. PUBLICATIONS SECTION OF THIS AD					MANDATORY	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-JUL-2014		MOS HRS/MSC AFL	1 (s)	16-AUG-2013			
EASA 2013-0020 R04 PARA (3)	REMOVE AND REPLACE BELTS NOT MEETING THE CERTIFICATION REQUIREMENTS OR MAKE RELEVANT SEAT INOPERATIVE					MANDATORY	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-JUL-2014		MOS HRS/MSC - (s) AFL		16-AUG-2013			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2013-0020 R04 PARA (4)	AFTER 14 FEBRUARY 2013 [THE EFFECTIVE DATE OF THE ORIGINAL ISSUE OF THIS AD], DO NOT INSTALL SAFETY BELTS OR TORSO RESTRAINT SYSTEMS ON ANY AIRCRAFT, UNLESS INSPECTED AND CORRECTED IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD					MANDATORY	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-JUL-2014	MOS HRS/MSC - AFL			16-AUG-2013			
EASA 2014-0019	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR - MODIFICATION AIRCRAFT FLIGHT MANUAL - AMENDMENT (SUPERSEDED BY EASA 2014-0095)					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY EASA AD 2014-0095
31-JAN-2014	MOS HRS/MSC - AFL			03-FEB-2014 812 708			
EASA 2014-0019 PARA (1)	AMEND THE AFM OF THE AFFECTED AIRCRAFT					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY EASA AD 2014-0095
31-JAN-2014	DAYs HRS/MSC - AFL			03-FEB-2014 812 708			
EASA 2014-0019 PARA (2)	REPLACE THE SYSTEM INTERFACE UNIT P/N 503-24-() OR 503-42-()					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY EASA AD 2014-0095
31-JAN-2014	MOS HRS/MSC - AFL			03-FEB-2014 812 708			
EASA 2014-0019 PARA (3)	DO NOT INSTALL A HR SMITH (TECHNICAL DEVELOPMENTS) CPI SYSTEM SERIES 15-503-134 OR 15-503-134-1 EQUIPPED WITH CONTROL PANEL P/N 503-22-(), BEACON RELEASE UNIT P/N 503-21 AND SYSTEM INTERFACE UNIT P/N 503-24-() OR P/N 503-42-(), EXCLUDING SYSTEM INTERFACE UNIT P/N 503-24-A, OR 503-24-()A, OR 503-24-G, OR 503-24-()G, OR 503-42-A OR 503-42-()A OR 503-42-G OR 503-42-()G, ON AN AIRCRAFT, UNLESS IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY EASA AD 2014-0095
31-JAN-2014	MOS HRS/MSC - AFL			03-FEB-2014 812 708			
EASA 2014-0019 PARA (4)	REMOVE AFM AMENDMENT AND PLACARD AS REQUIRED BY PARAGRAPH (1) OF THIS AD					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY EASA AD 2014-0095
31-JAN-2014	MOS HRS/MSC - AFL			03-FEB-2014 812 708			
EASA 2014-0088	APPLIANCE AD - COMMUNICATIONS - COCKPIT VOICE RECORDER - REPLACEMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
29-APR-2014	MOS HRS/MSC - AFL			07-JUL-2014 848 738			
EASA 2014-0088 PARA (1)	REMOVE THE TEAM CVR P/N AP71232101 OR P/N AP71231101, AS APPLICABLE, FROM THE AIRCRAFT AND, DEPENDING ON OPERATIONAL REGULATIONS, INSTALL A SERVICEABLE CVR IN ACCORDANCE WITH APPROVED AIRCRAFT MODIFICATION INSTRUCTIONS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
29-APR-2014	MOS HRS/MSC - AFL			07-JUL-2014 848 738			
EASA 2014-0088 PARA (2)	DO NOT INSTALL ON ANY AIRCRAFT A TEAM CVR P/N AP71232101 OR P/N AP71231101, AS REQUIRED BY PARAGRAPH (2.1) OR (2.2) OF THIS AD, AS APPLICABLE					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
29-APR-2014	MOS HRS/MSC - AFL			07-JUL-2014 848 738			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2014-0095	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR - MODIFICATION AIRCRAFT FLIGHT MANUAL - AMENDMENT					SUPERSEDED	NOT APPLICABLE - N/A EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED. SUPERSEDED BY R01
07-MAY-2014		MOS HRS/MSC - AFL		07-JUL-2014			
EASA 2014-0095 PARA (1)	INSTALL A PLACARD "DO NOT USE TRANSMIT OVER WATER" NEXT TO THE CPI CONTROL PANEL/AMEND THE AFM OF THE AIRCRAFT					SUPERSEDED	NOT APPLICABLE - N/A EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED. SUPERSEDED BY R01
07-MAY-2014		MOS HRS/MSC - AFL		07-JUL-2014			
EASA 2014-0095 PARA (2)	INCORPORATION OF APPENDIX A OF THIS AD INTO THE EMERGENCY PROCEDURES SECTION OF THE AFM OF THE AIRCRAFT IS AN ACCEPTABLE METHOD TO COMPLY WITH THE REQUIREMENT OF PARAGRAPH (1.2) OF THIS AD					SUPERSEDED	NOT APPLICABLE - N/A EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED. SUPERSEDED BY R01
07-MAY-2014		MOS HRS/MSC - AFL		07-JUL-2014			
EASA 2014-0095 PARA (3)	REPLACE THE SYSTEM INTERFACE UNIT P/N 503-24-() (INCLUDING 503-24) OR P/N 503-42-() (INCLUDING 503-42) WITH AN IMPROVED PART P/N 503-24-A, OR P/N 503-24-()A, OR P/N 503-24-G, OR P/N 503-24-()G, OR P/N 503-42-A OR P/N 503-42-()A OR P/N 503-42-G OR P/N 503-42-()G (THAT INCORPORATES AUTOMATIC CPI DEPLOYMENT AFTER MANUAL ACTIVATION) IN ACCORDANCE WITH AN APPROVED AIRCRAFT MAINTENANCE INSTRUCTION					SUPERSEDED	NOT APPLICABLE - N/A EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED. SUPERSEDED BY R01
07-MAY-2014		MOS HRS/MSC - (s) AFL		07-JUL-2014			
EASA 2014-0095 PARA (4)	DO NOT INSTALL A HR SMITH (TECHNICAL DEVELOPMENTS) CPI SYSTEM SERIES 15-503-134 OR 15-503-134-1 EQUIPPED WITH CONTROL PANEL P/N 503-22-(), BEACON RELEASE UNIT P/N 503-21 AND SYSTEM INTERFACE UNIT P/N 503-24-() (INCLUDING 503-24) OR P/N 503-42-() (INCLUDING 503-42) EXCLUDING SYSTEM INTERFACE UNIT P/N 503-24-A OR P/N 503-24-()A OR P/N 503-24-G OR P/N 503-24-()G OR P/N 503-42-A OR P/N 503-42-()A OR P/N 503-42-G OR P/N 503-42-()G ON AN AIRCRAFT UNLESS IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD					SUPERSEDED	NOT APPLICABLE - N/A EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED. SUPERSEDED BY R01
07-MAY-2014		MOS HRS/MSC - AFL		07-JUL-2014			
EASA 2014-0095 PARA (5)	REMOVE THE AFM AMENDMENT AND PLACARD AS REQUIRED BY PARAGRAPH (1) OF THIS AD					SUPERSEDED	NOT APPLICABLE - N/A EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED. SUPERSEDED BY R01
07-MAY-2014		MOS HRS/MSC - AFL		07-JUL-2014			
EASA 2014-0095 R01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR - MODIFICATION AIRCRAFT FLIGHT MANUAL - AMENDMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
12-MAY-2014		MOS HRS/MSC - AFL		07-JUL-2014 848 738			
EASA 2014-0095 R01 PARA (1)	INSTALL A PLACARD "DO NOT USE TRANSMIT OVER WATER" NEXT TO THE CPI CONTROL PANEL/AMEND THE AFM OF THE AIRCRAFT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
12-MAY-2014		MOS HRS/MSC - AFL		07-JUL-2014 848 738			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2014-0095 R01 PARA (2)	INCORPORATION OF APPENDIX A OF THIS AD INTO THE EMERGENCY PROCEDURES SECTION OF THE AFM OF THE AIRCRAFT IS AN ACCEPTABLE METHOD TO COMPLY WITH THE REQUIREMENT OF PARAGRAPH (1.2) OF THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
12-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	-	848			
		AFL		738			
EASA 2014-0095 R01 PARA (3)	REPLACE THE SYSTEM INTERFACE UNIT P/N 503-24-() (INCLUDING 503-24) OR P/N 503-42-() (INCLUDING 503-42) WITH AN IMPROVED PART P/N 503-24-A, OR P/N 503-24-()A, OR P/N 503-24-G, OR P/N 503-24-()G, OR P/N 503-42-A OR P/N 503-42-()A OR P/N 503-42-G OR P/N 503-42-()G (THAT INCORPORATES AUTOMATIC CPI DEPLOYMENT AFTER MANUAL ACTIVATION) IN ACCORDANCE WITH AN APPROVED AIRCRAFT MAINTENANCE INSTRUCTION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
12-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	- (s)	848			
		AFL		738			
EASA 2014-0095 R01 PARA (4)	DO NOT INSTALL A HR SMITH (TECHNICAL DEVELOPMENTS) CPI SYSTEM SERIES 15-503-134 OR 15-503-134-1 EQUIPPED WITH CONTROL PANEL P/N 503-22-(), BEACON RELEASE UNIT P/N 503-21 AND SYSTEM INTERFACE UNIT P/N 503-24-() (INCLUDING 503-24) OR P/N 503-42-() (INCLUDING 503-42) EXCLUDING SYSTEM INTERFACE UNIT P/N 503-24-A OR P/N 503-24-()A OR P/N 503-24-G OR P/N 503-24-()G OR P/N 503-42-A OR P/N 503-42-()A OR P/N 503-42-G OR P/N 503-42-()G ON AN AIRCRAFT UNLESS IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
12-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	-	848			
		AFL		738			
EASA 2014-0095 R01 PARA (5)	REMOVE THE AFM AMENDMENT AND PLACARD AS REQUIRED BY PARAGRAPH (1) OF THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
12-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	-	848			
		AFL		738			
EASA 2014-0125	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR SYSTEM - REPLACEMENT; AIRCRAFT FLIGHT MANUAL - AMENDMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
22-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	-	848			
		AFL		738			
EASA 2014-0125 PARA (1)	AMEND THE AFM OF AFFECTED AIRCRAFT TO INCORPORATE TEMPORARY CPI SIU OPERATING PROCEDURES BY INSERTING A COPY OF APPENDIX 1 OF THIS AD (OR ITS TEXT) INTO THE APPLICABLE NORMAL PROCEDURES SECTION OF THE AFM					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
22-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	-	848			
		AFL		738			
EASA 2014-0125 PARA (2)	ACCOMPLISH THE COMPLETE START-UP PROCEDURE/APPLICABLE START-UP PROCEDURE/SHUTDOWN PROCEDURE					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
22-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	-	848			
		AFL		738			
EASA 2014-0125 PARA (3)	COMPLIANCE WITH THE REQUIREMENTS OF PARAGRAPH (2) OF THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
22-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	-	848			
		AFL		738			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2014-0125 PARA (4)	REPLACE THE CPI SIU HAVING P/N 503-24 OR P/N 503-24-2 OR P/N 503-24-6 WITH AN IMPROVED UNIT P/N 503-24G OR P/N 503-24-2G OR P/N 503-24-6G IN ACCORDANCE WITH THE APPLICABLE AIRCRAFT DESIGN APPROVAL HOLDER SERVICE INSTRUCTIONS AND, CONCURRENTLY, REMOVE THE TEMPORARY AFM PROCEDURE AS REQUIRED BY PARAGRAPH (2) OF THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
22-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	-	848			
		AFL		738			
EASA 2014-0125 PARA (5)	MODIFICATION OF AN AIRCRAFT AS REQUIRED BY PARAGRAPH (4) OF THIS AD CONSTITUTES TERMINATING ACTION FOR ACCOMPLISHMENT OF THE PROCEDURES AS REQUIRED BY PARAGRAPH (2) OF THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
22-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	-	848			
		AFL		738			
EASA 2014-0125 PARA (6)	FROM THE EFFECTIVE DATE OF THIS AD, INSTALLATION ON AN AIRCRAFT OF AN HR SMITH (TECHNICAL DEVELOPMENTS) CPI SYSTEM SERIES 15-503-134-1 EQUIPPED WITH BRU P/N 503-21-1 AND SIU P/N 503-24 OR P/N 503-24-2 OR P/N 503-24-6 IS ALLOWED, PROVIDED THE AIRCRAFT IS OPERATED IN COMPLIANCE WITH THE PROCEDURES AS REQUIRED BY THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
22-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	-	848			
		AFL		738			
EASA 2014-0125 PARA (7)	AFTER REPLACEMENT OF THE CPI SIU ON AN AIRCRAFT AS REQUIRED BY PARAGRAPH (4) OF THIS AD, DO NOT INSTALL AN SIU P/N 503-24 OR P/N 503-24-2 OR P/N 503-24-6 ON THE CPI SYSTEM OF THAT AIRCRAFT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
22-MAY-2014		MOS		07-JUL-2014			
		HRS/MSC	-	848			
		AFL		738			
EASA 2014-0142	APPLIANCE AD - OXYGEN - OXYGEN MASK REGULATOR INFLATABLE HARNESS / INFLATION HOSE - IDENTIFICATION / REPLACEMENT					SUPERSEDED	COMPLIED WITH - C/W EASA 2014-0142 REV. 1. FOUND N/A. NO FURTHER ACTIONS REQUIRED. SUPERSEDED BY R01
18-JUN-2014		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
EASA 2014-0142 PARA (1)	ACCOMPLISH ACCOMPLISH THE ACTIONS AS SPECIFIED IN PARAGRAPHS (1.1) AND (1.2) OF THIS AD - DETERMINE THE DATE OF MANUFACTURING / REPLACE THE HARNESS INFLATION HOSE P/N 445952 WITH A SERVICEABLE PART, OR REMOVE THE INFLATABLE HARNESS FROM THE MASK REGULATOR AND REPLACE IT WITH A SERVICEABLE HARNESS					SUPERSEDED	COMPLIED WITH - C/W EASA 2014-0142 REV. 2. FOUND N/A. NO FURTHER ACTIONS REQUIRED. SUPERSEDED BY R01
18-JUN-2014		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
EASA 2014-0142 PARA (2)	ACCOMPLISH AN OXYGEN MASK REGULATOR EQUIPPED WITH A P/N MXH21-1 INFLATABLE HARNESS HAVING A DMF CODE OF NOVEMBER 2008 (0845-S OR 08/45-S) OR EARLIER, AND THOSE WITH A DMF OF JANUARY 2011 (1101-S OR 11/01-S) OR LATER, IS EXCLUDED FROM THE INSPECTION AND REPLACEMENT REQUIREMENTS OF PARAGRAPH (1) OF THIS AD					SUPERSEDED	COMPLIED WITH - C/W EASA 2014-0142 REV. 2. FOUND N/A. NO FURTHER ACTIONS REQUIRED. SUPERSEDED BY R01
18-JUN-2014		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2014-0142 PARA (3)	ACCOMPLISH IT IS ALLOWED TO INSTALL ON AN AEROPLANE A FLIGHT CREW OXYGEN MASK REGULATOR, HAVING A P/N AS IDENTIFIED IN SECTION 1.A.(1) OF ZODIAC AEROTECHNICS SB MC10-35-274, PROVIDED IT HAS BEEN DETERMINED THAT A P/N MXH21-31 INFLATABLE HARNESS IS INSTALLED, OR THAT THE P/N MXH21-1 INFLATABLE HARNESS INSTALLED ON THAT FLIGHT CREW OXYGEN MASK REGULATOR HAS BEEN CORRECTED, AS REQUIRED BY THIS AD.						COMPLIED WITH - C/W EASA 2014-0142 REV. 2. FOUND N/A. NO FURTHER ACTIONS REQUIRED. SUPERSEDED BY R01
18-JUN-2014		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2014-0142 R01	APPLIANCE AD - OXYGEN – OXYGEN MASK REGULATOR INFLATABLE HARNESS / INFLATION HOSE – IDENTIFICATION / REPLACEMENT						NOT APPLICABLE - INSTALLED P/N NOT AFFECTED.
18-JUN-2014		MOS HRS/MSC - AFL		21-AUG-2015 953 822			
EASA 2014-0142 R01 PARA (1)	ACCOMPLISH ACCOMPLISH THE ACTIONS AS SPECIFIED IN PARAGRAPHS (1.1) AND (1.2) OF THIS AD - DETERMINE THE DATE OF MANUFACTURING / REPLACE THE HARNESS INFLATION HOSE P/N 445186 OR P/N 445952, AS APPLICABLE, WITH A SERVICEABLE PART, OR REMOVE THE INFLATABLE HARNESS FROM THE MASK REGULATOR AND REPLACE IT WITH A SERVICEABLE HARNESS					MANDATORY	NOT APPLICABLE - INSTALLED P/N NOT AFFECTED.
18-JUN-2014		MOS HRS/MSC - AFL		21-AUG-2015 953 822			
EASA 2014-0142 R01 PARA (2)	ACCOMPLISH AN OXYGEN MASK REGULATOR EQUIPPED WITH A P/N MXH20-1 OR P/N MXH21-1 INFLATABLE HARNESS HAVING A DMF CODE OF NOVEMBER 2008 (0845-S OR 0845-S) OR EARLIER, AND THOSE WITH A DMF OF JANUARY 2011 (1101-S OR 11/01-S) OR LATER, IS EXCLUDED FROM THE INSPECTION AND REPLACEMENT REQUIREMENTS OF PARAGRAPH (1) OF THIS AD					MANDATORY	NOT APPLICABLE - INSTALLED P/N NOT AFFECTED.
18-JUN-2014		MOS HRS/MSC - AFL		21-AUG-2015 953 822			
EASA 2014-0142 R01 PARA (3)	ACCOMPLISH IT IS ALLOWED TO INSTALL ON AN AEROPLANE A FLIGHT CREW OXYGEN MASK REGULATOR, HAVING A P/N AS IDENTIFIED IN SECTION 1.A.(1) OF ZODIAC AEROTECHNICS SB MC10-35-274, PROVIDED IT HAS BEEN DETERMINED THAT A P/N MXH21-31 INFLATABLE HARNESS IS INSTALLED, OR THAT THE P/N MXH20-1 OR P/N MXH21-1 INFLATABLE HARNESS INSTALLED ON THAT FLIGHT CREW OXYGEN MASK REGULATOR HAS BEEN CORRECTED, AS REQUIRED BY THIS AD					MANDATORY	NOT APPLICABLE - INSTALLED P/N NOT AFFECTED.
18-JUN-2014		MOS HRS/MSC - AFL		21-AUG-2015 953 822			
EASA 2014-0187	APPLIANCE AD - EQUIPMENT & FURNISHINGS – SAFETY BELT ATTACHMENT BOLTS – INSPECTION / REPLACEMENT					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
03-SEP-2014		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2014-0187 PARA (1)	INSPECT THE SAFETY BELT ATTACHMENT BOLTS					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
03-SEP-2014		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2014-0187 PARA (2)	IF, DURING THE INSPECTION AS REQUIRED BY PARAGRAPH (1) OF THIS AD, DETACHED OR LOOSENED SAFETY BELT ATTACHMENT BOLTS ARE FOUND, BEFORE NEXT FLIGHT, RE-TORQUE THE AFFECTED BOLTS TO THE VALUE AS DEFINED IN, AND IN ACCORDANCE WITH THE INSTRUCTIONS OF, GEVEN SB NO. D103-25-004 REVISION 2.					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
03-SEP-2014		MOS HRS/MSC - AFL		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2014-0187 PARA (3)	FOR SPECIFIC D1-03 SEAT ASSEMBLIES (P/N AS IDENTIFIED IN TABLE 1.1.1 OF GEVEN SB NO. D103-25-004 REVISION 2, EFF CODE FROM AAA TO AUC), WITHIN 6 MONTHS AFTER THE EFFECTIVE DATE OF THIS AD, MODIFY THE SEAT BELT ATTACHMENT ASSEMBLY ON THE AISLE SIDE SPREADER OF STANDARD AND LAST ROW SEATS IN ACCORDANCE WITH THE INSTRUCTIONS OF GEVEN SB NO. D103-25-004 REVISION 2.					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
03-SEP-2014	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2014-0187 PARA (4)	AS AN ALTERNATIVE TO THE CORRECTIVE ACTIONS AS REQUIRED BY PARAGRAPH (1) OR (2) OF THIS AD, AS APPLICABLE, BEFORE NEXT FLIGHT, BLOCK EACH AFFECTED SEAT FOR OCCUPANCY, PENDING ACCOMPLISHMENT OF THE APPLICABLE CORRECTIVE ACTION(S).					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
03-SEP-2014	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2014-0279	APPLIANCE AD - EQUIPMENT / FURNISHING - RESTRAINT SYSTEM ROTARY BUCKLE SUBASSEMBLY - IDENTIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
02-JAN-2015	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2014-0279 PARA (1)	INSPECT THE LABEL OF THE ROTARY BUCKLE SUB-ASSEMBLY TO DETERMINE ITS PART NUMBER (P/N) AND SERIAL NUMBER (S/N)					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
02-JAN-2015	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2014-0279 PARA (1.1)	REPLACE THE ROTARY BUCKLE SUB-ASSEMBLY WITH A SERVICEABLE PART					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
02-JAN-2015	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2014-0279 PARA (1.2)	MARK THE SEAT AS "INOPERATIVE" UNTIL REPLACEMENT OF THE ROTARY BUCKLE SUB-ASSEMBLY AS REQUIRED BY PARAGRAPH (2) OF THIS AD					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
02-JAN-2015	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2014-0279 PARA (2)	REPLACE EACH ROTARY BUCKLE SUB-ASSEMBLY HAVING A P/N AND S/N AS SPECIFIED IN ROMTEX ANJOU AERONAUTIQUE SB 358SB-14-101 WITH A SERVICEABLE PART					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
02-JAN-2015	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2014-0279 PARA (3)	DO NOT INSTALL: - ON ANY RESTRAINT SYSTEM A SPARE ROTARY BUCKLE SUB-ASSEMBLY, OR - ON ANY AIRCRAFT A RESTRAINT SYSTEM EQUIPPED WITH A ROTARY BUCKLE SUB-ASSEMBLY HAVING A P/N AND A S/N LISTED IN ROMTEX ANJOU AERONAUTIQUE SB 358SB-14-101, UNLESS THE SUB-ASSEMBLY HAS BEEN REPAIRED,					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
02-JAN-2015	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2015-0093	APPLIANCE/EMERGENCY AD - NAVIGATION ATTITUDE HEADING REFERENCE SYSTEM MODIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - INSTALLED P/N NOT AFFECTED.
10-JUN-2015	MOS HRS/MSC - AFL			21-AUG-2015 953 822			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2015-0093 PARA (1)	AMEND THE AFM OF THE AIRCRAFT BY INSERTING A TEMPORARY REVISION (TR) TO THE AFM (SUPPLEMENT)					MANDATORY	NOT APPLICABLE - INSTALLED P/N NOT AFFECTED.
10-JUN-2015		MOS HRS/MSC - AFL		21-AUG-2015 953 822			
EASA 2015-0093 PARA (2)	MODIFY THE AIRCRAFT BY REPLACING EACH AHRS UNIT HAVING A P/N SPECIFIED AS 'OLD' IN TABLE 2 OF THIS AD WITH A MODIFIED UNIT, HAVING A P/N SPECIFIED AS 'NEW' IN TABLE 2 OF THIS AD					MANDATORY	NOT APPLICABLE - INSTALLED P/N NOT AFFECTED.
10-JUN-2015		MOS HRS/MSC - AFL		21-AUG-2015 953 822			
EASA 2015-0093 PARA (3)	CONCURRENT WITH MODIFICATION OF AN AIRCRAFT AS REQUIRED BY PARAGRAPH (2) OF THIS AD, THE AFM CHANGE, IF REQUIRED BY PARAGRAPH (1) OF THIS AD (SEE NOTE 1 OF THIS AD), CAN BE REMOVED FROM THAT AIRCRAFT					MANDATORY	NOT APPLICABLE - INSTALLED P/N NOT AFFECTED.
10-JUN-2015		MOS HRS/MSC - AFL		21-AUG-2015 953 822			
EASA 2015-0093 PARA (4)	DO NOT INSTALL ON ANY AIRCRAFT A LCR-100 AHRS UNIT, HAVING A P/N SPECIFIED AS 'OLD' IN TABLE 1 OF THIS AD					MANDATORY	NOT APPLICABLE - INSTALLED P/N NOT AFFECTED.
10-JUN-2015		MOS HRS/MSC - AFL		21-AUG-2015 953 822			
EASA 2016-0024	APPLIANCE AD - FIRE PROTECTION - OPTICAL AND AMBIENT SMOKE DETECTORS - IDENTIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
01-FEB-2016		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2016-0024 PARA (1)	INSPECT EACH SIEMENS SMOKE DETECTOR TO DETERMINE WHETHER IT IS AN AFFECTED PART					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
01-FEB-2016		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2016-0024 PARA (2.1)	REPLACE CARGO COMPARTMENT SMOKE DETECTORS, IDENTIFIED IN PARAGRAPH (1), IN ACCORDANCE WITH TABLE 1 OR TABLE 2					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
01-FEB-2016		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2016-0024 PARA (2.2)	REPLACE PASSENGER, CABIN OR ANY OTHER ON BOARD LOCATION SMOKE DETECTORS, IDENTIFIED IN PARAGRAPH (1), IN ACCORDANCE WITH TABLE 3					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
01-FEB-2016		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2016-0024 PARA (2.3)	REPLACE REPAIRED SMOKE DETECTOR IDENTIFIED IN APPENDIX 1					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
01-FEB-2016		MOS HRS/MSC - AFL		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2016-0024 PARA (3)	FROM THE EFFECTIVE DATE OF THIS AD, DO NOT INSTALL ON ANY AEROPLANE AN AFFECTED P/N SMOKE DETECTOR UNLESS THE UNIT (GMC ONLY) IS MARKED 'SIL PMC-26-002'					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
01-FEB-2016		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2016-0044	APPLIANCE AD - ATA 26 - FIRE PROTECTION - ENGINE AND AUXILIARY POWER UNIT AUTOMATIC FIRE EXTINGUISHERS - INSPECTION/OVERHAUL					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
22-MAR-2016		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2016-0044 PARA (1)	INSPECT EACH FIRE EXTINGUISHER, EXCEPT THOSE HAVING P/N 57333 SERIES, INSTALLED ON BAE146 AND RJ AEROPLANES, AND THOSE HAVING P/N 57183 SERIES, INSTALLED ON ATP AEROPLANES, AND DEPENDING ON FINDINGS, ACCOMPLISH CORRECTIVE ACTIONS IN ACCORDANCE WITH THE INSTRUCTIONS OF KG SB 26-080 REVISION 1					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
22-MAR-2016		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2016-0044 PARA (2)	ACCOMPLISHMENT OF AN OVERHAUL (SEE NOTE 2 OF THIS AD) OF A FIRE EXTINGUISHER BY KIDDE GRAVINGER OR HUGEN, OR IN ACCORDANCE WITH THE INSTRUCTIONS OF KG SIL 01-10 OR IN ACCORDANCE WITH KG CMM 26-21-40 REVISION 14 OR LATER OR KG CMM 26-21-52 REVISION 13 OR LATER (AS APPLICABLE TO FIRE EXTINGUISHER P/N) IS ACCEPTABLE TO COMPLY WITH THE REQUIREMENT OF PARAGRAPH (1).					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
22-MAR-2016		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2016-0044 PARA (3)	FROM THE EFFECTIVE DATE OF THIS AD DO NOT INSTALL ON ANY AIRCRAFT AN AFFECTED FIRE EXTINGUISHER, UNLESS IT IS NEW, OR HAS PASSED AN INSPECTION IN ACCORDANCE WITH THE INSTRUCTIONS OF KG SB 26-080 REVISION 1, OR IT HAS BEEN OVERHAULED (SEE NOTE 2) BY KG, OR BY HUGEN OR IN ACCORDANCE WITH THE INSTRUCTIONS OF KG SIL 01-10 OR IN ACCORDANCE WITH THE INSTRUCTIONS OF KG CMM 26-21-40 REVISION 14, OR OF KG CMM 26-21-52 REVISION 13, AS APPLICABLE TO FIRE EXTINGUISHER P/N					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
22-MAR-2016		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2017-0192	APPLIANCE AD - EQUIPMENT AND FURNISHING - PASSENGER SEATS - MODIFICATION					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
12-OCT-2017		MOS HRS/MSC - AFL		26-SEP-2022			
EASA 2017-0192 PARA (1)	MODIFY AND RE-IDENTIFY EACH AFFECTED PASSENGER SEAT					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
12-OCT-2017		MOS HRS/MSC - AFL		26-SEP-2022			
EASA 2017-0192 PARA (2)	DO NOT INSTALL (SEE NOTE 2 OF THIS AD) AN AFFECTED PASSENGER SEAT ON ANY AEROPLANE, AS REQUIRED BY PARAGRAPH (2.1) OR (2.2) OF THIS AD, AS APPLICABLE					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
12-OCT-2017		MOS HRS/MSC - AFL		26-SEP-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2017-0225	APPLIANCE AD - EQUIPMENT / FURNISHINGS - SEAT RESTRAINT SYSTEMS - AFM AMENDMENT / MODIFICATION					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
01-DEC-2017		MOS HRS/MSC - AFL		26-SEP-2022			
EASA 2017-0225 PARA (1)	INSTALL A PLACARD AS SPECIFIED IN TABLE 1 OF THIS AD IN FULL VIEW OF THE PILOT(S), AMEND THE APPLICABLE AFM, INFORM ALL FLIGHT CREWS AND, THEREAFTER, OPERATE THE AIRCRAFT ACCORDINGLY					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
01-DEC-2017		DAYS HRS/MSC - AFL		26-SEP-2022			
EASA 2017-0225 PARA (3)	DO NOT INSTALL AN AFFECTED PART ON ANY AIRCRAFT THAT, ACCORDING TO THE APPLICABLE AFM, IS CERTIFICATED IN THE AEROBATIC CATEGORY, AS REQUIRED BY PARAGRAPH (3.1) OR (3.2) OF THIS AD, AS APPLICABLE					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
01-DEC-2017		MOS HRS/MSC - AFL		26-SEP-2022			
EASA 2018-0247	APPLIANCE AD - NAVIGATION - TRANSPONDERS - INSPECTION / MODIFICATION					MANDATORY	NOT APPLICABLE - AS PER P/N
27-NOV-2018		MOS HRS/MSC - AFL		26-SEP-2022			
EASA 2018-0247 PARA (1)	INSPECT THE INSTALLATION OF THE AFFECTED PART ON THE AIRCRAFT					MANDATORY	NOT APPLICABLE - AS PER P/N
27-NOV-2018		MOS HRS/MSC - AFL		26-SEP-2022			
EASA 2018-0247 PARA (2)	IF, DURING THE INSPECTION AS REQUIRED BY PARAGRAPH (1) OF THIS AD, IT IS DETERMINED THAT THE INSTALLATION IS NOT A CONVENTIONAL INSTALLATION, AS DEFINED IN THIS AD, BEFORE NEXT FLIGHT, REMOVE THE TRANSPONDER FROM SERVICE FOR IN-SHOP MODIFICATION.					MANDATORY	NOT APPLICABLE - AS PER P/N
27-NOV-2018		MOS HRS/MSC - AFL		26-SEP-2022			
EASA 2018-0247 PARA (3)	RETURNING AN AFFECTED PART, REMOVED FROM AN AIRCRAFT AS REQUIRED BY PARAGRAPH (2) OF THIS AD, TO TRIG AVIONICS FOR MODIFICATION, AND RE-INSTALLATION OF THAT MODIFIED TRANSPONDER ON THAT AIRCRAFT IS AN ACCEPTABLE METHOD TO COMPLY WITH THE REQUIREMENTS OF THIS AD FOR THAT AIRCRAFT					MANDATORY	NOT APPLICABLE - AS PER P/N
27-NOV-2018		MOS HRS/MSC - AFL		26-SEP-2022			
EASA 2018-0247 PARA (4)	FROM THE EFFECTIVE DATE OF THIS AD, DO NOT INSTALL AN AFFECTED PART ON ANY AIRCRAFT, UNLESS THE INSTALLATION IS CONVENTIONAL, AS DEFINED IN THIS AD					MANDATORY	NOT APPLICABLE - AS PER P/N
27-NOV-2018		MOS HRS/MSC - AFL		26-SEP-2022			
EASA 2018-0262	APPLIANCE AD - EQUIPMENT / FURNISHINGS - PILOT AND CO-PILOTS SEATS - MODIFICATION / INSPECTION					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY G-2022-0011
20-DEC-2018		MOS HRS/MSC - AFL		21-SEP-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2018-0262 PARA (1)	MODIFY AND RE-IDENTIFY EACH PRE-MOD SEAT (FOR GROUP 1 AEROPLANES) (RESTATEMENT OF EASA AD 2016-0256 (1))					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY G-2022-0011
20-DEC-2018		MOS HRS/MSC - AFL		21-SEP-2022			
EASA 2018-0262 PARA (2)	DO NOT INSTALL A PRE-MOD SEAT ON ANY AEROPLANE (RESTATEMENT OF EASA AD 2016-0256 PARA (2))					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY G-2022-0011
20-DEC-2018		MOS HRS/MSC - AFL		21-SEP-2022			
EASA 2018-0262 PARA (3)	INSPECT ANY AFFECTED SPRING OF EACH SEAT; REPLACE BOTH SPRINGS (IF, DURING ANY INSPECTION ANY DAMAGE OR INCORRECT INSTALLATION OF AN EFFECTED SPING IS FOUND)					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY G-2022-0011
20-DEC-2018		MOS HRS/MSC - AFL		21-SEP-2022			
EASA 2018-0262 PARA (5)	IT IS ALLOWED TO DEFER ACCOMPLISHMENT OF CORRECTIVE ACTIONS REQUIRED BT PARA (4) OF THIS AD FOR THAT SEAT, PROVIDED A COPY OF THE ATR OEB IS INCLUDED IN THE APPLICABLE AFM, PILOTS ARE INFORMED, AND THE AEROPLANE IS OPERATED IAW THE INSTRUCTIONS OF THAT OEB (IF, DURING ANY INSPECTION AS REQ BY PARA (3) OF THIS AD, ANY DAMAGE OR INCORRECT INSTALLATION OF ONLY ONE AFFECTED SPRING IS FOUND ON THE PILOT OR CO-PILOT SEAT) (FOR ATR AEROPLANES)					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY G-2022-0011
20-DEC-2018		DAY HRS/MSC - AFL		21-SEP-2022			
EASA 2018-0262 PARA (8)	IT IS ALLOWED TO INSTALL AN AFFECTED SPRING ON A SEAT INSTALLED ON AN AEROPLANE PROVIDED THAT, AFTER INSTALLATION, THAT SPRING PASSES AN INSPECTION (NO DEFECT FOUND)					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY G-2022-0011
20-DEC-2018		MOS HRS/MSC - AFL		21-SEP-2022			
EASA 2018-0262 PARA (9) & (10)	REPORTING					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY G-2022-0011
20-DEC-2018		DAY HRS/MSC - AFL		21-SEP-2022			
EASA 2018-0264 R01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - LIFE VEST POUCH - INSPECTION					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
04-APR-2019		MOS HRS/MSC - AFL		26-SEP-2022			
EASA 2019-0004	APPLIANCE AD - NAVIGATION - GLOBAL NAVIGATION SATELLITE SYSTEM - OPERATIONAL LIMITATIONS					MANDATORY	NOT APPLICABLE - GPS/SBAS Receiver Topstar 200 LPV not installed, see also LBA D-2019-015, No further Action required
25-JAN-2019		DAY HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2019-0010	APPLIANCE AD - EQUIPMENT/FURNISHING - LIFE JACKET - REMOVAL/REPAIR					MANDATORY	NOT APPLICABLE - Life Jacket / Infant - Small Child Life Jacket not installed, see also LBA D-2019-028, No further Action required
06-FEB-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2019-0010 PARA (1)	REMOVE EACH AFFECTED PART FROM SERVICE AND REPLACE IT WITH A SERVICEABLE PART					MANDATORY	NOT APPLICABLE - Life Jacket / Infant - Small Child Life Jacket not installed, see also LBA D-2019-028, No further Action required
06-FEB-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2019-0010 PARA (2)	DO NOT INSTALL AN AFFECTED PART ON ANY AIRCRAFT					MANDATORY	NOT APPLICABLE - Life Jacket / Infant - Small Child Life Jacket not installed, see also LBA D-2019-028, No further Action required
06-FEB-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2019-0010 PARA (3)	DO NOT RELEASE TO SERVICE ANY AFFECTED PART, UNLESS IT HAS BEEN REPAIRED AND RE-IDENTIFIED					MANDATORY	NOT APPLICABLE - Life Jacket / Infant - Small Child Life Jacket not installed, see also LBA D-2019-028, No further Action required
06-FEB-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2019-0086-E	APPLIANCE/EMERGENCY AD - FLIGHT CONTROLS - ACTIVE TECHNOLOGY LOAD ALLEVIATING SYSTEM - DEACTIVATION / MODIFICATION - AIRPLANE FLIGHT MANUAL SUPPLEMENT - AMENDMENT					SUPERSEDED	NOT APPLICABLE - TAMARACK ATLAS WINGLETS NOT INSTALLED, SEE ALSO LBA LTA D-2019-103, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R01
19-APR-2019	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2019-0086-E PARA (1)	DEACTIVATE THE ATLAS AND MODIFY THE TACS TO RESTRICT THEIR MOVEMENT					SUPERSEDED	NOT APPLICABLE - TAMARACK ATLAS WINGLETS NOT INSTALLED, SEE ALSO LBA LTA D-2019-103, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R01
19-APR-2019	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2019-0086-E PARA (4)	CONTACT CRANFIELD AEROSPACE SOLUTIONS FOR APPROVED ATLAS MODIFICATION INSTRUCTIONS AND ACCOMPLISH THOSE INSTRUCTIONS ACCORDINGLY					SUPERSEDED	NOT APPLICABLE - TAMARACK ATLAS WINGLETS NOT INSTALLED, SEE ALSO LBA LTA D-2019-103, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R01
19-APR-2019	MOS HRS/MSC - AFL			05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2019-0086-E PARA (5)	MODIFICATION OF AN AEROPLANE AS REQUIRED BY PARAGRAPH (4) OF THIS AD CONSTITUTES TERMINATING ACTION FOR THE DEACTIVATION, LIMITATIONS AND REPETITIVE PRE-FLIGHT INSPECTIONS AS REQUIRED BY THIS AD FOR THAT AEROPLANE					SUPERSEDED	NOT APPLICABLE - TAMARACK ATLAS WINGLETS NOT INSTALLED, SEE ALSO LBA LTA D-2019-103, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R01
19-APR-2019		MOS HRS/MSC - AFL		05-DEC-2022			
EASA 2019-0179	APPLIANCE AD - NAVIGATION - AIRBORNE COLLISION AVOIDANCE SYSTEM DISPLAY SOFTWARE - UPDATE (SUPERSEDED BY EASA AD 2019-0179 R01)					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY R1
31-JUL-2019		MOS HRS/MSC - AFL		21-SEP-2022			
EASA 2019-0179 PARA (1)	AMEND THE APPLICABLE AFM(S) IN ACCORDNADCE WITH THE OPSB AND INSTALL THE APPROPRIATE PLACARD; VERIFY THAT A PRESSURE ALTITUDE REPORTING TRANSPONDER IS INSTALLED AND INTRODUCE PRE-FLIGHT CHECKS					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY R1
31-JUL-2019		DAYs HRS/MSC - AFL		21-SEP-2022			
EASA 2019-0179 PARA (2)	MODIFY THE AEROPLANE BY INSTALLING A SOFTWARE UPDATE THAT RECTIFIES THE UNSAFE CONDITION ADDRESSED BY THIS AD; BEFORE NEXT FLIGHT AFTER MODIFICATION REMOVE THE AFM CHANGES AND PLACARD AND CONCURRENT WITH REMOVAL OF THE AFM(S) CHANGE AND PLACARD INSERT THE APPLICABLE POST-SB MTB 34-02 AFM TC					SUPERSEDED	NOT APPLICABLE - SUPERSEDED BY R1
31-JUL-2019		MOS HRS/MSC - AFL		21-SEP-2022			
EASA 2019-0179 R01	APPLIANCE AD - NAVIGATION - AIRBORNE COLLISION AVOIDANCE SYSTEM DISPLAY SOFTWARE - UPDATE					MANDATORY	NOT APPLICABLE - AS PER P/N
24-APR-2020		MOS HRS/MSC - (s) AFL		21-SEP-2022			
EASA 2019-0179 R01 PARA (1)	AMEND THE APPLICABLE AFM(S) IAW THE OPSB AND INSTALL THE APPROPRIATE PLACARD; VERIFY THAT A PRESSURE ALTITUDE REPORTING TRANSPONDER IS INSTALLED; AND INTRODUCE PRE-FLIGHT CHECKS					MANDATORY	NOT APPLICABLE - AS PER P/N
24-APR-2020		DAYs HRS/MSC - AFL		21-SEP-2022			
EASA 2019-0179 R01 PARA (2) & (4)	MODIFY THE AEROPLANE BY INSTALLING A SOFTWARE UPDATE THAT RECTIFIES THE UNSAFE CONDITION THEN REMOVE THE AFM(S) CHANGES AND PLACARD, AS REQUIRED BY PARA (1) OF THIS AD. CONCURRENTLY, FOR CERTAIN TEXTRON AVIATION AEROPLANES, INSERT THE APPLICABLE POST-SB MTB-34-02 AFM TC OR POST-MOD AFMS, AS IDENTIFIED IN APPENDIX 2 OF THIS AD					MANDATORY	NOT APPLICABLE - AS PER P/N
24-APR-2020		MOS HRS/MSC - AFL		21-SEP-2022			
EASA 2019-0235	APPLIANCE AD - EQUIPMENT / FURNISHINGS - EMERGENCY LOCATOR TRANSMITTER - INSPECTION / MODIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - ELT PN: 453-5060 SN: 04225, UNIT INSTALLED IN NEW CONDITION DURING PRODUCTION, NEVER INSTALLED IN A HELICOPTER BEFORE / CAMO / JHA / 24.09.2019
04-OCT-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2019-0235 PARA (6)	IN-SHOP CORRECTION OF AN AFFECTED PART OR MODIFICATION INTO A SERVICEABLE PART IAW THE INSTRUCTIONS OF THE SB CONSTITUTES TERMINATING ACTION FOR THE REPETITIVE INSPECTIONS AND TESTING AS REQUIRED BY THIS AD FOR THAT PART					MANDATORY	NOT APPLICABLE - ELT PN: 453-5060 SN: 04225, UNIT INSTALLED IN NEW CONDITION DURING PRODUCTION, NEVER INSTALLED IN A HELICOPTER BEFORE / CAMO / JHA / 24.09.2019
04-OCT-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2019-0235 PARA (9)	DO NOT INSTALL ON ANY AIRCRAFT AN AFFECTED PART THAT HAS ACCUMULATED 10 YEAR TIS OR MORE					MANDATORY	NOT APPLICABLE - ELT PN: 453-5060 SN: 04225, UNIT INSTALLED IN NEW CONDITION DURING PRODUCTION, NEVER INSTALLED IN A HELICOPTER BEFORE / CAMO / JHA / 24.09.2019
04-OCT-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
EASA 2020-0272	APPLIANCE AD - EQUIPMENT / FURNISHINGS - BUCKLE - MODIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - AS PER INSTALLED EQUIPMENT
23-DEC-2020	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2020-0272 PARA (1)	MODIFY EACH AFFECTED BUCKLE OR REPLACE THE AFFECTED BUCKLE WITH A SERVICEABLE BUCKLE					MANDATORY	NOT APPLICABLE - AS PER INSTALLED EQUIPMENT
23-DEC-2020	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2020-0272 PARA (2)	REPLACE EACH AFFECTED BUCKLE WITH A SERVICEABLE BUCKLE (IF POST-MODIFICATION AND PRE-REPLACEMENT PER PARA (1))					MANDATORY	NOT APPLICABLE - AS PER INSTALLED EQUIPMENT
23-DEC-2020	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2021-0137	APPLIANCE AD - EQUIPMENT / FURNISHINGS - PILOT AND CO-PILOT SEATS / LONGITUDINAL LOCKING SYSTEM PINS - MEASUREMENT / ADJUSTMENT					MANDATORY	NOT APPLICABLE - AS PER P/N
22-JUN-2021	MOS HRS/MSC - AFL			26-SEP-2022			
EASA 2021-0185 R02	APPLIANCE AD - FIRE PROTECTION - HAND-OPERATED FIRE EXTINGUISHERS - INSPECTION/REPLACEMENT					N/A BY PART NUMBER	NOT APPLICABLE - AS PER INSTALLED P/N
14-SEP-2022	MOS HRS/MSC - AFL			05-DEC-2022			
EASA 2022-0024	APPLIANCE AD - ATA 34 - NAVIGATION - FLIGHT MANAGEMENT COMPUTER 2 / NAVIGATION MODULES - OPERATIONAL LIMITATIONS / AMENDMENT					MANDATORY	NOT APPLICABLE - AS PER P/N
18-FEB-2022	DAYs HRS/MSC - AFL			21-SEP-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2025-0088	APPLIANCE AD - NAVIGATION - SATELLITE BASED AUGMENTATION SYSTEMS / GLOBAL POSITIONING SYSTEM RECEIVER - REPLACEMENT					MANDATORY	
30-APR-2025		MOS HRS/MSC AFL	24	(EFF)	30-APR-2027		
FAA 1997-05-03 R01	APPLIANCE AD - ALLIEDSIGNAL GNS-XLS & GNS-XL					MANDATORY	NOT APPLICABLE - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS HRS/MSC AFL		20-FEB-2008 0 0			
FAA 1998-25-02	APPLIANCE AD - BFGOODRICH SKYWATCH SKY497					MANDATORY	NOT APPLICABLE - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS HRS/MSC AFL		20-FEB-2008 0 0			
FAA 1998-25-10 R01	APPLIANCE AD - AIRCRAFT BELTS INC					MANDATORY	NOT APPLICABLE - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS HRS/MSC AFL		20-FEB-2008 0 0			
FAA 1999-08-21	APPLIANCE AD - PURITAN-BENNETT AERO SYSTEM C					MANDATORY	NOT APPLICABLE - NOT APPLICABLE BY DATE OF MANUFACTURE
		MOS HRS/MSC AFL		20-FEB-2008 0 0			
FAA 2001-23-17	APPLIANCE AD - GARMIN GNS 430					MANDATORY	NOT APPLICABLE - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS HRS/MSC AFL		20-FEB-2008 0 0			
FAA 2002-20-09	APPLIANCE AD - COLLINS AFD-3010 AFD UNITS					MANDATORY	COMPLIED WITH
		MOS HRS/MSC AFL		20-FEB-2008 0 0			
FAA 2004-08-15	APPLIANCE AD - TAWS 8000 TERRAIN AWARENESS					MANDATORY	NOT APPLICABLE - N/A PER MOD OR SOFTWARE LEVEL
		MOS HRS/MSC AFL		20-FEB-2008 0 0			
FAA 2006-16-18	APPLIANCE AD - SANDEL AVIONICS INCORPORATED MODEL ST3400 TERRAIN AWARENESS WARNING SYSTEM/RADIO MAGNETIC INDICATOR(TAWS/RMI)					MANDATORY	NOT APPLICABLE - SUPERSEDED BY R01
25-SEP-2006		MOS HRS/MSC AFL		30-SEP-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2006-16-18 PARA(F)	INSTALL SANDEL AVIONICS INCORPORATED MODEL ST3400 TERRAIN AWARENESS WARNING SYSTEM/RADIO MAGNETIC INDICATOR(TAWS/RMI) PLACARD					MANDATORY	NOT APPLICABLE - SUPERSEDED BY R01
25-SEP-2006		DAYS HRS/MSC AFL		30-SEP-2022			
FAA 2006-16-18 PARA(G)	REVISE SANDEL AVIONICS INCORPORATED MODEL ST3400 TERRAIN AWARENESS WARNING SYSTEM/RADIO MAGNETIC INDICATOR(TAWS/RMI) AIRPLANE FLIGHT MANUAL (AFM)					MANDATORY	NOT APPLICABLE - SUPERSEDED BY R01
25-SEP-2006		DAYS HRS/MSC AFL		30-SEP-2022			
FAA 2006-16-18 PARA(H)	UPDATE SANDEL AVIONICS INCORPORATED MODEL ST3400 TERRAIN AWARENESS WARNING SYSTEM/RADIO MAGNETIC INDICATOR(TAWS/RMI) SOFTWARE					MANDATORY	NOT APPLICABLE - SUPERSEDED BY R01
25-SEP-2006		DAYS HRS/MSC AFL		30-SEP-2022			
FAA 2006-16-18 R01	APPLIANCE AD - SANDEL ST3400 TAWS/RMI PLACARD					AIRWORTHINESS	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
18-JUL-2008		MOS HRS/MSC AFL		30-SEP-2022			
FAA 2007-26-11	APPLIANCE AD - HIGH-PRESSURE OXYGEN CYLINDER TEARING WITH SUDDEN EMPTYING					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS HRS/MSC AFL		30-SEP-2022			
FAA 2009-05-05	APPLIANCE AD - TO PREVENT CERTAIN CONDITIONS FROM EXISTING WHEN PFDS DISPLAY INCORRECT ATTITUDE, ALTITUDE, AND AIRSPEED INFORMATION					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS HRS/MSC AFL		30-SEP-2022			
FAA 2009-08-01	APPLIANCE AD - NAVIGATION - HONEYWELL NZ-2000 NAVIGATION COMPUTERS AND IC-800 INTEGRATED AVIONICS COMPUTERS - IDENTIFICATION/MODIFICATION					MANDATORY	NOT APPLICABLE - AS PER P/N
		DAYS HRS/MSC AFL		30-SEP-2022			
FAA 2009-21-10 R01	APPLIANCE AD - INSPECT TO DETERMINE THE SERIAL NUMBER OF THE OXYGEN ASSEMBLIES INSTALLED IN THE AIRPLANE					MANDATORY	NOT APPLICABLE - AS PER P/N
17-DEC-2009		DAYS HRS/MSC AFL		30-SEP-2022			
FAA 2009-21-10 R1	APPLIANCE AD - AVOX SYSTEMS AND B/E AEROSPACE OXYGEN CYLINDER ASSEMBLIES					MANDATORY	NOT APPLICABLE - AS PER P/N
		DAYS HRS/MSC AFL		30-SEP-2022			
FAA 2010-01-03	APPLIANCE AD - IDENTIFY AND REMOVE FROM SERVICE ALL AFFECTED FIRE EXTINGUISHERS AND REPLACE WITH SERVICABLE UNITS					MANDATORY	NOT APPLICABLE - AS PER P/N
20-JAN-2010		MOS HRS/MSC AFL		30-SEP-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2010-04-16 PARA (G)	REPLACE TYPE H1-10 AIR HALON 1211 (BCF) PORTABLE FIRE EXTINGUISHERS MANUFACTURED BY SICLI WITH SERVICABLE UNIT					MANDATORY	NOT APPLICABLE - AS PER P/N
08-MAR-2010		MOS HRS/MSC AFL		30-SEP-2022			
FAA 2010-04-16 PARA (H)	RETURN TYPE H1-10 AIR HALON 1211 (BCF) PORTABLE FIRE EXTINGUISHERS MANUFACTURED BY SICLI THE AFFECTED FIRE EXTINGUISHER TO MANUFACTURER					MANDATORY	NOT APPLICABLE - AS PER P/N
08-MAR-2010		MOS HRS/MSC AFL		30-SEP-2022			
FAA 2010-07-02	APPLIANCE AD - HONEYWELL PRIMUS II RNZ-850/-851 INTEGRATED NAVIGATION UNITS					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS HRS/MSC AFL		30-SEP-2022			
FAA 2010-11-05	APPLIANCE AD - AVOX SYSTEMS AND B/E AEROSPACE OXYGEN CYLINDERS					MANDATORY	NOT APPLICABLE - AS PER P/N
		DAYS HRS/MSC AFL		30-SEP-2022			
FAA 2011-01-09	APPLIANCE AD - B/E AEROSPACE PROTECTIVE BREATHING EQUIPMENT (PBE) UNITS HAVING PART NUMBER (P/N) 119003-11					MANDATORY	NOT APPLICABLE - AS PER P/N
		DAYS HRS/MSC AFL		30-SEP-2022			
FAA 2011-14-08	APPLIANCE AD - B/E AEROSPACE, CONTINUOUS FLOW PASSENGER OXYGEN MASK ASSEMBLY					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS HRS/MSC AFL		30-SEP-2022			
FAA 2012-02-08	APPLIANCE AD - AVIATION COMMUNICATION AND SURVEILLANCE SYSTEMS (ACSS) TRAFFIC ALERT AND COLLISION AVOIDANCE SYSTEM (TCAS) UNITS					MANDATORY	NOT APPLICABLE - ACASS NOT INSTALLED.
13-MAR-2012		MOS HRS/MSC AFL		15-FEB-2013 713 620			
FAA 2012-14-15	APPLIANCE AD - HONEYWELL INTERNATIONAL, INC. KGS200 MERCURY <sup>2</sup> SYSTEM SOFTWARE PROBLEM					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS HRS/MSC AFL		30-SEP-2022			
FAA 2012-14-15 (G)	INCORPORATE LANGUAGE INTO THE LIMITATIONS SECTION OF THE AIRCRAFT FLIGHT MANUAL					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS HRS/MSC AFL		30-SEP-2022			
FAA 2012-14-15 (H)	FABRICATE AND INSTALL A PLACARD					MANDATORY	NOT APPLICABLE - AS PER P/N
		DAYS HRS/MSC AFL	3 (s)	30-SEP-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2012-17-01	APPLIANCE AD - GOODYEAR AVIATION TIRES					MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2012-26-15 R01	APPLIANCE AD - AIR DATA PRESSURE TRANSDUCERS, AS INSTALLED IN AIR DATA COMPUTERS (ADC), AIR DATA MODULES (ADM), AIR DATA ATTITUDE HEADING REFERENCE SYSTEMS (ADAHRS), AND DIGITAL AIR DATA COMPUTERS (DADC)					MANDATORY	NOT APPLICABLE - AS PER P/N
03-DEC-2014		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2014-17-02	APPLIANCE AD - EMERGENCY LOCATOR TRANSMITTER - BATTERY WIRING DISCREPANCIES - HONEYWELL ASCA INC					MANDATORY	NOT APPLICABLE - AS PER P/N
09-SEP-2014		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2015-08-07	APPLIANCE AD - OXYGEN - ZODIAC AEROTECHNICS (FORMERLY INTERTECHNIQUE AIRCRAFT SYSTEMS) FLIGHTCREW OXYGEN MASK REGULATORS - INSPECTION / REPLACEMENT OF INFLATABLE HARNESSSES					MANDATORY	NOT APPLICABLE - AS PER P/N & S/N
16-JUN-2015		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2015-08-07 PARA (G)	INSPECT THE INFLATABLE HARNESS FITTED TO EACH FLIGHTCREW OXYGEN MASK REGULATOR TO DETERMINE IF THE INFLATABLE HARNESS IS INSTALLED WITH A PART NUMBER AND A BATCH NUMBER IDENTIFIED IN APPENDIX I OF ZODIAC AEROSPACE SERVICE BULLETIN MXH-35-240, REVISION 7, DATED SEPTEMBER 1, 2011					MANDATORY	NOT APPLICABLE - AS PER P/N & S/N
16-JUN-2015		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2015-08-07 PARA (H)	REPLACE THE INFLATABLE HARNESS IDENTIFIED IN PAPRGRAPH G WITH A NEW OR RE-IDENTIFIED HARNESSSES					MANDATORY	NOT APPLICABLE - AS PER P/N & S/N
16-JUN-2015		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2015-10-51	APPLIANCE AD - AVIDYNE INTEGRATED FLIGHT DISPLAY (IFD)- INCORPORATE OPERATIONAL LIMITATIONS INTO LIMITATIONS SECTION OF THE AFM OR AFMS					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
01-JUL-2015		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
FAA 2015-10-51-E	APPLIANCE AD - AVIDYNE INTEGRATED FLIGHT DISPLAY (IFD)- INCORPORATE OPERATIONAL LIMITATIONS INTO LIMITATIONS SECTION OF THE AFM OR AFMS.					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
18-MAY-2015		MOS		(EFF)			
		HRS/MSC	-				
		AFL					
FAA 2015-16-04	APPLIANCE AD - FIRE PROTECTION - MODIFY ALL KIDDE GRAVINGER HAND-OPERATED FIRE EXTINGUISHERS HAVING PART NUMBERS 56412-001 (34H), 56411-001 (35H), AND 56412-002 (38H)					MANDATORY	NOT APPLICABLE - AS PER P/N
15-SEP-2015		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2015-23-09	APPLIANCE AD - OXYGEN - ZODIAC AEROTECHNICS (FORMERLY INTERTECHNIQUE AIRCRAFT SYSTEMS) FLIGHT CREW OXYGEN MASK REGULATORS - INSPECTION / REPLACEMENT OF OXYGEN MASK REGULATORS					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
28-DEC-2015		MOS HRS/MSC - AFL		30-SEP-2022			
FAA 2015-23-09 PARA (G)	INSPECT EACH FLIGHTCREW OXYGEN MASK REGULATOR TO IDENTIFY THE PART NUMBER AND SERIAL NUMBER					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
28-DEC-2015		DAY HRS/MSC - AFL		30-SEP-2022			
FAA 2015-23-09 PARA (H.1)	REPLACE EACH AFFECTED FLIGHTCREW OXYGEN MASK WITH A PART IDENTIFIED IN PARAGRAPH (H)(1)(I) OR (H)(1)(II).					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
28-DEC-2015		DAY HRS/MSC - AFL		30-SEP-2022			
FAA 2015-23-09 PARA (H.2.I)	REVISE THE EMERGENCY PROCEDURES SECTION OF THE AIRPLANE FLIGHT MANUAL (AFM) BY INSERTING THE STATEMENT PROVIDED IN FIGURE 1					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
28-DEC-2015		DAY HRS/MSC - AFL		30-SEP-2022			
FAA 2015-23-09 PARA (H.2.II)	FABRICATE AND INSTALL A PLACARD ON THE FLIGHTCREW OXYGEN MASK CONTAINER THAT STATES: "USE SELECTOR ON 100% OR EMERGENCY ONLY."					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
28-DEC-2015		DAY HRS/MSC - AFL		30-SEP-2022			
FAA 2015-23-09 PARA (I)	REGULATOR REPLACEMENT					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
28-DEC-2015		MOS HRS/MSC - AFL		30-SEP-2022			
FAA 2016-11-20	APPLIANCE AD - OXYGEN - INSPECTION AND REPLACEMENT OF B/E AEROSPACE PROTECTIVE BREATHING EQUIPMENT (PBE), PART NUMBER 119003-11 THAT ARE INSTALLED ON AIRPLANES. SUPERSEDED BY FAA AD 2017-18-12					SUPERSEDED	NOT APPLICABLE - FAA AD 2016-11-20 AND LBA LTA D-2016-189 CHECKED IAW AD/LTA INSTRUCTIONS AND FOUND PBE NOT EFFECTED DUE TO ESSEX MODEL MR-10051N INSTALLED WITH S/N E0704837
15-JUL-2016		MOS HRS/MSC - AFL ACH		05-AUG-2016 1020 882 480:24			
FAA 2016-11-20 PARA (G)	PHYSICALLY INSPECT THE PBE POUCH TO DETERMINE IF IT HAS AN INTACT VACUUM SEAL IN ACCORDANCE WITH B/E AEROSPACE SERVICE BULLETIN NO. 119003-35-011, REV .000, DATED FEBRUARY 4, 2015, PARA III.A.1 SUPERSEDED BY FAA AD 2017-18-12					SUPERSEDED	NOT APPLICABLE - FAA AD 2016-11-20 AND LBA LTA D-2016-189 CHECKED IAW AD/LTA INSTRUCTIONS AND FOUND PBE NOT EFFECTED DUE TO ESSEX MODEL MR-10051N INSTALLED WITH S/N E0704837
15-JUL-2016		MOS HRS/MSC - AFL ACH		05-AUG-2016 1020 882 480:24			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2016-11-20 PARA (H.1)	REPLACEMENT OF A PBE POUCH, FOUND DURING THE INSPECTION IN PARAGRAPH (G) OF THIS AD, THAT DOES NOT SUPERSEDED HAVE AN INTACT VACUUM SEAL. SUPERSEDED BY FAA AD 2017-18-12						NOT APPLICABLE - FAA AD 2016-11-20 AND LBA LTA D-2016-189 CHECKED IAW AD/LTA INSTRUCTIONS AND FOUND PBE NOT EFFECTED DUE TO ESSEX MODEL MR-10051N INSTALLED WITH S/N E0704837
15-JUL-2016		MOS HRS/MSC - AFL ACH		05-AUG-2016 1020 882 480:24			
FAA 2016-11-20 PARA (H.2)	REPLACEMENT OF A PBE POUCH, FOUND DURING THE INSPECTION IN PARAGRAPH (G) OF THIS AD, WHERE THE VACUUM SEAL IS INTACT. SUPERSEDED BY FAA AD 2017-18-12					SUPERSEDED	NOT APPLICABLE - FAA AD 2016-11-20 AND LBA LTA D-2016-189 CHECKED IAW AD/LTA INSTRUCTIONS AND FOUND PBE NOT EFFECTED DUE TO ESSEX MODEL MR-10051N INSTALLED WITH S/N E0704837
15-JUL-2016		MOS HRS/MSC - AFL ACH		05-AUG-2016 1020 882 480:24			
FAA 2017-04-06	APPLIANCE AD - CABIN SYSTEMS - REPLACEMENT OF UNITED INSTRUMENTS INC. 5934 SERIES ALTIMETERS MANUFACTURED BETWEEN JANUARY 2015 AND FEBRUARY 2016					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
07-APR-2017		MOS HRS/MSC - AFL		30-SEP-2022			
FAA 2017-06-03	APPLIANCE AD - HEATING SYSTEM - ACCOMPLISH REPETATIVE DETAILED INSPECTIONS AND PRESSURE DECAY TESTS OF THE COMBUSTION HEATER AND DISABLE / REMOVE IF NECESSARY					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
05-MAY-2017		MOS HRS/MSC - AFL		26-SEP-2022			
FAA 2017-06-03 PARA (G)	PERFORM INSPECTIONS AND PRESSURE DECAY TEST (PDT) OF THE COMBUSTION HEATER					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
05-MAY-2017		MOS HRS/MSC - AFL		26-SEP-2022			
FAA 2017-06-03 PARA (K)	DISABLE OR REMOVE COMBUSTION HEATER					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
05-MAY-2017		DAYs HRS/MSC - AFL		26-SEP-2022			
FAA 2017-11-11	APPLIANCE AD - NAVWORX, INC. AUTOMATIC DEPENDENT SURVEILLANCE - BROADCAST (ADS-B) UNIVERSAL ACCESS TRANSCEIVER UNITS - REMOVE, DISABLE, OR REVISE SOFTWARE TO BROADCAST A SIL OF 0					MANDATORY	NOT APPLICABLE - AS PER P/N
11-JUL-2017		MOS HRS/MSC - AFL		30-SEP-2022			
FAA 2017-16-01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - AMERI-KING CORPORATION MODEL AK-450() AND AK-451() SERIES EMERGENCY LOCATOR TRANSMITTERS - REPETATIVE INSPECTIONS, CHECKS, TESTS AND VERIFICATIONS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
24-OCT-2017		MOS HRS/MSC - AFL		22-FEB-2018 1161:54 1003			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2017-16-01 PARA (G)	PERFORM GENERAL VISUAL INSPECTIONS OF THE ELT FOR DISCREPANCIES; CHECKS , TESTS AND VERIFICATIONS AS APPLICABLE, TO ENSURE THE ELT IS FUNCTIONING, AND ALL APPLICABLE CORRECTIVE ACTIONS			MANDATORY		NOT APPLICABLE - EQUIPMENT NOT INSTALLED	
24-OCT-2017		MOS		22-FEB-2018			
		HRS/MSC	-	1161:54			
		AFL		1003			
FAA 2017-16-01 PARA (J)	OPTIONAL TERMINATING ACTION: REPLACE ELT WITH A SERVICEABLE FAA-APPROVED ELT			MANDATORY		NOT APPLICABLE - EQUIPMENT NOT INSTALLED	
24-OCT-2017		MOS		22-FEB-2018			
		HRS/MSC	-	1161:54			
		AFL		1003			
FAA 2017-18-12	APPLIANCE AD - OXYGEN - INSPECTION AND REPLACEMENT OF B/E AEROSPACE PROTECTIVE BREATHING EQUIPMENT (PBE), PART NUMBER 119003-11 AND 119003-21 THAT ARE INSTALLED ON AIRPLANES			MANDATORY		NOT APPLICABLE - NOT EFFECTED BY P/N	
16-OCT-2017		MOS		22-FEB-2018			
		HRS/MSC	- (s)	1161:54			
		AFL		1003			
FAA 2017-18-12 PARA (G)	INSPECTION RETAINED FROM AD 2016-11-20 FOR AIRPLANES WITH PBE, P/N 119003-11, INSTALLED			MANDATORY		NOT APPLICABLE - NOT EFFECTED BY P/N	
16-OCT-2017		MOS		22-FEB-2018			
		HRS/MSC	- (s)	1161:54			
		AFL		1003			
FAA 2017-18-12 PARA (H)	REPLACEMENT RETAINED FROM AD 2016-11-20 FOR AIRPLANES WITH PBE, P/N 119003-11, INSTALLED			MANDATORY		NOT APPLICABLE - NOT EFFECTED BY P/N	
16-OCT-2017		MOS		22-FEB-2018			
		HRS/MSC	- (s)	1161:54			
		AFL		1003			
FAA 2017-18-12 PARA (I) & (J)	INSPECT TO DETERMINE IF THE S/N OF THE INSTALLED PBE, P/N 119003-21, IS WITHIN THE RANGE OF 004-14768M THROUGH 004-21093M OR 004-02393M THROUGH 004-03033M AND IF FOUND WITHIN THE S/N RANGE REPLACE IT.			MANDATORY		NOT APPLICABLE - NOT EFFECTED BY P/N	
16-OCT-2017		MOS		22-FEB-2018			
		HRS/MSC	-	1161:54			
		AFL		1003			
FAA 2017-22-14	APPLIANCE AD - NAVIGATION - INSTALLATION OF THE TSSA-4100 FLS UPGRADES ON THE ROCKWELL COLLINS, INC. TSS-4100 TRAFFIC SURVEILANCE SYSTEM PROCESSING UNITS			MANDATORY		NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED	
20-DEC-2017		MOS		21-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2018-02-04	APPLIANCE AD - EXHAUST NOISE SUPPRESSOR - INSPECTION OF THE MUFFLER FOR LEAKING TO IDENTIFY CRACKS AND REPLACEMENT OF THE MUFFLER			MANDATORY		NOT APPLICABLE - AS PER P/N	
21-FEB-2018		MOS		26-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2018-02-04 PARA (G)(1)	INSPECTION OF THE MUFFLER			MANDATORY		NOT APPLICABLE - AS PER P/N	
21-FEB-2018		MOS		26-SEP-2022			
		HRS/MSC	-				
		AFL					
FAA 2018-02-04 PARA (G)(2)	REMOVE AND REPLACE THE AFFECTED MUFFLER IN LIEU OF DOING THE INSPECTION REQUIRED IN PARA (G)(1)			MANDATORY		NOT APPLICABLE - AS PER P/N	
21-FEB-2018		MOS		26-SEP-2022			
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2018-02-04 PARA (H)(1)	REPLACEMENT OF THE MUFFLER & (2)					MANDATORY	NOT APPLICABLE - AS PER P/N
21-FEB-2018		MOS HRS/MSC - AFL		26-SEP-2022			
FAA 2018-02-04 PARA (H)(3)	DO NOT INSTALL ON ANY AIRPLANE AN AFFECTED MUFFLER LISTED IN FIGURE 1 OF PARAGRAPH (C) OF THIS AD					MANDATORY	NOT APPLICABLE - AS PER P/N
21-FEB-2018		MOS HRS/MSC - AFL		26-SEP-2022			
FAA 2018-03-04	APPLIANCE AD - NAVIGATION - REPLACEMENT OF ROSEMOUNT AEROSPACE INC. MODEL 851AK PITOT PROBES REPAIRED BY CSI AEROSPACE INC					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
16-MAR-2018		MOS HRS/MSC - AFL		26-SEP-2022			
FAA 2018-03-04 PARA (G)	DETERMINE NUMBER OF AFFECTED PITOT PROBES INSTALLED					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
16-MAR-2018		DAYS HRS/MSC - AFL		26-SEP-2022			
FAA 2018-03-04 PARA (H)(1)	REPLACE AFFECTED PITOT PROBES					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
16-MAR-2018		MOS HRS/MSC - AFL		26-SEP-2022			
FAA 2018-03-04 PARA (H)(2)	DO NOT INSTALL ON ANY AIRPLANE A PITOT PROBE HAVING A SERIAL NUMBER LISTED IN PARA (C)(1) OF THIS AD, UNLESS IT HAS BEEN PROPERLY REPAIRED, AND IF REPAIRED BY CSI AEROSPACE, INC., HAS A REPAIR DATE OF AUGUST 1, 2014, OR LATER					MANDATORY	NOT APPLICABLE - AS EQUIPMENT NOT INSTALLED
16-MAR-2018		MOS HRS/MSC - AFL		26-SEP-2022			
FAA 2018-21-14	APPLIANCE AD - OXYGEN - OXYGEN MASK REGULATOR HARNESS INFLATION HOSES - INSPECTION / REPLACEMENT					MANDATORY	NOT APPLICABLE - DUE TO INSTALLED P/N OF CREW OXYGEN MASKS.
27-MAR-2019		MOS HRS/MSC - AFL		18-FEB-2020 1394:06 1227			
FAA 2018-21-14 PARA (G)	REQUIRED ACTIONS					MANDATORY	NOT APPLICABLE - DUE TO INSTALLED P/N OF CREW OXYGEN MASKS.
27-MAR-2019		MOS HRS/MSC - AFL		18-FEB-2020 1394:06 1227			
FAA 2018-21-14 PARA (H)	DO NOT INSTALL ON ANY AIRPLANE A FLIGHT CREW OXYGEN MASK REGULATOR WITH A P/N LISTED IN PLANNING INFORMATION, PARAGRAPH 1.A.(1), OF ZODIAC SB MC10-35-274 R02, DATED JUNE 25, 2014, UNLESS IT MEETS THE DEFINITION OF A PART ELIGIBLE FOR INSTALLATION IN PARA (I) OF THIS AD					MANDATORY	NOT APPLICABLE - DUE TO INSTALLED P/N OF CREW OXYGEN MASKS.
27-MAR-2019		MOS HRS/MSC - AFL		18-FEB-2020 1394:06 1227			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2019-01-02	APPLIANCE AD - NAVIGATION - AUTOMATIC DEPENDENT SURVEILLANCE-BROADCAST (ADS-B) IN - AIRPLANE FLIGHT MANUAL SUPPLEMENT (AFMS) - DISABLE / REVISE						NOT APPLICABLE - ASPEN AVIONICS Flight Display System not installed, see also LBA D-2019-031, no further Action required
07-FEB-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
FAA 2019-01-02 PARA (G)(1)	DISABLE THE AUTOMATIC DEPENDENT SURVEILLANCE-BROADCAST (ADS-B) IN FUNCTION IN EACH UNIT					MANDATORY	NOT APPLICABLE - ASPEN AVIONICS Flight Display System not installed, see also LBA D-2019-031, no further Action required
07-FEB-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
FAA 2019-01-02 PARA (G)(2)	REVISE THE AIRPLANE FLIGHT MANUAL SUPPLEMENT IN ACCORDANCE WITH PARAGRAPH 5.2.C OF SB2018-01					MANDATORY	NOT APPLICABLE - ASPEN AVIONICS Flight Display System not installed, see also LBA D-2019-031, no further Action required
07-FEB-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
FAA 2019-07-10	APPLIANCE AD - NAVIGATION - LITEF ATTITUDE HEADING AND REFERENCE SYSTEM (AHRS) - REMOVAL					MANDATORY	NOT APPLICABLE - Grumman LITEF GmbH LCR-100 Attitude and Heading Reference System not Installed. AHRS P/N 822-1110-002 installed. No further action required
29-MAY-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
FAA 2019-07-10 PARA (F)(1)	REMOVE THE AHRS UNIT FROM SERVICE					MANDATORY	NOT APPLICABLE - Grumman LITEF GmbH LCR-100 Attitude and Heading Reference System not Installed. AHRS P/N 822-1110-002 installed. No further action required
29-MAY-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
FAA 2019-07-10 PARA (F)(2)	REMOVAL FROM SERVICE OF P/N 145130-7100 TERMINATES THE REQUIREMENTS OF AD 2010-26-09 (75 FR 81424, DECEMBER 28, 2010)					MANDATORY	NOT APPLICABLE - Grumman LITEF GmbH LCR-100 Attitude and Heading Reference System not Installed. AHRS P/N 822-1110-002 installed. No further action required
29-MAY-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2019-07-10 PARA (F)(3)	DO NOT INSTALL AN AHRS UNIT P/N 145130-2000, 145130-2001, 145130-7000, 145130-7001, OR 145130-7100 ON ANY AIRCRAFT					MANDATORY	NOT APPLICABLE - Grumman LITEF GmbH LCR-100 Attitude and Heading Reference System not Installed. AHRS P/N 822-1110-002 installed. No further action required
29-MAY-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
FAA 2019-12-09	APPLIANCE AD - NAVIGATION - FDSA-6500 TCAS - AFM OR AFMS LIMITATIONS SECTION - REVISION / PLACARD INSTALLATION (SUPERSEDED BY FAA AD 2021-05-17)					SUPERSEDED	NOT APPLICABLE - NOT EQUIPPED WITH ROCKWELL COLLINS FLIGHT DISPLAY SYSTEM APPLICATION FDSA-6500 PART NUMBERS 810-0234-XXXXXX
23-JUL-2019		DAY HRS/MSC - AFL		21-SEP-2022			
FAA 2019-13-03	APPLIANCE AD - TRIG AVIONICS LTD. - NAVIGATION - TRANSPONDERS INSTALLATION - INSPECTION / MODIFICATION					MANDATORY	NOT APPLICABLE - Trig Avionics Transponder not installed, No further Action required
27-AUG-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
FAA 2019-13-03 PARA (G)	INSPECT THE TRANSPONDER INSTALLATION TO DETERMINE IF THE TRANSPONDER IS INSTALLED IN A CONVENTIONAL AFT-FACING AVIONICS RACK					MANDATORY	NOT APPLICABLE - Trig Avionics Transponder not installed, No further Action required
27-AUG-2019		DAY HRS/MSC - AFL ACH					
FAA 2019-13-03 PARA (H)	DO NOT INSTALL AN Affected TRANSPONDER ON ANY AIRCRAFT, UNLESS THE TRANSPONDER IS INSTALLED IN A CONVENTIONAL AFT-FACING AVIONICS RACK AS DEFINED IN THIS AD					MANDATORY	NOT APPLICABLE - Trig Avionics Transponder not installed, No further Action required
27-AUG-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
FAA 2019-15-10	APPLIANCE AD - EQUIPMENT / FURNISHING - LIFE JACKET - REMOVAL / REPAIR					MANDATORY	NOT APPLICABLE - P/N and listed Models are not applicable, No further action required
19-SEP-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
FAA 2019-15-10 PARA (G)	REMOVE EACH Affected LIFE JACKET FROM THE AIRPLANE AND REPLACE THE LIFE JACKET WITH A LIFE JACKET ELIGIBLE FOR INSTALLATION					MANDATORY	NOT APPLICABLE - P/N and listed Models are not applicable, No further action required
19-SEP-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2019-15-10 PARA (H)	DO NOT INSTALL ON ANY AIRPLANE AN AFFECTED LIFE JACKET UNLESS IT HAS BEEN REPAIRED AND MARKED TO INDICATE COMPLIANCE WITH SUCH REPAIR IN ACCORDANCE WITH ZODIAC AEROSPACE SERVICES SB 25-65-34, REVISION 01, DATED MARCH 15, 2019, OR ORIGINAL ISSUE, DATED JANUARY 8, 2019; OR A METHOD APPROVED BY THE FAA					MANDATORY	NOT APPLICABLE - P/N and listed Models are not applicable, No further action required
19-SEP-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
FAA 2019-21-06	APPLIANCE AD - FLIGHT COMPARTMENT EQUIPMENT - IPECO HOLDINGS LTD. -MODIFICATION AND REIDENTIFICATION OF PILOT'S AND CO-PILOT'S SEATS					MANDATORY	NOT APPLICABLE - AS PER PN
13-DEC-2019		MOS HRS/MSC - AFL		27-SEP-2022			
FAA 2019-21-06 PARA (G)(1)	MODIFY AND RE-IDENTIFY EACH AFFECTED PILOT AND CO-PILOT SEAT (RESTATEMENT OF FAA 2017-22-02)					MANDATORY	NOT APPLICABLE - AS PER PN
13-DEC-2019		MOS HRS/MSC - AFL		27-SEP-2022			
FAA 2019-21-06 PARA (G)(2)	INSPECT ANY AFFECTED SPRING OF EACH SEAT; REPLACE BOTH SPRINGS (IF, DURING ANY INSPECTION ANY DAMAGE OR INCORRECT INSTALLATION OF AN EFFECTED SPING IS FOUND)					MANDATORY	NOT APPLICABLE - AS PER PN
13-DEC-2019		MOS HRS/MSC - AFL		27-SEP-2022			
FAA 2019-21-06 PARA (G)(3)	SEND THE INSPECTION RESULTS, INCLUDING NO FINDINGS, TO IPECO AT TECHNICALSUPPORT@IPECO.COM					MANDATORY	NOT APPLICABLE - AS PER PN
13-DEC-2019		DAYS HRS/MSC - AFL		27-SEP-2022			
FAA 2019-21-06 PARA (H)	DO NOT INSTALL ANY PILOT OR CO-PILOT SEAT IDENTIFIED IN PARAGRAPH (C)(1)(I) OF THIS AD UNLESS THE SEAT IS MODIFIED AND RE-IDENTIFIED AS SPECIFIED IN PARAGRAPH (G)(1) OF THIS AD					MANDATORY	NOT APPLICABLE - AS PER PN
13-DEC-2019		MOS HRS/MSC - AFL		27-SEP-2022			
FAA 2020-08-02	APPLIANCE AD - NAVIGATION - THALES AVS FRANCE SAS - GLOBAL NAVIGATION SATELLITE SYSTEM - OPERATIONAL LIMITATIONS					MANDATORY	NOT APPLICABLE - AS PER PN
19-MAY-2020		MOS HRS/MSC - AFL		27-SEP-2022			
FAA 2020-09-02	APPLIANCE AD - EQUIPMENT/FURNISHINGS - ANJOU AERONAUTIQUE - RESTRAINT SYSTEMS ROTARY BUCKLE SUB ASSEMBLY - REPLACEMENT					MANDATORY	NOT APPLICABLE - AS PER EQUIPMENT INSTALLED
29-MAY-2020		MOS HRS/MSC - AFL		05-DEC-2022			
FAA 2020-09-02 PARA (G)(1)	INSPECT EACH RESTRAINT SYSTEM FOR PROPER RELEASE OF THE STRAPS FROM THE RESTRAINT SYSTEM AND, DEPENDING IF THE STRAPS RELEASE, PLACARD THE SEAT AS INOPERATIVE AND REMOVE AND REPLACE THE ROTARY BUCKLE SUB-ASSEMBLY (FOR THE RESTRAINT SYSTEMS LISTED IN THE EFFECTIVITY OF ANJOU AERO SB 358SB-14-101 R01, EXCEPT FOR S/NS 1038-1048 (INCLUSIVE), 1050-1055 (INCLUSIVE), AND 1062-1073 (INCLUSIVE))					MANDATORY	NOT APPLICABLE - AS PER EQUIPMENT INSTALLED
29-MAY-2020		MOS HRS/MSC - AFL		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2020-09-02 PARA (G)(2)	INSPECT EACH RESTRAINT SYSTEM FOR PROPER RELEASE OF THE STRAPS FROM THE RESTRAINT SYSTEM AND, DEPENDING IF THE STRAPS RELEASE, PLACARD THE SEAT AS INOPERATIVE AND REMOVE AND REPLACE THE RESTRAINT SYSTEM FROM SERVICE (FOR RESTRAINT SYSTEMS, P/N 358XX-XXX-YY-ZZZ (WHERE 358XX-XXX-YY-ZZZ CAN BE ANY COMBINATION OF NUMBERS AND/OR LETTERS), HAVING S/N 738-1619 (INCLUSIVE))					MANDATORY	NOT APPLICABLE - AS PER EQUIPMENT INSTALLED
29-MAY-2020	MOS HRS/MSC - AFL			05-DEC-2022			
FAA 2020-09-02 PARA (H)	DO NOT INSTALL ON ANY AIRCRAFT AN ANJOU AERONAUTIQUE RESTRAINT SYSTEM, P/N 358XX-XXX-YY-ZZZ, HAVING S/N 738-1619 (INCLUSIVE), EVEN IF THE RESTRAINT SYSTEM IS LABELED IN COMPLIANCE WITH ANJOU AERO SB 358SB-14-101 R01, DATED DECEMBER 12, 2014					MANDATORY	NOT APPLICABLE - AS PER EQUIPMENT INSTALLED
29-MAY-2020	MOS HRS/MSC - AFL			05-DEC-2022			
FAA 2020-10-05	APPLIANCE AD - NAVIGATION - ROCKWELL COLLINS PRO LINE 4 AND PRO LINE 21 FLIGHT MANAGEMENT SYSTEMS					MANDATORY	NOT APPLICABLE - FOUND BARO TEMP COMPENSATION DIASABLED. SL525B34-14 AND AD 2020-10-05 ARE NOT APPLICABLE.
24-JUN-2020	MOS HRS/MSC - AFL			31-JUL-2020 1493:18 1303			
FAA 2020-16-08	APPLIANCE AD - ASPEN AVIONICS, INC. - EFD1000 FLIGHT DISPLAY SYSTEMS - AIRPLANE FLIGHT MANUAL - REVISION					MANDATORY	NOT APPLICABLE - AS PER P/N
17-AUG-2020	MOS HRS/MSC - AFL			21-SEP-2022			
FAA 2020-18-51	APPLIANCE AD - SANDIA AEROSPACE - AIRPLANE FLIGHT MANUAL - SECTION LIMITATIONS - AMENDMENT					MANDATORY	NOT APPLICABLE - AS PER P/N
28-SEP-2020	MOS HRS/MSC - AFL			21-SEP-2022			
FAA 2020-21-02	APPLIANCE AD - FIRE PROTECTION - KIDDE AEROSPACE & DEFENSE CARGO FIRE EXTINGUISHER HALON BOTTLES - REPLACEMENT					MANDATORY	NOT APPLICABLE - AS PER P/N
19-NOV-2020	MOS HRS/MSC - AFL			21-SEP-2022			
FAA 2020-21-02 PARA (H) & (I)	DO AN INSPECTION TO DETERMINE THE PART NUMBER AND SERIAL NUMBER OF THE CARGO FIRE EXTINGUISHER HALON BOTTLES INSTALLED IN THE CARGO COMPARTMENT AND REPLACE WITH A SERVICEABLE PART AS REQUIRED					MANDATORY	NOT APPLICABLE - AS PER P/N
	MOS HRS/MSC - AFL			21-SEP-2022			
FAA 2020-21-02 PARA (J)	NO PERSON MAY INSTALL ON ANY AIRPLANE AN Affected PART AS IDENTIFIED IN PARAGRAPH (G)(3) OF THIS AD UNLESS THAT PART HAS A CIRCLED LETTER "G" STAMPED AT A DISTANCE 8 OF APPROXIMATELY ONE INCH FROM THE LEFT EDGE OF THE PLACARD, INDICATING THAT THE CARGO FIRE EXTINGUISHER HALON BOTTLE HAS BEEN TESTED AND REFILLED					MANDATORY	NOT APPLICABLE - AS PER P/N
	MOS HRS/MSC - AFL			21-SEP-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2021-05-17	APPLIANCE AD - NAVIGATION - ROCKWELL COLLINS FDSA-6500 FLIGHT DISPLAY SYSTEM - OPERATING LIMITIATIIONS / SOFTWARE UPGRADE					MANDATORY	NOT APPLICABLE - AS PER P/N
29-APR-2021		MOS HRS/MSC - AFL		21-SEP-2022			
FAA 2021-05-17 PARA (G)(1) & (G)(2)	REVISE THE AIRCRAFT FLIGHT MANUAL (AFM) OR AFM SUPPLEMENT (AFMS), FABRICATE A PLACARD FOR EACH PRIMARY FLIGHT DISPLAY AND INSTALL THE PLACARD ON THE BOTTOM OF EACH PRIMARY FLIGHT DISPLAY BEZEL (RESTATEMENT OF FAA AD 2019-12-09)					MANDATORY	NOT APPLICABLE - AS PER P/N
29-APR-2021		DAY HRS/MSC - AFL		21-SEP-2022			
FAA 2021-05-17 PARA (G)(3)	UPGRADE THE FDSA-6500 FIELD LOADABLE SOFTWARE					MANDATORY	NOT APPLICABLE - AS PER P/N
29-APR-2021		MOS HRS/MSC - AFL		21-SEP-2022			
FAA 2021-05-17 PARA (G)(5)	AS OF THE EFFECTIVE DATE OF THIS AD, DO NOT INSTALL A ROCKWELL COLLINS FLIGHT DISPLAY SYSTEM APPLICATION FDSA-6500 P/N 810-0234-1H0001, 810-0234-1H0002, 810-0234-1H0003, 810-0234-2H0001, 810-0234-2C0001, 810-0234-2C0002, OR 810-0234-4B0001 ON ANY AIRPLANE					MANDATORY	NOT APPLICABLE - AS PER P/N
29-APR-2021		MOS HRS/MSC - AFL		21-SEP-2022			
FAA 2021-07-13	APPLIANCE AD - EQUIPMENT AND FURNISHING - SEAT RESTRAINT SYSTEM PLASTIC ROTARY BUCKLE HANDLE - INSPECTION/REPLACEMENT					MANDATORY	NOT APPLICABLE - AS PER P/N
11-MAY-2021		MOS HRS/MSC - AFL		21-SEP-2022			
FAA 2021-07-13 PARA (E)(1)	INSPECT THE BUCKLE HANDLE FOR A CRACK AND IF CRACKED, BEFORE FURTHER FLIGHT, REPLACE IT WITH AN AIRWORTHY BUCKLE					MANDATORY	NOT APPLICABLE - AS PER P/N
11-MAY-2021		MOS HRS/MSC - AFL		21-SEP-2022			
FAA 2021-07-13 PARA (E)(2)	MEASURE THE THICKNESS OF THE BUCKLE HANDLE VANE; IF THICKNESS IS 0.125 INCH OR GREATER, BEFORE FURTHER FLIGHT, REMOVE THE BUCKLE FROM SERVICE AND REPLACE IT WITH AN AIRWORTHY BUCKLE					MANDATORY	NOT APPLICABLE - AS PER P/N
11-MAY-2021		MOS HRS/MSC - AFL		21-SEP-2022			
FAA 2021-07-13 PARA (E)(3)	DO NOT INSTALL A BUCKLE OR RESTRAINT SYSTEM WITH A BUCKLE P/N 1111430 OR 1111475, ALL DASH NUMBERS, WITH A HANDLE VANE THICKNESS OF 0.125 INCH OR GREATER					MANDATORY	NOT APPLICABLE - AS PER P/N
11-MAY-2021		MOS HRS/MSC - AFL		21-SEP-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2021-08-07	APPLIANCE AD - ROCKWELL COLLINS - GLOBAL POSITIONING SYSTEM GPS-4000S - UPGRADE					MANDATORY	COMPLIED WITH - EASA AD US-2021-08-07 PERFORMED GPS-4000S UNITS REPLACED. REPLACEMENT AND OPERATIONAL TEST PERFORMED.
							WORK PERFORMED BY WAA IN VIE WITH WO 22-0138
12-MAY-2021		MOS HRS/MSC - AFL		10-NOV-2022 2091:36 1700			
FAA 2021-08-15	APPLIANCE AD - NAVIGATION - GARMIN INTERNATIONAL GMN-00962 GTS PROCESSOR UNITS, PART NUMBER 011-02571-0() - SOFTWARE UPDATE					MANDATORY	NOT APPLICABLE - AS PER P/N
17-MAY-2021		MOS HRS/MSC - AFL		26-SEP-2022			
FAA 2021-22-07	APPLIANCE AD - FIRE PROTECTION - HAND-OPERATED FIRE EXTINGUISHERS - INSPECTION / REPLACEMENT					MANDATORY	NOT APPLICABLE - AS PER INSTALLED FIRE EXTINGUISHER
18-NOV-2021		DAY HRS/MSC - AFL		27-SEP-2022			
FAA 2021-23-12	APPLIANCE AD - INDICATING / RECORDING / NAVIGATION - RADIO (RADAR) ALTIMETER - AFM REVISION TO INCORPORATE LIMITATIONS					SUPERSEDED	COMPLIED WITH - AD REMOVED FROM AFM, AD SUPERSEDED BY AD 2023-10-02
09-DEC-2021		MOS HRS/MSC - AFL		27-SEP-2022			
FAA 2022-01-03	APPLIANCE AD - FIRE PROTECTION - HAND-HELD FIRE EXTINGUISHERS - REPLACEMENT					MANDATORY	NOT APPLICABLE - AS PER EQUIPMENT INSTALLED
07-MAR-2022		MOS HRS/MSC - AFL		05-DEC-2022			
FAA 2022-04-09	APPLIANCE AD - OXYGEN - OXYGEN VALVE ASSEMBLIES, AND OXYGEN CYLINDER AND VALVE ASSEMBLIES - INSPECT / REPLACE					SUPERSEDED	NOT APPLICABLE - AS PER P/N
04-APR-2022		MOS HRS/MSC - AFL		21-SEP-2022			
FAA 2022-04-09 PARA (H) & (I)	INSPECT THE OXYGEN VALVE ASSEMBLIES, AND OXYGEN CYLINDER AND VALVE ASSEMBLIES, TO DETERMINE IF AN EFFECTED PART INSTALLED; IF INSTALLED, BEFORE FURTHER FLIGHT, DO A DETAILED INSPECTION FOR CORRECT SPACING OF THE GAP BETWEEN THE BOTTOM OF THE PACKING RETAINER AND TOP OF THE VALVE BODY AND PERFORM CORRECTIVE ACTIONS					SUPERSEDED	NOT APPLICABLE - AS PER P/N
04-APR-2022		DAY HRS/MSC - AFL		21-SEP-2022			
FAA 2022-04-09 PARA (J)	REPORT THE RESULTS OF THE INSPECTION					SUPERSEDED	NOT APPLICABLE - AS PER P/N
04-APR-2022		DAY HRS/MSC - AFL		21-SEP-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2022-05-10	APPLIANCE AD - CABIN EQUIPMENT/FURNISHINGS - GOODRICH HOIST ASSEMBLY - INSPECT/REPLACE					MANDATORY	NOT APPLICABLE - AS PER EQUIPMENT INSTALLED
	MOS HRS/MSC - AFL			05-DEC-2022			
FAA 2022-05-10 PARA (G)(1)	REPLACE A HOIST WITHOUT THE NUMBER 4 AS THE FIRST DIGIT OF ITS SERIAL NUMBER					MANDATORY	NOT APPLICABLE - AS PER EQUIPMENT INSTALLED
	MOS HRS/MSC - AFL			05-DEC-2022			
FAA 2022-05-10 PARA (G)(2)	INSTALL PLACARDS AND REVIS THE EXISTING RFM					MANDATORY	NOT APPLICABLE - AS PER EQUIPMENT INSTALLED
	MOS HRS/MSC - AFL			05-DEC-2022			
FAA 2022-05-10 PARA (G)(3)	DEACTIVATE OR REMOVE THE HOIST IF PARTIAL PEEL OUT OCCURS					MANDATORY	NOT APPLICABLE - AS PER EQUIPMENT INSTALLED
	MOS HRS/MSC - AFL			05-DEC-2022			
FAA 2022-05-10 PARA (G)(4)	REVIEW THE HELICOPTER'S HOIST SLIP LOAD TEST RECORDS					MANDATORY	NOT APPLICABLE - AS PER EQUIPMENT INSTALLED
	DAY HRS/MSC - AFL			05-DEC-2022			
FAA 2022-05-10 PARA (G)(5)	INSPECT CABLE FROM THE HOOK ASSEMBLY, PERFORM CABLE CONDITIONING AND HOIST SLIP LOAD TEST					MANDATORY	NOT APPLICABLE - AS PER EQUIPMENT INSTALLED
	DAY HRS/MSC - AFL			05-DEC-2022			
FAA 2022-05-10 PARA (G)(6)	REPORT HOIST SLIP LOAD TEST INFORMATION REQUESTED IN APPENDIX 1					MANDATORY	NOT APPLICABLE
	DAY HRS/MSC - AFL			05-DEC-2022			
FAA 2023-10-02	APPLIANCE AD - INDICATING/RECORDING SYSTEM/NAVIGATION - RADIO ALTIMETER - AFM REVISION					MANDATORY	- NOT ADOPTED BY EASA - NO FURTHER ACTION REQUIRED
26-MAY-2023	MOS HRS/MSC - AFL			22-JUN-2023			
FAA 2023-10-02 PARA (H)	REVISE THE LIMITATIONS SECTION OF THE EXISTING AFM (UNTIL 30-JUNE-2023 - SATISFIED BY FAA 2021-23-12)					MANDATORY	- NOT ADOPTED BY EASA - NO FURTHER ACTION REQUIRED
26-MAY-2023	MOS HRS/MSC - AFL			22-JUN-2023			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2023-12-25	APPLIANCE AD - EQUIPMENT / FURNISHINGS - SURVITEC GROUP LIMITED (RFD BEAUFOT LTD.) TYPE 102 MK 3, 102 MK 4 AND TYPE 105 MK 1 LIFE JACKETS - REPLACE					MANDATORY	NOT APPLICABLE - BY INSTALLED PART
39-22484 23-AUG-2023		MOS HRS/MSC - AFL		08-AUG-2023			
FAA 2023-12-25 PARA (G)	DO A GENERAL VISUAL INSPECTION OF THE LIFE JACKET					MANDATORY	NOT APPLICABLE - BY INSTALLED PART
		MOS HRS/MSC - AFL		08-AUG-2023			
FAA 2023-12-25 PARA (J)	SUBMIT A REPORT OF THE INSPECTION TO SURVITEC					MANDATORY	NOT APPLICABLE - BY INSTALLED PART
		DAYS HRS/MSC - AFL		08-AUG-2023			
FAA 2023-13-11	APPLIANCE AD - OXYGEN - OXYGEN VALVE ASSEMBLIES / OXYGEN CYLINDER AND VALVE ASSEMBLIES - INSPECTION/REPLACEMENT					MANDATORY	NOT APPLICABLE - AS PER PART NUMBER
39-22496 05-SEP-2023		MOS HRS/MSC - AFL		17-AUG-2023			
FAA 2023-13-11 PARA (H)	INSPECT THE OXYGEN VALVE ASSEMBLIES AND OXYGEN CYLINDER AND VALVE ASSEMBLIES					MANDATORY	NOT APPLICABLE - AS PER PART NUMBER
39-22496 05-SEP-2023		DAYS HRS/MSC - AFL		17-AUG-2023			
FAA 2023-14-10	APPLIANCE AD - FLIGHT COMPARTMENT EQUIPMENT - IPECO HOLDINGS LIMITED (IPECO) PILOT AND CO-PILOT SEATS - INSPECTION/MODIFICATION					MANDATORY	NOT APPLICABLE - By Part- N/A per installed Seat
39-22510 07-SEP-2023		MOS HRS/MSC - AFL ACH					
FAA 2023-14-10 PARA (G)(1)	MODIFY AND RE-IDENTIFY EACH AFFECTED PILOT AND CO-PILOT SEAT (SEATS THAT HAVE NOT INSTALLED THE TRACK LOCK SPRING MODIFICATION KIT)					MANDATORY	NOT APPLICABLE - By Part- N/A per installed Seat
07-SEP-2023		MOS HRS/MSC - AFL ACH					
FAA 2023-14-10 PARA (G)(2)	INSPECT THE TRACK LOCK SPRING OF EACH SEAT					MANDATORY	NOT APPLICABLE - By Part- N/A per installed Seat
07-SEP-2023		MOS HRS/MSC - AFL ACH					
FAA 2023-14-10 PARA (G)(3)	SEND THE INSPECTION RESULTS, INCLUDING NO FINDINGS, TO IPECO					MANDATORY	NOT APPLICABLE - By Part- N/A per installed Seat
07-SEP-2023		MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2023-14-10 PARA (H)	MODIFY AND RE-IDENTIFY EACH AFFECTED SEAT					MANDATORY	NOT APPLICABLE - By Part- N/A per installed Seat
07-SEP-2023	MOS HRS/MSC - AFL ACH						
FAA 2023-21-05	APPLIANCE AD - NAVIGATION - FLIGHT MANAGEMENT COMPUTER 2/NAVIGATION MODULES - OPERATIONAL LIMITATIONS/AMENDMENT					MANDATORY	NOT APPLICABLE - AS PER INSTALLED FMC
39-22577 12-DEC-2023	DAYS HRS/MSC - AFL			28-NOV-2023			
FAA 2024-26-02 PARA (G)(1)	INSPECT THE BUCKLE HANDLE FOR A CRACK AND IF CRACKED, BEFORE FURTHER FLIGHT, REPLACE IT WITH AN AIRWORTHY BUCKLE	MOS HRS/MSC AFL	6	(EFF)	07-SEP-2025	MANDATORY	
07-MAR-2025							
FAA 2024-26-02 PARA (G)(2)	MEASURE THE THICHNESS OF THE BUCKLE HANDLE VANE; IF THICKNESS IS 0.125 INCH OR GREATER, BEFORE FURTHER FLIGHT, REMOVE THE BUCKLE FROM SERVICE AND REPLACE IT WITH AN AIRWORTHY BUCKLE	MOS HRS/MSC AFL	12	(EFF)	07-MAR-2026	MANDATORY	
07-MAR-2025							
LBA D-1994-329 R01	APPLIANCE AD - EROS - FULL FACE MASK OXYGEN REGULATOR VALVE - RADIO CORD HOSE CLAMP INSPECTION / REPLACEMENT	MOS HRS/MSC AFL		05-DEC-2022		MANDATORY	NOT APPLICABLE - MODEL AND P/N NOT INSTALLED, SEE ALSO DGAC AD CN 92-085(AB) R2, NO FURTHER ACTION REQUIRED
14-JUN-2017							
LBA D-2010-011 R01	APPLIANCE AD - NAVIGATION - MODE S TRANSPONDER AIRCRAFT TYPE MODE STRAPPING - CHECK / MODIFICATION	MOS HRS/MSC AFL		16-FEB-2015 897 783		MANDATORY	COMPLIED WITH - COMPLIED WITH; NO FURTHER ACTION REQUIRED
12-NOV-2014							
LBA D-2012-237	APPLIANCE AD - FIRE PROTECTION IN LAVATORIES	MOS HRS/MSC AFL		15-FEB-2013 713 620		MANDATORY	COMPLIED WITH - PERFORMED AD LBA D-2012-237 FIRE SAFETY IN THE RESTROOMS.
LBA D-2012-237 R01	APPLIANCE AD - FIRE PROTECTION IN LAVATORIES	MOS HRS/MSC AFL		07-JUL-2014 848 738		MANDATORY	NOT APPLICABLE - AIRCRAFT COVERED BY (EC) 216/2008
19-APR-2013							
LBA D-2012-237 R01 PARA (A)	FIRE PROTECTION IN LAVATORIES INSTALL PLACARDS	MOS HRS/MSC AFL		07-JUL-2014 848 738		MANDATORY	NOT APPLICABLE - AIRCRAFT COVERED BY (EC) 216/2008
19-APR-2013							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
LBA D-2012-237 R01 PARA (B)	FIRE PROTECTION IN LAVATORIES ANNOUNCEMENT PROCEDURES					MANDATORY	NOT APPLICABLE - AIRCRAFT COVERED BY (EC) 216/2008
19-APR-2013		MOS HRS/MSC - AFL		07-JUL-2014 848 738			
LBA D-2012-237 R01 PARA (C)	FIRE PROTECTION IN LAVATORIES ASHTRAY INSTALLATION					MANDATORY	NOT APPLICABLE - AIRCRAFT COVERED BY (EC) 216/2008
19-APR-2013		MOS HRS/MSC - AFL		07-JUL-2014 848 738			
LBA D-2012-237 R01 PARA (D)	FIRE PROTECTION IN LAVATORIES ALLOWANCES OF PARTIALLY MISSING OR INOPERATIVE ASHTRAYS					MANDATORY	NOT APPLICABLE - AIRCRAFT COVERED BY (EC) 216/2008
19-APR-2013		MOS HRS/MSC - AFL		07-JUL-2014 848 738			
LBA D-2012-237 R01 PARA (E)	FIRE PROTECTION IN LAVATORIES INSPECTIONS					MANDATORY	NOT APPLICABLE - AIRCRAFT COVERED BY (EC) 216/2008
19-APR-2013		MOS HRS/MSC - AFL		07-JUL-2014 848 738			
LBA D-2012-237 R01 PARA (F)	FIRE PROTECTION IN LAVATORIES FIRE PROTECTING CHARACTERISTICS OF THE LAVATORY EQUIPMENT					MANDATORY	NOT APPLICABLE - AIRCRAFT COVERED BY (EC) 216/2008
19-APR-2013		MOS HRS/MSC - AFL		07-JUL-2014 848 738			
LBA D-2012-237 R01 PARA (G)	FIRE PROTECTION IN LAVATORIES FIRE/SMOKE ALARM SYSTEMS OR FIRE EXTINGUISHING SYSTEMS					MANDATORY	NOT APPLICABLE - AIRCRAFT COVERED BY (EC) 216/2008
19-APR-2013		MOS HRS/MSC - AFL		07-JUL-2014 848 738			
LBA D-2012-237 R01 PARA (H)	FIRE PROTECTION IN LAVATORIES OCCURRENCE REPORTS					MANDATORY	NOT APPLICABLE - AIRCRAFT COVERED BY (EC) 216/2008
19-APR-2013		MOS HRS/MSC - AFL		07-JUL-2014 848 738			
LBA D-2012-445	APPLIANCE AD - OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT					MANDATORY	COMPLIED WITH - FOUND NOT Affected - PART- AND SERIALNUMBER NOT APPLICABLE.
		MOS HRS/MSC - AFL		10-JAN-2013 708 612			
LBA D-2012-445 R01	APPLIANCE AD - OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT					MANDATORY	COMPLIED WITH - C/W. SEE LBA D-2012-445. NO FURTHER ACTIONS REQUIRED.
		MOS HRS/MSC - AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
LBA D-2013-041	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					MANDATORY	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-FEB-2013		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2013-041 R01	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					MANDATORY	COMPLIED WITH - C/W LBA D-2013-041 R2 , FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2013-041 R02	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					MANDATORY	COMPLIED WITH - PERFORMED LBA D-2013-041 R2 , FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
12-JUL-2013		MOS HRS/MSC - AFL		16-AUG-2013 764 666			
LBA D-2013-041 R03	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					MANDATORY	NOT APPLICABLE - EASA 2013-0020 R3 IS AN AIRWORTHINESS DIRECTIVE WHICH HAS THE SAME CONTENT AS LBA D-2013-041 R3 (SEE ANNEXE LBA LTA 2013-041R3). REVISION 3 ONLY CONTAINS NEW INFORMATION ABOUT SERVICE DOCUMENTS PUBLISHED BY SOME SEAT BELT MANUFACTURERS (SEE HIGHLIGHTED LINES IN ANNEXE EASA AD 2013-0020 R3) AND NO TECHNICAL REQUIREMENTS. HOWEVER REVISION 1 AND 2 WERE ALREADY PERFORMED LAST YEAR ON EVERY AIRCRAFT WE PROVIDE SERVICE FOR. PLEASE DELETE EASA 2013-0020 R3 AND LBA D-2013-041 R3 FROM CESCOM OF ALL OUR AIRCRAFT (SEE LIST BELOW).
		MOS HRS/MSC - AFL		21-FEB-2014 812 708			
LBA D-2013-041 R04	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					MANDATORY	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
11-JUL-2014		MOS HRS/MSC - AFL		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
LBA D-2013-041 R05	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					MANDATORY	COMPLIED WITH - C/W EASA 2013-0020 R2. FOUND NOT AFFECTED, ORIGINAL BELTS AND RESTRAINING SYSTEM INSTALLED AND NOT MODIFIED OR REPLACED.
09-SEP-2014		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2013-235	APPLIANCE AD - EMERGENCY LOCATOR TRANSMITTER - BATTERY WIRING INSTALLATION DISCREPANCIES					MANDATORY	NOT APPLICABLE - N/A. ARTEX ELT UNIT (MODEL: C406N) INSTALLED. NO FURTHER ACTIONS REQUIRED.
		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2014-026	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR - MODIFICATION AIRCRAFT FLIGHT MANUAL - AMENDMENT					MANDATORY	NOT APPLICABLE
		MOS HRS/MSC - AFL		03-FEB-2014 812 708			
LBA D-2014-026 R01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR - MODIFICATION AIRCRAFT FLIGHT MANUAL - AMENDMENT					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2014-026 R02	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR - MODIFICATION AIRCRAFT FLIGHT MANUAL - AMENDMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		07-JUL-2014 848 738			
LBA D-2014-116	APPLIANCE AD - COMMUNICATIONS - COCKPIT VOICE RECORDER - REPLACEMENT					MANDATORY	NOT APPLICABLE - N/A EQUIPMENT NOT INSTALLED.
		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2014-120	APPLIANCE AD - NAVIGATION - MODE S TRANSPONDERS - TEST / CALIBRATION					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
23-APR-2014		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2014-120 R01	APPLIANCE AD - NAVIGATION - MODE S TRANSPONDERS - TEST / CALIBRATION					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2014-149	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR SYSTEM - REPLACEMENT / AIRCRAFT FLIGHT MANUAL - AMENDMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		07-JUL-2014 848 738			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
LBA D-2014-164	APPLIANCE AD - OXYGEN - OXYGEN MASK REGULATOR INFLATABLE HARNESS / INFLATION HOSE - IDENTIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - INSTALLED P/N NOT AFFECTED.
13-JUN-2014		MOS HRS/MSC - AFL		21-AUG-2015 953 822			
LBA D-2014-223	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELT ATTACHMENT BOLTS - INSPECTION / REPLACEMENT					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
21-AUG-2014		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2015-027	APPLIANCE AD - EQUIPMENT / FURNISHING - RESTRAINT SYSTEM ROTARY BUCKLE SUB-ASSEMBLY - IDENTIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTIONS REQUIRED.
27-JAN-2015		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2015-116	APPLIANCE/EMERGENCY AD - AIRPLANE FLIGHT MANUAL (SUPPLEMENT) - AMENDMENT					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
20-MAY-2015		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2015-130	APPLIANCE AD - NAVIGATION - ATTITUDE HEADING REFERENCE SYSTEM - MODIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - INSTALLED P/N NOT AFFECTED.
10-JUN-2015		MOS HRS/MSC - AFL		21-AUG-2015 953 822			
LBA D-2016-020	APPLIANCE AD - FIRE PROTECTION - OPTICAL AND AMBIENT SMOKE DETECTORS - IDENTIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
01-FEB-2016		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2016-067	APPLIANCE AD - FIRE PROTECTION - ENGINE AND AUXILIARY POWER UNIT AUTOMATIC FIRE EXTINGUISHERS - INSPECTION/OVERHAUL					MANDATORY	NOT APPLICABLE - N/A. EQUIPMENT NOT INSTALLED. NO FURTHER ACTION REQUIRED.
23-MAR-2016		MOS HRS/MSC - AFL		05-DEC-2022			
LBA D-2016-189	APPLIANCE AD - OXYGEN - PROTECTIVE BREATHING EQUIPMENT - INSPECTION / REPLACEMENT					MANDATORY	NOT APPLICABLE - FAA AD 2016-11-20 AND LBA LTA D-2016-189 CHECKED IAW AD/LTA INSTRUCTIONS AND FOUND PBE NOT EFFECTED DUE TO ESSEX MODEL MR-10051N INSTALLED WITH S/N E0704837
14-JUL-2016		MOS HRS/MSC - AFL ACH		05-AUG-2016 1020 882 480:24			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
LBA D-2016-189 R01	APPLIANCE AD - OXYGEN - B/E AEROSPACE - PROTECTIVE BREATHING EQUIPMENT - INSPECTION / REPLACEMENT					MANDATORY	NOT APPLICABLE - LBA REV.01 CHECKED, PBE NOT INSTALLED, SEE ALSO FAA AD 2016-11-20, NO FURTHER ACTION REQUIRED
11-OCT-2017		MOS HRS/MSC AFL		(EFF)			
LBA D-2016-191	APPLIANCE AD - FIRE PROTECTION - ENGINE AND AUXILIARY POWER UNIT AUTOMATIC FIRE EXTINGUISHERS - INSPECTION / OVERHAUL					MANDATORY	NOT APPLICABLE - NOT ADOPTED. BY EASA. FOR EASA REGISTERED AIRCRAFTS SEE EASA AD 2016-0044.
19-JUL-2016		MOS HRS/MSC AFL		05-DEC-2022			
LBA D-2016-346 R01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - PILOT AND CO-PILOT SEATS - MODIFICATION / INSPECTION					MANDATORY	NOT APPLICABLE - Type 3A063 Flight Crew Seats not installed, see also EASA AD 2018-0262, No further action required
17-DEC-2018		MOS HRS/MSC AFL ACH		05-DEC-2022			
LBA D-2017-150	APPLIANCE AD - EQUIPMENT/FURNISHINGS - ZODIAC SEATS CALIFORNIA LLC - SEATING SYSTEMS - REMOVAL					MANDATORY	NOT APPLICABLE - MODEL NOT INSTALLED, SEE ALSO FAA AD 2017-09-09, NO FURTHER ACTION REQUIRED
28-JUN-2017		MOS HRS/MSC AFL		05-DEC-2022			
LBA D-2017-250	APPLIANCE AD - EQUIPMENT & FURNISHINGS - AMERI-KING CORPORATION - EMERGENCY LOCATOR TRANSMITTERS - INSPECTION					MANDATORY	NOT APPLICABLE - MODEL NOT INSTALLED, ARTEX C406-N INSTALLED, SEE ALSO FAA 2017-16-01, NO FURTHER ACTION REQUIRED
12-OCT-2017		MOS HRS/MSC AFL		05-DEC-2022			
LBA D-2018-234	APPLIANCE AD - EQUIPMENT / FURNISHINGS - RESTRAINT SYSTEMS ROTARY BUCKLE SUB ASSEMBLY - REMOVAL FROM SERVICE					MANDATORY	NOT APPLICABLE - Not Equipped: Equipment not installed. no further Actions required.
18-SEP-2018		MOS HRS/MSC AFL ACH		05-DEC-2022			
LBA D-2018-305	APPLIANCE AD - NAVIGATION - TRANSPONDERS - INSPECTION / MODIFICATION					MANDATORY	NOT APPLICABLE - Transponder Type (Trig) not installed, see also EASA 2018-0247, No further Action required
30-NOV-2018		MOS HRS/MSC AFL ACH		05-DEC-2022			
LBA D-2018-312	APPLIANCE AD - EQUIPMENT/FURNISHINGS - ZODIAC AERO EVACUATION SYSTEMS - FUSIBLE PLUGS - REPLACEMENT						- SUPERSEDED BY LBA D-2018-312 REV.1
11-DEC-2018		MOS HRS/MSC AFL		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
LBA D-2018-312 R01	APPLIANCE AD - EQUIPMENT/FURNISHINGS - ZODIAC AERO EVACUATION SYSTEMS - FUSIBLE PLUGS - REPLACEMENT					MANDATORY	NOT APPLICABLE - Zodiac Aero Evacuation Systems not installed, see also FAA AD 2018-23-12, No further Action required
11-JAN-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
LBA D-2019-015	APPLIANCE AD - NAVIGATION - GLOBAL NAVIGATION SATELLITE SYSTEM - OPERATIONAL LIMITATIONS					MANDATORY	NOT APPLICABLE - GPS/SBAS Receiver Topstar 200 LPV not installed, see also EASA AD 2019-0004, No further Action required
24-JAN-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
LBA D-2019-028	APPLIANCE AD - EQUIPMENT / FURNISHING - LIFE JACKET - REMOVAL / REPAIR					MANDATORY	NOT APPLICABLE - Life Jacket / Infant - Small Child Life Jacket not installed, see also EASA AD 2019-0010, No further Action required
05-FEB-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
LBA D-2019-031	APPLIANCE AD - NAVIGATION - ASPEN AVIONICS, INC. - FLIGHT DISPLAY ADS-B FUNCTION - DISABLING / AIRPLANE FLIGHT MANUAL SUPPLEMENT - REVISION					MANDATORY	NOT APPLICABLE - ASPEN AVIONICS Flight Display System not installed, see also FAA AD 2019-01-02, no further Action required
06-FEB-2019		MOS HRS/MSC - AFL ACH					
LBA D-2019-192	APPLIANCE AD - NAVIGATION - AIRBORNE COLLISION AVOIDANCE SYSTEM DISPLAY SOFTWARE - UPDATE (SUPERSEDED BY LBA AD D-2019-192 R01)					MANDATORY	NOT APPLICABLE - FDSA-6500 Flight Display System not Installed, see also FAA 2019-12-09 and EASA 2019-0179. No further action required
06-AUG-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
LBA D-2019-249	APPLIANCE AD - EQUIPMENT / FURNISHINGS - EMERGENCY LOCATOR TRANSMITTER - INSPECTION / MODIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - ELT has never been installed in helicopters before. See also EASA AD 2019-0235.No further action required
27-SEP-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
TCCA CF-2009-44	APPLIANCE AD - EMERGENCY LOCATOR TRANSMITTER - POTENTIAL FAILURE TO TRANSMIT THE REQUIRED 406MHZ CODED SIGNAL - HONEYWELL ASCA. INC				30-SEP-2022	MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS HRS/MSC - AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
VAD FAA 2011-14-08 PARA (G) (1)						MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
VAD FAA 2011-14-08 PARA (G) (2)						MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					
VAD FAA 2011-14-08 PARA (H)						MANDATORY	NOT APPLICABLE - AS PER P/N
		MOS		30-SEP-2022			
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
AIRFRAME - SB - 525B-0220/OK-UMO							
AN LTH 02B	ELT/PLB, AIRWORTHINESS NOTICE					COMPLIED WITH - ELT FREQUENCY CHECKED, NO FURTHER ACTION REQUIRED	
		MOS		22-FEB-2023			
		HRS/MSC	-				
		AFL					
BEA BEA2023-03	OPERATION IN ICING CONDITIONS - ADHERENCE TO STANDARD OPERATING PROCEDURES , SPECIAL AIRWORTHINESS BULLETIN (BEA)					INFORMATIONAL	NOT APPLICABLE - AS PER AIRCRAFT TYPE
		MOS		17-AUG-2023			
		HRS/MSC	-				
		AFL					
COM MC 525B-002	500 COMPRESSOR HOUR INSPECTION, COMMUNIQUE					INFORMATIONAL	NOT APPLICABLE - Has already been performed / considered in the past.
12-JUL-2019		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
		ACH					
COM MC 525B-003	ATA 76 – FADEC PART NUMBER CHANGE, COMMUNIQUE					NOT APPLICABLE - S/N not applicable, No further action required	
01-AUG-2019		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
COM MC 525B-012	"HYD FLOW SENSE L (OR) R" CAS MESSAGE AT ENGINE SHUTDOWN, COMMUNIQUE					INFORMATIONAL	NOT APPLICABLE - BY A/C S/N
01-JUN-2022		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
COM MC 525B-013	GENERATOR CONTROL UNIT TROUBLESHOOTING GUIDELINES, COMMUNIQUE					INFORMATIONAL	- INFORMATIONAL ONLY - MAINTENANCE INFORMED
02-MAY-2023		MOS		15-MAY-2023			
		HRS/MSC	-				
		AFL					
COM MC 525B-014	AVIONICS O'TEMP CAUSED BY GIA #2 OVER TEMP, COMMUNIQUE					INFORMATIONAL	NOT APPLICABLE - BY A/C SERIAL NUMBER
01-JAN-2024		MOS					
		HRS/MSC	-				
		AFL					
MCC DOA EASA.21J.405	MINOR CHANGE - EXTENSION OF THE EXISTING GROUND DISPATCH FUNCTIONALITY OF THE FMS SYSTEM					COMPLIED WITH	
		MOS		21-FEB-2018			
		HRS/MSC	-	1161:55			
		AFL		1003			
SAIB SAIB-2023-08	PROMOTION OF SAFETY ENHANCING FEATURES FOR CERTAIN TRANSPORT, SPECIAL AIRWORTHINESS INFORMATION BULLETIN					- INFORMATIONAL ONLY- NO FURTHER ACTION REQUIRED	
		MOS					
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB 525B-23-06	COMMUNICATIONS - AVIATOR 300 SATCOM ANTENNA REPLACEMENT, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - BY A/C S/N
06-JUN-2022		MOS HRS/MSC - AFL		05-DEC-2022			
SB 525B-23-07	COMMUNICATIONS - AIRCRAFT COMMUNICATIONS ADDRESSING AND REPORTING SYSTEM (ACARS) OPTION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
26-FEB-2021		MOS HRS/MSC - AFL		05-DEC-2022			
SB 525B-23-07 R01	COMMUNICATIONS - AIRCRAFT COMMUNICATIONS ADDRESSING AND REPORTING SYSTEM (ACARS) OPTION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - By Effectivity-
31-OCT-2023		MOS HRS/MSC - AFL ACH					
SB 525B-23-08	COMMUNICATIONS - LINK 2000+ CONTROLLER PILOT DATA LINK COMMUNICATIONS (CPDLC) INSTALLATION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
26-FEB-2021		MOS HRS/MSC - AFL		05-DEC-2022			
SB 525B-23-09	COMMUNICATIONS - FAA DATACOMM INSTALLATION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
26-FEB-2021		MOS HRS/MSC - AFL		05-DEC-2022			
SB 525B-23-10	COMMUNICATIONS - GARMIN GDR 66 VHF DATA LINK RADIO INSTALLATION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
26-MAR-2021		MOS HRS/MSC - AFL		05-DEC-2022			
SB 525B-24-02	RELAY CIRCUIT PROJECTION, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - AS PER S/N. SUPERSEDED BY R01
10-JAN-2007		MOS HRS/MSC A/R AFL		21-SEP-2022			
SB 525B-24-02 R01	RELAY CIRCUIT PROTECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - AS PER S/N
04-OCT-2007		DAY HRS/MSC A/R AFL		27-SEP-2022			
SB 525B-24-09	GENERATOR CONTROL UNIT WIRE BUNDLE ROUTING, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - PERFORMED SB 525B-24-09 GENERATOR CONTROL UNIT WIRE BUNDLE ROUTING.
15-FEB-2013		MOS HRS/MSC - AFL		16-AUG-2013 764 666			
SB 525B-25-10 R01	EQUIPMENT/FURNISHINGS - GARMIN FLIGHT STREAM 510 INSTALLATION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
25-MAR-2021		MOS HRS/MSC - AFL		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB 525B-26-04	FORWARD SMOKE DETECTOR HEATER AND COVER INSTALLATION, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
25-SEP-2009		MOS		26-MAR-2012			
		HRS/MSC	A/R	601			
		AFL		518			
SB 525B-26-07	FIRE PROTECTION - FIRE LOOP WIRING IMPROVEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY A/C SERIAL NUMBER
20-JUL-2022		MOS					
		HRS/MSC	-				
		AFL					
SB 525B-26-07 R01	FIRE PROTECTION - FIRE LOOP WIRING IMPROVEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY A/C SERIAL NUMBER
06-OCT-2023		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
SB 525B-27-03	VERTICAL STABILIZER CABLE FAIRLEAD INSTALLATION, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SUPERSEDED BY R01
01-OCT-2010		MOS		11-FEB-2011			
		HRS/MSC	A/R	459			
		AFL		394			
SB 525B-27-03 R01	VERTICAL STABILIZER CABLE FAIRLEAD INSTALLATION, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - C/W. SEE SB 525B-27-03. NO FURTHER ACTIONS REQUIRED.
22-NOV-2011		MOS					
		HRS/MSC	A/R				
		AFL					
SB 525B-27-05 R01	FLIGHT CONTROLS - GARMIN GSM 86 ELEVATOR TRIM MODIFICATION, SERVICE BULLETIN					DISCRETIONARY	NOT APPLICABLE - DUE TO A/C S/N
26-AUG-2022		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
SB 525B-27-07	FLIGHT CONTROLS - ELEVATOR TRIM WHEEL INSPECTION, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
16-JAN-2024		MOS		03-MAY-2025			
		HRS/MSC	-	2855:56			
		AFL		2326			
SB 525B-29-01 R02	HYDRAULIC RELIEF VALVE INSPECTION, SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
13-JAN-2009		MOS		09-FEB-2018			
		HRS/MSC	A/R				
		AFL					
SB 525B-29-03	HYDRAULIC RELIEF VALVE STAKING IMPROVEMENT, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SUPERSEDED BY R01
07-MAY-2010		MOS		11-FEB-2011			
		HRS/MSC	A/R	459			
		AFL		394			
SB 525B-29-03 R01	HYDRAULIC POWER - HYDRAULIC RELIEF VALVE STAKING IMPROVEMENT, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - C/W. SEE SB 525B-29-03. NO FURTHER ACTIONS REQUIRED.
06-JUN-2011		MOS					
		HRS/MSC	A/R				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB 525B-31-01	INDICATING/RECORDING SYSTEMS - FLIGHT DATA RECORDER INSTALLATION, SERVICE BULLETIN					OPTIONAL	- SUPERSEDED BY REV.1
25-AUG-2009	MOS HRS/MSC A/R AFL						
SB 525B-31-01 R01	INDICATING/RECORDING SYSTEMS - FLIGHT DATA RECORDER INSTALLATION, SERVICE BULLETIN					OPTIONAL	- APPLICABLE TO AIRCRAFT -0135 AND ON.
05-APR-2010	MOS HRS/MSC A/R AFL						
SB 525B-31-02	AILERON, RUDDER AND ELEVATOR POSITION SENSOR ARM TORQUE INSPECTION AND FDR - AILERON SUPPORT BRACKET MODIFICATION, SERVICE BULLETIN					MANDATORY	COMPLIED WITH
09-FEB-2010	MOS HRS/MSC A/R AFL			11-FEB-2011 459 394			
SB 525B-32-09	BRAKE METERING VALVE CABLE INSPECTION, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
	MOS HRS/MSC - AFL			11-FEB-2011 459 394			
SB 525B-32-10	LANDING GEAR - NOSE LANDING GEAR ACTUATOR IMPROVEMENT, SERVICE BULLETIN					DISCRETIONARY	COMPLIED WITH
26-AUG-2011	MOS HRS/MSC A/R AFL			15-MAY-2012 619 533			
SB 525B-33-05	ELECTROLUMINESCENT PANEL MOUNTING IMPROVEMENT, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - PERFORMED SB525B-33-05 ELECTROLUMINESCENT PANEL MOUNTING IMPROVEMENT.
01-MAY-2012	MOS HRS/MSC - AFL			15-FEB-2013 713 620			
SB 525B-34-11	GPS-4000S RECEIVER IMPROVEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
14-JAN-2010	MOS HRS/MSC A/R AFL			09-FEB-2018			
SB 525B-34-19 R01	COLLINS FMS-3000 WIDE AREA AUGMENTATION SYSTEM (WAAS) WITH FMS 4.0 SOFTWARE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY REV.1
14-AUG-2013	MOS HRS/MSC - AFL						
SB 525B-34-19 R02	COLLINS FMS-3000 WIDE AREA AUGMENTATION SYSTEM (WAAS) WITH FMS 4.0 SOFTWARE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY R03
25-FEB-2014	MOS HRS/MSC - AFL						
SB 525B-34-21	NAVIGATION - TRAFFIC ALERT AND COLLISION AVOIDANCE SYSTEM (TCAS II) SOFTWARE 7.1 UPGRADE, SERVICE BULLETIN					OPTIONAL	COMPLIED WITH - COMPLIED WITH
19-APR-2012	MOS HRS/MSC - AFL			16-FEB-2015 897 783			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB 525B-34-22	ENHANCED SURVEILLANCE TRANSPONDER STRAPPING MODIFICATION, SERVICE BULLETIN					DISCRETIONARY	NOT APPLICABLE - SB 525B-34-22 NOT AFFECTED, TCAS II INSTALLED IN AIRCRAFT.
01-MAY-2013		MOS HRS/MSC - AFL		16-AUG-2013 764 666			
SB 525B-34-26	NAVIGATION - AUTOMATIC DEPENDENT SURVEILLANCE BROADCAST (ADS-B) OUT TRANSPONDER INSTALLATION, SERVICE BULLETIN					OPTIONAL	- SUPERSEDED BY REV.1
11-JAN-2016		MOS HRS/MSC - AFL					
SB 525B-34-26 R01	NAVIGATION - AUTOMATIC DEPENDENT SURVEILLANCE BROADCAST (ADS-B) OUT TRANSPONDER INSTALLATION, SERVICE BULLETIN					OPTIONAL	- ALTERNATIVE PERFORMED WITH EASA STC 10064261 FTI STC APPROVAL ADS-B OUT
20-APR-2018		MOS HRS/MSC - AFL		05-DEC-2022			
SB 525B-34-30	NAVIGATION - ADS-B OUT WIRING MODIFICATION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
22-AUG-2017		MOS HRS/MSC - AFL		09-FEB-2018			
SB 525B-34-32 R02	NAVIGATION - GARMIN SOFTWARE UPDATE TO VERSION 4.8.11, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - DUE TO A/C S/N
12-AUG-2022		MOS HRS/MSC - AFL		05-DEC-2022			
SB 525B-34-32 R03	NAVIGATION - GARMIN SOFTWARE UPDATE TO VERSION 4.8.11, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY A/C SERIAL NUMBER
25-JAN-2024		MOS HRS/MSC - AFL					
SB 525B-34-33	NAVIGATION - GROUND CLUTTER SUPPRESSION (GCS) AND TURBULENCE DETECTION SYSTEM (TDS) OPTION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
26-FEB-2021		MOS HRS/MSC - AFL		05-DEC-2022			
SB 525B-34-34	NAVIGATION - FUTURE AIR NAVIGATION SYSTEM (FANS) 1/A INSTALLATION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
26-FEB-2021		MOS HRS/MSC - AFL		05-DEC-2022			
SB 525B-34-35	NAVIGATION - GARMIN SURFACEWATCH INSTALLATION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
26-FEB-2021		MOS HRS/MSC - AFL		05-DEC-2022			
SB 525B-34-36	NAVIGATION - SYNTHETIC VISION SYSTEM INSTALLATION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
26-FEB-2021		MOS HRS/MSC - AFL		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB 525B-34-37	NAVIGATION - TERRAIN AWARENESS WARNING SYSTEM (TAWS) CLASS A INSTALLATION, SERVICE BULLETIN				05-DEC-2022	OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
26-FEB-2021		MOS					
		HRS/MSC	-				
		AFL					
SB 525B-34-38 R01	NAVIGATION - REACTIVE WINDSHEAR INSTALLATION, SERVICE BULLETIN				05-DEC-2022	OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
06-SEP-2022		MOS					
		HRS/MSC	-				
		AFL					
SB 525B-34-38 R02	NAVIGATION - REACTIVE WINDSHEAR INSTALLATION, SERVICE BULLETIN				05-DEC-2022	OPTIONAL	NOT APPLICABLE - By Effectivity-
31-OCT-2023		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
SB 525B-34-39	NAVIGATION - GDL 69 SXM DATA LINK UPDATE, SERVICE BULLETIN				05-DEC-2022	OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
26-FEB-2021		MOS					
		HRS/MSC	-				
		AFL					
SB 525B-34-40 R02	NAVIGATION - GARMIN HARDWARE AND SOFTWARE UPDATE TO VERSION 4.8.9, SERVICE BULLETIN				05-DEC-2022	OPTIONAL	NOT APPLICABLE - BY A/C S/N
25-AUG-2021		MOS					
		HRS/MSC	-				
		AFL					
SB 525B-34-41	NAVIGATION - GARMIN HARDWARE AND SOFTWARE UPDATE TO VERSION 4.8.16 (4.8 PRIME), SERVICE BULLETIN				05-DEC-2022	OPTIONAL	NOT APPLICABLE - By Effectivity-
31-OCT-2023		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
SB 525B-34-42	NAVIGATION - PREDICTIVE WINDSHEAR INSTALLATION, SERVICE BULLETIN				05-DEC-2022	OPTIONAL	NOT APPLICABLE - By Effectivity- N/A per MSN
31-OCT-2023		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
SB 525B-34-45	NAVIGATION - AVIONICS O'TEMP CAS MESSAGE(ON HOLD), SERVICE BULLETIN				20-MAY-2025	MANDATORY	NOT APPLICABLE - AS PER S/N
22-NOV-2024		MOS					
		HRS/MSC	- (s)				
		AFL					
		2875:33					
		2349					
SB 525B-36-02	PRECOOLER EXHAUST IMPROVEMENT, SERVICE BULLETIN				28-JUN-2010	SUPERSEDED	- SUPERSEDED SUPERSEDED BY REVISION 1
		MOS					
		HRS/MSC	A/R (s)				
		AFL					
SB 525B-36-03	PNEUMATIC - MOISTURE TRAP INSTALLATION, SERVICE BULLETIN				25-MAY-2011	OPTIONAL	- SUPERSEDED BY REV.1
		MOS					
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB 525B-52-02	AFT CABIN SKIN INSPECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
26-MAR-2009		MOS HRS/MSC - AFL		09-FEB-2018			
SB 525B-53-03	FUSELAGE - RADOME LATCH IMPROVEMENT, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER A/C S/N
17-JUN-2021		MOS HRS/MSC - AFL		05-DEC-2022			
SB 525B-57-01	KEEL FITTING INSPECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
25-JAN-2010		MOS HRS/MSC - AFL		09-FEB-2018			
SB 525B-57-02	WINGS - ANTI-ICE EXHAUST OUTLET IMPROVEMENT, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - C/W. SEE SB 525B-57-02 REV.1. NO FURTHER ACTIONS REQUIRED.
		MOS HRS/MSC - AFL					
SB 525B-57-02 R01	ANTI-ICE EXHAUST OUTLET IMPROVEMENT, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
06-MAR-2015		MOS HRS/MSC - AFL		06-MAR-2016			
SB 525B-71-01 R01	PT2/TT2 SENSOR INSTALLATION IMPROVEMENT, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
		MOS HRS/MSC A/R AFL		15-JAN-2009 152			
SB 525B-71-01 R02	PT2/TT2 SENSOR INSTALLATION IMPROVEMENT, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - SB REV.2 CHECKED, PERFORMED WITH SB 525B-71-01 REV.1, NO FURTHER ACTION REQUIRED
08-DEC-2008		MOS HRS/MSC A/R AFL					
SB 525B-71-03	COWL STIFFENER INSTALLATION, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - PERFORMED COWLING STIFFERES INSTALLATION IAW SB 525B-71-03, REV OCTOBER 8,2013. ALL AREAS RUBBED DOWN CLEAN AND DEGREASED PEIMED FILLED PAINTED AND POLISHED. WORK PERFORMED IAW CESSNA 525B AMM (REV 16) CHAPTER 20-51-00 (REV 8).
08-OCT-2013		MOS HRS/MSC - AFL		02-SEP-2014 853:33 745			
SB 525B-73-02	ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT (FDU) FIELD REPLACEMENT, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - BY A/C S/N
08-APR-2022		MOS HRS/MSC - AFL		05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB 525B-76-03 R01	ENGINE CONTROLS - FADEC CONNECTOR WASHER REMOVAL, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
28-APR-2011		MOS HRS/MSC AFL		26-MAR-2012 601 518			
SB 525B-76-04	ENGINE CONTROLS - UPDATED FJ44-3A FULL AUTHORITY ENGINE CONTROL (FADEC) FIELD REPLACEMENT, SERVICE BULLETIN				OPTIONAL		NOT APPLICABLE - S/N not applicable, No further action required
12-AUG-2019		MOS HRS/MSC AFL ACH		08-FEB-2023			
SB CASSB1480 ISSUE A	TAMARACK ATLAS ENHANCEMENTS IMPLEMENTATION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - TAMARACK (Atlas) Winglets not installed, No further action required
11-JUL-2019		MOS HRS/MSC AFL ACH		05-DEC-2022			
SB CIB-25-01	EQUIPMENT/FURNISHINGS - PASSENGER SEAT QUICK RELEASE PIN INSTALLATION, SERVICE BULLETIN					OPTIONAL	COMPLIED WITH - PAX SEAT QUICK RELEASE PIN INSTALLATION PERFORMED ON LH + RH PAX SEATS
22-MAR-2016		MOS HRS/MSC AFL ACH		29-JAN-2024 2345:02 1913			
SB CIB-25-02	EQUIPMENT/FURNISHINGS - BELTED TOILET SEAT INERTIA REEL MODIFICATION, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
28-JAN-2016		MOS HRS/MSC AFL		05-DEC-2022			
SB CIB-34-02	GPS-4000S SOFTWARE UPDATE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
30-APR-2014		MOS HRS/MSC AFL		07-JUL-2014 848 738			
SB CIL-34-11	NAVIGATION - TRANSMITTAL OF COLLINS AEROSPACE SERVICE BULLETIN ALT-4000-34-14, NAVIGATION - ALT 4000 POWER SUPPLY ROBUSTNESS IMPROVEMENT, SERVICE BULLETIN					OPTIONAL	DEFERRED - AS PER RADIO ALTIMETER S/N + COSTS
17-OCT-2022		MOS HRS/MSC AFL		05-DEC-2022			
SIB EASA2013-04 R02	HOOK AND LOOP STYLE FASTENERS AS MOUNTING MECHANISM FOR AN EMERGENCY LOCATOR TRANSMITTER, SAFETY INFORMATION BULLETIN					INFORMATIONAL	NOT APPLICABLE - AS PER ELT MOUNTING
		MOS HRS/MSC AFL		17-AUG-2023			
SIB EASA2019-14 R02	AIRCRAFT FUEL SYSTEM ICE INHIBITORS, SAFETY INFORMATION BULLETIN					INFORMATIONAL	NOT APPLICABLE - AS PER AIRCRAFT TYPE
		MOS HRS/MSC AFL		17-AUG-2023			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SIB EASA2021-01 R01	COLLINS AEROSPACE VERY HIGH FREQUENCY DATA RADIOS - DATA LINK OVER VERY HIGH FREQUENCY DATA LINK MODE 2 OPERATIONS, SAFETY INFORMATION BULLETIN						NOT APPLICABLE - AS PER VHF PART NUMBER
	MOS HRS/MSC - (s) AFL			17-AUG-2023			
SIB EASA2021-16 R01	OPERATIONS TO AERODROMES LOCATED IN UNITED STATES WITH POTENTIAL RISK OF INTERFERENCE FROM 5G GROUND STATIONS, SAFETY INFORMATION BULLETIN					INFORMATIONAL	COMPLIED WITH - FORWARDED TO FLIGHT OPS SAFETY
	MOS HRS/MSC - AFL			17-AUG-2023			
SIB EASA2022-02 R01	GLOBAL NAVIGATION SATELLITE SYSTEM OUTAGE LEADING TO NAVIGATION / SURVEILLANCE DEGRADATION, SAFETY INFORMATION BULLETIN					INFORMATIONAL	COMPLIED WITH - FORWARDED TO FLIGHT OPS SAFETY
	MOS HRS/MSC - AFL			17-AUG-2023			
SIB EASA2022-10 R01	DURBAL METALLWARENFABRIK AND MAEDLER PUSH ROD ENDS PRODUCTION DEFICIENCY, SAFETY INFORMATION BULLETIN					INFORMATIONAL	NOT APPLICABLE - AS PER AIRCRAFT TYPE
	MOS HRS/MSC - AFL			17-AUG-2023			
SIB EASA2023-02	BROKEN AILERON CABLE AND NON-REVERSIBLE FILTERING OF CONTROL POSITION DATA FOR FLIGHT DATA RECORDING, SAFETY INFORMATION BULLETIN					INFORMATIONAL	NOT APPLICABLE - AS PER AIRCRAFT TYPE
	MOS HRS/MSC - AFL			17-AUG-2023			
SIB EASA2023-08	REPORTING OF OCCURRENCES INVOLVING HUMAN INTERVENTIONS LINKED TO FLIGHT DECK DESIGN, OPERATING PROCEDURES, TRAINING, OR A COMBINATION THEREOF, SAFETY INFORMATION BULLETIN					INFORMATIONAL	COMPLIED WITH - FORWARDED TO FLIGHT OPS SAFETY
	MOS HRS/MSC - AFL			17-AUG-2023			FORWARDED TO FLIGHT OPS SAFETY
SIB EASA2023-09	ERRONEOUS COMPUTATION OF FLIGHT PATH ACCELERATION AND POTENTIAL VERTICAL SPEED, SAFETY INFORMATION BULLETIN					INFORMATIONAL	NOT APPLICABLE - AS PER PART NUMBER NOT INSTALLED
	MOS HRS/MSC - AFL			17-AUG-2023			
SIB EASA2023-10	AIRCRAFT FLIGHT MANUAL OPERATIONAL PROCEDURES FOR AIR DATA LOSS OR ERRONEOUS AIR DATA, SAFETY INFORMATION BULLETIN					INFORMATIONAL	COMPLIED WITH - FORWARDED TO FLIGHT OPS SAFETY & CAMO NOTED
	MOS HRS/MSC - AFL			19-SEP-2023 2289:33 1874			
SIB EASASIB 2023-03	INCORRECT BAROMETRIC ALTIMETER SETTING, SAFETY INFORMATION BULLETIN					INFORMATIONAL	COMPLIED WITH - FORWARDED TO FLIGHT OPS SAFETY
	MOS HRS/MSC - AFL			17-AUG-2023			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SIB EASASIB 2023-05	POSSIBLE RISKS EMERGING DURING SUMMER 2023, SAFETY INFORMATION BULLETIN					INFORMATIONAL	COMPLIED WITH - FORWARDED TO FLIGHT OPS SAFETY, CMM & SO
		MOS HRS/MSC - AFL		17-AUG-2023			
SL CIL-20-01	STANDARD PRACTICES - CESSNA CERTIFICATION OF NONDESTRUCTIVE TESTING FACILITIES/PERSONNEL, SERVICE LETTER					SUPERSEDED	- SUPERSEDED BY R3 / CANCELS THIS CIL
09-APR-2012		MOS HRS/MSC - AFL		30-MAY-2023			
SL CIL-20-01 R02	STANDARD PRACTICES - CESSNA CERTIFICATION OF NONDESTRUCTIVE TESTING FACILITIES/PERSONNEL, SERVICE LETTER					SUPERSEDED	- SUPERSEDED BY R3 / CANCELS THIS CIL
18-MAR-2014		MOS HRS/MSC - AFL		30-MAY-2023			
SL CIL-20-01 R03-CN	STANDARD PRACTICES - CESSNA CERTIFICATION OF NONDESTRUCTIVE TESTING FACILITIES/PERSONNEL, SERVICE LETTER					CANCELLED	- CANCELLED
30-MAY-2023		MOS HRS/MSC - AFL		05-JUN-2023			
SL CIL-25-02	EQUIPMENT/FURNISHINGS - MEDAIRE AIRCRAFT FIRST AID KITS WITH MEDICATION SUBJECT TO RECALL NOTICE, SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - S/N not applicable, No further action required
05-NOV-2019		MOS HRS/MSC - AFL ACH		05-DEC-2022			
SL CIL-25-03 R01	EQUIPMENT/FURNISHINGS - SEAT PAN TILT BLOCKING TAB INSTALLATION, SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - BY A/C S/N
08-OCT-2020		MOS HRS/MSC - AFL		05-DEC-2022			
SL CIL-26-01 R01	FIRE PROTECTION - FIRE EXTINGUISHER BOTTLE CARTRIDGE GROUND STUD TORQUING, SERVICE LETTER					MANDATORY	COMPLIED WITH - PERFORMED CIL-26-01 REV. 1 - FIRE EXTINGUISHER BOTTLE CARTRIDGE GROUND STUD TORQUING IN ACCORDANCE WITH CIL-26-01, REV. 1 DATED JUNE 16/2016 INSTRUCTIONS. NO FINDINGS.
16-JUN-2016		MOS HRS/MSC - AFL ACH		04-JUL-2017 1088:25 940 502:30			
SL CIL-28-01	FUEL - MICROBIOLOGICAL CONTAMINATION IN AIRCRAFT FUEL TANKS AND FUEL SYSTEMS, SERVICE LETTER					INFORMATIONAL	COMPLIED WITH - TRACKED OVER TC 28-00-02-220
24-FEB-2023		MOS HRS/MSC - AFL		24-MAR-2023			
SL CIL-32-03	NLG UPLOCK ROLLER BRACKET INSPECTION, SERVICE LETTER					RECOMMENDED	COMPLIED WITH - COMPLIED WITH
12-NOV-2014		MOS HRS/MSC - AFL		16-FEB-2015 897 783			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL CIL-34-05 R01	TRANSMITTAL OF GARMIN SERVICE ALERT 1478, LP AND LPV APPROACHES, SERVICE LETTER					CANCELLED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
13-FEB-2015	MOS HRS/MSC - AFL			09-FEB-2018			
SL CIL-34-08	NAVIGATION - TRANSMITTAL OF COLLINS AEROSPACE SERVICE BULLETIN ATL-4000-34-D, NAVIGATION - ALT-4000 - EVALUATION OF SURFACE MOUNT FERRITE BEAD USED ON THE POWER SUPPLY, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - BY A/C S/N
18-MAY-2021	MOS HRS/MSC - AFL			05-DEC-2022			
SL CIL-34-10	NAVIGATION - TRANSMITTAL OF GARMIN SB 19102 GSR 56 MOD 1, SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - AS PER A/C S/N
26-JAN-2022	MOS HRS/MSC - AFL			05-DEC-2022			
SL CIL-35-01	TRANSMITTAL OF BE AEROSPACE SERVICE BULLETIN 118077-35-01, SERVICE LETTER					MANDATORY	NOT APPLICABLE - SERVICE LETTER CIL-35-01 NOT EFFECTED
14-NOV-2013	MOS HRS/MSC - AFL			02-SEP-2014 853:33 745			
SL CIL-35-05	OXYGEN - TRANSMITTAL OF ZODIAC AEROSPACE SB MCF-SBU-35-001, SERVICE LETTER					MANDATORY	NOT APPLICABLE - BY INSTALLATION
08-JAN-2016	DAYS HRS/MSC - AFL			11-MAR-2016			
SL CIL-52-01	DOORS - EMERGENCY DOOR INSPECTION, SERVICE LETTER					MANDATORY	COMPLIED WITH - PERFORMED CIL-52-01 INSPECTION -OK.
27-NOV-2012	MOS HRS/MSC - AFL			15-FEB-2013 713 620			
SL CIL-52-02	DOORS - EMERGENCY EXIT DOOR INSPECTION, SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - AS PER EFFECTIVITY
28-JUL-2020	MOS HRS/MSC - AFL			05-DEC-2022			
SL CIL-52-03	DOORS - EMERGENCY ESCAPE HATCH INSPECTION, SERVICE LETTER					MANDATORY	COMPLIED WITH - CIL-52-03 PERFORMED WORK PERFORMED BY WAA OVER WO 22-0117
04-NOV-2020	MOS HRS/MSC - AFL			28-SEP-2022 2049:12 1665			
SL CIL-53-01 R01	FUSELAGE - NOSE RADOME GUIDE PIN REPLACEMENT, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - AS PER A/C S/N
17-MAR-2021	MOS HRS/MSC - AFL			05-DEC-2022			
SL CIL-71-02	LEFT ENGINE TRANSMITTAL OF WILLIAMS INTERNATIONAL FJ44 SERVICE BULLETIN FJ44-72-128, ENGINE - SPLIT INNER RING BALL BEARING - REPLACE, SERVICE LETTER					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
17-FEB-2015	MOS HRS/MSC - AFL			09-FEB-2018			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL CIL-99-01	USE OF CORROSION INHIBITING COMPOUNDS, SERVICE LETTER					INFORMATIONAL	COMPLIED WITH
12-JAN-2012		MOS		26-MAR-2012			
		HRS/MSC	-	601			
		AFL		518			
SL CIL-99-01 R01	USE OF CORROSION INHIBITING COMPOUNDS, SERVICE LETTER					INFORMATIONAL	- SUPERSEDED BY CIL-99-01 REV.2
15-FEB-2013		MOS					
		HRS/MSC	-				
		AFL					
SL CIL-99-01 R02	USE OF CORROSION INHIBITING COMPOUNDS, SERVICE LETTER					INFORMATIONAL	COMPLIED WITH - PERFORMED CIL-99-01 R2 COR-BAN TREATMENT TO MLG W/W, NLG WW, WING TRAILING EDGES, H STAB TRAILING EDGES, VERTICLE STAB TRAILING EDGE.
02-JUL-2015		MOS		22-MAR-2016			
		HRS/MSC	-	985:42			
		AFL		851			
SL CIL-99-02	MISCELLANEOUS - AVOID OPERATIONS ON RUNWAYS TREATED WITH RUNWAY DE-ICE (RDI) FLUIDS. AIRCRAFT WASHING RECOMMENDED AFTER EXPOSURE TO RDI FLUIDS, SERVICE LETTER					RECOMMENDED	- SUPERSEDED BY CIL-99-02 REV.1
23-MAY-2012		MOS		(EFF)			
		HRS/MSC	-				
		AFL					
SL CIL-99-03	MISCELLANEOUS - CORROSION PREVENTION AND CONTROL PROGRAM (CPCP), SERVICE LETTER					RECOMMENDED	COMPLIED WITH
04-JAN-2013		MOS		12-SEP-2018			
		HRS/MSC	-	1217:42			
		AFL		1048			
SL CIL-99-04	MISCELLANEOUS - INCREMENTAL LIBRARY UPDATES FOR CESVIEW, SERVICE LETTER					INFORMATIONAL	- SUPERSEDED BY CIL-99-04 REV.1
29-JAN-2016		MOS					
		HRS/MSC	-				
		AFL					
SL SL525B-05-03	TIME LIMITS/MAINTENANCE CHECKS - WING INSPECTION INTERVAL IMPLEMENTATION GRACE PERIOD, SERVICE LETTER					INFORMATIONAL	COMPLIED WITH - INCORPORATED TO AMP
21-JUN-2022		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
SL SL525B-05-04 R01	TIME LIMITS/MAINTENANCE CHECKS - SCHEDULED MAINTENANCE PROGRAM CHANGE, SERVICE LETTER					MANDATORY	COMPLIED WITH
07-JAN-2025		MOS		30-JAN-2025			
		HRS/MSC	-	2773:55			
		AFL		2262			
SL SL525B-21-04	AIR CONDITIONING - PRESSURIZATION PRINTED CIRCUIT BOARD REPLACEMENT, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - N/A by AC SN. No further action required.
05-NOV-2018		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
		ACH					
SL SL525B-21-07	AIR CONDITIONING - FORWARD EVAPORATOR MOTOR ASSEMBLY INSPECTION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - AS PER A/C S/N
20-MAY-2020		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-24-02	TAIL DE-ICE CONTROL PRINTED CIRCUIT BOARD (PCB) INSPECTION/REPLACEMENT, SERVICE LETTER					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
25-JAN-2012	MOS HRS/MSC - AFL			09-FEB-2018			
SL SL525B-25-03	EQUIPMENT/FURNISHINGS - TRANSMITTAL OF B/E AEROSPACE SERVICE BULLETIN 2524.565-25-01 REPLACEMENT OF SWIVEL ASSEMBLY, SERVICE LETTER					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
06-OCT-2010	MOS HRS/MSC A/R AFL			09-FEB-2018			
SL SL525B-25-07	EQUIPMENT/FURNISHINGS - TRANSMITTAL OF AMSAFE SERVICE BULLETIN SB514633, REMOVAL AND REPLACEMENT OF BUCKLE ASSEMBLY PART NUMBERS 505703, 504443, AND 511442, SERVICE LETTER					MANDATORY	NOT APPLICABLE - S/N not applicable, No further action required
01-OCT-2019	DAY HRS/MSC - AFL ACH						
SL SL525B-25-08	EQUIPMENT/FURNISHINGS - MODIFICATION OF THE PASSENGER SEATS, SERVICE LETTER					OPTIONAL	NOT APPLICABLE - S/N not applicable, No further action required
07-AUG-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
SL SL525B-25-09	EQUIPMENT/FURNISHINGS - INSPECTION OF THE MILLENNIUM CREW SEAT ASSEMBLIES FOR INCORRECTLY INSTALLED SEAT PAN TILT MECHANISM SNAP RINGS (MILLENNIUM SERVICE BULLETIN SB2049-25-20-02) (SUPERSEDED BY SL525B-25-09 R01), SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - S/N not applicable, No further action required
10-SEP-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
SL SL525B-25-09 R01	EQUIPMENT/FURNISHINGS - REPLACEMENT OF THE SEAT PAN TILT SNAP RINGS (MILLENNIUM SERVICE BULLETIN SB2049-25-20-02B), SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - SB Rev.01 Checked, S/N not applicable, No further action required
21-NOV-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
SL SL525B-27-03	FLIGHT CONTROLS - ELEVATOR TRIM TAB PUSHROD REPLACEMENT, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - S/N not applicable, No further action required
02-APR-2019	MOS HRS/MSC - AFL ACH			05-DEC-2022			
SL SL525B-27-04	FLIGHT CONTROLS - FDR FLAP POSITION WIRING INSPECTION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - AS PER A/C S/N
19-MAY-2021	MOS HRS/MSC - AFL			05-DEC-2022			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-27-05	FLIGHT CONTROLS - TRIM ACTUATOR GREASE INSTALLATION, SERVICE LETTER					SUPERSEDED	NOT APPLICABLE - AS PER A/C S/N. SUPERSEDED BY R1
09-FEB-2023		DAYs			21-FEB-2023		
		HRS/MSC	-				
		AFL					
SL SL525B-27-07	FLIGHT CONTROLS - SPEED BRAKE ASSEMBLY FASTENER INSPECTION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - AS PER AIRCRAFT SERIAL NUMBER
30-MAY-2023		MOS			21-JUN-2023		
		HRS/MSC	-				
		AFL					
SL SL525B-28-01	FUEL LINE CLEARANCE IMPROVEMENT, SERVICE LETTER					MANDATORY	COMPLIED WITH
10-DEC-2008		MOS			17-APR-2009		
		HRS/MSC	A/R		197		
		AFL					
SL SL525B-29-02	HYDRAULIC POWER - ENGINE DRIVEN HYDRAULIC PUMP VERIFICATION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - DUE TO INSTALLED PART NUMBERS 9912062-6
13-JUN-2017		MOS			18-FEB-2020		
		HRS/MSC	-		1394:06		
		AFL			1227		
SL SL525B-29-03	HYDRAULIC POWER - CV02-193 CHECK VALVE INSPECTION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - BY A/C S/N
20-JUL-2021		MOS			05-DEC-2022		
		HRS/MSC	-				
		AFL					
SL SL525B-30-02	ICE AND RAIN PROTECTION - WING ANTI-ICE PRESSURE REGULATING SHUTOFF VALVE INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - BY SERIAL NUMBER APPLICABLE TO -0248 THRU -0256 ONLY.
09-DEC-2010		DAYs			05-DEC-2022		
		HRS/MSC	A/R				
		AFL					
SL SL525B-31-03	TRANSMITTAL OF L-3 COMMUNICATIONS ALERT BULLETIN NO. CESSNA SB 001, SERVICE LETTER					MANDATORY	NOT APPLICABLE - FDR S/N:488583 IS NOT AFFECTED.
31-AUG-2011		MOS			26-MAR-2012		
		HRS/MSC	A/R		601		
		AFL			518		
SL SL525B-31-04	INDICATING/RECORDING SYSTEMS - INDICATING/RECORDING - ARES SOFTWARE UPDATE, SERVICE LETTER					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
14-NOV-2011		MOS			09-FEB-2018		
		HRS/MSC	A/R				
		AFL					
SL SL525B-32-09	EMERGENCY GEAR RELEASE INSPECTION, SERVICE LETTER					SUPERSEDED	COMPLIED WITH - C/W. SEE SL 525B-32-09 REV.2. NO FURTHER ACTIONS REQUIRED. SUPERSEDED
01-DEC-2009		MOS					
		HRS/MSC	-				
		AFL					

Note: MUST BE ACCOMPLISHED IN CONJUNCTION WITH INSPECTION DOCUMENT 14.

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-32-09 R02	EMERGENCY GEAR RELEASE INSPECTION, SERVICE LETTER					MANDATORY	COMPLIED WITH
12-MAY-2010		MOS HRS/MSC AFL		11-FEB-2011 459 394			
<b>Note:</b>							
SL SL525B-32-10	LANDING GEAR - MAIN LANDING GEAR TIRE INFLATION PLACARD INSPECTION, SERVICE LETTER					RECOMMENDED	COMPLIED WITH
11-MAY-2011		MOS HRS/MSC AFL		26-MAR-2012 601 518			
<b>Note:</b>							
SL SL525B-32-12	LANDING GEAR - REPLACE THE DIGITAL ANTIKID CONTROL BOX, SERVICE LETTER					MANDATORY	NOT APPLICABLE - S/N not applicable, No further action required
04-JUN-2019		DAYs HRS/MSC AFL ACH					
<b>Note:</b>							
SL SL525B-32-13	LANDING GEAR - EMERGENCY BRAKE VALVE ASSEMBLY INSPECTION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - AS PER A/C S/N
04-MAY-2020		MOS HRS/MSC AFL		05-DEC-2022			
<b>Note:</b>							
SL SL525B-32-14	LANDING GEAR - MAIN LANDING GEAR REPAIR, SERVICE LETTER					INFORMATIONAL	- INFORMATION ONLY
02-NOV-2020		MOS HRS/MSC AFL					
<b>Note:</b>							
SL SL525B-34-10 R02	NAVIGATION - TRANSMITTAL OF GARMIN SERVICE ADVISORY NO. 1612 REVISION F, 2020 IGRF (INTERNATIONAL GEOMAGNETIC REFERENCE FIELD) MAGNETIC FIELD MODEL, SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - BY A/C S/N
04-AUG-2021		MOS HRS/MSC AFL		05-DEC-2022			
<b>Note:</b>							
SL SL525B-34-13	NAVIGATION - TRANSMITTAL OF GARMIN SB 1994, GRS 77 SOFTWARE VERSION 3.04 - PITCH/ROLL OFFSET CALIBRATION PROCEDURE, SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - AS PER A/C S/N
17-MAR-2020		MOS HRS/MSC AFL		05-DEC-2022			
<b>Note:</b>							
SL SL525B-34-14	NAVIGATION - DISABLE FMS TEMPERATURE COMPENSATION AND IMPLEMENT AIRPLANE FLIGHT MANUAL (AFM) CHANGES FOR LNAV/VNAV, SERVICE LETTER					MANDATORY	NOT APPLICABLE - AS FOUND PER AD 2020-10-05
07-OCT-2020		MOS HRS/MSC AFL		27-SEP-2022			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-34-15	NAVIGATION - STORMSCOPE PROCESSOR MODIFICATION (MOD) LEVEL INSPECTION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - BY A/C S/N
09-NOV-2021		MOS HRS/MSC - AFL		05-DEC-2022			
<b>Note:</b>							
SL SL525B-34-16	NAVIGATION - TRANSMITTAL OF GARMIN SERVICE ADVISORY LETTER NO. 22037 REV A FALSE GPS NEEDS SERVICE SYSTEM MESSAGE, SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - AS PER A/C S/N
24-OCT-2022		MOS HRS/MSC - AFL		05-DEC-2022			
<b>Note:</b>							
SL SL525B-35-02	OXYGEN - TRANSMITTAL OF INTERTECHNIQUE SERVICE BULLETIN MXH-35-240, SERVICE LETTER					MANDATORY	COMPLIED WITH - C/W. SEE SL 525B-35-02 REV.1. NO FURTHER ACTIONS REQUIRED.
02-SEP-2011		MOS HRS/MSC - AFL		(EFF)			
<b>Note:</b>							
SL SL525B-35-02 R01	TRANSMITTAL OF INTERTECHNIQUE SERVICE BULLETIN MXH-35-240, SERVICE LETTER					MANDATORY	COMPLIED WITH
19-JAN-2012		MOS HRS/MSC - AFL		26-MAR-2012 601 518			
<b>Note:</b>							
SL SL525B-35-02 R02	OXYGEN - TRANSMITTAL OF INTERTECHNIQUE SERVICE BULLETIN MXH-35-240, SERVICE LETTER					MANDATORY	COMPLIED WITH - C/W. SEE SL 525B-35-02 REV.1. NO FURTHER ACTIONS REQUIRED.
25-OCT-2012		MOS HRS/MSC - AFL					
<b>Note:</b>							
SL SL525B-36-01	PRECOOLER LIFE LIMIT, SERVICE LETTER					SUPERSEDED	- SUPERSEDED BY REV.1
19-MAR-2015		MOS HRS/MSC - AFL					
<b>Note:</b>							
SL SL525B-36-01 R01	PNEUMATIC - PRECOOLER LIFE LIMIT, SERVICE LETTER					INFORMATIONAL	COMPLIED WITH - LIFE LIMIT ON PRECOOLERS ADDED, NO FURTHER ACTION NECESSARY.
24-MAR-2016		MOS HRS/MSC - AFL					
<b>Note:</b>							
SL SL525B-53-06	INTERCOSTAL DRAINAGE PATH INSPECTION, SERVICE LETTER					RECOMMENDED	COMPLIED WITH
27-OCT-2009		MOS HRS/MSC A/R (s) AFL		11-FEB-2011 459 394			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-53-07	UPPER TAILCONE SKIN INSPECTION, SERVICE LETTER					MANDATORY	COMPLIED WITH
03-JUN-2010		MOS HRS/MSC AFL		11-FEB-2011 459 394			
	<b>Note:</b>						
SL SL525B-53-08	FUSELAGE - RIGHT HAND AFT ENGINE BEAM BOLT REPLACEMENT, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - AS PER AIRCRAFT SERIALNUMBER
18-JUL-2023		MOS HRS/MSC AFL		02-AUG-2023			
	<b>Note:</b>						
SL SL525B-54-01 R01	PYLON STRUCTURE INSPECTION, SERVICE LETTER					SUPERSEDED	COMPLIED WITH - SUPERSEDED BY R02
20-AUG-2007		MOS HRS/MSC AFL		15-JAN-2009 152			
	<b>Note:</b>						
SL SL525B-54-01 R02	PYLON INSPECTION, SERVICE LETTER					SUPERSEDED	- SUPERSEDED BY REVISION 3
		MOS HRS/MSC AFL					
	<b>Note:</b>						
SL SL525B-54-01 R03	PYLON INSPECTION, SERVICE LETTER					CANCELLED	- WHICH CANCELLED THIS BULLETIN. SEE MAINTENANCE MANUAL REVISION 14 OR LATER INSPECTION DOCUMENT 1 TASK 54-50-00-210
21-OCT-2010		MOS HRS/MSC AFL					
	<b>Note:</b>						
SL SL525B-55-03	STABILIZERS - VERTICAL STABILIZER BOLT TORQUE INSPECTION, SERVICE LETTER					SUPERSEDED	DECLINED - NO PROBLEMS REPORTED - DECLINED
14-MAR-2023		MOS HRS/MSC AFL		24-MAR-2023			
	<b>Note:</b>						
SL SL525B-55-03 R01	STABILIZERS - VERTICAL STABILIZER BOLT TORQUE INSPECTION, SERVICE LETTER					RECOMMENDED	DECLINED - NO PROBLEMS REPORTED - DECLINED WITH R0
23-MAR-2023		MOS HRS/MSC AFL		04-APR-2023			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-57-03	WING STATION 48.00 FASTENER INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
16-JUL-2013		MOS HRS/MSC - AFL		09-FEB-2018			
	<b>Note:</b>						
SL SL525B-57-04	WING STATION 48.00 RIB INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
21-MAY-2015		MOS HRS/MSC - AFL		09-FEB-2018			
	<b>Note:</b>						
SL SL525B-57-05	WINGS - CENTER WING FUEL PLATE REPLACEMENT, SERVICE LETTER					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
11-APR-2016		MOS HRS/MSC - AFL		09-FEB-2018			
	<b>Note:</b>						
SL SL525B-71-08 R02	POWERPLANT - FUEL AND HYDRAULIC HOSE REPLACEMENT, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY AIRCRAFT S/N. NO FURTHER ACTIONS REQUIRED.
20-JAN-2016		MOS HRS/MSC - AFL					
	<b>Note:</b>						
SL SL525B-71-09	POWER PLANT - ENGINE ISOLATOR MOUNTS INSPECTION EXTENSION (SUPERSEDED BY SL525B-71-09 R01), SERVICE LETTER						NOT APPLICABLE - N/A by AC TT. No further action required.
07-DEC-2018		MOS HRS/MSC - AFL ACH					
	<b>Note:</b>						
SL SL525B-71-09 R01	POWER PLANT - ENGINE ISOLATOR MOUNTS INSPECTION EXTENSION, SERVICE LETTER					OPTIONAL	NOT APPLICABLE - N/A, due to AC TT. No further action required.
27-FEB-2019		MOS HRS/MSC - AFL ACH					
	<b>Note:</b>						
SL SL525B-72-01	ENGINE - TRANSMITTAL OF WILLIAMS INTERNATIONAL SERVICE BULLETIN WISB-72-1050, ENGINE - HPT ASSEMBLY - REPLACE, SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - BY A/C S/N
27-MAY-2022		MOS HRS/MSC - AFL		05-DEC-2022			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-73-02	RIGHT TRANSMITTAL OF WILLIAMS INTERNATIONAL SERVICE BULLETIN FJ44-73-030R1, ENGINE AND FUEL CONTROL - RECOMMENDED FADEC SOFTWARE UPLOAD OF CP219.11.06, SERVICE LETTER					COMPLIED WITH	
04-MAR-2009		MOS HRS/MSC AFL		17-APR-2009 197			
<b>Note:</b>							
SL SL525B-73-02	LEFT TRANSMITTAL OF WILLIAMS INTERNATIONAL SERVICE BULLETIN FJ44-73-030R1, ENGINE AND FUEL CONTROL - RECOMMENDED FADEC SOFTWARE UPLOAD OF CP219.11.06, SERVICE LETTER					COMPLIED WITH	
04-MAR-2009		MOS HRS/MSC AFL		17-APR-2009 197			
<b>Note:</b>							
SL SL525B-73-03	6355003-6 ORIFICE AND AS5174-0404 UNION INSPECTION, SERVICE LETTER					RECOMMENDED	COMPLIED WITH
30-MAR-2009		MOS HRS/MSC AFL		20-JAN-2010 318			
<b>Note:</b>							
SL SL525B-80-01	STARTING - STARTER-GENERATOR EXHAUST DUCT INSTALLATION VERIFICATION (SUPERSEDED BY SL525B-80-01 R01), SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - By Serial: N/A by Aircraft S/N. No further Actions required.
18-SEP-2018		MOS HRS/MSC AFL ACH					
<b>Note:</b>							
SL SL525B-80-01 R01	STARTING - STARTER-GENERATOR EXHAUST DUCT INSTALLATION VERIFICATION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - N/A by AC SN. No further action required.
05-OCT-2018		MOS HRS/MSC AFL ACH					
<b>Note:</b>							
SL SL525B-99-01 R03	CESCOME PRICES (THIS SL CANCELS SL525B-99-01 R2 AND PREVIOUS), SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - THIS SL CANCELS SL525B-99-01 R2 AND PREVIOUS
01-JUN-2013		MOS HRS/MSC AFL		03-MAR-2023			
<b>Note:</b>							
SL SL525B-99-03	TRANSMITTAL OF CESSNA'S CERTIFICATION REQUIREMENTS FOR PERSONAL ELECTRONIC DEVICE USAGE, SERVICE LETTER					SUPERSEDED	- SUPERSEDED BY REV.1
		MOS HRS/MSC AFL					
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-99-03 R01	TRANSMITTAL OF CESSNA'S CERTIFICATION REQUIREMENTS FOR PORTABLE ELECTRONIC DEVICE USAGE, SERVICE LETTER					SUPERSEDED	- SUPERSEDED BY REV.2
23-AUG-2013				MOS HRS/MSC - AFL			
<b>Note:</b>							
STC EASA STC 10064261	FDI ENGINEERING NETWORK GMBH / ADS-B OUT FOR CESSNA 525, 525A AND 525B					COMPLIED WITH	
				MOS HRS/MSC - AFL	21-FEB-2018 1161:55 1003		
<b>Note:</b>							
STC SA01434WI-D	(EASA STC 10016517) MODIFICATION OF ROCKWELL COLLINS GPS-4000 TO GPS-4000S					COMPLIED WITH	
				MOS HRS/MSC - AFL	21-FEB-2018 1161:55 1003		
<b>Note:</b>							
STC SA01848WI-D	(EASA STC 10064000) MODIFICATION OF ROCKWELL COLLINS GPS-4000S TO GPS-4000S					COMPLIED WITH	
				MOS HRS/MSC - AFL	21-FEB-2018 1161:55 1003		
<b>Note:</b>							
VSB SBATLAS-57-05	TACS CENTERING STRIP MODIFICATION, VENDOR SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - Tamarack STC ATLAS winglets System not Installed, No further action required
20-FEB-2019				MOS HRS/MSC - AFL ACH			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
<b>ENGINE NO. 1 - AD - 141453/67000-200</b>							
FAA 2022-13-15	NO. 1 ENGINE - TURBINE SECTION - HIGH-PRESSURE TURBINE (HPT) DISK - REPLACE					MANDATORY	NOT APPLICABLE - AS PER ENGINE S/N
09-AUG-2022		MOS		05-DEC-2022			
		HRS/MSC	-				
		AFL					
		ENC					
Note:							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
<b>ENGINE NO. 2 - AD - 141454/67000-200</b>							
FAA 2022-13-15	NO. 2 ENGINE - TURBINE SECTION - HIGH-PRESSURE TURBINE (HPT) DISK - REPLACE					MANDATORY	NOT APPLICABLE - AS PER ENGINE S/N
09-AUG-2022	MOS HRS/MSC - ENC			05-DEC-2022			

Note:

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
<b>ENGINE NO. 1 - SB - 141453/67000-200</b>							
PSID	WIPSID-05-1000 R04	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, PRODUCT SUPPORT INFORMATIONAL DOCUMENT				SUPERSEDED	- INFORMATION ONLY
26-SEP-2022		MOS HRS/MSC - ENC		11-JUL-2023			
<b>Note:</b>							
PSID	WIPSID-05-1000 R05	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, PRODUCT SUPPORT INFORMATIONAL DOCUMENT				INFORMATIONAL	- INFORMATIONAL ONLY - NO MAINTENANCE ACTION REQUIRED
10-JUL-2023		MOS HRS/MSC - ENC		08-AUG-2023			
<b>Note:</b>							
PSID	WIPSID-05-1000 R06	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, PRODUCT SUPPORT INFORMATIONAL DOCUMENT				INFORMATIONAL	- Information Only -
08-NOV-2023		MOS HRS/MSC - ENC AFL		(EFF)			
<b>Note:</b>							
PSID	WIPSID-05-1003	NO. 1 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - FORMS, PRODUCT SUPPORT INFORMATIONAL DOCUMENT					- INFORMATIONAL ONLY - BLANKO FORMSHEETS - NO FURTHER ACTION REQUIRED
05-MAY-2023		MOS HRS/MSC - ENC		16-MAY-2023			
<b>Note:</b>							
PSID	WIPSID-05-1003 R01	NO. 1 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - FORMS, PRODUCT SUPPORT INFORMATIONAL DOCUMENT					NOT APPLICABLE - For information only
19-OCT-2023		MOS HRS/MSC - ENC AFL					
<b>Note:</b>							
PSID	WIPSID-72-1010 R04	NO. 1 ENGINE - ENGINE - HP TURBINE DISK - INSPECT, PRODUCT SUPPORT INFORMATIONAL DOCUMENT					DEFERRED - NO PROACTIVE PERFORMANCE
31-MAR-2021		MOS HRS/MSC - (s) ENC					
<b>Note:</b>							
PSID	WIPSID-72-1022 R01	NO. 1 ENGINE - OPERATING IN AREAS OF SMOKE, PRODUCT SUPPORT INFORMATIONAL DOCUMENT					COMPLIED WITH - FORWARDED INFORMATION TO FLIGHT OPS SAFETY - NO FURTHER ACTION REQUIRED CURRENTLY
09-JUN-2023		MOS HRS/MSC - ENC		23-JUN-2023			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-05-002	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION (SUPERSEDED BY FJ44-05-002 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-05-002 R01
02-OCT-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-05-002 R01	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION (SUPERSEDED BY FJ44-05-002 R02), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-05-002 R02
22-MAY-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-05-002 R02	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-05-002 R03
17-AUG-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-05-002 R04	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY WIPSID-05-1000
01-OCT-2019		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-05-002 R05-CN	NO. 1 ENGINE - SUPERSEDED - UNSERVICEABLE PARTS - NOTIFICATION (THIS SERVICE DOCUMENT HAS BEEN SUPERSEDED BY WIPSID-05-1000), SERVICE BULLETIN					CANCELLED	- CANCELLED
07-APR-2020		MOS HRS/MSC - (s) ENC					
	<b>Note:</b>						
SB FJ44-72-066 R02	NO. 1 ENGINE - ENGINE - HOUSING, CARBON RING SEAL AND BEARING (NO. 3 BEARING RETAINER) - REPLACE (SUPERSEDED BY FJ44-72-066 R03), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-066 R03
16-DEC-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-066 R03	NO. 1 ENGINE - ENGINE - CARBON RING SEAL AND BEARING HOUSING - REPLACE (SUPERSEDED BY FJ44-72-066 R04), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-066 R04
03-JUN-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-066 R06	NO. 1 ENGINE - CARBON RING SEAL AND BEARING HOUSING - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
09-DEC-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-068 R03	NO. 1 ENGINE - ENGINE - UPGRADE GEARBOX (4K MAGSEAL) TO SPRING LOADED CONFIGURATION (SUPERSEDED BY FJ44-72-068 R04), SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
05-OCT-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-070 R02	NO. 1 ENGINE - CANCELLED - UPGRADE GEARBOX (4K SPRING-LOADED) TO IMPROVED CONFIGURATION (SUPERSEDED BY SB FJ44-72-105 R05), SERVICE BULLETIN					CANCELLED	- CANCELLED
18-DEC-2009		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-075 R01	NO. 1 ENGINE - GEARBOX P/N 78823 - INSPECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY ENGINE S/N. NO FURTHER ACTIONS REQUIRED.
17-AUG-2009		MOS HRS/MSC A/R ENC					
	<b>Note:</b>						
SB FJ44-72-078 R01	NO. 1 ENGINE - ENGINE - IP COMPRESSOR STATOR (STAGE 1-2) - REWORK (SUPERSEDED BY FJ44-72-078 R02), SERVICE BULLETIN					OPTIONAL	- SUPERSEDED BY FJ44-72-078 R02
15-APR-2013		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-078 R02	NO. 1 ENGINE - IP COMPRESSOR STATOR (STAGE 1-2) - REWORK (SUPERSEDED BY FJ44-72-078 R03), SERVICE BULLETIN					OPTIONAL	- SUPERSEDED BY FJ44-72-078 R03
12-FEB-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-078 R03	NO. 1 ENGINE - IP COMPRESSOR STATOR (STAGE 1-2) - REWORK, SERVICE BULLETIN					OPTIONAL	COMPLIED WITH
26-FEB-2016		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-080 R01	NO. 1 ENGINE - ENGINE - 2ND REDUCTION BEVEL GEAR BALL BEARING (GEARBOX ASSEMBLY) - REPLACE, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R02
16-APR-2013		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-080 R02	NO. 1 ENGINE - 2ND REDUCTION BEVEL GEAR BALL BEARING (GEARBOX ASSEMBLY) - REPLACE, SERVICE BULLETIN			RECOMMENDED	NOT APPLICABLE - AS PER ENGINE S/N		
10-DEC-2020	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-085 R05	NO. 1 ENGINE - ENGINE - IP BLEED VALVE - REPLACE (SUPERSEDED BY FJ44-72-085 R06), SERVICE BULLETIN			SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R06		
20-MAY-2011	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-085 R06	NO. 1 ENGINE - IP BLEED VALVE - REPLACE, SERVICE BULLETIN			SUPERSEDED	NOT APPLICABLE - SB REV.6 CHECKED, S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R07		
01-OCT-2014	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-085 R07	NO. 1 ENGINE - IP BLEED VALVE - REPLACE, SERVICE BULLETIN			SUPERSEDED	NOT APPLICABLE - AS PER ENGINE S/N		
22-APR-2021	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-085 R08	NO. 1 ENGINE - IP BLEED VALVE - REPLACE, SERVICE BULLETIN			RECOMMENDED	NOT APPLICABLE - AS PER ENGINE SERIALNUMBER		
13-JUL-2023	MOS HRS/MSC - ENC			18-JUL-2023			
<b>Note:</b>							
SB FJ44-72-086 R02	NO. 1 ENGINE - ENGINE - BLEED VALVE SHAFT - REPLACE (SUPERSEDED BY FJ44-72-086 R03), SERVICE BULLETIN			RECOMMENDED	- SUPERSEDED BY FJ44-72-086 R03		
16-JUL-2010	MOS HRS/MSC - ENC						
<b>Note:</b>							
SB FJ44-72-086 R03	NO. 1 ENGINE - ENGINE - BLEED VALVE SHAFT - REPLACE, SERVICE BULLETIN			RECOMMENDED			
05-OCT-2010	MOS HRS/MSC 4000/CSI ENC		0	4000			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-089	NO. 1 ENGINE - ENGINE – TYPE CERTIFICATION CONFIGURATION, SERVICE BULLETIN					INFORMATIONAL	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
17-NOV-2009		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-72-093	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R01), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W FJ44-72-093
07-MAY-2010		MOS HRS/MSC - ENC		18-MAR-2011 477 405			
	<b>Note:</b>						
SB FJ44-72-093 R02	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R03), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
25-AUG-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R03	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R04), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
17-NOV-2010		MOS HRS/MSC - ENC		23-MAR-2011 477 405			
	<b>Note:</b>						
SB FJ44-72-093 R05	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R06), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
08-MAR-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R06	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R07), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
25-MAY-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R07	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R08), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
28-JUN-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-093 R08	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R09), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
07-OCT-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R09	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY (SUPERSEDED BY FJ44-72-093 R10), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
29-NOV-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R10	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R11), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
13-APR-2012		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R11	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R12), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
01-AUG-2012		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R12	NO. 1 ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
01-APR-2014		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R13	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0 NO FURTHER ACTIONS REQUIRED.
28-JUN-2021		MOS HRS/MSC MPI ENC					
	<b>Note:</b>						
SB FJ44-72-095	NO. 1 ENGINE - ENGINE - HP TURBINE BLADE - ACCEPTABLE FOR CONTINUED USE, SERVICE BULLETIN						NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
08-SEP-2011		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-097	NO. 1 ENGINE - ENGINE - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-097 R01), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - REV. 4 OF THIS SB CANCELS SB FJ44-72-097 AND SUPERSEDES THIS SB WITH SB FJ44-72-151. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB FJ44-72-097 R01	NO. 1 ENGINE - ENGINE - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-097 R02), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - REV. 4 OF THIS SB CANCELS SB FJ44-72-097 AND SUPERSEDES THIS SB WITH SB FJ44-72-151. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB FJ44-72-097 R02	NO. 1 ENGINE - ENGINE - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-097 R03), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - REV. 4 OF THIS SB CANCELS SB FJ44-72-097 AND SUPERSEDES THIS SB WITH SB FJ44-72-151. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB FJ44-72-097 R03	NO. 1 ENGINE - ENGINE - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-097 R04), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - REV. 4 OF THIS SB CANCELS SB FJ44-72-097 AND SUPERSEDES THIS SB WITH SB FJ44-72-151. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB FJ44-72-097 R04	NO. 1 ENGINE - CANCELLED - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-151 R06), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - REV. 4 OF THIS SB CANCELS SB FJ44-72-097 AND SUPERSEDES THIS SB WITH SB FJ44-72-151. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB FJ44-72-105 R03	NO. 1 ENGINE - UPGRADE GEARBOX (4K SPRING LOADED) TO IMPROVED CONFIGURATION (SUPERSEDED BY FJ44-72-105 R04), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R04
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
22-JAN-2016				05-DEC-2022			

**Note:**

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-105 R05	NO. 1 ENGINE - UPGRADE GEARBOX (4K SPRING LOADED) TO IMPROVED CONFIGURATION, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - AS PER ENGINE S/N
15-APR-2021	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-105 R06	NO. 1 ENGINE - UPGRADE GEARBOX (4K SPRING LOADED) TO IMPROVED CONFIGURATION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER ENGINE S/N
02-MAY-2023	MOS HRS/MSC - ENC			16-MAY-2023			
<b>Note:</b>							
SB FJ44-72-106 R01	NO. 1 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
24-MAR-2015	MOS HRS/MSC - ENC			09-FEB-2018			
<b>Note:</b>							
SB FJ44-72-106 R02	NO. 1 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - AS PER ENGINE S/N
29-JUN-2021	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-106 R03	NO. 1 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - AS PER ENGINE S/N
19-JAN-2023	MOS HRS/MSC - ENC			21-MAR-2023			
<b>Note:</b>							
SB FJ44-72-107	NO. 1 ENGINE - ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE (SUPERSEDED BY FJ44-72-107 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-107 R01
20-MAR-2013	MOS HRS/MSC - ENC						
<b>Note:</b>							
SB FJ44-72-107 R02	NO. 1 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-107 R03
24-MAR-2015	MOS HRS/MSC - ENC						
<b>Note:</b>							
SB FJ44-72-107 R03	NO. 1 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SUPERSEDED WITH REV.04
11-OCT-2019	MOS HRS/MSC CSI ENC			24-AUG-2022 2048 1669			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-107 R05	NO. 1 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - PREVIOUS REVISION
28-JUN-2021		MOS HRS/MSC - ENC		05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-108	NO. 1 ENGINE - ACCESSORY DRIVE SHAFT - REPLACE (SUPERSEDED BY FJ44-72-108 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-108 R01
17-APR-2013		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-72-108 R01	NO. 1 ENGINE - ACCESSORY DRIVE SHAFT - REPLACE (SUPERSEDED BY SB WISB-72-1037 R01), SERVICE BULLETIN					CANCELLED	- SB CANCELLED.
17-JUN-2014		MOS HRS/MSC - ENC		0			
<b>Note:</b>							
SB FJ44-72-108 R01-CN	NO. 1 ENGINE - SUPERSEDED - ACCESSORY DRIVE SHAFT - REPLACE (THIS SERVICE DOCUMENT IS NO LONGER AVAILABLE), SERVICE BULLETIN					CANCELLED	- CANCELLED
18-JUN-2020		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-72-109	NO. 1 ENGINE - ENGINE - 1ST REDUCTION BEVEL GEAR BALL BEARING - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
17-APR-2013		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
<b>Note:</b>							
SB FJ44-72-110	NO. 1 ENGINE - ENGINE - DAMPENER BRACKET ASSEMBLY - REPLACE, SERVICE BULLETIN					MANDATORY	COMPLIED WITH
17-APR-2013		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
<b>Note:</b>							
SB FJ44-72-111 R02	NO. 1 ENGINE - ENGINE - 1ST LP TURBINE NOZZLE - INSPECTION, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
10-SEP-2013		MOS HRS/MSC - ENC		09-FEB-2018			
<b>Note:</b>							
SB FJ44-72-122	NO. 1 ENGINE - ACCESSORY DRIVE SHAFT - REPLACE, SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
06-AUG-2014		MOS HRS/MSC - ENC		09-FEB-2018			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-122-CN	NO. 1 ENGINE - SUPERSEDED - ENGINE - ACCESSORY DRIVE SHAFT - REPLACE, SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - CANCELLED
06-DEC-2019		MOS HRS/MSC - ENC AFL					
	<b>Note:</b>						
SB FJ44-72-124	NO. 1 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-124 R01
09-DEC-2014		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-124 R01	NO. 1 ENGINE - REPLACE HP TURBINE BLADES, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-124 R02
27-JAN-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-124 R02	NO. 1 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-124 R03
20-NOV-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-124 R03	NO. 1 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-124 R04
06-FEB-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-124 R04	NO. 1 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-124 R05
04-MAY-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-124 R05	NO. 1 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SUPERSEDED BY R09
29-OCT-2019		MOS HRS/MSC - ENC		02-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-124 R09	NO. 1 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - PREVIOUS REVISION.
30-SEP-2022		MOS HRS/MSC MPI ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-129	NO. 1 ENGINE - REPLACE INNER GUIDED ROLLER BEARING (NO. 3 BEARING), SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SB CANCELLED
06-FEB-2015		MOS HRS/MSC - ENC		09-FEB-2018			
<b>Note:</b>							
SB FJ44-72-129 R01	NO. 1 ENGINE - INNER GUIDED ROLLER BEARING (NO. 3 BEARING) - REPLACE, SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - N/A BY ESN. NO FURTHER ACTION REQUIRED. SB CANCELLED
		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-72-129 R01-CN	NO. 1 ENGINE - CANCELED - ENGINE - INNER GUIDED ROLLER BEARING (NO. 3 BEARING) - REPLACE, SERVICE BULLETIN					CANCELLED	- CANCELLED
08-OCT-2021		MOS HRS/MSC - (s) ENC					
<b>Note:</b>							
SB FJ44-72-130	NO. 1 ENGINE - HP COMPRESSOR ROTOR - INSPECTION (SUPERSEDED BY FJ44-72-130 R01), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-130 R01
05-MAR-2015		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-72-130 R01	NO. 1 ENGINE - HP COMPRESSOR ROTOR - INSPECTION (SUPERSEDED BY FJ44-72-130 R02), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-130 R02
08-MAY-2017		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-72-130 R02	NO. 1 ENGINE - HP COMPRESSOR ROTOR - INSPECTION, SERVICE BULLETIN					RECOMMENDED	
06-FEB-2018		MOS HRS/MSC 4000/CSI ENC	0		4000		
<b>Note:</b>							
SB FJ44-72-133	NO. 1 ENGINE - REPLACE 1ST LP TURBINE NOZZLE (SUPERSEDED BY FJ44-72-133 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-133 R01
27-JAN-2016		MOS HRS/MSC - ENC		24-AUG-2022			
<b>Note:</b>							
SB FJ44-72-133 R01	NO. 1 ENGINE - REPLACE 1ST LP TURBINE NOZZLE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
05-FEB-2016		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-133 R02	NO. 1 ENGINE - REPLACE 1ST LP TURBINE NOZZLE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - R01 - NO ADDITIONAL WORK REQUIRED WITH R02
18-MAY-2023		MOS HRS/MSC - ENC		24-AUG-2022			
	<b>Note:</b>						
SB FJ44-72-135 R01	NO. 1 ENGINE - IDENTIFICATION PLATE - REPLACE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
02-JUL-2015		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-72-140	NO. 1 ENGINE - GEARBOX HOUSING ASSEMBLY - INSPECTION, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
22-OCT-2015		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-140 R01	NO. 1 ENGINE - GEARBOX HOUSING ASSEMBLY - INSPECTION, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - WITH R01
23-AUG-2021		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-142	NO. 1 ENGINE - NO. 1 CARBON SEAL ASSEMBLY & SEAL RUNNER - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
08-JUN-2016		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-72-142 R01	NO. 1 ENGINE - NO. 1 CARBON SEAL ASSEMBLY & SEAL RUNNER - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - SB REV.01 CHECKED, ENGINE S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
23-JAN-2019		MOS HRS/MSC DUE ENC AFL					
	<b>Note:</b>						
SB FJ44-72-143	NO. 1 ENGINE - BLEED VALVE SHAFT - REPLACE (SUPERSEDED BY FJ44-72-143 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY REV.1
06-MAY-2016		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-143 R01	NO. 1 ENGINE - BLEED VALVE SHAFT - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SUPERSEDED BY R02
15-SEP-2016		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-143 R02	NO. 1 ENGINE - BLEED VALVE SHAFT - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - PREVIOUS REVISION
24-SEP-2021		MOS HRS/MSC - ENC		05-DEC-2022			
	<b>Note:</b>						
SB FJ44-72-150	NO. 1 ENGINE - LP REAR BEARING SEAL RETAINER - REPLACE (SUPERSEDED BY FJ44-72-150 R01), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-150 R01
29-AUG-2016		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-150 R01	NO. 1 ENGINE - LP REAR BEARING SEAL RETAINER - REPLACE (SUPERSEDED BY FJ44-72-150 R02), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-150 R02
29-SEP-2016		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-150 R02	NO. 1 ENGINE - LP REAR BEARING SEAL RETAINER - REPLACE, SERVICE BULLETIN						- SUPERSEDED BY FJ44-72-150 R03
29-OCT-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-150 R03	NO. 1 ENGINE - LP REAR BEARING SEAL RETAINER - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
27-JUN-2019		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-151	NO. 1 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL (SUPERSEDED BY FJ44-72-151 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-151 R01
06-OCT-2016		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-151 R01	NO. 1 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL (SUPERSEDED BY FJ44-72-151 R02), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-151 R02
25-JAN-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-151 R02	NO. 1 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL (SUPERSEDED BY FJ44-72-151 R03), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-151 R03
10-FEB-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-151 R03	NO. 1 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-151 R04
07-APR-2017	MOS HRS/MSC - ENC						
	<b>Note:</b>						
SB FJ44-72-151 R04	NO. 1 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
12-NOV-2019	MOS HRS/MSC - ENC			24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-151 R05	NO. 1 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
11-MAR-2020	MOS HRS/MSC - ENC			24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-151 R06	NO. 1 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					MANDATORY	COMPLIED WITH
29-JUN-2021	MOS HRS/MSC - ENC			24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-152 R01	NO. 1 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SB SUPERSEDED
08-MAY-2017	MOS HRS/MSC - ENC			09-FEB-2018			
	<b>Note:</b>						
SB FJ44-72-152 R02	NO. 1 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - By Serial: NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
11-MAR-2020	MOS HRS/MSC - ENC AFL						
	<b>Note:</b>						
SB FJ44-72-154	NO. 1 ENGINE - 1ST LP TURBINE NOZZLE - INSPECTION (SUPERSEDED BY FJ44-72-154 R01), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-154 R01
15-FEB-2017	MOS HRS/MSC - ENC						
	<b>Note:</b>						
SB FJ44-72-154 R01	NO. 1 ENGINE - 1ST LP TURBINE NOZZLE - INSPECTION (CANCELLED), SERVICE BULLETIN					RECOMMENDED	- CANCELLED
08-MAR-2017	MOS HRS/MSC - ENC						
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-030 R08	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06 (SUPERSEDED BY FJ44-73-030 R09), SERVICE BULLETIN					CANCELLED	COMPLIED WITH - C/W. SEE FJ44-73-030 R10. NO FURTHER ACTIONS REQUIRED.
12-AUG-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-030 R09	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06 (SUPERSEDED BY FJ44-73-030 R10), SERVICE BULLETIN					CANCELLED	COMPLIED WITH - C/W. SEE FJ44-73-030 R10. NO FURTHER ACTIONS REQUIRED.
19-JUL-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-030 R10	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06 (SUPERSEDED BY FJ44-73-030 R11), SERVICE BULLETIN					CANCELLED	COMPLIED WITH - C/W. SEE FJ44-73-030 R10. NO FURTHER ACTIONS REQUIRED.
26-JUL-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-030 R11	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06 (SUPERSEDED BY FJ44-73-030 R12), SERVICE BULLETIN					CANCELLED	COMPLIED WITH - C/W. SEE FJ44-73-030 R10. NO FURTHER ACTIONS REQUIRED.
11-NOV-2011		MOS HRS/MSC A/R ENC					
	<b>Note:</b>						
SB FJ44-73-030 R12	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06 (SUPERSEDED BY FJ44-73-030 R13), SERVICE BULLETIN					CANCELLED	COMPLIED WITH
29-NOV-2011		MOS HRS/MSC - ENC		26-MAR-2012 601 521			
	<b>Note:</b>						
SB FJ44-73-030 R13	NO. 1 ENGINE - CANCELLED - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06, SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - CANCELLED SEE FJ44-73-030 R10. NO FURTHER ACTIONS REQUIRED.
12-JUL-2012		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-038	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R01), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - ENGINE S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
25-JAN-2010		MOS HRS/MSC A/R ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-038 R01	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R02), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.01 CHECKED, P/N 115180 IS ALREADY INSTALLED, NO FURTHER ACTION REQUIRED
31-MAR-2011		MOS HRS/MSC ENC	A/R				
<b>Note:</b>							
SB FJ44-73-038 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R03), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.02 CHECKED, P/N 115180 IS ALREADY INSTALLED, NO FURTHER ACTION REQUIRED
18-APR-2011		MOS HRS/MSC ENC	A/R				
<b>Note:</b>							
SB FJ44-73-038 R03	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R04), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.03 CHECKED, P/N 115180 IS ALREADY INSTALLED, NO FURTHER ACTION REQUIRED
		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-73-038 R04	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R05), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.04 CHECKED, P/N 115180 IS ALREADY INSTALLED, NO FURTHER ACTION REQUIRED
		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-73-038 R05	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R06), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.05 CHECKED, P/N 115180 IS ALREADY INSTALLED, NO FURTHER ACTION REQUIRED
14-AUG-2012		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-73-038 R06	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R07), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.06 CHECKED, P/N 115180 IS ALREADY INSTALLED, NO FURTHER ACTION REQUIRED
14-NOV-2013		MOS HRS/MSC ENC	-				
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-038 R07	NO. 1 ENGINE - DUAL CHANNEL FADEC - REPLACE, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - C/W. FOUND N/A BY INSTALLED FADEC P/N 115180. NO FURTHER ACTIONS REQUIRED.
22-OCT-2014		MOS HRS/MSC ENC		21-AUG-2015 953 827			
<b>Note:</b>							
SB FJ44-73-039 R01	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-039 R02), SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY ENGINE S/N. NO FURTHER ACTIONS REQUIRED.
31-MAR-2011		MOS HRS/MSC ENC		A/R			
<b>Note:</b>							
SB FJ44-73-039 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-039 R03), SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY ENGINE S/N. NO FURTHER ACTIONS REQUIRED.
18-APR-2011		MOS HRS/MSC ENC		A/R			
<b>Note:</b>							
SB FJ44-73-042	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET - REPLACE (SUPERSEDED BY FJ44-73-042 R01), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-73-042 R01
04-NOV-2010		MOS HRS/MSC ENC					
<b>Note:</b>							
SB FJ44-73-042 R01	NO. 1 ENGINE - REPLACE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET (SUPERSEDED BY FJ44-73-042 R02), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-73-042 R02
23-MAR-2011		MOS HRS/MSC ENC					
<b>Note:</b>							
SB FJ44-73-042 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET - REPLACE (SUPERSEDED BY FJ44-73-042 R03), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-73-042 R03
24-AUG-2011		MOS HRS/MSC ENC					
<b>Note:</b>							
SB FJ44-73-042 R03	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET - REPLACE (SUPERSEDED BY FJ44-73-042 R04), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-73-042 R04
29-NOV-2011		MOS HRS/MSC ENC					
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-042 R04	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET - REPLACE (SUPERSEDED BY FJ44-73-042 R05), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-73-042 R05
03-FEB-2012		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-73-042 R05	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET - REPLACE, SERVICE BULLETIN				24-AUG-2022	RECOMMENDED	COMPLIED WITH
04-SEP-2013		MOS HRS/MSC - ENC			2048 1669		
<b>Note:</b>							
SB FJ44-73-043 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FADEC REPLACEMENT AND APPLICATION SOFTWARE UPLOAD, SERVICE BULLETIN					RECOMMENDED	- AS REQUIRED
12-JUL-2012		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-73-044	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-73-044 R01
07-MAY-2012		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-73-044 R01	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R02), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-73-044 R02
11-JUN-2012		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-73-044 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R03), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-73-044 R03
14-AUG-2012		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-73-044 R03	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R04), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-73-044 R04
11-FEB-2013		MOS HRS/MSC - ENC					
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-044 R04	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R05), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-73-044 R05
11-SEP-2014		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-044 R05	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R06), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SB FJ44-73-044R5 PERFORMED ON LH ENGINE. FDU REPLACED IAW FJ44-3A ENGINE LMM AND PERFORMED ALL NECESSARY TESTS. FDU INSTALLED P/N 119149 S/N CL7APU0823 TSN 2027.3 AND CSN 1507
14-JUN-2016		MOS HRS/MSC - ENC		05-AUG-2016 1020 887			
	<b>Note:</b>						
SB FJ44-73-044 R06	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R07), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SB REV. 6 CHECKED, PERFORMED WITH SB FJ44-73-044R5, NO FURTHER ACTION REQUIRED
16-MAR-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-044 R07	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SB REV. 7 CHECKED, PERFORMED WITH SB FJ44-73-044R5, NO FURTHER ACTION REQUIRED
24-AUG-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-044 R08	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - PERFORMED WITH FJ44-73-044 R05, NO FURTHER ACTION REQUIRED
31-OCT-2019		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-044 R09	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - PREVIOUSLY COMPLIED WITH: NO ADDITIONAL WORK WITH THIS REVISION
15-SEP-2023		MOS HRS/MSC - ENC		19-SEP-2023			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-046 R04	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
24-AUG-2017		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-73-046 R05	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A by Part SN. No further action required.
		MOS HRS/MSC - ENC AFL					
	<b>Note:</b>						
SB FJ44-73-049	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL FILTER & FILTER BOWL - INSPECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
24-APR-2013		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-73-061	NO. 1 ENGINE - CANCELLED - FUEL DELIVERY UNIT (FDU) - TIME EXTENSION OF TIME BETWEEN OVERHAUL (TBO), SERVICE BULLETIN					RECOMMENDED	- CANCELLED
09-JAN-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-009 R01	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY SB FJ44-77-011 R18), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY SB FJ44-77-011 R18
		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-011 R02	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R03), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-77-011 R03
24-SEP-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-011 R03	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R04), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-77-011 R04
27-OCT-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-77-011 R04	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R05), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-77-011 R05
16-NOV-2010		MOS HRS/MSC ENC	A/R				
<b>Note:</b>							
SB FJ44-77-011 R05	NO. 1 ENGINE - ENGINE INDICATING & FADEC ENGINE HARNESS ASSEMBLY & INSPECTION (SUPERSEDED BY FJ44-77-011 R06), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
16-NOV-2010		MOS HRS/MSC ENC	-	11-FEB-2011 459 394			
<b>Note:</b>							
SB FJ44-77-011 R06	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R07), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.06 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
14-JAN-2011		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-77-011 R07	NO. 1 ENGINE - ENGINE INDICATING & FADEC ENGINE HARNESS ASSEMBLY & INSPECTION (SUPERSEDED BY FJ44-77-011 R08), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.07 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
14-OCT-2011		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-77-011 R08	NO. 1 ENGINE - ENGINE INDICATING & FADEC ENGINE HARNESS ASSEMBLY & INSPECTION (SUPERSEDED BY FJ44-77-011 R09), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.08 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
17-NOV-2011		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-77-011 R09	NO. 1 ENGINE - ENGINE INDICATING & FADEC ENGINE HARNESS ASSEMBLY & INSPECTION (SUPERSEDED BY FJ44-77-011 R10), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.09 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
29-NOV-2011		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-77-011 R10	NO. 1 ENGINE - ENGINE INDICATING & FADEC ENGINE HARNESS ASSEMBLY & INSPECTION (SUPERSEDED BY FJ44-77-011 R11), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.10 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
09-FEB-2012		MOS HRS/MSC ENC	-				
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-77-011 R11	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R12), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.11 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB FJ44-77-011 R12	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R13), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.12 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB FJ44-77-011 R13	NO. 1 ENGINE - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R14), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.13 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB FJ44-77-011 R14	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R15), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.14 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB FJ44-77-011 R15	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R16), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.15 CHECKED, PERFORMED WITH SB FJ44-77-011 REV. 5, NO FURTHER ACTION REQUIRED
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB FJ44-77-011 R16	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R17), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.16 CHECKED, PERFORMED WITH SB FJ44-77-011 REV. 5, NO FURTHER ACTION REQUIRED
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-77-011 R17	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R18), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.17 CHECKED, PERFORMED WITH SB FJ44-77-011 REV. 5, NO FURTHER ACTION REQUIRED
09-MAY-2016		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-011 R18	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - PREVIOUSLY COMPLIED WITH:
14-NOV-2018		MOS HRS/MSC - ENC		25-MAR-2019 1251:36 1091			
	<b>Note:</b>						
SB FJ44-77-013	NO. 1 ENGINE - FADEC ENGINE HARNESS ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-77-013 R01), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R01
20-JAN-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-013 R01	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R02), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R02
18-MAR-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-013 R02	NO. 1 ENGINE - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R03), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R03
16-JUN-2015		MOS HRS/MSC - ENC		(EFF)			
	<b>Note:</b>						
SB FJ44-77-013 R04	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R05), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R05
01-SEP-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-013 R05	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R06), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R06
22-OCT-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-77-013 R06	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R07), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R07
02-FEB-2016		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-77-013 R07	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK, SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R08
09-MAY-2016		MOS HRS/MSC DUE ENC		(EFF)			
<b>Note:</b>							
SB FJ44-77-013 R09	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
17-JAN-2019		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
<b>Note:</b>							
SB FJ44-79-009 R02	NO. 1 ENGINE - ADJUST-LUBRICATION-OIL PRESSURE VALVE (SUPERSEDED BY FJ44-79-009 R03), SERVICE BULLETIN				SUPERSEDED		- SUPERSEDED BY FJ44-79-009 R03
26-JUL-2011		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-79-009 R05	NO. 1 ENGINE - LUBRICATION - OIL PRESSURE RELIEF VALVE - ADJUST (SUPERSEDED BY FJ44-79-009 R06), SERVICE BULLETIN				SUPERSEDED		NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R06
30-APR-2013		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-79-009 R08	NO. 1 ENGINE - LUBRICATION - OIL PRESSURE RELIEF VALVE - ADJUST, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R09
29-JUN-2016		MOS HRS/MSC - ENC		09-FEB-2018			
<b>Note:</b>							
SB FJ44-79-009 R09	NO. 1 ENGINE - LUBRICATION - OIL PRESSURE RELIEF VALVE - ADJUST, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - AS PER ENGINE S/N
20-MAY-2021		MOS HRS/MSC - ENC		05-DEC-2022			
<b>Note:</b>							
SB FJ44-79-011	NO. 1 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE (SUPERSEDED BY FJ44-79-011 R01), SERVICE BULLETIN				SUPERSEDED		- SUPERSEDED BY FJ44-79-011 REV.4.
17-JAN-2013		MOS HRS/MSC - ENC					
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-79-011 R01	NO. 1 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE (SUPERSEDED BY FJ44-79-011 R02), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-79-011 REV.4.
13-MAR-2013		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-011 R03	NO. 1 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE (SUPERSEDED BY FJ44-79-011 R04), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-79-011 REV.4.
23-JUL-2013		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-011 R04	NO. 1 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-79-011 R05
16-MAY-2014		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-011 R05	NO. 1 ENGINE - OIL - MAGNETIC SELF-CLOSING VALVE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-79-011 R06
08-OCT-2019		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-011 R06	NO. 1 ENGINE - OIL - MAGNETIC SELF-CLOSING VALVE - REPLACE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - AS PER S/N
06-AUG-2021		MOS HRS/MSC - ENC		26-SEP-2022			
	<b>Note:</b>						
SB FJ44-79-012 R01	NO. 1 ENGINE - OIL - LUBE OIL COOLER - REWORK OR REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
12-APR-2017		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-79-013 R02	NO. 1 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R03), SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
25-AUG-2017		MOS HRS/MSC - ENC		22-FEB-2018 1161:54 1008			
	<b>Note:</b>						
SB FJ44-79-013 R03	NO. 1 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R04), SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - SB REV.3 CHECKED, PERFORMED WITH SB FJ44-79-013 REV. 2, NO FURTHER ACTION REQUIRED
26-MAR-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-79-013 R04	NO. 1 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R05), SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - SB REV.4 CHECKED, PERFORMED WITH SB FJ44-79-013 REV. 2, NO FURTHER ACTION REQUIRED
21-MAY-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-013 R05	NO. 1 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - SB REV.5 CHECKED, PERFORMED WITH SB FJ44-79-013 REV. 2, NO FURTHER ACTION REQUIRED
06-AUG-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-015	NO. 1 ENGINE - CANCELLED - OIL - LUBE AND SCAVENGE PUMP ASSEMBLY - TIME EXTENSION OF TIME BETWEEN OVERHAUL (TBO) FOR TOTAL ASSURANCE PROGRAM (TAP), SERVICE BULLETIN					RECOMMENDED	- AS REQUIRED
24-FEB-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-016 R03	NO. 1 ENGINE - OIL - RELIEF VALVE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-016 R04), SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
28-APR-2017		MOS HRS/MSC - ENC	09-FEB-2018				
	<b>Note:</b>						
SB FJ44-79-016 R04	NO. 1 ENGINE - OIL - RELIEF VALVE ASSEMBLY - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - SB REV.4 CHECKED, S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
22-FEB-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-T017 R01	NO. 1 ENGINE - LUBRICATION - OIL PRESSURE RELIEF VALVE - ADJUST, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
04-NOV-2008		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB WISB-72-1004	NO. 1 ENGINE - 1ST LP TURBINE NOZZLE - REPLACE (SUPERSEDED BY WISB-72-1004 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY WISB-72-1004 R01
25-MAY-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-72-1004 R03	NO. 1 ENGINE - ENGINE - 1ST LP TURBINE NOZZLE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY WISB-72-1004 R04
21-JUL-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB WISB-72-1004 R04	NO. 1 ENGINE - 1ST LP TURBINE NOZZLE - REPLACE (SUPERSEDED BY SB WISB-72-1054), SERVICE BULLETIN					COMPLIED WITH	
06-FEB-2018		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB WISB-72-1004 R04-CN	NO. 1 ENGINE - 1ST LP TURBINE NOZZLE - REPLACE (SUPERSEDED BY SB WISB-72-1054), SERVICE BULLETIN					CANCELLED	- CANCELLED
01-JUN-2023		MOS HRS/MSC - ENC		22-JUN-2023			
	<b>Note:</b>						
SB WISB-72-1032 R02	NO. 1 ENGINE - HIGH PRESSURE TURBINE DISK - REPLACE, SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - AS PER ENGINE S/N. SB CANCELLED
04-JUN-2020		MOS HRS/MSC - ENC		05-DEC-2022			
	<b>Note:</b>						
SB WISB-72-1034	NO. 1 ENGINE - HP TURBINE - RE-IDENTIFY ASSEMBLY AND DISK, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
20-DEC-2019		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB WISB-72-1034 R03	NO. 1 ENGINE - HP TURBINE - RE-IDENTIFY ASSEMBLY AND DISK, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W R0
02-JUL-2021		MOS HRS/MSC MPI ENC		24-AUG-2022			
	<b>Note:</b>						
SB WISB-72-1034 R04	NO. 1 ENGINE - HP TURBINE - RE-IDENTIFY ASSEMBLY AND DISK, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - REV.0 - NO ADDITIONAL WORK REQUIRED WITH REV.04
19-APR-2023		MOS HRS/MSC - ENC		24-AUG-2022			
	<b>Note:</b>						
SB WISB-72-1037 R01	NO. 1 ENGINE - ACCESSORY DRIVE TOWERSHAFT - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SUPERSEDED BY R02
18-JUN-2020		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-72-1037 R03	NO. 1 ENGINE - ACCESSORY DRIVE TOWERSHAFT - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - WITH PREVIOUS REVISION. SUPERSEDED BY R04
03-MAR-2022		MOS HRS/MSC - ENC		05-DEC-2022			
	<b>Note:</b>						
SB WISB-72-1037 R04	NO. 1 ENGINE - ACCESSORY DRIVE TOWERSHAFT - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - PREVIOUS REVISION
03-JAN-2023		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB WISB-72-1041	NO. 1 ENGINE - HEAT EXCHANGER CLAMP ASSEMBLY - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
19-JUN-2020		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB WISB-72-1041 R03	NO. 1 ENGINE - HEAT EXCHANGER CLAMP ASSEMBLY - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - WITH PREVIOUS REVISION
16-DEC-2021		MOS HRS/MSC - ENC		05-DEC-2022			
	<b>Note:</b>						
SB WISB-72-1041 R04	NO. 1 ENGINE - HEAT EXCHANGER CLAMP ASSEMBLY - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - PREVIOUS REVISION
18-JAN-2023		MOS HRS/MSC MPI ENC					
	<b>Note:</b>						
SB WISB-72-1044	NO. 1 ENGINE - ENGINE - BALANCE PISTON - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - PREVIOUS REV
15-MAR-2021		MOS HRS/MSC - ENC		24-AUG-2022			
	<b>Note:</b>						
SB WISB-72-1044 R02	NO. 1 ENGINE - BALANCE PISTON - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - PREV REVISION
26-JUL-2022		MOS HRS/MSC - ENC		05-DEC-2022			
	<b>Note:</b>						
SB WISB-72-1044 R03	NO. 1 ENGINE - BALANCE PISTON - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - PREVIOUS REVISION
12-JAN-2023		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-72-1050	NO. 1 ENGINE - HPT ASSEMBLY - REPLACE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE
		MOS		05-DEC-2022			
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB WISB-73-1002	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE (SUPERSEDED BY WISB-73-1002 R01), SERVICE BULLETIN					CANCELLED	COMPLIED WITH
20-DEC-2017		MOS		22-FEB-2018			
		HRS/MSC	-		1161:54		
		ENC			1008		
	<b>Note:</b>						
SB WISB-73-1002 R02-CN	NO. 1 ENGINE - CANCELLED - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					CANCELLED	- CANCELLED
06-FEB-2018		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB WISB-73-1007 R01	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - ENGINE MAINTENANCE TERMINAL (EMT) SOFTWARE UPGRADE TO CP356.10.02 (CANCELLED), SERVICE BULLETIN						COMPLIED WITH - INFORMATIONAL ONLY: INFORMATIONAL ONLY.
22-MAY-2018		MOS		03-APR-2019			
		HRS/MSC	-		1251:36		
		ENC			1091		
	<b>Note:</b>						
SB WISB-73-1008	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY REV WISB-73-1008 REV.1
13-JUL-2018		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB WISB-73-1008 R01	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY REV WISB-73-1008 REV.2
27-JUL-2018		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB WISB-73-1008 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY REV WISB-73-1008 REV.3
06-AUG-2018		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB WISB-73-1008 R03	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY REV WISB-73-1008 REV.4
29-JAN-2019		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-73-1008 R04	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
19-FEB-2019		MOS		02-AUG-2022			
		HRS/MSC	-	2048			
		ENC		1669			
<b>Note:</b>							
SB WISB-73-1009	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY REV WISB-73-1009 REV.1
13-JUL-2018		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB WISB-73-1009 R01	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN						- SUPERSEDED BY REV WISB-73-1009 REV.2
27-JUL-2018		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB WISB-73-1009 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN						- SUPERSEDED BY WISB-73-1009 R03
06-AUG-2018		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB WISB-73-1009 R03	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN						- SUPERSEDED BY WISB-73-1009 R04
30-JUL-2019		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB WISB-73-1009 R04	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
05-AUG-2019		MOS					
		HRS/MSC	-	0			
		ENC					
<b>Note:</b>							
SB WISB-73-1009 R05	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
21-MAR-2024		MOS					
		HRS/MSC	CSI		4000 M		
		ENC					
<b>Note:</b>							
SB WISB-73-1019-CN	NO. 1 ENGINE - SUPERSEDED - ENGINE FUEL AND CONTROL - ENGINE MAINTENANCE TERMINAL (EMT) SOFTWARE UPGRADE TO CP356.12.01 (SUPERSEDED BY SB WISB-73-1022), SERVICE BULLETIN					SUPERSEDED	- CANCELLED
14-JUL-2021		MOS					
		HRS/MSC	- (s)				
		ENC					
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-73-1027 R01	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL CONTROL UNIT - REPLACE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - AS PER ENGINE S/N
03-AUG-2022		MOS HRS/MSC - ENC		05-DEC-2022			
<b>Note:</b>							
SB WISB-73-1040 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN						
14-MAR-2025		MOS HRS/MSC DUE ENC			6993:06 M		
<b>Note:</b>							
SB WISB-74-1000	NO. 1 ENGINE - IGNITION - IGNITER LEAD INSPECTION AND CLAMPING ARRANGEMENT, SERVICE BULLETIN					MANDATORY	COMPLIED WITH
17-AUG-2017		MOS HRS/MSC - ENC		22-FEB-2018 1161:54 1008			
<b>Note:</b>							
SB WISB-74-1004 R02	NO. 1 ENGINE - IGNITION - IGNITER LEAD - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - BY A/C S/N
01-JUL-2021		MOS HRS/MSC - ENC		05-DEC-2022			
<b>Note:</b>							
SB WISB-75-1001	NO. 1 ENGINE - AIR - I.P. BLEED VALVE LEVER PIN - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY WISB-75-1001 REV.1
17-MAY-2018		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB WISB-75-1001 R01	NO. 1 ENGINE - AIR - I.P. BLEED VALVE LEVER PIN - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY R02
25-JAN-2019		MOS HRS/MSC CSI ENC		0			
<b>Note:</b>							
SB WISB-75-1001 R02	NO. 1 ENGINE - AIR - I.P. BLEED VALVE LEVER PIN - REPLACE, SERVICE BULLETIN					RECOMMENDED	- RECOMMENDED PERFORMANCE DURING NEXT CSI - WILL BE COVERED BY TAP
20-MAY-2021		MOS HRS/MSC CSI ENC					
<b>Note:</b>							
SL SL44-71-385	NO. 1 ENGINE - START ITT EXCEEDANCE - BORESCOPE INSPECTION & HIGH POWER CHECK RUN, SERVICE LETTER						NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
06-JAN-2017		MOS HRS/MSC - (s) ENC		09-FEB-2018			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL44-72-227 R11	NO. 1 ENGINE - ENGINE - DIFFUSER CASE - FLUORESCENT PENETRANT INSPECTION, SERVICE LETTER						NOT APPLICABLE - AS PER ENGINE S/N
14-JUL-2011		MOS HRS/MSC - ENC		05-DEC-2022			
	<b>Note:</b>						
SL SL44-72-300 R07	NO. 1 ENGINE - ENGINE - HP COMPRESSOR COVER - REAM HOLES, SERVICE LETTER						DEFERRED - NO PROACTIVE REPLACEMENT NECESSARY
20-NOV-2017		MOS HRS/MSC - (s) ENC					
	<b>Note:</b>						
SL SL44-72-325 R04	NO. 1 ENGINE - 1ST LP TURBINE DISK - INSPECTION, SERVICE LETTER					SUPERSEDED	- SUPERSEDED BY SL44-72-325 R07
06-OCT-2016		MOS HRS/MSC CSI ENC		0			
	<b>Note:</b>						
SL SL44-72-325 R07	NO. 1 ENGINE - 1ST LP TURBINE DISK - INSPECTION, SERVICE LETTER						- RECOMMENDED AT NEXT CSI
16-NOV-2022		MOS HRS/MSC CSI ENC			5000 M		
	<b>Note:</b>						
SL SL44-72-327	NO. 1 ENGINE - SL44-72-327, SERVICE LETTER						COMPLIED WITH
		MOS HRS/MSC - ENC		02-AUG-2022 2048 1669			
	<b>Note:</b>						
SL WISL-05-1045-CN	NO. 1 ENGINE - CANCELED-TIME LIMITS/MAINTENANCE CHECKS - SCHEDULED MAINTENANCE CHECKS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						- CANCELLED
13-OCT-2022		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SL WISL-05-1095-CN	NO. 1 ENGINE - CANCELED - TIME LIMITS/MAINTENANCE CHECKS - AIRWORTHINESS LIMITATIONS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						- CANCELLED
13-OCT-2022		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SL WISL-05-1149	NO. 1 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - SCHEDULED MAINTENANCE CHECKS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					INFORMATIONAL	COMPLIED WITH - INFORMATIONAL - NO FURTHER ACTION REQUIRED
14-APR-2023		MOS HRS/MSC - ENC		19-APR-2023			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL WISL-05-1155	NO. 1 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - TIME EXTENSION OF MAJOR PERIODIC INSPECTION, SERVICE LETTER						NOT APPLICABLE - AS PER ENGINE SERIAL NUMBER
08-JUN-2023		MOS HRS/MSC - ENC		23-JUN-2023			
<b>Note:</b>							
SL WISL-71-1319-CN	NO. 1 ENGINE - CANCELED - POWER PLANT - ENGINE SHIPPING - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					CANCELLED	- CANCELLED
13-OCT-2022		MOS HRS/MSC - ENC					
<b>Note:</b>							
SL WISL-71-1541	NO. 1 ENGINE - POWER PLANT - IDLE SPEED AND LEAK CHECK RUN - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					INFORMATIONAL	COMPLIED WITH - INFORMATIONAL ONLY - NO FURTHER ACTION REQUIRED
13-APR-2023		MOS HRS/MSC - ENC		19-APR-2023			
<b>Note:</b>							
SL WISL-72-1308	NO. 1 ENGINE - INSPECTION, EVALUATION, AND RETURN TO SERVICE, SERVICE LETTER						NOT APPLICABLE - AS PER ENGINE SERIALNUMBER
26-MAY-2023		MOS HRS/MSC - ENC		30-MAY-2023			
<b>Note:</b>							
SL WISL-73-1018	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - REVISION TO ILLUSTRATED PARTS CATALOG, SERVICE LETTER						NOT APPLICABLE - Engine S/N not applicable, No further action required
04-JUN-2019		MOS HRS/MSC - ENC AFL					
<b>Note:</b>							
SL WISL-73-1018-CN	NO. 1 ENGINE - CANCELED - ENGINE FUEL AND CONTROL - REVISION TO ILLUSTRATED PARTS CATALOG, SERVICE LETTER					CANCELLED	NOT APPLICABLE - Cancelled
16-OCT-2019		MOS HRS/MSC - ENC AFL					
<b>Note:</b>							
SL WISL-73-1045	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FADEC HARNESS CHAFING - ACCEPTABLE FOR CONTINUED USE, SERVICE LETTER						NOT APPLICABLE - AS PER ENGINE S/N
07-MAY-2021		MOS HRS/MSC - ENC		05-DEC-2022			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
<b>ENGINE NO. 2 - SB - 141454/67000-200</b>							
PSID	WIPSID-05-1000 R04	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, PRODUCT SUPPORT INFORMATIONAL DOCUMENT				SUPERSEDED	- INFORMATION ONLY
26-SEP-2022		MOS HRS/MSC - ENC		11-JUL-2023			
<b>Note:</b>							
PSID	WIPSID-05-1000 R05	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, PRODUCT SUPPORT INFORMATIONAL DOCUMENT				INFORMATIONAL	- INFORMATIONAL ONLY - NO MAINTENANCE ACTION REQUIRED
10-JUL-2023		MOS HRS/MSC - ENC		08-AUG-2023			
<b>Note:</b>							
PSID	WIPSID-05-1000 R06	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, PRODUCT SUPPORT INFORMATIONAL DOCUMENT				INFORMATIONAL	- Informational Only -
08-NOV-2023		MOS HRS/MSC - ENC AFL		(EFF)			
<b>Note:</b>							
PSID	WIPSID-05-1003	NO. 2 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - FORMS, PRODUCT SUPPORT INFORMATIONAL DOCUMENT					- INFORMATIONAL ONLY - BLANKO FORMSHEETS - NO FURTHER ACTION REQUIRED
05-MAY-2023		MOS HRS/MSC - ENC		16-MAY-2023			
<b>Note:</b>							
PSID	WIPSID-05-1003 R01	NO. 2 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - FORMS, PRODUCT SUPPORT INFORMATIONAL DOCUMENT					- Informational Only -
19-OCT-2023		MOS HRS/MSC - ENC AFL		(EFF)			
<b>Note:</b>							
PSID	WIPSID-72-1010 R04	NO. 2 ENGINE - ENGINE - HP TURBINE DISK - INSPECT, PRODUCT SUPPORT INFORMATIONAL DOCUMENT					DEFERRED - NO PROACTIVE PERFORMANCE
31-MAR-2021		MOS HRS/MSC - (s) ENC					
<b>Note:</b>							
PSID	WIPSID-72-1022 R01	NO. 2 ENGINE - OPERATING IN AREAS OF SMOKE, PRODUCT SUPPORT INFORMATIONAL DOCUMENT					COMPLIED WITH - FORWARDED INFORMATION TO FLIGHT OPS SAFETY - NO FURTHER ACTION REQUIRED CURRENTLY
09-JUN-2023		MOS HRS/MSC - ENC		23-JUN-2023			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-05-002	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION (SUPERSEDED BY FJ44-05-002 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-05-002 R01
02-OCT-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-05-002 R01	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION (SUPERSEDED BY FJ44-05-002 R02), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-05-002 R02
22-MAY-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-05-002 R02	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-05-002 R03
17-AUG-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-05-002 R04	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY WIPSID-05-1000
01-OCT-2019		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-05-002 R05-CN	NO. 2 ENGINE - SUPERSEDED - UNSERVICEABLE PARTS - NOTIFICATION (THIS SERVICE DOCUMENT HAS BEEN SUPERSEDED BY WIPSID-05-1000), SERVICE BULLETIN					CANCELLED	- CANCELLED
07-APR-2020		MOS HRS/MSC - (s) ENC					
	<b>Note:</b>						
SB FJ44-72-066 R02	NO. 2 ENGINE - ENGINE - HOUSING, CARBON RING SEAL AND BEARING (NO. 3 BEARING RETAINER) - REPLACE (SUPERSEDED BY FJ44-72-066 R03), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-066 R03
16-DEC-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-066 R03	NO. 2 ENGINE - ENGINE - CARBON RING SEAL AND BEARING HOUSING - REPLACE (SUPERSEDED BY FJ44-72-066 R04), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-066 R04
03-JUN-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-066 R06	NO. 2 ENGINE - CARBON RING SEAL AND BEARING HOUSING - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
09-DEC-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-068 R03	NO. 2 ENGINE - ENGINE - UPGRADE GEARBOX (4K MAGSEAL) TO SPRING LOADED CONFIGURATION (SUPERSEDED BY FJ44-72-068 R04), SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
05-OCT-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-070 R02	NO. 2 ENGINE - CANCELLED - UPGRADE GEARBOX (4K SPRING-LOADED) TO IMPROVED CONFIGURATION (SUPERSEDED BY SB FJ44-72-105 R05), SERVICE BULLETIN					CANCELLED	- CANCELLED
18-DEC-2009		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-075 R01	NO. 2 ENGINE - GEARBOX P/N 78823 - INSPECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY ENGINE S/N. NO FURTHER ACTIONS REQUIRED.
17-AUG-2009		MOS HRS/MSC A/R ENC					
	<b>Note:</b>						
SB FJ44-72-078 R01	NO. 2 ENGINE - ENGINE - IP COMPRESSOR STATOR (STAGE 1-2) - REWORK (SUPERSEDED BY FJ44-72-078 R02), SERVICE BULLETIN					OPTIONAL	- SUPERSEDED BY FJ44-72-078 R02
15-APR-2013		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-078 R02	NO. 2 ENGINE - IP COMPRESSOR STATOR (STAGE 1-2) - REWORK (SUPERSEDED BY FJ44-72-078 R03), SERVICE BULLETIN					OPTIONAL	- SUPERSEDED BY FJ44-72-078 R03
12-FEB-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-078 R03	NO. 2 ENGINE - IP COMPRESSOR STATOR (STAGE 1-2) - REWORK, SERVICE BULLETIN					OPTIONAL	COMPLIED WITH
26-FEB-2016		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-080 R01	NO. 2 ENGINE - ENGINE - 2ND REDUCTION BEVEL GEAR BALL BEARING (GEARBOX ASSEMBLY) - REPLACE, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R02
16-APR-2013		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-080 R02	NO. 2 ENGINE - 2ND REDUCTION BEVEL GEAR BALL BEARING (GEARBOX ASSEMBLY) - REPLACE, SERVICE BULLETIN			RECOMMENDED	NOT APPLICABLE - AS PER ENGINE S/N		
10-DEC-2020	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-085 R05	NO. 2 ENGINE - ENGINE - IP BLEED VALVE - REPLACE (SUPERSEDED BY FJ44-72-085 R06), SERVICE BULLETIN			SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R06		
20-MAY-2011	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-085 R06	NO. 2 ENGINE - IP BLEED VALVE - REPLACE, SERVICE BULLETIN			SUPERSEDED	NOT APPLICABLE - SB REV.6 CHECKED, S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R07		
01-OCT-2014	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-085 R07	NO. 2 ENGINE - IP BLEED VALVE - REPLACE, SERVICE BULLETIN			SUPERSEDED	NOT APPLICABLE - AS PER ENGINE S/N		
22-APR-2021	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-085 R08	NO. 2 ENGINE - IP BLEED VALVE - REPLACE, SERVICE BULLETIN			RECOMMENDED	NOT APPLICABLE - AS PER ENGINE SERIALNUMBER		
13-JUL-2023	MOS HRS/MSC - ENC			18-JUL-2023			
<b>Note:</b>							
SB FJ44-72-086 R02	NO. 2 ENGINE - ENGINE - BLEED VALVE SHAFT - REPLACE (SUPERSEDED BY FJ44-72-086 R03), SERVICE BULLETIN			RECOMMENDED	- SUPERSEDED BY FJ44-72-086 R03		
16-JUL-2010	MOS HRS/MSC - ENC						
<b>Note:</b>							
SB FJ44-72-086 R03	NO. 2 ENGINE - ENGINE - BLEED VALVE SHAFT - REPLACE, SERVICE BULLETIN			RECOMMENDED			
05-OCT-2010	MOS HRS/MSC 4000/CSI ENC		0	4000			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-089	NO. 2 ENGINE - ENGINE – TYPE CERTIFICATION CONFIGURATION, SERVICE BULLETIN					INFORMATIONAL	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
17-NOV-2009		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-72-093	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R01), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W FJ44-72-093
07-MAY-2010		MOS HRS/MSC - ENC		18-MAR-2011 477 405			
	<b>Note:</b>						
SB FJ44-72-093 R02	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R03), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
25-AUG-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R03	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R04), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
17-NOV-2010		MOS HRS/MSC - ENC		23-MAR-2011 477 405			
	<b>Note:</b>						
SB FJ44-72-093 R05	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R06), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
08-MAR-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R06	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R07), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
25-MAY-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R07	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R08), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
28-JUN-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-093 R08	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R09), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
07-OCT-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R09	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY (SUPERSEDED BY FJ44-72-093 R10), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
29-NOV-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R10	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R11), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
13-APR-2012		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R11	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R12), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0. NO FURTHER ACTIONS REQUIRED.
01-AUG-2012		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R12	NO. 2 ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0 NO FURTHER ACTIONS REQUIRED.
01-APR-2014		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-093 R13	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - C/W. SEE SB FJ44-72-093 REV.0 NO FURTHER ACTIONS REQUIRED.
28-JUN-2021		MOS HRS/MSC MPI ENC					
	<b>Note:</b>						
SB FJ44-72-095	NO. 2 ENGINE - ENGINE - HP TURBINE BLADE - ACCEPTABLE FOR CONTINUED USE, SERVICE BULLETIN						NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
08-SEP-2011		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-097	NO. 2 ENGINE - ENGINE - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-097 R01), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - REV. 4 OF THIS SB CANCELS SB FJ44-72-097 AND SUPERSEDES THIS SB WITH SB FJ44-72-151. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB FJ44-72-097 R01	NO. 2 ENGINE - ENGINE - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-097 R02), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - REV. 4 OF THIS SB CANCELS SB FJ44-72-097 AND SUPERSEDES THIS SB WITH SB FJ44-72-151. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB FJ44-72-097 R02	NO. 2 ENGINE - ENGINE - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-097 R03), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - REV. 4 OF THIS SB CANCELS SB FJ44-72-097 AND SUPERSEDES THIS SB WITH SB FJ44-72-151. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB FJ44-72-097 R03	NO. 2 ENGINE - ENGINE - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-097 R04), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - REV. 4 OF THIS SB CANCELS SB FJ44-72-097 AND SUPERSEDES THIS SB WITH SB FJ44-72-151. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB FJ44-72-097 R04	NO. 2 ENGINE - CANCELLED - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-151 R06), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - REV. 4 OF THIS SB CANCELS SB FJ44-72-097 AND SUPERSEDES THIS SB WITH SB FJ44-72-151. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB FJ44-72-105 R03	NO. 2 ENGINE - UPGRADE GEARBOX (4K SPRING LOADED) TO IMPROVED CONFIGURATION (SUPERSEDED BY FJ44-72-105 R04), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R04
		MOS					
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
22-JAN-2016				05-DEC-2022			

**Note:**

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-105 R05	NO. 2 ENGINE - UPGRADE GEARBOX (4K SPRING LOADED) TO IMPROVED CONFIGURATION, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - AS PER ENGINE S/N
15-APR-2021	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-105 R06	NO. 2 ENGINE - UPGRADE GEARBOX (4K SPRING LOADED) TO IMPROVED CONFIGURATION, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - AS PER ENGINE S/N
02-MAY-2023	MOS HRS/MSC - ENC			16-MAY-2023			
<b>Note:</b>							
SB FJ44-72-106 R01	NO. 2 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
24-MAR-2015	MOS HRS/MSC - ENC			09-FEB-2018			
<b>Note:</b>							
SB FJ44-72-106 R02	NO. 2 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - AS PER ENGINE S/N
29-JUN-2021	MOS HRS/MSC - ENC			05-DEC-2022			
<b>Note:</b>							
SB FJ44-72-106 R03	NO. 2 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - AS PER ENGINE S/N
19-JAN-2023	MOS HRS/MSC - ENC			21-MAR-2023			
<b>Note:</b>							
SB FJ44-72-107	NO. 2 ENGINE - ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE (SUPERSEDED BY FJ44-72-107 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-107 R01
20-MAR-2013	MOS HRS/MSC - ENC						
<b>Note:</b>							
SB FJ44-72-107 R02	NO. 2 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-107 R03
24-MAR-2015	MOS HRS/MSC - ENC						
<b>Note:</b>							
SB FJ44-72-107 R03	NO. 2 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SUPERSEDED WITH REV.04
11-OCT-2019	MOS HRS/MSC CSI ENC			24-AUG-2022 2048 1669			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-107 R05	NO. 2 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - PREVIOUS REVISION
28-JUN-2021		MOS HRS/MSC - ENC		05-DEC-2022			
	<b>Note:</b>						
SB FJ44-72-108	NO. 2 ENGINE - ACCESSORY DRIVE SHAFT - REPLACE (SUPERSEDED BY FJ44-72-108 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-108 R01
17-APR-2013		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-108 R01	NO. 2 ENGINE - ACCESSORY DRIVE SHAFT - REPLACE (SUPERSEDED BY SB WISB-72-1037 R01), SERVICE BULLETIN					CANCELLED	- SB CANCELLED.
17-JUN-2014		MOS HRS/MSC - ENC		0			
	<b>Note:</b>						
SB FJ44-72-108 R01-CN	NO. 2 ENGINE - SUPERSEDED - ACCESSORY DRIVE SHAFT - REPLACE (THIS SERVICE DOCUMENT IS NO LONGER AVAILABLE), SERVICE BULLETIN					CANCELLED	- CANCELLED
18-JUN-2020		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-109	NO. 2 ENGINE - ENGINE - 1ST REDUCTION BEVEL GEAR BALL BEARING - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
17-APR-2013		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-110	NO. 2 ENGINE - ENGINE - DAMPENER BRACKET ASSEMBLY - REPLACE, SERVICE BULLETIN					MANDATORY	COMPLIED WITH
17-APR-2013		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-111 R02	NO. 2 ENGINE - ENGINE - 1ST LP TURBINE NOZZLE - INSPECTION, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
10-SEP-2013		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-72-122	NO. 2 ENGINE - ACCESSORY DRIVE SHAFT - REPLACE, SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
06-AUG-2014		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-122-CN	NO. 2 ENGINE - SUPERSEDED - ENGINE - ACCESSORY DRIVE SHAFT - REPLACE, SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - CANCELLED
06-DEC-2019		MOS HRS/MSC - ENC AFL					
	<b>Note:</b>						
SB FJ44-72-124	NO. 2 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-124 R01
09-DEC-2014		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-124 R01	NO. 2 ENGINE - REPLACE HP TURBINE BLADES, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-124 R02
27-JAN-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-124 R02	NO. 2 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-124 R03
20-NOV-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-124 R03	NO. 2 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-124 R04
06-FEB-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-124 R04	NO. 2 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-124 R05
04-MAY-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-124 R05	NO. 2 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SUPERSEDED BY R09
29-OCT-2019		MOS HRS/MSC MPI ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-124 R09	NO. 2 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - PREVIOUS REVISION.
30-SEP-2022		MOS HRS/MSC MPI ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-129	NO. 2 ENGINE - REPLACE INNER GUIDED ROLLER BEARING (NO. 3 BEARING), SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SB CANCELLED
06-FEB-2015		MOS HRS/MSC - ENC		09-FEB-2018			
<b>Note:</b>							
SB FJ44-72-129 R01	NO. 2 ENGINE - INNER GUIDED ROLLER BEARING (NO. 3 BEARING) - REPLACE, SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - N/A BY ESN. NO FURTHER ACTION REQUIRED. SB CANCELLED
		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-72-129 R01-CN	NO. 2 ENGINE - CANCELED - ENGINE - INNER GUIDED ROLLER BEARING (NO. 3 BEARING) - REPLACE, SERVICE BULLETIN					CANCELLED	- CANCELLED
08-OCT-2021		MOS HRS/MSC - (s) ENC					
<b>Note:</b>							
SB FJ44-72-130	NO. 2 ENGINE - HP COMPRESSOR ROTOR - INSPECTION (SUPERSEDED BY FJ44-72-130 R01), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-130 R01
05-MAR-2015		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-72-130 R01	NO. 2 ENGINE - HP COMPRESSOR ROTOR - INSPECTION (SUPERSEDED BY FJ44-72-130 R02), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-130 R02
08-MAY-2017		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-72-130 R02	NO. 2 ENGINE - HP COMPRESSOR ROTOR - INSPECTION, SERVICE BULLETIN					RECOMMENDED	
06-FEB-2018		MOS HRS/MSC 4000/CSI ENC	0		4000		
<b>Note:</b>							
SB FJ44-72-133	NO. 2 ENGINE - REPLACE 1ST LP TURBINE NOZZLE (SUPERSEDED BY FJ44-72-133 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-133 R01
27-JAN-2016		MOS HRS/MSC - ENC		24-AUG-2022			
<b>Note:</b>							
SB FJ44-72-133 R01	NO. 2 ENGINE - REPLACE 1ST LP TURBINE NOZZLE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
05-FEB-2016		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-133 R02	NO. 2 ENGINE - REPLACE 1ST LP TURBINE NOZZLE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - R01 - NO ADDITIONAL WORK REQUIRED WITH R02
18-MAY-2023	MOS HRS/MSC - ENC			24-AUG-2022			
	<b>Note:</b>						
SB FJ44-72-135 R01	NO. 2 ENGINE - IDENTIFICATION PLATE - REPLACE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
02-JUL-2015	MOS HRS/MSC - ENC			09-FEB-2018			
	<b>Note:</b>						
SB FJ44-72-140	NO. 2 ENGINE - GEARBOX HOUSING ASSEMBLY - INSPECTION, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
22-OCT-2015	MOS HRS/MSC - ENC			24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-140 R01	NO. 2 ENGINE - GEARBOX HOUSING ASSEMBLY - INSPECTION, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - WITH R01
23-AUG-2021	MOS HRS/MSC - ENC						
	<b>Note:</b>						
SB FJ44-72-142	NO. 2 ENGINE - NO. 1 CARBON SEAL ASSEMBLY & SEAL RUNNER - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
08-JUN-2016	MOS HRS/MSC - ENC			09-FEB-2018			
	<b>Note:</b>						
SB FJ44-72-142 R01	NO. 2 ENGINE - NO. 1 CARBON SEAL ASSEMBLY & SEAL RUNNER - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - SB REV.01 CHECKED, ENGINE S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
23-JAN-2019	MOS HRS/MSC DUE ENC AFL						
	<b>Note:</b>						
SB FJ44-72-143	NO. 2 ENGINE - BLEED VALVE SHAFT - REPLACE (SUPERSEDED BY FJ44-72-143 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY REV.1
06-MAY-2016	MOS HRS/MSC - ENC						
	<b>Note:</b>						
SB FJ44-72-143 R01	NO. 2 ENGINE - BLEED VALVE SHAFT - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SUPERSEDED BY R02
15-SEP-2016	MOS HRS/MSC - ENC			24-AUG-2022 2048 1669			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-143 R02	NO. 2 ENGINE - BLEED VALVE SHAFT - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - PREVIOUS REVISION
24-SEP-2021		MOS HRS/MSC - ENC		05-DEC-2022			
	<b>Note:</b>						
SB FJ44-72-150	NO. 2 ENGINE - LP REAR BEARING SEAL RETAINER - REPLACE (SUPERSEDED BY FJ44-72-150 R01), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-150 R01
29-AUG-2016		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-150 R01	NO. 2 ENGINE - LP REAR BEARING SEAL RETAINER - REPLACE (SUPERSEDED BY FJ44-72-150 R02), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-150 R02
29-SEP-2016		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-150 R02	NO. 2 ENGINE - LP REAR BEARING SEAL RETAINER - REPLACE, SERVICE BULLETIN						- SUPERSEDED BY FJ44-72-150 R03
29-OCT-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-150 R03	NO. 2 ENGINE - LP REAR BEARING SEAL RETAINER - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
27-JUN-2019		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-151	NO. 2 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL (SUPERSEDED BY FJ44-72-151 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-151 R01
06-OCT-2016		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-151 R01	NO. 2 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL (SUPERSEDED BY FJ44-72-151 R02), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-151 R02
25-JAN-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-72-151 R02	NO. 2 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL (SUPERSEDED BY FJ44-72-151 R03), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-151 R03
10-FEB-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-151 R03	NO. 2 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-72-151 R04
07-APR-2017	MOS HRS/MSC - ENC						
	<b>Note:</b>						
SB FJ44-72-151 R04	NO. 2 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
12-NOV-2019	MOS HRS/MSC - ENC			24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-151 R05	NO. 2 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
11-MAR-2020	MOS HRS/MSC - ENC			24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-151 R06	NO. 2 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					MANDATORY	COMPLIED WITH
29-JUN-2021	MOS HRS/MSC - ENC			24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB FJ44-72-152 R01	NO. 2 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SB SUPERSEDED
08-MAY-2017	MOS HRS/MSC - ENC			09-FEB-2018			
	<b>Note:</b>						
SB FJ44-72-152 R02	NO. 2 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - By Serial: NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
11-MAR-2020	MOS HRS/MSC - ENC AFL						
	<b>Note:</b>						
SB FJ44-72-154	NO. 2 ENGINE - 1ST LP TURBINE NOZZLE - INSPECTION (SUPERSEDED BY FJ44-72-154 R01), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-72-154 R01
15-FEB-2017	MOS HRS/MSC - ENC						
	<b>Note:</b>						
SB FJ44-72-154 R01	NO. 2 ENGINE - 1ST LP TURBINE NOZZLE - INSPECTION (CANCELLED), SERVICE BULLETIN					RECOMMENDED	- CANCELLED
08-MAR-2017	MOS HRS/MSC - ENC						
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-030 R08	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06 (SUPERSEDED BY FJ44-73-030 R09), SERVICE BULLETIN					CANCELLED	COMPLIED WITH - C/W. SEE FJ44-73-030 R10. NO FURTHER ACTIONS REQUIRED.
12-AUG-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-030 R09	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06 (SUPERSEDED BY FJ44-73-030 R10), SERVICE BULLETIN					CANCELLED	COMPLIED WITH - C/W. SEE FJ44-73-030 R10. NO FURTHER ACTIONS REQUIRED.
19-JUL-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-030 R10	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06 (SUPERSEDED BY FJ44-73-030 R11), SERVICE BULLETIN					CANCELLED	COMPLIED WITH - C/W. SEE FJ44-73-030 R10. NO FURTHER ACTIONS REQUIRED.
26-JUL-2011		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-030 R11	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06 (SUPERSEDED BY FJ44-73-030 R12), SERVICE BULLETIN					CANCELLED	COMPLIED WITH - C/W. SEE FJ44-73-030 R10. NO FURTHER ACTIONS REQUIRED.
11-NOV-2011		MOS HRS/MSC A/R ENC					
	<b>Note:</b>						
SB FJ44-73-030 R12	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06 (SUPERSEDED BY FJ44-73-030 R13), SERVICE BULLETIN					CANCELLED	COMPLIED WITH
29-NOV-2011		MOS HRS/MSC - ENC		26-MAR-2012 601 521			
	<b>Note:</b>						
SB FJ44-73-030 R13	NO. 2 ENGINE - CANCELLED - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06, SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - CANCELLED SEE FJ44-73-030 R10. NO FURTHER ACTIONS REQUIRED.
12-JUL-2012		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-73-038	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R01), SUPERSEDED SERVICE BULLETIN						COMPLIED WITH - NEW FADEC P/N 117790.
25-JAN-2010		MOS HRS/MSC A/R ENC		02-JUL-2014 846 740			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-038 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R02), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.01 CHECKED, PERFORMED WITH FJ44-73-038, P/N 117790 INSTALLED, NO FURTHER ACTION REQUIRED
31-MAR-2011		MOS HRS/MSC ENC	A/R				
<b>Note:</b>							
SB FJ44-73-038 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R03), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.02 CHECKED, PERFORMED WITH FJ44-73-038, P/N 117790 INSTALLED, NO FURTHER ACTION REQUIRED
18-APR-2011		MOS HRS/MSC ENC	A/R				
<b>Note:</b>							
SB FJ44-73-038 R03	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R04), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.03 CHECKED, PERFORMED WITH FJ44-73-038, P/N 117790 INSTALLED, NO FURTHER ACTION REQUIRED
		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-73-038 R04	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R05), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.04 CHECKED, PERFORMED WITH FJ44-73-038, P/N 117790 INSTALLED, NO FURTHER ACTION REQUIRED
		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-73-038 R05	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R06), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.05 CHECKED, PERFORMED WITH FJ44-73-038, P/N 117790 INSTALLED, NO FURTHER ACTION REQUIRED
14-AUG-2012		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-73-038 R06	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R07), SUPERSEDED SERVICE BULLETIN						NOT APPLICABLE - SB REV.06 CHECKED, PERFORMED WITH FJ44-73-038, P/N 117790 INSTALLED, NO FURTHER ACTION REQUIRED
14-NOV-2013		MOS HRS/MSC ENC	-				
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-038 R07	NO. 2 ENGINE - DUAL CHANNEL FADEC - REPLACE, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - C/W. FOUND N/A BY INSTALLED FADEC P/N 117790. NO FURTHER ACTIONS REQUIRED.
22-OCT-2014		MOS HRS/MSC ENC		21-AUG-2015 953 827			
<b>Note:</b>							
SB FJ44-73-039 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-039 R02), SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY ENGINE S/N. NO FURTHER ACTIONS REQUIRED.
31-MAR-2011		MOS HRS/MSC ENC		A/R			
<b>Note:</b>							
SB FJ44-73-039 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-039 R03), SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY ENGINE S/N. NO FURTHER ACTIONS REQUIRED.
18-APR-2011		MOS HRS/MSC ENC		A/R			
<b>Note:</b>							
SB FJ44-73-042	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET - REPLACE (SUPERSEDED BY FJ44-73-042 R01), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-73-042 R01
04-NOV-2010		MOS HRS/MSC ENC					
<b>Note:</b>							
SB FJ44-73-042 R01	NO. 2 ENGINE - REPLACE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET (SUPERSEDED BY FJ44-73-042 R02), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-73-042 R02
23-MAR-2011		MOS HRS/MSC ENC					
<b>Note:</b>							
SB FJ44-73-042 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET - REPLACE (SUPERSEDED BY FJ44-73-042 R03), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-73-042 R03
24-AUG-2011		MOS HRS/MSC ENC					
<b>Note:</b>							
SB FJ44-73-042 R03	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET - REPLACE (SUPERSEDED BY FJ44-73-042 R04), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-73-042 R04
29-NOV-2011		MOS HRS/MSC ENC					
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-042 R04	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET - REPLACE (SUPERSEDED BY FJ44-73-042 R05), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-73-042 R05
03-FEB-2012		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-73-042 R05	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET - REPLACE, SERVICE BULLETIN				24-AUG-2022	RECOMMENDED	COMPLIED WITH
04-SEP-2013		MOS HRS/MSC - ENC		2048			
				1669			
<b>Note:</b>							
SB FJ44-73-043 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FADEC REPLACEMENT AND APPLICATION SOFTWARE UPLOAD, SERVICE BULLETIN					RECOMMENDED	- AS REQUIRED
12-JUL-2012		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-73-044	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-73-044 R01
07-MAY-2012		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-73-044 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R02), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-73-044 R02
11-JUN-2012		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-73-044 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R03), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-73-044 R03
14-AUG-2012		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-73-044 R03	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R04), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - NEW FDU INSTALLED P/N 119149 S/N CL7APU0823 WITH TSN:2987.1 AND CSN:2181
11-FEB-2013		MOS HRS/MSC - ENC		24-JUN-2014 843 733			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-044 R04	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R05), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SB REV.4 CHECKED, PERFORMED WITH SB FJ44-73-044R3, NO FURTHER ACTION REQUIRED
11-SEP-2014		MOS HRS/MSC ENC	-				
	<b>Note:</b>						
SB FJ44-73-044 R05	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R06), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SB REV. 5 CHECKED, PERFORMED WITH SB FJ44-73-044R3, NO FURTHER ACTION REQUIRED
14-JUN-2016		MOS HRS/MSC ENC	-				
	<b>Note:</b>						
SB FJ44-73-044 R06	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R07), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SB REV. 6 CHECKED, PERFORMED WITH SB FJ44-73-044R3, NO FURTHER ACTION REQUIRED
16-MAR-2017		MOS HRS/MSC ENC	-				
	<b>Note:</b>						
SB FJ44-73-044 R07	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SB REV.7 CHECKED, PERFORMED WITH SB FJ44-73-044R3, NO FURTHER ACTION REQUIRED
24-AUG-2017		MOS HRS/MSC ENC	-	(EFF)			
	<b>Note:</b>						
SB FJ44-73-044 R08	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - PERFORMED WITH FJ44-73-044 R03, NO FURTHER ACTION REQUIRED
31-OCT-2019		MOS HRS/MSC ENC	-				
	<b>Note:</b>						
SB FJ44-73-044 R09	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - PREVIOUSLY COMPLIED WITH: NO ADDITIONAL WORK WITH THIS REVISION
15-SEP-2023		MOS HRS/MSC ENC	-	19-SEP-2023			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-046 R04	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
24-AUG-2017		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-73-046 R05	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A by Part SN. No further action required.
		MOS HRS/MSC - ENC AFL					
	<b>Note:</b>						
SB FJ44-73-049	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL FILTER & FILTER BOWL - INSPECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
24-APR-2013		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-73-061	NO. 2 ENGINE - CANCELLED - FUEL DELIVERY UNIT (FDU) - TIME EXTENSION OF TIME BETWEEN OVERHAUL (TBO), SERVICE BULLETIN					RECOMMENDED	- CANCELLED
09-JAN-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-009 R01	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY SB FJ44-77-011 R18), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY SB FJ44-77-011 R18
		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-011 R02	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R03), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-77-011 R03
24-SEP-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-011 R03	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R04), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-77-011 R04
27-OCT-2010		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-77-011 R04	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R05), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-77-011 R05
16-NOV-2010		MOS HRS/MSC ENC	A/R				
<b>Note:</b>							
SB FJ44-77-011 R05	NO. 2 ENGINE - ENGINE INDICATING & FADEC ENGINE HARNESS ASSEMBLY & INSPECTION (SUPERSEDED BY FJ44-77-011 R06), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
16-NOV-2010		MOS HRS/MSC ENC	-	11-FEB-2011 459 394			
<b>Note:</b>							
SB FJ44-77-011 R06	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R07), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.06 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
14-JAN-2011		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-77-011 R07	NO. 2 ENGINE - ENGINE INDICATING & FADEC ENGINE HARNESS ASSEMBLY & INSPECTION (SUPERSEDED BY FJ44-77-011 R08), SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SB REV.07 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
14-OCT-2011		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-77-011 R08	NO. 2 ENGINE - ENGINE INDICATING & FADEC ENGINE HARNESS ASSEMBLY & INSPECTION (SUPERSEDED BY FJ44-77-011 R09), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.08 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
17-NOV-2011		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-77-011 R09	NO. 2 ENGINE - ENGINE INDICATING & FADEC ENGINE HARNESS ASSEMBLY & INSPECTION (SUPERSEDED BY FJ44-77-011 R10), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.09 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
29-NOV-2011		MOS HRS/MSC ENC	-				
<b>Note:</b>							
SB FJ44-77-011 R10	NO. 2 ENGINE - ENGINE INDICATING & FADEC ENGINE HARNESS ASSEMBLY & INSPECTION (SUPERSEDED BY FJ44-77-011 R11), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.10 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
09-FEB-2012		MOS HRS/MSC ENC	-				
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-77-011 R11	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R12), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.11 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED.
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB FJ44-77-011 R12	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R13), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.12 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB FJ44-77-011 R13	NO. 2 ENGINE - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R14), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.13 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB FJ44-77-011 R14	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R15), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.14 CHECKED, PERFORMED WITH FJ44-77-011 REV.5. NO FURTHER ACTIONS REQUIRED
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB FJ44-77-011 R15	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R16), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.15 CHECKED, PERFORMED WITH SB FJ44-77-011 REV. 5, NO FURTHER ACTION REQUIRED
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB FJ44-77-011 R16	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R17), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.16 CHECKED, PERFORMED WITH SB FJ44-77-011 REV. 5, NO FURTHER ACTION REQUIRED
		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-77-011 R17	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R18), SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - SB REV.17 CHECKED, PERFORMED WITH SB FJ44-77-011 REV. 5, NO FURTHER ACTION REQUIRED
09-MAY-2016		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-011 R18	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - PREVIOUSLY COMPLIED WITH:
14-NOV-2018		MOS HRS/MSC - ENC		25-MAR-2019 1251:36 1091			
	<b>Note:</b>						
SB FJ44-77-013	NO. 2 ENGINE - FADEC ENGINE HARNESS ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-77-013 R01), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R01
20-JAN-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-013 R01	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R02), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R02
18-MAR-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-013 R02	NO. 2 ENGINE - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R03), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R03
16-JUN-2015		MOS HRS/MSC - ENC		(EFF)			
	<b>Note:</b>						
SB FJ44-77-013 R04	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R05), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R05
01-SEP-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-77-013 R05	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R06), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R06
22-OCT-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-77-013 R06	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R07), SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R07
02-FEB-2016		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-77-013 R07	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK, SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY FJ44-77-013 R08
09-MAY-2016		MOS HRS/MSC DUE ENC		(EFF)			
<b>Note:</b>							
SB FJ44-77-013 R09	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
17-JAN-2019		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
<b>Note:</b>							
SB FJ44-79-009 R02	NO. 2 ENGINE - ADJUST-LUBRICATION-OIL PRESSURE VALVE (SUPERSEDED BY FJ44-79-009 R03), SERVICE BULLETIN				SUPERSEDED		- SUPERSEDED BY FJ44-79-009 R03
26-JUL-2011		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-79-009 R05	NO. 2 ENGINE - LUBRICATION - OIL PRESSURE RELIEF VALVE - ADJUST (SUPERSEDED BY FJ44-79-009 R06), SERVICE BULLETIN				SUPERSEDED		NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R06
30-APR-2013		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB FJ44-79-009 R08	NO. 2 ENGINE - LUBRICATION - OIL PRESSURE RELIEF VALVE - ADJUST, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED. SUPERSEDED BY R09
29-JUN-2016		MOS HRS/MSC - ENC		09-FEB-2018			
<b>Note:</b>							
SB FJ44-79-009 R09	NO. 2 ENGINE - LUBRICATION - OIL PRESSURE RELIEF VALVE - ADJUST, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - AS PER ENGINE S/N
20-MAY-2021		MOS HRS/MSC - ENC		05-DEC-2022			
<b>Note:</b>							
SB FJ44-79-011	NO. 2 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE (SUPERSEDED BY FJ44-79-011 R01), SERVICE BULLETIN				SUPERSEDED		- SUPERSEDED BY FJ44-79-011 REV.4.
17-JAN-2013		MOS HRS/MSC - ENC					
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-79-011 R01	NO. 2 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE (SUPERSEDED BY FJ44-79-011 R02), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-79-011 REV.4.
13-MAR-2013		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-011 R03	NO. 2 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE (SUPERSEDED BY FJ44-79-011 R04), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-79-011 REV.4.
23-JUL-2013		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-011 R04	NO. 2 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-79-011 R05
16-MAY-2014		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-011 R05	NO. 2 ENGINE - OIL - MAGNETIC SELF-CLOSING VALVE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY FJ44-79-011 R06
08-OCT-2019		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-011 R06	NO. 2 ENGINE - OIL - MAGNETIC SELF-CLOSING VALVE - REPLACE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - AS PER S/N
06-AUG-2021		MOS HRS/MSC - ENC		26-SEP-2022			
	<b>Note:</b>						
SB FJ44-79-012 R01	NO. 2 ENGINE - OIL - LUBE OIL COOLER - REWORK OR REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
12-APR-2017		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-79-013 R02	NO. 2 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R03), SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
25-AUG-2017		MOS HRS/MSC - ENC		22-FEB-2018 1161:54 1008			
	<b>Note:</b>						
SB FJ44-79-013 R03	NO. 2 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R04), SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - SB REV.3 CHECKED, PERFORMED WITH SB FJ44-79-013 REV. 2, NO FURTHER ACTION REQUIRED
26-MAR-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-79-013 R04	NO. 2 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R05), SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - SB REV.4 CHECKED, PERFORMED WITH SB FJ44-79-013 REV. 2, NO FURTHER ACTION REQUIRED
21-MAY-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-013 R05	NO. 2 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - SB REV.5 CHECKED, PERFORMED WITH SB FJ44-79-013 REV. 2, NO FURTHER ACTION REQUIRED
06-AUG-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-015	NO. 2 ENGINE - CANCELLED - OIL - LUBE AND SCAVENGE PUMP ASSEMBLY - TIME EXTENSION OF TIME BETWEEN OVERHAUL (TBO) FOR TOTAL ASSURANCE PROGRAM (TAP), SERVICE BULLETIN					RECOMMENDED	- AS REQUIRED
24-FEB-2015		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-016 R03	NO. 2 ENGINE - OIL - RELIEF VALVE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-016 R04), SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
28-APR-2017		MOS HRS/MSC - ENC		09-FEB-2018			
	<b>Note:</b>						
SB FJ44-79-016 R04	NO. 2 ENGINE - OIL - RELIEF VALVE ASSEMBLY - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - SB REV.4 CHECKED, S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
22-FEB-2018		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB FJ44-79-T017 R01	NO. 2 ENGINE - LUBRICATION - OIL PRESSURE RELIEF VALVE - ADJUST, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
04-NOV-2008		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB WISB-72-1004	NO. 2 ENGINE - 1ST LP TURBINE NOZZLE - REPLACE (SUPERSEDED BY WISB-72-1004 R01), SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY WISB-72-1004 R01
25-MAY-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-72-1004 R03	NO. 2 ENGINE - ENGINE - 1ST LP TURBINE NOZZLE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY WISB-72-1004 R04
21-JUL-2017		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SB WISB-72-1004 R04	NO. 2 ENGINE - 1ST LP TURBINE NOZZLE - REPLACE (SUPERSEDED BY SB WISB-72-1054), SERVICE BULLETIN					COMPLIED WITH	
06-FEB-2018		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB WISB-72-1004 R04-CN	NO. 2 ENGINE - 1ST LP TURBINE NOZZLE - REPLACE (SUPERSEDED BY SB WISB-72-1054), SERVICE BULLETIN					CANCELLED	- CANCELLED
01-JUN-2023		MOS HRS/MSC - ENC		22-JUN-2023			
	<b>Note:</b>						
SB WISB-72-1032 R02	NO. 2 ENGINE - HIGH PRESSURE TURBINE DISK - REPLACE, SERVICE BULLETIN					CANCELLED	NOT APPLICABLE - AS PER ENGINE S/N. SB CANCELLED.
04-JUN-2020		MOS HRS/MSC - ENC		05-DEC-2022			
	<b>Note:</b>						
SB WISB-72-1034	NO. 2 ENGINE - HP TURBINE - RE-IDENTIFY ASSEMBLY AND DISK, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
20-DEC-2019		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						
SB WISB-72-1034 R03	NO. 2 ENGINE - HP TURBINE - RE-IDENTIFY ASSEMBLY AND DISK, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - C/W R0
02-JUL-2021		MOS HRS/MSC MPI ENC		24-AUG-2022			
	<b>Note:</b>						
SB WISB-72-1034 R04	NO. 2 ENGINE - HP TURBINE - RE-IDENTIFY ASSEMBLY AND DISK, SERVICE BULLETIN					MANDATORY	COMPLIED WITH - REV.0 - NO ADDITIONAL WORK REQUIRED WITH REV.04
19-APR-2023		MOS HRS/MSC - ENC		24-AUG-2022			
					8000 M		
	<b>Note:</b>						
SB WISB-72-1037 R01	NO. 2 ENGINE - ACCESSORY DRIVE TOWERSHAFT - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - SUPERSEDED BY R02
18-JUN-2020		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-72-1037 R03	NO. 2 ENGINE - ACCESSORY DRIVE TOWERSHAFT - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - WITH PREVIOUS REVISION.
03-MAR-2022		MOS HRS/MSC - ENC		05-DEC-2022			SUPERSEDED BY R04
<b>Note:</b>							
SB WISB-72-1037 R04	NO. 2 ENGINE - ACCESSORY DRIVE TOWERSHAFT - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - PREVIOUS REVISION
03-JAN-2023		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB WISB-72-1041	NO. 2 ENGINE - HEAT EXCHANGER CLAMP ASSEMBLY - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH
19-JUN-2020		MOS HRS/MSC - ENC		24-AUG-2022 2048 1669			
<b>Note:</b>							
SB WISB-72-1041 R03	NO. 2 ENGINE - HEAT EXCHANGER CLAMP ASSEMBLY - REPLACE, SERVICE BULLETIN					SUPERSEDED	COMPLIED WITH - WITH PREVIOUS REVISION
16-DEC-2021		MOS HRS/MSC - ENC		05-DEC-2022			
<b>Note:</b>							
SB WISB-72-1041 R04	NO. 2 ENGINE - HEAT EXCHANGER CLAMP ASSEMBLY - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - PREVIOUS REVISION
18-JAN-2023		MOS HRS/MSC MPI ENC					
<b>Note:</b>							
SB WISB-72-1044	NO. 2 ENGINE - ENGINE - BALANCE PISTON - REPLACE, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - AS PER ENG S/N
15-MAR-2021		MOS HRS/MSC - ENC		24-AUG-2022			
<b>Note:</b>							
SB WISB-72-1044 R02	NO. 2 ENGINE - BALANCE PISTON - REPLACE, SERVICE BULLETIN					SUPERSEDED	NOT APPLICABLE - AS PER ENGINE S/N
26-JUL-2022		MOS HRS/MSC - ENC		05-DEC-2022			
<b>Note:</b>							
SB WISB-72-1044 R03	NO. 2 ENGINE - BALANCE PISTON - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - AS PER ENGINE S/N
12-JAN-2023		MOS HRS/MSC - ENC					
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-72-1050	NO. 2 ENGINE - HPT ASSEMBLY - REPLACE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE
		MOS		05-DEC-2022			
		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB WISB-73-1002	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE (SUPERSEDED BY WISB-73-1002 R01), SERVICE BULLETIN					CANCELLED	COMPLIED WITH
		MOS		22-FEB-2018			
20-DEC-2017		HRS/MSC	-	1161:54			
		ENC		1008			
	<b>Note:</b>						
SB WISB-73-1002 R02-CN	NO. 2 ENGINE - CANCELLED - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					CANCELLED	- CANCELLED
		MOS					
06-FEB-2018		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB WISB-73-1007 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - ENGINE MAINTENANCE TERMINAL (EMT) SOFTWARE UPGRADE TO CP356.10.02 (CANCELLED), SERVICE BULLETIN						COMPLIED WITH - INFORMATIONAL ONLY: INFORMATIONAL ONLY.
		MOS		03-APR-2019			
22-MAY-2018		HRS/MSC	-	1251:36			
		ENC		1091			
	<b>Note:</b>						
SB WISB-73-1008	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY REV WISB-73-1008 REV.1
		MOS					
13-JUL-2018		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB WISB-73-1008 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY REV WISB-73-1008 REV.2
		MOS					
27-JUL-2018		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB WISB-73-1008 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY REV WISB-73-1008 REV.3
		MOS					
06-AUG-2018		HRS/MSC	-				
		ENC					
	<b>Note:</b>						
SB WISB-73-1008 R03	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY REV WISB-73-1008 REV.4
		MOS					
29-JAN-2019		HRS/MSC	-				
		ENC					
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-73-1008 R04	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
19-FEB-2019		MOS		03-AUG-2022			
		HRS/MSC	-	2048			
		ENC		1669			
<b>Note:</b>							
SB WISB-73-1009	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					RECOMMENDED	- SUPERSEDED BY REV WISB-73-1009 REV.1
13-JUL-2018		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB WISB-73-1009 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN						- SUPERSEDED BY REV WISB-73-1009 REV.2
27-JUL-2018		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB WISB-73-1009 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN						- SUPERSEDED BY WISB-73-1009 R03
06-AUG-2018		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB WISB-73-1009 R03	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN						- SUPERSEDED BY WISB-73-1009 R04
30-JUL-2019		MOS					
		HRS/MSC	-				
		ENC					
<b>Note:</b>							
SB WISB-73-1009 R04	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
05-AUG-2019		MOS					
		HRS/MSC	-	0			
		ENC					
<b>Note:</b>							
SB WISB-73-1009 R05	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
21-MAR-2024		MOS					
		HRS/MSC	CSI		4000 M		
		ENC					
<b>Note:</b>							
SB WISB-73-1019-CN	NO. 2 ENGINE - SUPERSEDED - ENGINE FUEL AND CONTROL - ENGINE MAINTENANCE TERMINAL (EMT) SOFTWARE UPGRADE TO CP356.12.01 (SUPERSEDED BY SB WISB-73-1022), SERVICE BULLETIN					SUPERSEDED	- CANCELLED
14-JUL-2021		MOS					
		HRS/MSC	- (s)				
		ENC					
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-73-1027 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL CONTROL UNIT - REPLACE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - AS PER ENGINE S/N
03-AUG-2022		MOS HRS/MSC - ENC		05-DEC-2022			
<b>Note:</b>							
SB WISB-73-1040 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN						
14-MAR-2025		MOS HRS/MSC DUE ENC			5855:54 M		
<b>Note:</b>							
SB WISB-74-1000	NO. 2 ENGINE - IGNITION - IGNITER LEAD INSPECTION AND CLAMPING ARRANGEMENT, SERVICE BULLETIN					MANDATORY	COMPLIED WITH
17-AUG-2017		MOS HRS/MSC - ENC		22-FEB-2018 1161:54 1008			
<b>Note:</b>							
SB WISB-74-1004 R02	NO. 2 ENGINE - IGNITION - IGNITER LEAD - REPLACE, SERVICE BULLETIN					RECOMMENDED	NOT APPLICABLE - AS PER ENGINE S/N
01-JUL-2021		MOS HRS/MSC - ENC		05-DEC-2022			
<b>Note:</b>							
SB WISB-75-1001	NO. 2 ENGINE - AIR - I.P. BLEED VALVE LEVER PIN - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY WISB-75-1001 REV.1
17-MAY-2018		MOS HRS/MSC - ENC					
<b>Note:</b>							
SB WISB-75-1001 R01	NO. 2 ENGINE - AIR - I.P. BLEED VALVE LEVER PIN - REPLACE, SERVICE BULLETIN					SUPERSEDED	- SUPERSEDED BY R02
25-JAN-2019		MOS HRS/MSC CSI ENC		0			
<b>Note:</b>							
SB WISB-75-1001 R02	NO. 2 ENGINE - AIR - I.P. BLEED VALVE LEVER PIN - REPLACE, SERVICE BULLETIN					RECOMMENDED	- RECOMMENDED PERFORMANCE DURING NEXT CSI - WILL BE COVERED BY TAP
20-MAY-2021		MOS HRS/MSC CSI ENC					
<b>Note:</b>							
SL SL44-71-385	NO. 2 ENGINE - START ITT EXCEEDANCE - BORESCOPE INSPECTION & HIGH POWER CHECK RUN, SERVICE LETTER						NOT APPLICABLE - S/N NOT APPLICABLE, NO FURTHER ACTION REQUIRED
06-JAN-2017		MOS HRS/MSC - ENC		09-FEB-2018			
<b>Note:</b>							

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL44-72-227 R11	NO. 2 ENGINE - ENGINE - DIFFUSER CASE - FLUORESCENT PENETRANT INSPECTION, SERVICE LETTER						NOT APPLICABLE - AS PER ENGINE S/N
14-JUL-2011		MOS HRS/MSC - ENC		05-DEC-2022			
	<b>Note:</b>						
SL SL44-72-300 R07	NO. 2 ENGINE - ENGINE - HP COMPRESSOR COVER - REAM HOLES, SERVICE LETTER						DEFERRED - NO PROACTIVE REPLACEMENT NECESSARY
20-NOV-2017		MOS HRS/MSC - (s) ENC					
	<b>Note:</b>						
SL SL44-72-325 R04	NO. 2 ENGINE - 1ST LP TURBINE DISK - INSPECTION, SERVICE LETTER					SUPERSEDED	- SUPERSEDED BY SL44-72-325 R07
06-OCT-2016		MOS HRS/MSC CSI ENC		0			
	<b>Note:</b>						
SL SL44-72-325 R07	NO. 2 ENGINE - 1ST LP TURBINE DISK - INSPECTION, SERVICE LETTER						- RECOMMENDED AT NEXT CSI
16-NOV-2022		MOS HRS/MSC CSI ENC			5000 M		
	<b>Note:</b>						
SL SL44-72-327	NO. 2 ENGINE - SL44-72-327, SERVICE LETTER						COMPLIED WITH
		MOS HRS/MSC - ENC		03-AUG-2022 2048 1669			
	<b>Note:</b>						
SL WISL-05-1045-CN	NO. 2 ENGINE - CANCELED-TIME LIMITS/MAINTENANCE CHECKS - SCHEDULED MAINTENANCE CHECKS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						- CANCELLED
13-OCT-2022		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SL WISL-05-1095-CN	NO. 2 ENGINE - CANCELED - TIME LIMITS/MAINTENANCE CHECKS - AIRWORTHINESS LIMITATIONS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						- CANCELLED
13-OCT-2022		MOS HRS/MSC - ENC					
	<b>Note:</b>						
SL WISL-05-1149	NO. 2 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - SCHEDULED MAINTENANCE CHECKS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					INFORMATIONAL	COMPLIED WITH - INFORMATIONAL - NO FURTHER ACTION REQUIRED
14-APR-2023		MOS HRS/MSC - ENC		19-APR-2023			
	<b>Note:</b>						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL WISL-05-1155	NO. 2 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - TIME EXTENSION OF MAJOR PERIODIC INSPECTION, SERVICE LETTER						NOT APPLICABLE - AS PER ENGINE SERIAL NUMBER
08-JUN-2023		MOS HRS/MSC - ENC		23-JUN-2023			
<b>Note:</b>							
SL WISL-71-1319-CN	NO. 2 ENGINE - CANCELED - POWER PLANT - ENGINE SHIPPING - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					CANCELLED	- CANCELLED
13-OCT-2022		MOS HRS/MSC - ENC					
<b>Note:</b>							
SL WISL-71-1541	NO. 2 ENGINE - POWER PLANT - IDLE SPEED AND LEAK CHECK RUN - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					INFORMATIONAL	COMPLIED WITH - INFORMATIONAL ONLY - NO FURTHER ACTION REQUIRED
13-APR-2023		MOS HRS/MSC - ENC		19-APR-2023			
<b>Note:</b>							
SL WISL-72-1308	NO. 2 ENGINE - INSPECTION, EVALUATION, AND RETURN TO SERVICE, SERVICE LETTER						NOT APPLICABLE - AS PER ENGINE SERIALNUMBER
26-MAY-2023		MOS HRS/MSC - ENC		30-MAY-2023			
<b>Note:</b>							
SL WISL-73-1018	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - REVISION TO ILLUSTRATED PARTS CATALOG, SERVICE LETTER						NOT APPLICABLE - Engine S/N not applicable, No further action required
04-JUN-2019		MOS HRS/MSC - ENC AFL					
<b>Note:</b>							
SL WISL-73-1018-CN	NO. 2 ENGINE - CANCELED - ENGINE FUEL AND CONTROL - REVISION TO ILLUSTRATED PARTS CATALOG, SERVICE LETTER					CANCELLED	NOT APPLICABLE - Cancelled
16-OCT-2019		MOS HRS/MSC - ENC AFL					
<b>Note:</b>							
SL WISL-73-1045	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FADEC HARNESS CHAFING - ACCEPTABLE FOR CONTINUED USE, SERVICE LETTER						NOT APPLICABLE - AS PER ENGINE S/N
07-MAY-2021		MOS HRS/MSC - ENC		05-DEC-2022			
<b>Note:</b>							