



MASTER AD/SI REPORT

560XL - CITATION XL (MSG)

S/N 560XL-5230 OK-HAR

OWNER: AEROPARTNER A.S.
ADDRESS: K LETISTI / HANGAR C
PRAGUE 161 00

OPERATOR: AEROPARTNER A.S.
ADDRESS: K LETISTI / HANGAR C
PRAGUE 161 00

OFFICE:
FAX:

OFFICE:
FAX:

ANALYST: GUILLAUME DUCLOS
EMAIL: GUILLAUME.DUCLOS@CAMPSYSTEMS.EU

+33-1.55.93.45.84 (DIRECT)
+33-1.55.93.45.80 (MAIN)
WWW.CAMPSYSTEMS.COM

PLEASE REACH OUT TO YOUR ANALYST TO
RECORD CHANGES TO ADDRESS, LAST ACTUALS
(IF ANY).

FILTER CRITERIA : Mode:WITH COMPLIANCE OR NEXT DUE; Group by Profile or Bulletin:PROFILE TYPE;

AIRCRAFT SERIAL/REGNO: 560XL-5230/OK-HAR MODEL: 560XL - CITATION XL (MSG) MANUFACTURER: TEXTRON AVIATION INC.

CERTIFICATION DATE: 17-FEB-2002

LAST ACTUALS:
9055:06 A/C HRS as of 05-MAY-2026
7284 AFL as of 05-MAY-2026
3985:30 APH as of 30-APR-2026
7418 APS as of 30-APR-2026

APU SERIAL/PART: P-268/3800722-1 MODEL: RE100 (XL) MANUFACTURER: HONEYWELL

INSTALLED ON: 07-AUG-2009
0 APU HRS 2216 A/C HRS
0 APUS

LAST ACTUALS:
3985:30 APU HRS as of 30-APR-2026
7418 APUS as of 30-APR-2026

ENGINE NO. 1 SERIAL/PART: PCE-DB0473/31J1900-01 MODEL: PW545A MANUFACTURER: PRATT & WHITNEY CANADA CORP.

INSTALLED ON: 17-FEB-2002
17 ENG. HRS 17 A/C HRS
ENC

LAST ACTUALS:
9001:44 ENG. HRS as of 05-MAY-2026
7242 ENC as of 05-MAY-2026

ENGINE NO. 2 SERIAL/PART: PCE-DB0472/31J1900-01 MODEL: PW545A MANUFACTURER: PRATT & WHITNEY CANADA CORP.

INSTALLED ON: 17-FEB-2002
17 ENG. HRS 17 A/C HRS
ENC

LAST ACTUALS:
9055:06 ENG. HRS as of 05-MAY-2026
7284 ENC as of 05-MAY-2026



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
AIRCRAFT - AD - 560XL - CITATION XL (MSG) 560XL-5230/OK-HAR							
AD 26AD-01	OVERLAND AVIATION SERVICES						Complied With - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS HRS/MSC	-	26-FEB-2002 33	-		
AD 34AD-10	ROCKWELL COLLINS MODE C XPDR						Complied With - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS HRS/MSC	-	30-APR-2002 100	-		
AD 34AD-11	ROCKWELL COLLINS MODE S XPDR						Complied With - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS HRS/MSC	-	30-APR-2002 100	-		
EASA 2014-0095	EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR - MODIFICATION AIRCRAFT FLIGHT MANUAL - AMENDMENT					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 07-MAY-2014		MOS HRS/MSC AFL	-	20-MAY-2014 4573:18 4308	-		
EASA 2014-0095 PARA (1)	INSTALL A PLACARD "DO NOT USE TRANSMIT OVER WATER" NEXT TO THE CPI CONTROL PANEL/AMEND THE AFM OF THE AIRCRAFT					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 07-MAY-2014		DAYS HRS/MSC AFL	-	20-MAY-2014 4573:18 4308	-		
EASA 2014-0095 PARA (2)	INCORPORATION OF APPENDIX A OF THIS AD INTO THE EMERGENCY PROCEDURESSECTION OF THE AFM OF THE AIRCRAFT IS AN ACCEPTABLE METHOD TO COMPLY WITHTHE REQUIREMENT OF PARAGRAPH (1.2) OF THIS AD					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 07-MAY-2014		MOS HRS/MSC AFL	-	20-MAY-2014 4573:18 4308	-		
EASA 2014-0095 PARA (3)	REPLACE THE SYSTEM INTERFACE UNIT P/N 503-24-() (INCLUDING503-24) OR P/N 503-42-() (INCLUDING 503-42) WITH AN IMPROVED PART P/N503-24-A, OR P/N 503-24-()-A, OR P/N 503-24-G, OR P/N 503-24-()-G, OR P/N503-42-A OR P/N 503-42-()-A OR P/N 503-42-G OR P/N 503-42-()-G (THATINCORPORATES AUTOMATIC CPI DEPLOYMENT AFTER MANUAL ACTIVATION) INACCORDANCE WITH AN APPROVED AIRCRAFT MAINTENANCE INSTRUCTION					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 31-JAN-2014		MOS HRS/MSC AFL	-	20-MAY-2014 4573:18 4308	-		
EASA 2014-0095 PARA (4)	DO NOT INSTALL A HR SMITH (TECHNICAL DEVELOPMENTS) CPI SYSTEM SERIES 15-503-134OR 15-503-134-1 EQUIPPED WITH CONTROL PANEL P/N 503-22-(), BEACON RELEASE UNIT P/N 503-21 AND SYSTEM INTERFACE UNIT P/N 503-24-() (INCLUDING 503-24) OR P/N 503-42-() (INCLUDING 503-42) EXCLUDING SYSTEM INTERFACE UNIT P/N 503-24-A OR P/N 503-24-()-A OR P/N 503-24-G OR P/N 503-24-()-G OR P/N 503-42-A OR P/N 503-42-()-A OR P/N 503-42-G OR P/N 503-42-()-G ON AN AIRCRAFT UNLESS IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 31-JAN-2014		MOS HRS/MSC AFL	-	20-MAY-2014 4573:18 4308	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As
Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2014-0095 PARA (5)	REMOVE THE AFM AMENDMENT AND PLACARD AS REQUIRED BY PARAGRAPH (1) OF THIS AD					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 31-JAN-2014		MOS		20-MAY-2014			
		HRS/MSC	-	4573:18	-		
		AFL		4308			
EASA 2014-0142	OXYGEN - OXYGEN MASK REGULATOR INFLATABLE HARNESS / INFLATION HOSE - IDENTIFICATION / REPLACEMENT					MANDATORY	Not Applicable - SUPERSEDED BY AD 2014-0142 R1
Eff. Date: 18-JUN-2014		MOS		23-JUN-2014			
		HRS/MSC	-				
EASA 2014-0142 PARA (1)	ACCOMPLISH ACCOMPLISH THE ACTIONS AS SPECIFIED IN PARAGRAPHS (1.1) AND (1.2) OF THIS AD - DETERMINE THE DATE OF MANUFACTURING / REPLACE THE HARNESS INFLATION HOSE P/N 445952 WITH A SERVICEABLE PART, OR REMOVE THE INFLATABLE HARNESS FROM THE MASK REGULATOR AND REPLACE IT WITH A SERVICEABLE HARNESS					MANDATORY	Not Applicable - SUPERSEDED BY AD 2014-0142 R1
Eff. Date: 18-JUN-2014		MOS		23-JUN-2014			
		HRS/MSC	-				
EASA 2014-0142 PARA (2)	ACCOMPLISH AN OXYGEN MASK REGULATOR EQUIPPED WITH A P/N MXH21-1 INFLATABLE HARNESS HAVING A DMF CODE OF NOVEMBER 2008 (0845-S OR 08/45-S) OR EARLIER, AND THOSE WITH A DMF OF JANUARY 2011 (1101-S OR 11/01-S) OR LATER, IS EXCLUDED FROM THE INSPECTION AND REPLACEMENT REQUIREMENTS OF PARAGRAPH (1) OF THIS AD					MANDATORY	Not Applicable - SUPERSEDED BY AD 2014-0142 R1
Eff. Date: 18-JUN-2014		MOS		23-JUN-2014			
		HRS/MSC	-				
EASA 2014-0142 PARA (3)	ACCOMPLISH IT IS ALLOWED TO INSTALL ON AN AEROPLANE A FLIGHT CREW OXYGEN MASK REGULATOR, HAVING A P/N AS IDENTIFIED IN SECTION 1.A.(1) OF ZODIAC AEROTECHNICS SB MC10-35-274, PROVIDED IT HAS BEEN DETERMINED THAT A P/N MXH21-31 INFLATABLE HARNESS IS INSTALLED, OR THAT THE P/N MXH21-1 INFLATABLE HARNESS INSTALLED ON THAT FLIGHT CREW OXYGEN MASK REGULATOR HAS BEEN CORRECTED, AS REQUIRED BY THIS AD.					MANDATORY	Not Applicable - SUPERSEDED BY AD 2014-0142 R1
Eff. Date: 18-JUN-2014		MOS		23-JUN-2014			
		HRS/MSC	-				
EASA 2025-0088	NAVIGATION - SATELLITE BASED AUGMENTATION SYSTEMS / GLOBAL POSITIONING SYSTEM RECEIVER - REPLACEMENT					MANDATORY	
Eff. Date: 30-APR-2025		MOS	24		30-APR-2027		
EASA 2025-0222	OXYGEN - PORTABLE BREATHING EQUIPMENT - OPERATIONAL INSTRUCTIONS					MANDATORY	Not Applicable - PBE FROM DIFFERENT MANUFACTURER INSTALLED
Eff. Date: 20-OCT-2025		DAYS		19-NOV-2025			
		HRS/MSC	-	8950:07	-		
		AFL		7219			
FAA 1974-08-09 R02	LAVATORY PAPER OR LINEN WASTE RECEPTACLE FIRE PREVENTION					MANDATORY	Complied With
Eff. Date: 29-JUL-1996		MOS		17-JUN-2009			
		HRS/MSC	-	3835	-		
FAA 1974-08-09 R03	LAVATORY PAPER OR LINEN WASTE RECEPTACLE FIRE PREVENTION					MANDATORY	Not Applicable - ALL PLACARDS ARE INSTALLED.
Eff. Date: 28-MAR-2012		MOS		14-SEP-2021			
		HRS/MSC	1000	6755:02	-		
		AFL		5707			

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2000-15-51	AILERON CABLE FAIRLEAD TUBE AND AILERON CABLE SECTOR					MANDATORY	Complied With
Eff. Date: 14-AUG-2000		MOS HRS/MSC AFL	-	17-FEB-2002 17	-		
FAA 2001-14-09	WIRING OF THE LANDING LIGHT SWITCH AND THE J-BOX FAIRING RELAYS					MANDATORY	Not Applicable - THE AIRCRAFT IS NOT AFFECTED BY S/N.
Eff. Date: 26-JUL-2001		MOS HRS/MSC AFL	-	26-JUN-2023 7934:27 6529	-		
FAA 2001-23-17	NAVIGATION - GARMIN INTERNATIONAL GNS 430 - MODIFICATION					MANDATORY	Complied With - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS HRS/MSC AFL	A/R	17-FEB-2002 17	-		
FAA 2006-04-10	INSTALLING IDENTIFICATION SLEEVES ON THE WIRES FOR THE POSITIVE AND NEGATIVE STUDS OF THE ENGINE AND/ OR (APU) FIRE EXTINGUISHING BOTTLES, AS APPLICABLE, AND RECONNECTING THE WIRES TO THE CORRECT TERMINAL STUDS.					MANDATORY	Complied With
Eff. Date: 24-MAR-2006		MOS HRS/MSC	A/R	30-JAN-2006 2510	-		
FAA 2007-11-17	FIRE PROTECTION - INSTALLATION OF IDENTIFICATION SLEEVES ON THE WIRES FOR THE POSITIVE AND NEGATIVE TERMINAL STUDS OF THE APPLICABLE FIRE EXTINGUISHING BOTTLES					MANDATORY	Complied With
Eff. Date: 06-JUL-2007		MOS HRS/MSC	A/R	20-JUL-2007 3274	-		
FAA 2010-07-02	PERFORM A ONE-TIME GENERAL VISUAL INSPECTION OF THE MODIFICATION PLATE FOR THE HONEYWELL PRIMUS II NV-850 NAVIGATION RECEIVER MODULE (NRM)					MANDATORY	Complied With
Eff. Date: 03-MAY-2010		MOS HRS/MSC AFL	A/R	28-APR-2010 3970 3818	-		
FAA 2012-06-01	MODIFY THE DRAIN INSTALLATION OF THE TAILCONE STINGER ON THE AFT CANTED BULKHEAD					MANDATORY	Complied With
Eff. Date: 25-APR-2012		MOS HRS/MSC AFL	-	05-MAY-2012 4272:33 4072	-		
560XL-53-16							
FAA 2012-09-01	LANDING GEAR - TORQUE LUG - INSPECTION					MANDATORY	Complied With - SB 560XL-32-41R1 PREV. CW AT BOTH WHEEL ASSY'S
Eff. Date: 07-JUN-2012		MOS HRS/MSC AFL	-	05-JUN-2012 4272:33 4072	-		
560XL-32-41							
FAA 2013-09-11	AIR CONDITIONING - REPLACEMENT OF THE BRUSHES ON A/C COMPRESSOR MOTORS, PART NOS. 1134104-1/1134104-5, OR DEACTIVATION OF THE A/C SYSTEM					MANDATORY	Not Applicable - NO COMPRESSOR MOTOR PN 1134104-1/1134104-5 INSTALLED
Eff. Date: 05-JUL-2013		MOS HRS/MSC AFL	-	04-JUL-2013 4441:56 4208	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2013-09-11 PARA (G)	AIR CONDITIONING - REPLACEMENT OF THE BRUSHES ON A/C COMPRESSOR MOTORS, PART NOS. 1134104-1/1134104-5, OR DEACTIVATION OF THE A/C SYSTEM INSPECTION FOR PART NUMBER (P/N)					MANDATORY	Not Applicable - NO COMPRESSOR MOTOR PN 1134104-1/1134104-5 INSTALLED
Eff. Date: 05-JUL-2013		DAYS HRS/MSC AFL	-	04-JUL-2013 4441:56 4208	-		
FAA 2013-09-11 PARA (H)	AIR CONDITIONING - REPLACEMENT OF THE BRUSHES ON A/C COMPRESSOR MOTORS, PART NOS. 1134104-1/1134104-5, OR DEACTIVATION OF THE A/C SYSTEM INSPECTION A/C COMPRESSOR HOUR METER AND MAINTENANCE RECORDS					MANDATORY	Not Applicable - NO COMPRESSOR MOTOR PN 1134104-1/1134104-5 INSTALLED
Eff. Date: 05-JUL-2013		DAYS HRS/MSC AFL	-	04-JUL-2013 4441:56 4208	-		
FAA 2013-09-11 PARA (I) & (J)	AIR CONDITIONING - REPLACEMENT OF THE BRUSHES ON A/C COMPRESSOR MOTORS, PART NOS. 1134104-1/1134104-5, OR DEACTIVATION OF THE A/C SYSTEM REPLACEMENT OF A/C COMPRESSOR MOTOR BRUSHES AND RELATED MAINTENANCE MANUAL INFORMATION					MANDATORY	Not Applicable - NO COMPRESSOR MOTOR PN 1134104-1/1134104-5 INSTALLED
Eff. Date: 05-JUL-2013		MOS HRS/MSC AFL ACH	-	04-JUL-2013 4441:56 4208 2470:48	-		
FAA 2013-09-11 PARA (K)	AIR CONDITIONING - REPLACEMENT OF THE BRUSHES ON A/C COMPRESSOR MOTORS, PART NOS. 1134104-1/1134104-5, OR DEACTIVATION OF THE A/C SYSTEM DEACTIVATION OF A/C SYSTEM					MANDATORY	Not Applicable - NO COMPRESSOR MOTOR PN 1134104-1/1134104-5 INSTALLED
Eff. Date: 05-JUL-2013		MOS HRS/MSC AFL	A/R	04-JUL-2013 4441:56 4208	-		
FAA 2013-09-11 PARA (L)	AIR CONDITIONING - REPLACEMENT OF THE BRUSHES ON A/C COMPRESSOR MOTORS, PART NOS. 1134104-1/1134104-5, OR DEACTIVATION OF THE A/C SYSTEM REACTIVATION OF A/C SYSTEM					MANDATORY	Not Applicable - NO COMPRESSOR MOTOR PN 1134104-1/1134104-5 INSTALLED
Eff. Date: 05-JUL-2013		MOS HRS/MSC AFL	A/R	04-JUL-2013 4441:56 4208	-		
FAA 2013-09-11 PARA (M)	AIR CONDITIONING - REPLACEMENT OF THE BRUSHES ON A/C COMPRESSOR MOTORS, PART NOS. 1134104-1/1134104-5, OR DEACTIVATION OF THE A/C SYSTEM PARTS RETURN AND REPORTING REQUIREMENTS					MANDATORY	Not Applicable - NO COMPRESSOR MOTOR PN 1134104-1/1134104-5 INSTALLED
Eff. Date: 05-JUL-2013		DAYS HRS/MSC AFL	-	04-JUL-2013 4441:56 4208	-		
FAA 2014-18-01	NAVIGATION - ROCKWELL COLLINS, INC. MODE S TRANSPONDERS - INSPECTION / MODIFICATION					MANDATORY	Not Applicable - BY PN TRANSPONDER
Eff. Date: 14-OCT-2014		MOS HRS/MSC AFL	-	22-SEP-2014 4658:50 4378	-		
FAA 2017-04-14	ELECTRICAL POWER - INSPECTIONS OF THE FUEL TUBE AND RIGHT ALTERNATING CURRENT (AC) GENERATOR WIRES					MANDATORY	Complied With - BY COMPLETION OF SL 24-07 AT 4977.1 ACTT ON 15 FEB 2017.
Eff. Date: 09-MAR-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2017-04-14 PARA (G)	ACCOMPLISH GENERAL VISUAL INSPECTIONS OF THE FUEL TUBE AND RIGHT ALTERNATING CURRENT (AC) GENERATOR WIRES FOR EVIDENCE OF DAMAGE, ALL APPLICABLE ADJUSTMENTS, AND ALL APPLICABLE CORRECTIVE ACTIONS					MANDATORY	Complied With - BY COMPLETION OF SL 24-07 AT 4977.1 ACTT ON 15 FEB 2017.
Eff. Date: 09-MAR-2017		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-04-14 PARA (H)	SUBMIT A REPORT OF THE FINDINGS (BOTH POSITIVE AND NEGATIVE) OF THE INSPECTIONS REQUIRED BY PARAGRAPH (G) OF THIS AD TO TEXTRON AVIATION					MANDATORY	Complied With - BY COMPLETION OF SL 24-07 AT 4977.1 ACTT ON 15 FEB 2017.
Eff. Date: 09-MAR-2017		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-18-12	OXYGEN - INSPECTION AND REPLACEMENT OF B/E AEROSPACE PROTECTIVE BREATHING EQUIPMENT (PBE), PART NUMBER 119003-11 AND 119003-21 THAT ARE INSTALLED ON AIRPLANES					MANDATORY	Not Applicable
Eff. Date: 16-OCT-2017		MOS HRS/MSC AFL	-	17-JUN-2019 5110:47 4774	-		
FAA 2017-18-12 PARA (G)	INSPECTION RETAINED FROM AD 2016-11-20 FOR AIRPLANES WITH PBE, P/N 119003-11, INSTALLED					MANDATORY	Not Applicable
Eff. Date: 15-JUL-2016		MOS HRS/MSC AFL	-	17-JUN-2019 5110:47 4774	-		
FAA 2017-18-12 PARA (H)	REPLACEMENT RETAINED FROM AD 2016-11-20 FOR AIRPLANES WITH PBE, P/N 119003-11, INSTALLED					MANDATORY	Not Applicable
Eff. Date: 15-JUL-2016		MOS HRS/MSC AFL	-	17-JUN-2019 5110:47 4774	-		
FAA 2017-18-12 PARA (I) & (J)	INSPECT TO DETERMINE IF THE S/N OF THE INSTALLED PBE, P/N 119003-21, IS WITHIN THE RANGE OF 004-14768M THROUGH 004-21093M OR 004-02393M THROUGH 004-03033M AND IF FOUND WITHIN THE S/N RANGE REPLACE IT.					MANDATORY	Not Applicable
Eff. Date: 16-OCT-2017		MOS HRS/MSC AFL	-	17-JUN-2019 5110:47 4774	-		
FAA 2019-01-02	NAVIGATION - AUTOMATIC DEPENDENT SURVEILLANCE-BROADCAST (ADS-B) IN - AIRPLANE FLIGHT MANUAL SUPPLEMENT (AFMS) - DISABLE / REVISE					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 07-FEB-2019		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2019-01-02 PARA (G)(1)	DISABLE THE AUTOMATIC DEPENDENT SURVEILLANCE-BROADCAST (ADS-B) IN FUNCTION IN EACH UNIT					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2019-01-02 PARA (G)(2)	REVISE THE AIRPLANE FLIGHT MANUAL SUPPLEMENT IN ACCORDANCE WITH PARAGRAPH 5.2.C OF SB2018-01					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2020-26-05	ENGINE CONTROLS - LEFT AND RIGHT THROTTLE QUADRANT ASSEMBLY SENSOR LINK AND SENSOR DRIVE ARM PIVOT RIVETS - INSPECTION/CORRECTIVE ACTION					MANDATORY	Not Applicable - N/A BY AIRCRAFT S/N.
Eff. Date: 17-DEC-2020		MOS HRS/MSC AFL	-	17-JUN-2022 7366:02 6120	-		
FAA 2023-10-02	INDICATING/RECORDING SYSTEM/NAVIGATION - RADIO ALTIMETER - AFM REVISION					MANDATORY	Complied With - FAA 2023-10-02
Eff. Date: 26-MAY-2023		MOS HRS/MSC AFL	-	20-JUL-2023 7966:01 6563	-		
FAA 2023-10-02 PARA (H)	REVISE THE LIMITATIONS SECTION OF THE EXISTING AFM (UNTIL 30-JUNE-2023 - SATISFIED BY FAA 2021-23-12)					MANDATORY	Complied With - FAA 2023-10-02
Eff. Date: 26-MAY-2023		MOS HRS/MSC AFL	-	20-JUL-2023 7966:01 6563	-		
FAA 2023-10-02 PARA (I)	REVISE THE LIMITATIONS SECTION AND REMOVE THE AFM REVISION REQUIRED BY PARA (H) (AFTER 30 JUN 2023)					MANDATORY	Complied With - FAA 2023-10-02
Eff. Date: 26-MAY-2023		MOS HRS/MSC AFL	-	20-JUN-2023 7920:12 6521	-		
FAA 2024-26-02	EQUIPMENT AND FURNISHING - SEAT RESTRAINT SYSTEM PLASTIC ROTARY BUCKLE HANDLE - INSPECTION/REPLACEMENT					MANDATORY	Not Applicable - NOT EQUIPPED ON A/C
Eff. Date: 07-MAR-2025		MOS HRS/MSC AFL	-	21-AUG-2025 8875:18 7163	-		
FAA 2024-26-02 PARA (G)(1)	INSPECT THE BUCKLE HANDLE FOR A CRACK AND IF CRACKED, BEFORE FURTHER FLIGHT, REPLACE IT WITH AN AIRWORTHY BUCKLE					MANDATORY	Not Applicable - NOT EQUIPPED ON A/C
Eff. Date: 07-MAR-2025		MOS HRS/MSC AFL	-	21-AUG-2025 8875:18 7163	-		
FAA 2024-26-02 PARA (G)(2)	MEASURE THE THICKNESS OF THE BUCKLE HANDLE VANE; IF THICKNESS IS 0.125 INCH OR GREATER, BEFORE FURTHER FLIGHT, REMOVE THE BUCKLE FROM SERVICE AND REPLACE IT WITH AN AIRWORTHY BUCKLE					MANDATORY	Not Applicable - NOT EQUIPPED ON A/C
Eff. Date: 07-MAR-2025		MOS HRS/MSC AFL	-	21-AUG-2025 8875:18 7163	-		
FAA 2024-26-02 PARA (G)(3)	DO NOT INSTALL A BUCKLE OR RESTRAINT SYSTEM WITH A BUCKLE P/N 1111430 OR 1111475, ALL DASH NUMBERS, WITH A HANDLE VANE THICKNESS OF 0.125 INCH OR GREATER					MANDATORY	Not Applicable - NOT EQUIPPED ON A/C
Eff. Date: 07-MAR-2025		MOS HRS/MSC AFL	-	21-AUG-2025 8875:18 7163	-		
FAA 2025-11-09	FIRE PROTECTION - MIS-WIRED FIRE EXTINGUISHING BOTTLES					MANDATORY	Complied With - AS PER SL-560XL-26-02
Eff. Date: 11-JUL-2025		MOS HRS/MSC AFL	-	26-SEP-2024 8472:49 6872	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As
Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2025-11-09 PARA (G)	FIRE BOTTLE WIRE TEST AND INSPECTION					MANDATORY	Complied With
Eff. Date: 11-JUL-2025		DAYS			26-SEP-2024		
		HRS/MSC	-		8472:49		
		AFL			6872		
FAA 2025-11-09 PARA (I)	INSPECTION PROGRAM REVISION					MANDATORY	Complied With
		MOS			26-SEP-2024		
		HRS/MSC	-		8472:49		
		AFL			6872		
FAA 2025-25-02	OXYGEN - PORTABLE BREATHING EQUIPMENT - OPERATIONAL INSTRUCTIONS					MANDATORY	Not Applicable - AS PER S/N
Eff. Date: 24-DEC-2025		DAYS			17-DEC-2025		
		HRS/MSC	-		8969:45		
		AFL			7239		
FAA 2025-26-06	INCORRECT USAGE OF PORTABLE BREATHING EQUIPMENT					MANDATORY	Not Applicable - AS PER MANUFACTURER
Eff. Date: 14-JAN-2026		DAYS			07-JAN-2026		
		HRS/MSC	-		8981:14		
		AFL			7250		
FAA 2026-03-09 PARA (G) EASA (REPLACE THE AFFECTED PBE WITH A PBE NOT AFFECTED BY THIS AD					MANDATORY	Not Applicable
Eff. Date: 12-MAR-2026		DAYS			13-MAR-2026		
		HRS/MSC	-		9018:28		
		AFL			7267		
APPLIANCE - 560XL - CITATION XL (MSG) 560XL-5230/OK-HAR							
EASA 2005-0021	APPLIANCE AD - HONEYWELL RCZ-83() AND RCZ-85() COMMUNICATION UNITS					SUPERSEDED	Not Applicable - NOT APPLICABLE
Eff. Date: 01-AUG-2005		MOS			26-AUG-2005		
		HRS/MSC	A/R		2353		
EASA 2010-0003 R02	APPLIANCE AD - NAVIGATION - MODE S TRANSPONDER AIRCRAFT TYPE MODE STRAPPING - CHECK / MODIFICATION					MANDATORY	Not Applicable - BY PN TRANSPONDER
Eff. Date: 14-OCT-2014		MOS			22-SEP-2014		
		HRS/MSC	-		4658:50		
		AFL			4378		
EASA 2010-0003 R02 PARA (1)	APPLIANCE ADP - VERIFY AIRCRAFT TYPE MODE STRAPPING CODE S SET TO '0' (ZERO) OR '1', AS DEFINED IN ROCKWELL-COLLINS SERVICE LETTER TDR-94() SIL 07-2.					MANDATORY	Not Applicable - BY PN TRANSPONDER
Eff. Date: 14-OCT-2014		MOS			22-SEP-2014		
		HRS/MSC	-		4658:50		
		AFL			4378		
EASA 2010-0003 R02 PARA (2)	APPLIANCE ADP - EXEMPTIONS: DASSAULT AEROPLANES					MANDATORY	Not Applicable - BY PN TRANSPONDER
Eff. Date: 14-OCT-2014		MOS			22-SEP-2014		
		HRS/MSC	-		4658:50		
		AFL			4378		
EASA 2010-0003 R02 PARA (3)	APPLIANCE ADP - EXEMPTIONS: ATR 42 AND ATR 72 AEROPLANES					MANDATORY	Not Applicable - BY PN TRANSPONDER
Eff. Date: 14-OCT-2014		MOS			22-SEP-2014		
		HRS/MSC	-		4658:50		
		AFL			4378		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2010-0003 R02 PARA (4)	APPLIANCE ADP - EXEMPTIONS: SAAB 2000 AEROPLANES					MANDATORY	Not Applicable - BY PN TRANSPONDER
Eff. Date: 14-OCT-2014		MOS			22-SEP-2014		
		HRS/MSC	-		4658:50	-	
		AFL			4378		
EASA 2010-0003 R02 PARA (5)	APPLIANCE ADP - EXEMPTIONS: BOMBARDIER AEROSPACE (CANADAIR) AEROPLANES: CL-600-2B16 (604 VARIANT) AND CL-600-2B19 (RJ100 AND RJ200)					MANDATORY	Not Applicable - BY PN TRANSPONDER
Eff. Date: 14-OCT-2014		MOS			22-SEP-2014		
		HRS/MSC	-		4658:50	-	
		AFL			4378		
EASA 2010-0003 R02 PARA (6)	APPLIANCE ADP - EXEMPTIONS: CESSNA AIRCRAFT COMPANY AEROPLANES: CESSNA MODEL 525, 525A, 525B; AND CESSNA MODEL 525, 525A, 525B, 560; 560XL					MANDATORY	Not Applicable - BY PN TRANSPONDER
Eff. Date: 14-OCT-2014		MOS			22-SEP-2014		
		HRS/MSC	-		4658:50	-	
		AFL			4378		
EASA 2010-0003 R02 PARA (7)	APPLIANCE ADP - EXEMPTIONS: PIAGGIO AERO INDUSTRIES AEROPLANES: P.180 (AVANTI) AND P.180 (AVANTI II)					MANDATORY	Not Applicable - BY PN TRANSPONDER
Eff. Date: 14-OCT-2014		MOS			22-SEP-2014		
		HRS/MSC	-		4658:50	-	
		AFL			4378		
EASA 2011-0239	APPLIANCE AD - NAVIGATION - RADIO ALTIMETER INDICATOR - MODIFICATION - SMS (TRADING AS COBHAM AVIONICS), FORMERLY NEC AERO.					MANDATORY	Not Applicable - ITEM NOT INSTALLED
Eff. Date: 29-DEC-2011		MOS			16-JAN-2012		
		HRS/MSC	A/R		4210:59	-	
		AFL			4009		
EASA 2012-0037	APPLIANCE AD - FIRE PROTECTION - HAND OPERATED FIRE EXTINGUISHER - MODIFICATION - KIDDE GRAVINER (A HAMILTON SUNDSTRAND COMPANY)						Not Applicable - NA BY P/N
Eff. Date: 23-MAR-2012		MOS			05-MAY-2012		
		HRS/MSC	-		4272:33	-	
		AFL			4072		
EASA 2012-0038	APPLIANCE AD - EQUIPMENT & FURNISHINGS - PASSENGER SEAT BACKREST LINK - INSPECTION / REPLACEMENT - SICMA AERO SEAT						Not Applicable - NA BY OTHER MANUFACTURER
Eff. Date: 26-MAR-2012		MOS			06-MAY-2012		
		HRS/MSC	A/R		4272:33	-	
		AFL			4072		
EASA 2012-0254	APPLIANCE AD - OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT					MANDATORY	Not Applicable - SUPERSEDED BY R1
Eff. Date: 13-DEC-2012		MOS			08-JAN-2013		
		HRS/MSC	-		4390:08	-	
		AFL			4159		
EASA 2012-0254 PARA (1)	APPLIANCE ADP - INSPECT/CHECK OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT OXYGEN MASK REGULATOR TO IDENTIFY THE P/N AND S/N					MANDATORY	Not Applicable - SUPERSEDED BY R1
Eff. Date: 13-DEC-2012		DAYS			08-JAN-2013		
		HRS/MSC	-		4390:08	-	
		AFL			4159		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As
Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2012-0254 PARA (2.1)	APPLIANCE ADP - REPLACE OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR -IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT AFFECTED OXYGEN MASK REGULATOR					MANDATORY	Not Applicable - SUPERSEDED BY R1
Eff. Date: 13-DEC-2012		MOS HRS/MSC AFL	-	08-JAN-2013 4390:08 4159	-		
EASA 2012-0254 PARA (2.2)	APPLIANCE ADP - AMEND OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR -IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT AIRCRAFT FLIGHT MANUAL (AFM)					MANDATORY	Not Applicable - SUPERSEDED BY R1
Eff. Date: 13-DEC-2012		MOS HRS/MSC AFL	-	08-JAN-2013 4390:08 4159	-		
EASA 2012-0254 PARA (3)	APPLIANCE ADP - REPLACE OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR -IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT EACH AFFECTED FLIGHT CREW OXYGEN MASK REGULATOR WITH A SERVICEABLE PART					MANDATORY	Not Applicable - SUPERSEDED BY R1
Eff. Date: 13-DEC-2012		MOS HRS/MSC AFL	-	08-JAN-2013 4390:08 4159	-		
EASA 2012-0254 R01	APPLIANCE AD - OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT					MANDATORY	Not Applicable - BY PN AND SN CREW OXYGEN MASK REGULATOR
Eff. Date: 21-DEC-2012		MOS HRS/MSC AFL	-	08-JAN-2013 4390:08 4159	-		
EASA 2012-0254 R01 PARA (1)	APPLIANCE ADP - INSPECT OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT EACH FLIGHT CREW OXYGEN MASK REGULATOR TO IDENTIFY THE P/N AND S/N					MANDATORY	Not Applicable - BY PN AND SN CREW OXYGEN MASK REGULATOR
Eff. Date: 13-DEC-2012		DAYS HRS/MSC AFL	-	08-JAN-2013 4390:08 4159	-		
EASA 2012-0254 R01 PARA (2.1)	APPLIANCE ADP - REPLACE OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT EACH AFFECTED FLIGHT CREW OXYGEN MASK REGULATOR WITH A SERVICEABLE PART					MANDATORY	Not Applicable - BY PN AND SN CREW OXYGEN MASK REGULATOR
Eff. Date: 13-DEC-2012		DAYS HRS/MSC AFL	-	08-JAN-2013 4390:08 4159	-		
EASA 2012-0254 R01 PARA (2.2)	APPLIANCE ADP - AMEND OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT THE AIRCRAFT FLIGHT MANUAL (AFM) AND INSTALL A PLACARD					MANDATORY	Not Applicable - BY PN AND SN CREW OXYGEN MASK REGULATOR
Eff. Date: 13-DEC-2012		DAYS HRS/MSC AFL	-	08-JAN-2013 4390:08 4159	-		
EASA 2012-0254 R01 PARA (3)	APPLIANCE ADP - REPLACE OXYGEN - FLIGHT CREW OXYGEN MASK REGULATOR - IDENTIFICATION / OPERATIONAL PROCEDURE / REPLACEMENT EACH AFFECTED FLIGHT CREW OXYGEN MASK REGULATOR					MANDATORY	Not Applicable - BY PN AND SN CREW OXYGEN MASK REGULATOR
Eff. Date: 13-DEC-2012		MOS HRS/MSC AFL	-	08-JAN-2013 4390:08 4159	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2013-0020	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINTSYSTEMS - INSPECTION / REPLACEMENT					MANDATORY	Not Applicable - SUPERSEDED BY R1
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		
EASA 2013-0020 PARA (1)	APPLIANCE ADP - INSPECT EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINTSYSTEMS - INSPECTION / REPLACEMENT THE MARKINGSOF SAFETY BELTS AND/OR TORSO RESTRAINT SYSTEMS, TO DETERMINE IF THEY HAVEBEEN MAINTAINED OR REPAIRED BY ORGANISATIONS OTHER THAN THE DESIGNAPPROVAL HOLDER					MANDATORY	Not Applicable - SUPERSEDED BY R1
Eff. Date: 01-JAN-2000		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		
EASA 2013-0020 PARA (2)	APPLIANCE ADP - VERIFY EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINTSYSTEMS - INSPECTION / REPLACEMENT IF THE ORGANISATION IS LISTED AMONG THE AUTHORIZED MAINTENANCE OR REPAIRORGANISATION REFERENCE DOCUMENTS QUOTED IN THE REF. PUBLICATIONSSECTION OF THIS AD					MANDATORY	Not Applicable - SUPERSEDED BY R1
		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		
EASA 2013-0020 PARA (3)	APPLIANCE ADP - REMOVE EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINTSYSTEMS - INSPECTION / REPLACEMENT AND REPLACE BELTS NOT MEETING THE CERTIFICATION REQUIREMENTS OR MAKE RELEVANT SEAT INOPERATIVE					MANDATORY	Not Applicable - SUPERSEDED BY R1
		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		
EASA 2013-0020 R01	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					MANDATORY	Not Applicable - SUPERSEDED BY R2
Eff. Date: 12-MAR-2013		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		
EASA 2013-0020 R01 PARA (1)	APPLIANCE ADP - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT INSPECT THE MARKINGS OF SAFETY BELTS AND/OR TORSO RESTRAINT SYSTEMS, TO DETERMINE IF THEY HAVE BEEN MAINTAINED OR REPAIRED BY ORGANISATIONS OTHER THAN THE DESIGN APPROVAL HOLDER					MANDATORY	Not Applicable - SUPERSEDED BY R2
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		
EASA 2013-0020 R01 PARA (2)	APPLIANCE ADP - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT VERIFY IF THE ORGANISATION IS LISTED AMONG THE AUTHORIZED MAINTENANCE OR REPAIR ORGANISATION REFERENCE DOCUMENTS QUOTED IN THE REF. PUBLICATIONS SECTION OF THIS AD					MANDATORY	Not Applicable - SUPERSEDED BY R2
		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2013-0020 R01 PARA (3)	APPLIANCE ADP - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT REMOVE AND REPLACE BELTS NOT MEETING THE CERTIFICATION REQUIREMENTS OR MAKE RELEVANT SEAT INOPERATIVE	MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-	MANDATORY	Not Applicable - SUPERSEDED BY R2
EASA 2013-0020 R01 PARA (4)	APPLIANCE ADP - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT AFTER 14 FEBRUARY 2013 [THE EFFECTIVE DATE OF THE ORIGINAL ISSUE OF THIS AD], DO NOT INSTALL SAFETY BELTS OR TORSO RESTRAINT SYSTEMS ON ANY AIRCRAFT, UNLESS INSPECTED AND CORRECTED IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD.	MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-	MANDATORY	Not Applicable - SUPERSEDED BY R2
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		
EASA 2013-0020 R02	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT	MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-	MANDATORY	Complied With - FOUND NO EVIDENCE OR REPAIR, MODIFICATION
Eff. Date: 11-JUL-2013		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		
EASA 2013-0020 R02 PARA (1)	APPLIANCE ADP - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT INSPECT THE MARKINGS OF SAFETY BELTS AND/OR TORSO RESTRAINT SYSTEMS, TO DETERMINE IF THEY HAVE BEEN MAINTAINED OR REPAIRED BY ORGANISATIONS OTHER THAN THE DESIGN APPROVAL HOLDER	MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-	MANDATORY	Complied With - FOUND NO EVIDENCE OR REPAIR, MODIFICATION
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		
EASA 2013-0020 R02 PARA (2)	APPLIANCE ADP - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT VERIFY IF THE ORGANISATION IS LISTED AMONG THE AUTHORIZED MAINTENANCE OR REPAIR ORGANISATION REFERENCE DOCUMENTS QUOTED IN THE REF. PUBLICATIONS SECTION OF THIS AD	MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-	MANDATORY	Complied With - FOUND NO EVIDENCE OR REPAIR, MODIFICATION
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		
EASA 2013-0020 R02 PARA (3)	APPLIANCE ADP - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT REMOVE AND REPLACE BELTS NOT MEETING THE CERTIFICATION REQUIREMENTS OR MAKE RELEVANT SEAT INOPERATIVE	MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-	MANDATORY	Complied With - FOUND NO EVIDENCE OR REPAIR, MODIFICATION
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		
EASA 2013-0020 R02 PARA (4)	APPLIANCE ADP - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT AFTER 14 FEBRUARY 2013 [THE EFFECTIVE DATE OF THE ORIGINAL ISSUE OF THIS AD], DO NOT INSTALL SAFETY BELTS OR TORSO RESTRAINT SYSTEMS ON ANY AIRCRAFT, UNLESS INSPECTED AND CORRECTED IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD	MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-	MANDATORY	Complied With - FOUND NO EVIDENCE OR REPAIR, MODIFICATION
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	20-AUG-2013 4471:29 4230	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2013-0020 R03	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINTSYSTEMS - INSPECTION / REPLACEMENT					MANDATORY	Not Applicable - NOT MAINTAINED OR REPAIRED AFTER 28 SEP 2003
Eff. Date: 28-MAR-2014		MOS HRS/MSC AFL	-	08-APR-2014 4566:55 4303	-		
EASA 2013-0020 R03 PARA (1)	APPLIANCE ADP - INSPECT THE MARKINGS OF SAFETY BELTS AND/OR TORSO RESTRAINT SYSTEMS, TO DETERMINE IF THEY HAVE BEEN MAINTAINED OR REPAIRED BY ORGANISATIONS OTHER THAN THE DESIGN APPROVAL HOLDER					MANDATORY	Not Applicable - NOT MAINTAINED OR REPAIRED AFTER 28 SEP 2003
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	08-APR-2014 4566:55 4303	-		
EASA 2013-0020 R03 PARA (2)	APPLIANCE ADP - VERIFY IF THE ORGANISATION IS LISTED AMONG THE AUTHORIZED MAINTENANCE OR REPAIR ORGANISATION REFERENCE DOCUMENTS QUOTED IN THE REF. PUBLICATIONS SECTION OF THIS AD					MANDATORY	Not Applicable - NOT MAINTAINED OR REPAIRED AFTER 28 SEP 2003
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	08-APR-2014 4566:55 4303	-		
EASA 2013-0020 R03 PARA (3)	APPLIANCE ADP - REMOVE AND REPLACE BELTS NOT MEETING THE CERTIFICATION REQUIREMENTS OR MAKE RELEVANT SEAT INOPERATIVE					MANDATORY	Not Applicable - NOT MAINTAINED OR REPAIRED AFTER 28 SEP 2003
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	08-APR-2014 4566:55 4303	-		
EASA 2013-0020 R03 PARA (4)	APPLIANCE ADP - AFTER 14 FEBRUARY 2013 [THE EFFECTIVE DATE OF THE ORIGINAL ISSUE OF THIS AD], DO NOT INSTALL SAFETY BELTS OR TORSO RESTRAINT SYSTEMS ON ANY AIRCRAFT, UNLESS INSPECTED AND CORRECTED IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD					MANDATORY	Not Applicable - NOT MAINTAINED OR REPAIRED AFTER 28 SEP 2003
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	08-APR-2014 4566:55 4303	-		
EASA 2013-0020 R04	APPLIANCE AD - EQUIPMENT & FURNISHINGS - SAFETY BELTS / TORSO RESTRAINT SYSTEMS - INSPECTION / REPLACEMENT					MANDATORY	Not Applicable - NOT MAINTAINED / REPAIRED AFTER SEP 2003
Eff. Date: 11-JUL-2014		MOS HRS/MSC AFL	-	30-SEP-2014 4661:49 4380	-		
EASA 2013-0020 R04 PARA (1)	APPLIANCE ADP - INSPECT THE MARKINGS OF SAFETY BELTS AND/OR TORSO RESTRAINT SYSTEMS, TO DETERMINE IF THEY HAVE BEEN MAINTAINED OR REPAIRED BY ORGANISATIONS OTHER THAN THE DESIGN APPROVAL HOLDER					MANDATORY	Not Applicable - NOT MAINTAINED / REPAIRED AFTER SEP 2003
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	30-SEP-2014 4661:49 4380	-		
EASA 2013-0020 R04 PARA (2)	APPLIANCE ADP - VERIFY IF THE ORGANISATION IS LISTED AMONG THE AUTHORIZED MAINTENANCE OR REPAIR ORGANISATION REFERENCE DOCUMENTS QUOTED IN THE REF. PUBLICATIONS SECTION OF THIS AD					MANDATORY	Not Applicable - NOT MAINTAINED / REPAIRED AFTER SEP 2003
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	30-SEP-2014 4661:49 4380	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2013-0020 R04 PARA (3)	APPLIANCE ADP - REMOVE AND REPLACE BELTS NOT MEETING THE CERTIFICATION REQUIREMENTS OR MAKE RELEVANT SEAT INOPERATIVE					MANDATORY	Not Applicable - NOT MAINTAINED / REPAIRED AFTER SEP 2003
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	30-SEP-2014 4661:49 4380	-		
EASA 2013-0020 R04 PARA (4)	APPLIANCE ADP - AFTER 14 FEBRUARY 2013 [THE EFFECTIVE DATE OF THE ORIGINAL ISSUE OF THIS AD], DO NOT INSTALL SAFETY BELTS OR TORSO RESTRAINT SYSTEMS ON ANY AIRCRAFT, UNLESS INSPECTED AND CORRECTED IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD					MANDATORY	Not Applicable - NOT MAINTAINED / REPAIRED AFTER SEP 2003
Eff. Date: 14-FEB-2013		MOS HRS/MSC AFL	-	30-SEP-2014 4661:49 4380	-		
EASA 2014-0019	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR - MODIFICATION AIRCRAFT FLIGHT MANUAL - AMENDMENT (SUPERSEDED BY EASA 2014-0095)					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 31-JAN-2014		MOS HRS/MSC AFL	-	07-FEB-2014 4561:51 4299	-		
EASA 2014-0019 PARA (1)	APPLIANCE ADP - AMEND THE AFM OF THE AFFECTED AIRCRAFT					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 31-JAN-2014		DAYS HRS/MSC AFL	-	07-FEB-2014 4561:51 4299	-		
EASA 2014-0019 PARA (2)	APPLIANCE ADP - REPLACE THE SYSTEM INTERFACE UNIT P/N 503-24-() OR 503-42-()					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 31-JAN-2014		MOS HRS/MSC AFL	-	07-FEB-2014 4561:51 4299	-		
EASA 2014-0019 PARA (3)	APPLIANCE ADP - DO NOT INSTALL A HR SMITH (TECHNICAL DEVELOPMENTS) CPI SYSTEM SERIES 15-503-134 OR 15-503-134-1 EQUIPPED WITH CONTROL PANEL P/N 503-22-(), BEACON RELEASE UNIT P/N 503-21 AND SYSTEM INTERFACE UNIT P/N 503-24-() OR P/N 503-42-(), EXCLUDING SYSTEM INTERFACE UNIT P/N 503-24-A, OR 503-24-()-A, OR 503-24-G, OR 503-24-()-G, OR 503-42-A OR 503-42-()-A OR 503-42-G OR 503-42-()-G, ON AN AIRCRAFT, UNLESS IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 31-JAN-2014		MOS HRS/MSC AFL	-	07-FEB-2014 4561:51 4299	-		
EASA 2014-0019 PARA (4)	APPLIANCE ADP - REMOVE AFM AMENDMENT AND PLACARD AS REQUIRED BY PARAGRAPH (1) OF THIS AD					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 31-JAN-2014		MOS HRS/MSC AFL	-	07-FEB-2014 4561:51 4299	-		
EASA 2014-0088	APPLIANCE AD - COMMUNICATIONS - COCKPIT VOICE RECORDER - REPLACEMENT					MANDATORY	Not Applicable - BY PN CVR
Eff. Date: 29-APR-2014		MOS HRS/MSC AFL	-	20-MAY-2014 4573:18 4308	-		
EASA 2014-0088 PARA (1)	APPLIANCE ADP - REMOVE THE TEAM CVR P/N AP71232101 OR P/N AP71231101, AS APPLICABLE, FROM THE AIRCRAFT AND, DEPENDING ON OPERATIONAL REGULATIONS, INSTALL A SERVICEABLE CVR IN ACCORDANCE WITH APPROVED AIRCRAFT MODIFICATION INSTRUCTIONS					MANDATORY	Not Applicable - BY PN CVR
Eff. Date: 29-APR-2014		MOS HRS/MSC AFL	-	20-MAY-2014 4573:18 4308	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2014-0088 PARA (2)	APPLIANCE ADP - DO NOT INSTALL ON ANY AIRCRAFT A TEAM CVR P/N AP71232101 OR P/N AP71231101, AS REQUIRED BY PARAGRAPH (2.1) OR (2.2) OF THIS AD, AS APPLICABLE					MANDATORY	Not Applicable - BY PN CVR
Eff. Date: 29-APR-2014		MOS HRS/MSC AFL	-	20-MAY-2014 4573:18 4308	-		
EASA 2014-0095 R01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR - MODIFICATION AIRCRAFT FLIGHT MANUAL - AMENDMENT					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 12-MAY-2014		MOS HRS/MSC AFL	-	02-JUN-2014 4582:32 4317	-		
EASA 2014-0095 R01 PARA (1)	APPLIANCE ADP - INSTALL A PLACARD "DO NOT USE TRANSMIT OVER WATER" NEXT TO THE CPI CONTROL PANEL/AMEND THE AFM OF THE AIRCRAFT					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 12-MAY-2014		MOS HRS/MSC AFL	-	02-JUN-2014 4582:32 4317	-		
EASA 2014-0095 R01 PARA (2)	APPLIANCE ADP - INCORPORATION OF APPENDIX A OF THIS AD INTO THE EMERGENCY PROCEDURES SECTION OF THE AFM OF THE AIRCRAFT IS AN ACCEPTABLE METHOD TO COMPLY WITH THE REQUIREMENT OF PARAGRAPH (1.2) OF THIS AD					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 12-MAY-2014		MOS HRS/MSC AFL	-	02-JUN-2014 4582:32 4317	-		
EASA 2014-0095 R01 PARA (3)	APPLIANCE ADP - REPLACE THE SYSTEM INTERFACE UNIT P/N 503-24-() (INCLUDING 503-24) OR P/N 503-42-() (INCLUDING 503-42) WITH AN IMPROVED PART P/N 503-24-A, OR P/N 503-24-()-A, OR P/N 503-24-G, OR P/N 503-24-()-G, OR P/N 503-42-A OR P/N 503-42-()-A OR P/N 503-42-G OR P/N 503-42-()-G (THAT INCORPORATES AUTOMATIC CPI DEPLOYMENT AFTER MANUAL ACTIVATION) IN ACCORDANCE WITH AN APPROVED AIRCRAFT MAINTENANCE INSTRUCTION					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 31-JAN-2014		MOS HRS/MSC AFL	-	02-JUN-2014 4582:32 4317	-		
EASA 2014-0095 R01 PARA (4)	APPLIANCE ADP - DO NOT INSTALL A HR SMITH (TECHNICAL DEVELOPMENTS) CPI SYSTEM SERIES 15-503-134 OR 15-503-134-1 EQUIPPED WITH CONTROL PANEL P/N 503-22-(), BEACON RELEASE UNIT P/N 503-21 AND SYSTEM INTERFACE UNIT P/N 503-24-() (INCLUDING 503-24) OR P/N 503-42-() (INCLUDING 503-42) EXCLUDING SYSTEM INTERFACE UNIT P/N 503-24-A OR P/N 503-24-()-A OR P/N 503-24-G OR P/N 503-24-()-G OR P/N 503-42-A OR P/N 503-42-()-A OR P/N 503-42-G OR P/N 503-42-()-G ON AN AIRCRAFT UNLESS IN COMPLIANCE WITH THE REQUIREMENTS OF THIS AD					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 12-MAY-2014		MOS HRS/MSC AFL	-	02-JUN-2014 4582:32 4317	-		
EASA 2014-0095 R01 PARA (5)	APPLIANCE ADP - REMOVE THE AFM AMENDMENT AND PLACARD AS REQUIRED BY PARAGRAPH (1) OF THIS AD					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 31-JAN-2014		MOS HRS/MSC AFL	-	02-JUN-2014 4582:32 4317	-		
EASA 2014-0125	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CRASH POSITION INDICATOR SYSTEM - REPLACEMENT; AIRCRAFT FLIGHT MANUAL - AMENDMENT					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 22-MAY-2014		MOS HRS/MSC	-				

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2014-0125 PARA (1)	APPLIANCE ADP - AMEND THE AFM OF AFFECTED AIRCRAFT TO INCORPORATE TEMPORARY CPI SIU OPERATING PROCEDURES BY INSERTING A COPY OF APPENDIX 1 OF THIS AD (OR ITS TEXT) INTO THE APPLICABLE NORMAL PROCEDURES SECTION OF THE AFM	MOS	-			MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 22-MAY-2014		HRS/MSC					
EASA 2014-0125 PARA (2)	APPLIANCE ADP - ACCOMPLISH THE COMPLETE START-UP PROCEDURE/APPLICABLE START-UP PROCEDURE/SHUTDOWN PROCEDURE	MOS	-			MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 22-MAY-2014		HRS/MSC					
EASA 2014-0125 PARA (3)	APPLIANCE ADP - COMPLIANCE WITH THE REQUIREMENTS OF PARAGRAPH (2) OF THIS AD	MOS	-			MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 22-MAY-2014		HRS/MSC					
EASA 2014-0125 PARA (4)	APPLIANCE ADP - REPLACE THE CPI SIU HAVING P/N 503-24 OR P/N 503-24-2 OR P/N 503-24-6 WITH AN IMPROVED UNIT P/N 503-24G OR P/N 503-24-2G OR P/N 503-24-6G IN ACCORDANCE WITH THE APPLICABLE AIRCRAFT DESIGN APPROVAL HOLDER SERVICE INSTRUCTIONS AND, CONCURRENTLY, REMOVE THE TEMPORARY AFM PROCEDURE AS REQUIRED BY PARAGRAPH (2) OF THIS AD	MOS	-			MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 22-MAY-2014		HRS/MSC					
EASA 2014-0125 PARA (5)	APPLIANCE ADP - MODIFICATION OF AN AIRCRAFT AS REQUIRED BY PARAGRAPH (4) OF THIS AD CONSTITUTES TERMINATING ACTION FOR ACCOMPLISHMENT OF THE PROCEDURES AS REQUIRED BY PARAGRAPH (2) OF THIS AD	MOS	-			MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 22-MAY-2014		HRS/MSC					
EASA 2014-0125 PARA (6)	APPLIANCE ADP - FROM THE EFFECTIVE DATE OF THIS AD, INSTALLATION ON AN AIRCRAFT OF AN HR SMITH (TECHNICAL DEVELOPMENTS) CPI SYSTEM SERIES 15-503-134-1 EQUIPPED WITH BRU P/N 503-21-1 AND SIU P/N 503-24 OR P/N 503-24-2 OR P/N 503-24-6 IS ALLOWED, PROVIDED THE AIRCRAFT IS OPERATED IN COMPLIANCE WITH THE PROCEDURES AS REQUIRED BY THIS AD	MOS	-			MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 22-MAY-2014		HRS/MSC					
EASA 2014-0125 PARA (7)	APPLIANCE ADP - AFTER REPLACEMENT OF THE CPI SIU ON AN AIRCRAFT AS REQUIRED BY PARAGRAPH (4) OF THIS AD, DO NOT INSTALL AN SIU P/N 503-24 OR P/N 503-24-2 OR P/N 503-24-6 ON THE CPI SYSTEM OF THAT AIRCRAFT	MOS	-			MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 22-MAY-2014		HRS/MSC					
EASA 2014-0142 R01	APPLIANCE AD - OXYGEN OXYGEN MASK REGULATOR INFLATABLE HARNESS / INFLATION HOSE IDENTIFICATION / REPLACEMENT	MOS	-		30-JAN-2015	MANDATORY	Not Applicable - CREW OXYGEN MASKS WITH PN MC10-16-100 ARE INSTALLED
Eff. Date: 18-JUN-2014		HRS/MSC			4675:30		
		AFL			4392		
EASA 2014-0142 R01 PARA (1)	APPLIANCE ADP - ACCOMPLISH ACCOMPLISH THE ACTIONS AS SPECIFIED IN PARAGRAPHS (1.1) AND (1.2) OF THIS AD - DETERMINE THE DATE OF MANUFACTURING / REPLACE THE HARNESS INFLATION HOSE P/N 445186 OR P/N 445952, AS APPLICABLE, WITH A SERVICEABLE PART, OR REMOVE THE INFLATABLE HARNESS FROM THE MASK REGULATOR AND REPLACE IT WITH A SERVICEABLE HARNESS	MOS	-		30-JAN-2015	MANDATORY	Not Applicable - CREW OXYGEN MASKS WITH PN MC10-16-100 ARE INSTALLED
Eff. Date: 18-JUN-2014		HRS/MSC			4675:30		
		AFL			4392		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2014-0142 R01 PARA (2)	APPLIANCE ADP - ACCOMPLISH AN OXYGEN MASK REGULATOR EQUIPPED WITH A P/N MXH20-1 OR P/N MXH21-1 INFLATABLE HARNESS HAVING A DMF CODE OF NOVEMBER 2008 (0845-S OR 08/45-S) OR EARLIER, AND THOSE WITH A DMF OF JANUARY 2011 (1101-S OR 11/01-S) OR LATER, IS EXCLUDED FROM THE INSPECTION AND REPLACEMENT REQUIREMENTS OF PARAGRAPH (1) OF THIS AD					MANDATORY	Not Applicable - CREW OXYGEN MASKS WITH PN MC10-16-100 ARE INSTALLED
Eff. Date: 18-JUN-2014		MOS HRS/MSC AFL	-		30-JAN-2015 4675:30 4392		
EASA 2014-0142 R01 PARA (3)	APPLIANCE ADP - ACCOMPLISH IT IS ALLOWED TO INSTALL ON AN AEROPLANE A FLIGHT CREW OXYGEN MASK REGULATOR, HAVING A P/N AS IDENTIFIED IN SECTION 1.A.(1) OF ZODIAC AEROTECHNICS SB MC10-35-274, PROVIDED IT HAS BEEN DETERMINED THAT A P/N MXH21-31 INFLATABLE HARNESS IS INSTALLED, OR THAT THE P/N MXH20-1 OR P/N MXH21-1 INFLATABLE HARNESS INSTALLED ON THAT FLIGHT CREW OXYGEN MASK REGULATOR HAS BEEN CORRECTED, AS REQUIRED BY THIS AD					MANDATORY	Not Applicable - CREW OXYGEN MASKS WITH PN MC10-16-100 ARE INSTALLED
Eff. Date: 18-JUN-2014		MOS HRS/MSC AFL	-		30-JAN-2015 4675:30 4392		
EASA 2014-0187	APPLIANCE AD - EQUIPMENT & FURNISHINGS – SAFETY BELT ATTACHMENT BOLTS – INSPECTION / REPLACEMENT					MANDATORY	Not Applicable - BY P/N
Eff. Date: 03-SEP-2014		MOS HRS/MSC	-				
EASA 2014-0279	APPLIANCE AD - EQUIPMENT / FURNISHING - RESTRAINT SYSTEM ROTARY BUCKLE SUBASSEMBLY - IDENTIFICATION / REPLACEMENT					MANDATORY	Not Applicable
Eff. Date: 02-JAN-2015		MOS HRS/MSC	-				
EASA 2014-0279 PARA (1)	APPLIANCE ADP - INSPECT THE LABEL OF THE ROTARY BUCKLE SUB-ASSEMBLY TO DETERMINE ITS PART NUMBER (P/N) AND SERIAL NUMBER (S/N)					MANDATORY	Not Applicable
Eff. Date: 02-JAN-2015		MOS HRS/MSC	-				
EASA 2014-0279 PARA (1.1)	APPLIANCE ADP - REPLACE THE ROTARY BUCKLE SUB-ASSEMBLY WITH A SERVICEABLE PART					MANDATORY	Not Applicable
Eff. Date: 02-JAN-2015		MOS HRS/MSC	-				
EASA 2014-0279 PARA (1.2)	APPLIANCE ADP - MARK THE SEAT AS "INOPERATIVE" UNTIL REPLACEMENT OF THE ROTARY BUCKLE SUB-ASSEMBLY AS REQUIRED BY PARAGRAPH (2) OF THIS AD					MANDATORY	Not Applicable
Eff. Date: 02-JAN-2015		MOS HRS/MSC	-				
EASA 2014-0279 PARA (2)	APPLIANCE ADP - REPLACE EACH ROTARY BUCKLE SUB-ASSEMBLY HAVING A P/N AND S/N AS SPECIFIED IN ROMTEX ANJOU AERONAUTIQUE SB 358SB-14-101 WITH A SERVICEABLE PART					MANDATORY	Not Applicable
Eff. Date: 02-JAN-2015		MOS HRS/MSC	-				
EASA 2014-0279 PARA (3)	APPLIANCE ADP - DO NOT INSTALL:- ON ANY RESTRAINT SYSTEM A SPARE ROTARY BUCKLE SUB-ASSEMBLY, OR- ON ANY AIRCRAFT A RESTRAINT SYSTEM EQUIPPED WITH A ROTARY BUCKLESUB-ASSEMBLY HAVING A P/N AND A S/N LISTED IN ROMTEX ANJOU AERONAUTIQUE SB 358SB-14-101, UNLESS THE SUB-ASSEMBLY HAS BEEN REPAIRED,					MANDATORY	Not Applicable
Eff. Date: 02-JAN-2015		MOS HRS/MSC	-				

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As
Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2015-0093	APPLIANCE AD - NAVIGATION ATTITUDE HEADING REFERENCE SYSTEM MODIFICATION / REPLACEMENT	MOS	-			MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 10-JUN-2015		HRS/MSC					
EASA 2015-0093 PARA (1)	APPLIANCE ADP - AMEND THE AFM OF THE AIRCRAFT BY INSERTING A TEMPORARY REVISION (TR) TO THE AFM (SUPPLEMENT)	DAYS	-	30-JUN-2015		MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 10-JUN-2015		HRS/MSC		4794:57			
		AFL		4515			
EASA 2015-0093 PARA (2)	APPLIANCE ADP - MODIFY THE AIRCRAFT BY REPLACING EACH AHRS UNIT HAVING A P/N SPECIFIED AS 'OLD' IN TABLE 2 OF THIS AD WITH A MODIFIED UNIT, HAVING A P/N SPECIFIED AS 'NEW' IN TABLE 2 OF THIS AD	MOS	-	30-JUN-2015		MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 10-JUN-2015		HRS/MSC		4794:57			
		AFL		4515			
EASA 2015-0093 PARA (3)	APPLIANCE ADP - CONCURRENT WITH MODIFICATION OF AN AIRCRAFT AS REQUIRED BY PARAGRAPH (2) OF THIS AD, THE AFM CHANGE, IF REQUIRED BY PARAGRAPH (1) OF THIS AD (SEE NOTE 1 OF THIS AD), CAN BE REMOVED FROM THAT AIRCRAFT	MOS	-			MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 10-JUN-2015		HRS/MSC					
EASA 2015-0093 PARA (4)	APPLIANCE ADP - DO NOT INSTALL ON ANY AIRCRAFT A LCR-100 AHRS UNIT, HAVING A P/N SPECIFIED AS 'OLD' IN TABLE 1 OF THIS AD	MOS	-			MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 10-JUN-2015		HRS/MSC					
EASA 2016-0024	APPLIANCE AD - FIRE PROTECTION - OPTICAL AND AMBIENT SMOKE DETECTORS - IDENTIFICATION / REPLACEMENT	MOS	-	08-FEB-2016		MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 01-FEB-2016		HRS/MSC		4915:07			
		AFL		4609			
EASA 2016-0024 PARA (1)	APPLIANCE ADP - INSPECT EACH SIEMENS SMOKE DETECTOR TO DETERMINE WHETHER IT IS AN AFFECTED PART	MOS	-	08-FEB-2016		MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 01-FEB-2016		HRS/MSC		4915:07			
		AFL		4609			
EASA 2016-0024 PARA (2.1)	APPLIANCE ADP - REPLACE CARGO COMPARTMENT SMOKE DETECTORS, IDENTIFIED IN PARAGRAPH (1), IN ACCORDANCE WITH TABLE 1 OR TABLE 2	MOS	-	08-FEB-2016		MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 01-FEB-2016		HRS/MSC		4915:07			
		AFL		4609			
EASA 2016-0024 PARA (2.2)	APPLIANCE ADP - REPLACE PASSENGER, CABIN OR ANY OTHER ON BOARD LOCATION SMOKE DETECTORS, IDENTIFIED IN PARAGRAPH (1), IN ACCORDANCE WITH TABLE 3	MOS	-	08-FEB-2016		MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 01-FEB-2016		HRS/MSC		4915:07			
		AFL		4609			

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2016-0024 PARA (2.3)	APPLIANCE ADP - REPLACE REPAIRED SMOKE DETECTOR IDENTIFIED IN APPENDIX 1					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 01-FEB-2016		MOS		08-FEB-2016			
		HRS/MSC	-	4915:07	-		
		AFL		4609			
EASA 2016-0024 PARA (3)	APPLIANCE ADP - FROM THE EFFECTIVE DATE OF THIS AD, DO NOT INSTALL ON ANY AEROPLANE AN AFFECTED P/N SMOKE DETECTOR UNLESS THE UNIT (GMC ONLY) IS MARKED 'SIL PMC-26-002'					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 01-FEB-2016		MOS		08-FEB-2016			
		HRS/MSC	-	4915:07	-		
		AFL		4609			
EASA 2016-0044	APPLIANCE AD - ATA 26 - FIRE PROTECTION - ENGINE AND AUXILIARY POWER UNIT AUTOMATIC FIRE EXTINGUISHERS - INSPECTION/OVERHAUL					MANDATORY	Not Applicable - BY PN FIRE EXTINGUISHER
Eff. Date: 22-MAR-2016		MOS		29-FEB-2016			
		HRS/MSC	-	4940:20	-		
		AFL		4631			
EASA 2016-0044 PARA (1)	APPLIANCE ADP - INSPECT EACH FIRE EXTINGUISHER, EXCEPT THOSE HAVING P/N 57333 SERIES, INSTALLED ON BAE146 AND RJ AEROPLANES, AND THOSE HAVING P/N57183 SERIES, INSTALLED ON ATP AEROPLANES, AND DEPENDING ON FINDINGS, ACCOMPLISH CORRECTIVE ACTIONS IN ACCORDANCE WITH THE INSTRUCTIONS OF KG SB 26-080 REVISION 1					MANDATORY	Not Applicable - BY PN FIRE EXTINGUISHER
Eff. Date: 22-MAR-2016		MOS		29-FEB-2016			
		HRS/MSC	-	4940:20	-		
		AFL		4631			
EASA 2016-0044 PARA (2)	APPLIANCE ADP - ACCOMPLISHMENT OF AN OVERHAUL (SEE NOTE 2 OF THIS AD) OF A FIRE EXTINGUISHER BY KIDDE GRAVINER OR HUGEN, OR IN ACCORDANCE WITH THE INSTRUCTIONS OF KG SIL 01-10 OR IN ACCORDANCE WITH KG CMM 26-21-40 REVISION 14 OR LATER OR KG CMM 26-21-52 REVISION 13 OR LATER (AS APPLICABLE TO FIRE EXTINGUISHER P/N) IS ACCEPTABLE TO COMPLY WITH THE REQUIREMENT OF PARAGRAPH (1).					MANDATORY	Not Applicable - BY PN FIRE EXTINGUISHER
Eff. Date: 22-MAR-2016		MOS		29-FEB-2016			
		HRS/MSC	-	4940:20	-		
		AFL		4631			
EASA 2016-0044 PARA (3)	APPLIANCE ADP - FROM THE EFFECTIVE DATE OF THIS AD DO NOT INSTALL ON ANY AIRCRAFT AN AFFECTED FIRE EXTINGUISHER, UNLESS IT IS NEW, OR HAS PASSED AN INSPECTION IN ACCORDANCE WITH THE INSTRUCTIONS OF KG SB 26-080 REVISION 1, OR IT HAS BEEN OVERHAULED (SEE NOTE 2) BY KG, OR BY HUGEN OR IN ACCORDANCE WITH THE INSTRUCTIONS OF KG SIL 01-10 OR IN ACCORDANCE WITH THE INSTRUCTIONS OF KG CMM 26-21-40 REVISION 14, OR OF KG CMM 26-21-52 REVISION 13, AS APPLICABLE TO FIRE EXTINGUISHER P/N					MANDATORY	Not Applicable - BY PN FIRE EXTINGUISHER
Eff. Date: 22-MAR-2016		MOS		29-FEB-2016			
		HRS/MSC	-	4940:20	-		
		AFL		4631			
EASA 2019-0235	APPLIANCE AD - EQUIPMENT / FURNISHINGS - EMERGENCY LOCATOR TRANSMITTER - INSPECTION / MODIFICATION / REPLACEMENT					MANDATORY	Complied With - WORKS PERFORMED I.A.W. CESSNA 56X MM.
Eff. Date: 04-OCT-2019		MOS		13-DEC-2019			
		HRS/MSC	-	5416	-		
		AFL		4960			



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2019-0235 PARA (1)	THRU (APPLIANCE ADP - CONCURRENTLY ACCOMPLISH PARAS (1.1) AND (1.2) OF THIS AD AND ACCOMPLISH APPLICABLE CORRECTIVE ACTION(S) (IF, DISCREPANCIES ARE DETECTED, AS IDENTIFIED IN THE SIL); OPERATORS MAY CONTINUE TO USE ELTS WITH THE ORIGINAL G-SWITCHES BY REDUCING THE INTERVAL OF THE G-SWITCH TESTING, AS REQUIRED BY PARA (1.1)					MANDATORY	Complied With - WORKS PERFORMED I.A.W. CESSNA 56XMM
Eff. Date: 04-OCT-2019		DAYS HRS/MSC AFL	-	13-DEC-2019 5416 4960	-		
EASA 2019-0235 PARA (5)	APPLIANCE ADP - REMOVE THE AFFECTED PART FROM SERVICE IAW THE INSTRUCTIONS OF SECTION 7 OF THE SB FOR THE PURPOSE OF IN-SHOP MODIFICATION					MANDATORY	Not Applicable
Eff. Date: 04-OCT-2019		MOS HRS/MSC AFL	-	13-DEC-2019 5416 4960	-		
EASA 2019-0235 PARA (6)	APPLIANCE ADP - IN-SHOP CORRECTION OF AN AFFECTED PART OR MODIFICATION INTO A SERVICEABLE PART IAW THE INSTRUCTIONS OF THE SB CONSTITUTES TERMINATING ACTION FOR THE REPETITIVE INSPECTIONS AND TESTING AS REQUIRED BY THIS AD FOR THAT PART					MANDATORY	Not Applicable
Eff. Date: 04-OCT-2019		MOS HRS/MSC AFL	-	13-DEC-2019 5416 4960	-		
EASA 2019-0235 PARA (9)	APPLIANCE ADP - DO NOT INSTALL ON ANY AIRCRAFT AN AFFECTED PART THAT HAS ACCUMULATED 10 YEAR TIS OR MORE					MANDATORY	Not Applicable
Eff. Date: 04-OCT-2019		MOS HRS/MSC AFL	-	13-DEC-2019 5416 4960	-		
EASA 2025-0297	APPLIANCE AD - OXYGEN - PORTABLE BREATHING EQUIPMENT - REMOVAL FROM SERVICE					MANDATORY	Not Applicable - AS PER MANUFACTURER
Eff. Date: 06-JAN-2026		MOS HRS/MSC AFL	-	07-JAN-2026 8981:14 7250	-		
EASA 2025-0297 PARA (1)	APPLIANCE ADP - REPLACE THE AFFECTED PBE WITH A PBE NOT AFFECTED BY THIS AD					MANDATORY	Not Applicable - AS PER MANUFACTURER
Eff. Date: 06-JAN-2026		DAYS HRS/MSC AFL	-	07-JAN-2026 8981:14 7250	-		
EASA 2025-0297 PARA (2)	APPLIANCE ADP - ACCOMPLISHMENT OF THE ACTION AS REQUIRED BY PARA (1) OF THIS AD CAN BE DEFERRED IN ACCORDANCE WITH THE APPLICABLE INSTRUCTIONS AND LIMITATIONS OF THE APPLICABLE AIRCRAFT MMEL ITEMS, PROVIDED THAT THOSE MMEL ITEMS ARE INCLUDED IN THE OPERATOR APPROVED MEL, AND THAT THE MINIMUM REQUIRED INSTALLED PBES ARE CONFIRMED NOT AFFECTED BY THIS AD					MANDATORY	Not Applicable - AS PER MANUFACTURER
Eff. Date: 06-JAN-2026		MOS HRS/MSC AFL	-	07-JAN-2026 8981:14 7250	-		
EASA 2025-0297 PARA (3)	APPLIANCE ADP - PART INSTALLATION: STARTING FROM THE APPLICABILITY DATE AS IDENTIFIED IN TABLE 1 OF THIS AD, AS APPLICABLE, DEPENDING ON PBE LOCATION, DO NOT INSTALL AN AFFECTED PBE ON ANY AIRCRAFT					MANDATORY	Not Applicable - AS PER MANUFACTURER
Eff. Date: 06-JAN-2026		DAYS HRS/MSC AFL	-	07-JAN-2026 8981:14 7250	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
EASA 2025-0297 PARA (4)	APPLIANCE ADP - LIFE LIMIT: REMOVE FROM SERVICE					MANDATORY	Not Applicable - AS PER MANUFACTURER
Eff. Date: 06-JAN-2026		MOS			07-JAN-2026		
		HRS/MSC	-		8981:14	-	
		AFL			7250		
EASA 2025-0297 R01	APPLIANCE AD - OXYGEN - PORTABLE BREATHING EQUIPMENT - REMOVAL FROM SERVICE					MANDATORY	Not Applicable - AS PER S/N
Eff. Date: 06-JAN-2026		MOS			13-MAR-2026		
		HRS/MSC	-		9018:28	-	
		AFL			7267		
EASA 2025-0297 R01 PARA (1)	APPLIANCE ADP - REPLACE THE AFFECTED PBE WITH A PBE NOT AFFECTED BY THIS AD					MANDATORY	Not Applicable
Eff. Date: 06-JAN-2026		DAYS			13-MAR-2026		
		HRS/MSC	-		9018:28	-	
		AFL			7267		
EASA 2025-0297 R01 PARA (2)	APPLIANCE ADP - ACCOMPLISHMENT OF THE ACTION AS REQUIRED BY PARA (1) OF THIS AD CAN BE DEFERRED IN ACCORDANCE WITH THE APPLICABLE INSTRUCTIONS AND LIMITATIONS OF THE APPLICABLE AIRCRAFT MMEL ITEMS, PROVIDED THAT THOSE MMEL ITEMS ARE INCLUDED IN THE OPERATOR APPROVED MEL, AND THAT THE MINIMUM REQUIRED INSTALLED PBES ARE CONFIRMED NOT AFFECTED BY THIS AD					MANDATORY	Not Applicable
Eff. Date: 06-JAN-2026		MOS			13-MAR-2026		
		HRS/MSC	-		9018:28	-	
		AFL			7267		
EASA 2025-0297 R01 PARA (3)	APPLIANCE ADP - PART INSTALLATION: STARTING FROM THE APPLICABILITY DATE AS IDENTIFIED IN TABLE 1 OF THIS AD, AS APPLICABLE, DEPENDING ON PBE LOCATION, DO NOT INSTALL AN AFFECTED PBE ON ANY AIRCRAFT					MANDATORY	Not Applicable
Eff. Date: 06-JAN-2026		DAYS			13-MAR-2026		
		HRS/MSC	-		9018:28	-	
		AFL			7267		
EASA 2025-0297 R01 PARA (4)	APPLIANCE ADP - LIFE LIMIT: REMOVE FROM SERVICE					MANDATORY	Not Applicable
		MOS			13-MAR-2026		
		HRS/MSC	-		9018:28	-	
		AFL			7267		
FAA 1974-20-10	APPLIANCE AD - EQUIPMENT AND FURNISHINGS - TO PREVENT CHEMICAL CORROSION RESULTING IN EITHER FAILURE OF THE EMERGENCY LOCATOR TRANSMITTER (ELT) TO OPERATE OR INADVERTENT ACTIVATION, JAMMING THE EMERGENCY FREQUENCIES OF 121.5 MHZ AND 243.0 MHZ					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 30-DEC-1977		DAYS			08-FEB-2019		
		HRS/MSC	-		5066:42	-	
		AFL			4739		
FAA 1995-22-01	APPLIANCE AD - AEROSPACE LIGHTING POWER UNIT					MANDATORY	Complied With - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS			17-FEB-2002		
		HRS/MSC	A/R		17	-	
		AFL					
FAA 1997-05-03 R01	APPLIANCE AD - GNX-XLS AND GNS-XL GPS					MANDATORY	Complied With - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS			17-FEB-2002		
		HRS/MSC	A/R		17	-	
		AFL					

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 1998-25-10	APPLIANCE AD - AIRCRAFT BELT INSPECTION					MANDATORY	Complied With - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS HRS/MSC AFL	A/R		17-FEB-2002 17	-	
FAA 2002-13-07	APPLIANCE AD - HONEYWELL, INC. PART NUMBER HG1075AB05 AND HG1075GB05					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 09-AUG-2002		MOS HRS/MSC AFL	-		08-FEB-2019 5066:42 4739	-	
FAA 2002-14-19	APPLIANCE AD - ROCKWELL COLLINS, INC. ADC-85, ADC-85A, ADC-850D, AND ADC-850F AIR DATA COMPUTERS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 23-AUG-2002		MOS HRS/MSC AFL	-		08-FEB-2019 5066:42 4739	-	
FAA 2002-20-09	APPLIANCE AD - ROCKWELL COLLINS, INC. AFD-3010 ADAPTIVE FLIGHT DISPLAY UNITS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 12-NOV-2002		MOS HRS/MSC AFL	-		08-FEB-2019 5066:42 4739	-	
FAA 2002-22-13	APPLIANCE AD - NAVIGATION - REPLACEMENT OF ROCKWELL COLLINS FMC-4200, FMC-5000 AND FMC-6000 COMPUTERS TO PREVENT THE FMC FROM RETAINING ORIGINAL INFORMATION WHEN AN EDIT IS MADE TO A PROCEDURE OR FLIGHT PLAN						Not Applicable - COMPONENTS NOT INSTALLED
		MOS HRS/MSC AFL	-		08-FEB-2019 5066:42 4739	-	
FAA 2003-04-06	APPLIANCE AD - HONEYWELL PRIMUS RNZ-850/851 NM					SUPERSEDED	Complied With
		MOS HRS/MSC	A/R		09-MAY-2003 641	-	
FAA 2003-26-14	APPLIANCE AD - KIDDE AEROSPACE HAND HELD BOTTLE					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
		MOS HRS/MSC AFL	A/R		08-FEB-2019 5066:42 4739	-	
FAA 2005-11-05	APPLIANCE AD - VACUUM - REPLACE THE AIRPLANE FLIGHT MANUAL SUPPLEMENT (AFMS) IN THE AIRPLANE FLIGHT MANUAL WITH THE APPROPRIATE REVISION AND INSTALL PLACARDS AS DEFINED IN THE AFMS, UPGRADE THE MODEL SVS I OR SVS IA SVS TO THE MODEL VI SVS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 18-JUL-2005		MOS HRS/MSC AFL	-		08-FEB-2019 5066:42 4739	-	
FAA 2005-11-05 PARA (1)	APPLIANCE ADP - INCORPORATE THE AIRPLANE FLIGHT MANUAL SUPPLEMENT (AFMS) IN THE AIRPLANE FLIGHT MANUAL WITH THE APPROPRIATE REVISION IN THE FAA-APPROVED AIRPLANE FLIGHT MANUAL (AFM).					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 18-JUL-2005		MOS HRS/MSC AFL	-		08-FEB-2019 5066:42 4739	-	

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2005-11-05 PARA (2)	APPLIANCE ADP - INSTALL PLACARDS DESCRIBED IN THE AFMS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 18-JUL-2005		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2005-11-05 PARA (3)	APPLIANCE ADP - UPGRADE THE MODEL SVS I OR SVS IA SVS TO THE MODEL VI SVS, INSTALL THE APPROPRIATE PLACARDS, AND ADD THE INSTALLATION REPORT INCLUDING THE INSTRUCTIONS FOR CONTINUED AIRWORTHINESS (ICA) TO THE MAINTENANCE SCHEDULE FOR THE AIRCRAFT.					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 18-JUL-2005		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2006-04-04	APPLIANCE AD - IDENTIFY AND PROVIDE CORRECTIVE ACTION FOR A POTENTIALLY INOPERATIVE SMOKE DETECTOR AND TO ENSURE THAT THE FLIGHTCREW IS ALERTED IN THE EVENT OF A FIRE.					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 24-MAR-2006		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2006-16-18	APPLIANCE AD - SANDEL AVI MOD ST3400 TAWS/RM					MANDATORY	Not Applicable - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
Eff. Date: 17-OCT-2006		MOS HRS/MSC	A/R	10-OCT-2006 2842	-		
FAA 2006-19-04	APPLIANCE AD - HONEYWELL RCZ COMM & XPDRS					MANDATORY	Not Applicable - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
Eff. Date: 17-OCT-2006		MOS HRS/MSC	A/R	10-OCT-2006 2842	-		
FAA 2006-22-05	APPLIANCE AD - HONEYWELL PRIMUS RNZ-850/851 NM					MANDATORY	Not Applicable - NOT APPLICABLE
Eff. Date: 01-DEC-2006		MOS HRS/MSC	A/R	12-JAN-2007 2959	-		
FAA 2007-19-12	APPLIANCE AD - SICMA AERO SEATS - 50XXX					AIRWORTHINESS	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 26-OCT-2007		MOS HRS/MSC AFL	A/R	08-FEB-2019 5066:42 4739	-		
FAA 2007-19-13	APPLIANCE AD - B/E AEROSPACE SKYLUXE SEATS					AIRWORTHINESS	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 03-OCT-2007		MOS HRS/MSC AFL	A/R	08-FEB-2019 5066:42 4739	-		
FAA 2007-26-11	APPLIANCE AD - HIGH-PRESSURE OXYGEN CYLINDER TEARING WITH SUDDEN EMPTYING					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
		MOS HRS/MSC AFL	A/R	08-FEB-2019 5066:42 4739	-		



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2008-02-06	APPLIANCE AD - AUTO FLIGHT - INSPECT THE GSM 85 SERVO GEARBOX FOR FOREIGN OBJECT DEBRIS AND RETURN THE UNIT TO THE MANUFACTURER FOR REPLACEMENT IF YOU FIND DEBRIS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 26-FEB-2008		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2008-02-06 PARA (E)(1)	APPLIANCE ADP - CHECK THE SERIAL TAG OF THE INSTALLED GSM 85 SERVO GEARBOX UNIT TO DETERMINE THE MOD LEVEL					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 26-FEB-2008		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2008-02-06 PARA (E)(2)	APPLIANCE ADP - INSPECT THE SERVO GEARBOX FOR FOREIGN OBJECT DEBRIS (IF THE SERIAL TAG ON THE GSM 85 SERVO GEARBOX FOR P/NS SPECIFIED IN PARA (E)(1) IS NOT MARKED AT MOD LEVEL 1 OR MOD LEVEL 3)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 26-FEB-2008		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2008-02-06 PARA (E)(3)	APPLIANCE ADP - REMOVE AND RETURN THE GSM 85 SERVO GEARBOX TO THE MANUFACTURER FOR REPLACEMENT (IF FOREIGN OBJECT DEBRIS IS FOUND DURING THE INSPECTION REQUIRED IN PARA (E)(2))					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 26-FEB-2008		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2009-05-05	APPLIANCE AD - INDICATING AND RECORDING - CHECK OF THE MAINTENANCE RECORDS AND INSPECTION OF THE PFD (IF NECESSARY) TO DETERMINE IF AN AFFECTED SERIAL NUMBER PFD IS INSTALLED AND INCORPORATE (IF NECESSARY) OPERATIONAL LIMITATIONS.					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 03-APR-2009		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2009-05-05 PARA (F)(1)	APPLIANCE ADP - INCORPORATE THE OPERATIONAL LIMITATIONS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 03-APR-2009		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2009-05-05 PARA (F)(2)	APPLIANCE ADP - INSPECT FOR A LABEL MARKED "DEVIATION 08-19A" ON THE EXTERIOR OF THE PFD NEAR THE TSO LABEL OR A "MOD 52" MARKING.					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 03-APR-2009		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2009-05-05 PARA (F)(3)	APPLIANCE ADP - REMOVE REMOVE THE LIMITATIONS REQUIRED BY PARA (F)(1) AND AD 2008-06-28 R1 (IF PFD PASSES THE TEST REQUIRED IN PARAGRAPH (F)(2)(II))					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 03-APR-2009		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2009-05-05 PARA (F)(4)	APPLIANCE ADP - REMOVE THE PFD, INSTALL A PFD THAT HAS PASSED THE AIR DATA SYSTEM PERFORMANCE VERIFICATION TEST AND REMOVE THE LIMITATIONS REQUIRED BY PARA (F)(1)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 03-APR-2009		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2009-05-08	APPLIANCE AD - NAVIGATION - UPGRADE THE SYSTEM SOFTWARE OF ANY TRIMBLE OR FREEFLIGHT SYSTEMS 2101 I/O APPROACH PLUS GPS NAVIGATION SYSTEM, PART NUMBER (P/N) 81440-XX-241E, 81440-XX-241F, OR 81440-XX-241G					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 20-APR-2009		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2009-08-01	APPLIANCE AD - NAVIGATION - IDENTIFY AFFECTED COMPUTERS BY PART NUMBER AND SOFTWARE MODIFICATION LEVEL AND REVISE THE LIMITATIONS SECTION OF APPLICABLE AIRPLANE FLIGHT MANUALS & UPGRADING NEW SOFTWARE					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 14-MAY-2009		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2009-08-01 PARA (F)	APPLIANCE ADP - DETERMINE IF THE INSTALLED NZ-2000 NAVIGATION COMPUTERS AND IC-800 OR IC-800E INTEGRATED AVIONICS COMPUTERS SERVING FMSS HAVE COMPUTER PART NUMBERS AND SOFTWARE MODIFICATION LEVELS IDENTIFIED IN HONEYWELL TECHNICAL NEWSLETTER A23-6111-008 R1					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 18-APR-2007		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2009-08-01 PARA (G)	APPLIANCE ADP - REVISE THE LIMITATIONS SECTION OF THE APPLICABLE AFM					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 18-APR-2007		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2009-08-01 PARA (H)	APPLIANCE ADP - UPGRADE THE APPLICABLE SOFTWARE AS SPECIFIED IN TABLE 2 OF THIS AD					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 14-MAY-2009		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2009-21-10 R01	APPLIANCE AD - INSPECT TO DETERMINE THE SERIAL NUMBER OF THE OXYGEN CYLINDER ASSEMBLIES INSTALLED IN THE AIRPLANE					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 17-DEC-2009		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2010-01-03	APPLIANCE AD - IDENTIFY AND REMOVE FROM SERVICE ALL AFFECTED FIRE EXTINGUISHERS AND REPLACE WITH SERVICABLE UNITS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 20-JAN-2010		MOS HRS/MSC AFL	A/R	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2010-02-06	APPLIANCE AD - EQUIPMENT/FURNISHINGS - INSPECTIONS / REPLACEMENT OF CENTRAL SPREADERS, ALL APPLICABLE CORRECTIVE ACTIONS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 24-FEB-2010		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2010-02-06 PARA (F)(1)	APPLIANCE ADP - PERFORM A VISUAL INSPECTION OF CENTRAL SPREADERS, P/N 92-000100-200-1 AND P/N 92-000101-200-1, OF THE AFFECTED SEATS / REPEAT (IF NO CRACK IS FOUND)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 24-FEB-2010		MOS HRS/MSC AFL	500	08-FEB-2019 5066:42 4739	-		
FAA 2010-02-06 PARA (F)(1)(I)	APPLIANCE ADP - CHECK THE CRACK TO DETERMINE THAT IT DID NOT ENLARGE TO A TYPE 2 OR TYPE 3 CRACK (IF A TYPE 1 CRACK IS FOUND)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 24-FEB-2010		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2010-02-06 PARA (F)(1)(II)	APPLIANCE ADP - REPLACE THE AFFECTED CENTRAL SPREADER WITH A NEW ONE WITH THE SAME PART NUMBER, EQUIPPED WITH DOUBLERS, P/N 00-6536 (IF A TYPE 2 OR 3 CRACK IS FOUND)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 24-FEB-2010		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2010-02-06 PARA (F)(1)(III)	APPLIANCE ADP - ACCOMPLISH TEMPORARY REPAIR BY INSTALLING DOUBLERS, P/N 00-6536 (IF A NEW SPREADER IS UNAVAILABLE)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 24-FEB-2010		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2010-02-06 PARA (F)(2)	APPLIANCE ADP - INSTALL DOUBLERS, P/N 00-6536, ON NEW CENTRAL SPREADERS OF AFFECTED SEATS (IF ALREADY NOT DONE)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 24-FEB-2010		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2010-04-16	APPLIANCE AD - TYPE H1-10 AIR HALON 1211 (BCF) PORTABLE FIRE EXTINGUISHERSMANUFACTURED BY SICLI					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 08-MAR-2010		MOS HRS/MSC AFL	A/R	08-FEB-2019 5066:42 4739	-		
FAA 2010-04-16 PARA (G)	APPLIANCE ADP - REPLACE TYPE H1-10 AIR HALON 1211 (BCF) PORTABLE FIRE EXTINGUISHERSMANUFACTURED BY SICLI WITH SERVICABLE UNIT					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 08-MAR-2010		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2010-04-16 PARA (H)	APPLIANCE ADP - RETURN TYPE H1-10 AIR HALON 1211 (BCF) PORTABLE FIRE EXTINGUISHERSMANUFACTURED BY SICLI THE AFFECTED FIRE EXTINGUISHER TO MANUFACTURER					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 08-MAR-2010		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2010-09-04	APPLIANCE AD - NAVIGATION - REVISE THE LIMITATIONS SECTION OF THE APPLICABLE AFM					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 14-MAY-2010		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2010-11-05	APPLIANCE AD - INSPECT FOR AND REMOVE SUBSTANDARD OXYGEN CYLINDERS FROM AIRPLANE					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 06-JUL-2010		DAYS HRS/MSC AFL	A/R	08-FEB-2019 5066:42 4739	-		
FAA 2011-21-08	APPLIANCE AD - EQUIPMENT/FURNISHINGS - TO IDENTIFY AND CORRECT AN UNSAFE CONDITION FOR SICMA AERO SEAT 88XX, 89XX, 90XX, 91XX, 92XX, 93XX, 95XX, AND 96XX SERIES PASSENGER SEAT ASSEMBLIES					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 23-NOV-2011		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2011-21-08 PARA (F)(1)	APPLIANCE ADP - GENERAL VISUAL INSPECTION OF THE BACKREST LINKS HAVING P/NS 90-000200-104-1 AND 90-000200-104-2					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 23-NOV-2011		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2011-21-08 PARA (F)(2)	APPLIANCE ADP - REPLACE BOTH BACKREST LINKS OF THE AFFECTED SEAT WITH NEW, IMPROVED BACKREST LINKS HAVING P/NS 90-100200-104-1 AND 90-100200-104-2 (IF, DURING THE INSPECTION REQUIRED BY PARA (F)(1), CRACKING IS FOUND BETWEEN THE SIDE OF THE BACKREST LINK AND THE LOCK-OUT PIN HOLE BUT THE CRACKING DOES NOT PASS THIS LOCK-OUT PIN HOLE)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 23-NOV-2011		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2011-21-08 PARA (F)(3)	APPLIANCE ADP - REPLACE BOTH BACKREST LINKS OF THE AFFECTED SEAT WITH NEW, IMPROVED BACKREST LINKS HAVING P/NS 90-100200-104-1 AND 90-100200-104-2 (IF, DURING THE INSPECTION REQUIRED BY PARA (F)(1), CRACKING IS FOUND THAT PASSES BEYOND THE LOCK-OUT PIN HOLE)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 23-NOV-2011		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2011-21-08 PARA (F)(5)	APPLIANCE ADP - REPLACE THE LINKS, P/NS 90-000200-104-1 AND 90-000200-104-2, WITH NEW IMPROVED LINKS, P/NS 90-100200-104-1 AND 90-100200-104-2 (IF NO CRACKING IS FOUND DURING THE INSPECTION REQUIRED BY PARA (F)(1))					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 23-NOV-2011		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-02-08	APPLIANCE AD - AVIATION COMMUNICATIONS & SURVEILLANCE SYSTEMS (ACSS) TRAFFIC ALERT AND COLLISION AVOIDANCE SYSTEM (TCAS) UNITS						Not Applicable - N/A BY MANUF. (HONEYWELL TPU 67A IS INST.)
Eff. Date: 13-MAR-2012		MOS HRS/MSC AFL	-	16-MAR-2012 4257:01 4051	-		

560XL-34-71



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2012-08-07	APPLIANCE AD - EQUIPMENT/FURNISHINGS - REPETITIVE DETAILED INSPECTIONS FOR CRACKING OF THE CENTRAL AND LATERAL SPREADERS OF THE AFFECTED SEATS, AND REPAIR OR REPLACEMENT OF THE SPREADER IF NECESSARY					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 09-MAY-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-08-07 PARA (G)	APPLIANCE ADP - PERFORM A DETAILED INSPECTION FOR CRACKING OF THE CENTRAL AND LATERAL SPREADERS OF THE AFFECTED SEATS AND REPEAT THE DETAILED INSPECTION (IF NO CRACKING IS FOUND ON ANY CENTRAL SPREADER AND IF NO CRACKING OR ONLY CRACKS THAT ARE SHORTER THAN 8 MM (0.315 INCH) ARE FOUND ON ANY LATERAL SPREADER)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 09-MAY-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-08-07 PARA (G)(3)	APPLIANCE ADP - REPAIR THE AFFECTED SPREADER (IF ALL CRACKS FOUND ON ANY CENTRAL SPREADER ARE SHORTER THAN 8 MM (0.315 INCH)) / ACCOMPLISH THE DETAILED INSPECTION SPECIFIED IN PARA (G))					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 09-MAY-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-08-07 PARA (G)(4)	APPLIANCE ADP - REPLACE THE AFFECTED SPREADER (IF ONE OR MORE CRACKS ARE FOUND THAT ARE 8 MM (0.315 INCH) OR LONGER ON ANY LATERAL OR CENTRAL SPREADER)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 09-MAY-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-08-07 PARA (H)	APPLIANCE ADP - PERFORM A DETAILED INSPECTION FOR CRACKING OF THE CENTRAL AND LATERAL SPREADERS OF THE AFFECTED SEATS AND REPEAT THE DETAILED INSPECTION (IF NO CRACKING IS FOUND ON ANY CENTRAL SPREADER AND IF NO CRACKING OR ONLY CRACKS THAT ARE SHORTER THAN 8 MM (0.315 INCH) ARE FOUND ON ANY LATERAL SPREADER)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 09-MAY-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-08-07 PARA (H)(3)	APPLIANCE ADP - REPAIR THE AFFECTED SPREADER (IF ALL CRACKS FOUND ON ANY CENTRAL SPREADER ARE SHORTER THAN 8 MM (0.315 INCH))					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 09-MAY-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-08-07 PARA (H)(4)	APPLIANCE ADP - REPLACE THE AFFECTED SPREADER (IF ONE OR MORE CRACKS ARE FOUND THAT ARE 8 MM (0.315 INCH) OR LONGER ON ANY LATERAL OR CENTRAL SPREADER)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 09-MAY-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-08-07 PARA (I)	APPLIANCE ADP - TERMINATING ACTION REPLACING ALL CENTRAL AND LATERAL SPREADERS ON AN AFFECTED SEAT ASSEMBLY TERMINATES THE INSPECTIONS REQUIRED BY THIS AD FOR THAT SEAT ASSEMBLY					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 09-MAY-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2012-08-07 PARA (K)	APPLIANCE ADP - NO PERSON MAY INSTALL ANY PASSENGER SEAT ASSEMBLY IDENTIFIED IN PARAGRAPH (C) OF THIS AD, ON ANY AIRPLANE, UNLESS IT HAS BEEN MODIFIED TO "AMENDMENT B" STANDARD IN ACCORDANCE WITH THE ACCOMPLISHMENT INSTRUCTIONS OF SICMA AERO SEAT SERVICE BULLETIN 94-25-012, REVISION 1, DATED JUNE 26, 2008.					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 09-MAY-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-14-15	APPLIANCE AD - HONEYWELL INTERNATIONAL, INC. KGS200 MERCURY ² SYSTEM SOFTWARE PROBLEM					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 19-JUL-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-14-15 (G)	APPLIANCE ADP - INCORPORATE HONEYWELL INTERNATIONAL, INC. KGS200 MERCURY ² SYSTEM SOFTWARE PROBLEM LANGUAGE INTO THE LIMITATIONS SECTION OF THE AIRCRAFT FLIGHT MANUAL					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 19-JUL-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-14-15 (H)	APPLIANCE ADP - FABRICATE HONEYWELL INTERNATIONAL, INC. KGS200 MERCURY ² SYSTEM SOFTWARE PROBLEM AND INSTALL A PLACARD					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 19-JUL-2012		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-14-15 PARA (G)	APPLIANCE ADP - INCORPORATE LANGUAGE INTO THE LIMITATIONS SECTION OF THE AIRCRAFT FLIGHT MANUAL					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 19-JUL-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-14-15 PARA (H)	APPLIANCE ADP - FABRICATE AND INSTALL A PLACARD					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 19-JUL-2012		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2012-17-01	APPLIANCE AD - GOODYEAR AVIATION TIRES					MANDATORY	Not Applicable - N/A BY PN OF TIRES.
Eff. Date: 13-SEP-2012		MOS HRS/MSC AFL	-	18-SEP-2012 4325:32 4113	-		
FAA 2012-26-15	APPLIANCE AD - IDENTIFY OUT OF SPEC AIR DATA COMPUTERS (ADC), AIRDATA MODULES (ADM), AIR DATA ATTITUDE HEADING REFERENCE SYSTEMS (ADAHRS) AND DIGITAL AIR DATA COMPUTERS (DADC) (RESCINDED BY FAA 2012-26-15 R01)					MANDATORY	Not Applicable - BY SN AIR DATA COMPUTERS
Eff. Date: 24-JAN-2013		MOS HRS/MSC AFL	-	31-JAN-2013 4401:27 4170	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2012-26-15 PARA (G)(1)	APPLIANCE ADP - REMOVE IDENTIFY OUT OF SPEC AIR DATA COMPUTERS (ADC), AIRDATA MODULES (ADM), AIR DATA ATTITUDE HEADING REFERENCE SYSTEMS (ADAHRS) AND DIGITAL AIR DATA COMPUTERS (DADC) (RESCINDED BY FAA 2012-26-15 R01) AFFECTED ADC, ADM, ADAHRS, OR DADC					MANDATORY	Not Applicable - BY SN AIR DATA COMPUTERS
Eff. Date: 24-JAN-2013		DAYS HRS/MSC AFL	-	31-JAN-2013 4401:27 4170	-		
FAA 2012-26-15 PARA (G)(2)	APPLIANCE ADP - PERFORM IDENTIFY OUT OF SPEC AIR DATA COMPUTERS (ADC), AIRDATA MODULES (ADM), AIR DATA ATTITUDE HEADING REFERENCE SYSTEMS (ADAHRS) AND DIGITAL AIR DATA COMPUTERS (DADC) (RESCINDED BY FAA 2012-26-15 R01) PITOT-STATIC CERTIFICATION TEST						Not Applicable - BY SN AIR DATA COMPUTERS
		DAYS HRS/MSC AFL	-	31-JAN-2013 4401:27 4170	-		
FAA 2012-26-15 R01	APPLIANCE AD - AIR DATA PRESSURE TRANSDUCERS, AS INSTALLED IN AIR DATA COMPUTERS (ADC), AIR DATA MODULES (ADM), AIR DATA ATTITUDE HEADING REFERENCE SYSTEMS (ADAHRS), AND DIGITAL AIR DATA COMPUTERS (DADC)					MANDATORY	Not Applicable - R1 CANCELS AD 2012-26-15
Eff. Date: 03-DEC-2014		MOS HRS/MSC AFL	-	02-NOV-2014 4674:21 4389	-		
FAA 2014-05-27	APPLIANCE AD - ROCKWELL COLLINS, INC. TPR-720 AND TPR-900 MODE S TRANSPONDERS - TEST AND CALIBRATION					MANDATORY	Not Applicable - NOT MAINTAINED OR REPAIRED AFTER 28 SEP 2003
Eff. Date: 02-MAY-2014		MOS HRS/MSC AFL	-	08-APR-2014 4566:55 4303	-		
FAA 2014-17-02	APPLIANCE AD - EMERGENCY LOCATOR TRANSMITTER - BATTERY WIRING DISCREPANCIES - HONEYWELL ASCA INC					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 09-SEP-2014		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2015-08-07	APPLIANCE AD - OXYGEN - ZODIAC AEROTECHNICS (FORMERLY INTERTECHNIQUE AIRCRAFT SYSTEMS) FLIGHTCREW OXYGEN MASK REGULATORS - INSPECTION / REPLACEMENT OF INFLATABLE HARNESSSES					MANDATORY	Complied With - BOTH DMF'S BEFORE 11-08
Eff. Date: 16-JUN-2015		MOS HRS/MSC AFL	-	02-JUN-2017 5052 4732	-		
FAA 2015-10-02	APPLIANCE AD - EQUIPMENT/FURNISHINGS - ZODIAC SEATS FRANCE - INSPECTION/REPLACEMENT					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 12-JUN-2015		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2015-10-02 PARA (G)	APPLIANCE ADP - GENERAL VISUAL INSPECTION FOR CRACKING OF SEAT BACKREST LINKS HAVING PART NUMBER (P/N) 90-000200-104-1, P/N 90-000200-104-2, P/N 90-000202-104-1 AND P/N 90-000202-104-2					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 12-JUN-2015		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2015-10-02 PARA (H)	APPLIANCE ADP - CORRECTIVE ACTIONS - CRACKING IS FOUND ON THE LINK					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 12-JUN-2015		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2015-10-02 PARA (I)	APPLIANCE ADP - REPLACE ALL SEAT BACKREST LINKS, HAVING P/N 90-000200-104-1, P/N 90-000200-104-2, P/N 90-000202-104-1 AND P/N 90-000202-104-2, WITH NEW LINKS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 22-OCT-2014		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2015-10-51	APPLIANCE AD - AVIDYNE INTEGRATED FLIGHT DISPLAY (IFD)- INCORPORATE OPERATIONAL LIMITATIONS INTO LIMITATIONS SECTION OF THE AFM OR AFMS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 01-JUL-2015		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2015-10-51-E	APPLIANCE AD - AVIDYNE INTEGRATED FLIGHT DISPLAY (IFD)- INCORPORATE OPERATIONAL LIMITATIONS INTO LIMITATIONS SECTION OF THE AFM OR AFMS.					MANDATORY	Not Applicable - EQUIPMENT NOT INSTALLED
Eff. Date: 18-MAY-2015		MOS HRS/MSC AFL	-	30-JUN-2015 4794:57 4515	-		
FAA 2015-16-04	APPLIANCE AD - FIRE PROTECTION - MODIFY ALL KIDDE GRAVINER HAND-OPERATED FIRE EXTINGUISHERS HAVING PART NUMBERS 56412-001 (34H), 56411-001 (35H), AND 56412-002 (38H)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 15-SEP-2015		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2015-23-09	APPLIANCE AD - OXYGEN - ZODIAC AEROTECHNICS (FORMERLY INTERTECHNIQUE AIRCRAFT SYSTEMS) FLIGHT CREW OXYGEN MASK REGULATORS - INSPECTION / REPLACEMENT OF OXYGEN MASK REGULATORS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 28-DEC-2015		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2015-23-09 PARA (G)	APPLIANCE ADP - INSPECT EACH FLIGHTCREW OXYGEN MASK REGULATOR TO IDENTIFY THE PART NUMBER AND SERIAL NUMBER					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 28-DEC-2015		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2015-23-09 PARA (H)(1)	APPLIANCE ADP - REPLACE EACH AFFECTED FLIGHTCREW OXYGEN MASK WITH A PART IDENTIFIED IN PARAGRAPH (H)(1)(I) OR (H)(1)(II).					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 28-DEC-2015		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2015-23-09 PARA (H)(2)(I)	APPLIANCE ADP - REVISE THE EMERGENCY PROCEDURES SECTION OF THE AIRPLANE FLIGHT MANUAL (AFM) BY INSERTING THE STATEMENT PROVIDED IN FIGURE 1					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 28-DEC-2015		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2015-23-09 PARA (H)(2)(II)	APPLIANCE ADP - FABRICATE AND INSTALL A PLACARD ON THE FLIGHTCREW OXYGEN MASK CONTAINER THAT STATES: "USE SELECTOR ON 100% OR EMERGENCY ONLY."					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 28-DEC-2015		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2015-23-09 PARA (I)	APPLIANCE ADP - REGULATOR REPLACEMENT					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 28-DEC-2015		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2016-11-20	APPLIANCE AD - OXYGEN - INSPECTION AND REPLACEMENT OF B/E AEROSPACE PROTECTIVE BREATHING EQUIPMENT (PBE), PART NUMBER 119003-11 THAT ARE INSTALLED ON AIRPLANES. SUPERSEDED BY FAA AD 2017-18-12					MANDATORY	Not Applicable - BY PN PBE
Eff. Date: 15-JUL-2016		MOS HRS/MSC AFL	-	16-JUN-2016 4967:11 4654	-		
FAA 2016-11-20 PARA (G)	APPLIANCE ADP - PHYSICALLY INSPECT THE PBE POUCH TO DETERMINE IF IT HAS AN INTACT VACUUM SEAL IN ACCORDANCE WITH B/E AEROSPACE SERVICE BULLETIN NO. 119003-35-011, REV .000, DATED FEBRUARY 4, 2015, PARA III.A..1 SUPERSEDED BY FAA AD 2017-18-12					MANDATORY	Not Applicable - BY PN PBE
Eff. Date: 15-JUL-2016		MOS HRS/MSC AFL	-	16-JUN-2016 4967:11 4654	-		
FAA 2016-11-20 PARA (H)(1)	APPLIANCE ADP - REPLACEMENT OF A PBE POUCH, FOUND DURING THE INSPECTION IN PARAGRAPH (G) OF THIS AD, THAT DOES NOT HAVE AN INTACT VACUUM SEAL. SUPERSEDED BY FAA AD 2017-18-12					MANDATORY	Not Applicable - BY PN PBE
Eff. Date: 15-JUL-2016		MOS HRS/MSC AFL	-	16-JUN-2016 4967:11 4654	-		
FAA 2016-11-20 PARA (H)(2)	APPLIANCE ADP - REPLACEMENT OF A PBE POUCH, FOUND DURING THE INSPECTION IN PARAGRAPH (G) OF THIS AD, WHERE THE VACUUM SEAL IS INTACT. SUPERSEDED BY FAA AD 2017-18-12					MANDATORY	Not Applicable - BY PN PBE
Eff. Date: 15-JUL-2016		MOS HRS/MSC AFL	-	16-JUN-2016 4967:11 4654	-		
FAA 2017-09-09	APPLIANCE AD - PASSENGER COMPARTMENT EQUIPMENT - REPLACEMENT OF ZODIAC SEATS CALIFORNIA LLC SEATING SYSTEMS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 28-JUN-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-11-11	APPLIANCE AD - NAVWORX, INC, AUTOMATIC DEPENDENT SURVEILLANCE - BROADCAST (ADS-B) UNIVERSAL ACCESS TRANSCEIVER UNITS - REMOVE, DISABLE, OR REVISE SOFTWARE TO BROADCAST A SIL OF 0					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 11-JUL-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-16-01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - AMERI-KING CORPORATION MODEL AK-450() AND AK-451() SERIES EMERGENCY LOCATOR TRANSMITTERS - REPETATIVE INSPECTIONS, CHECKS, TESTS AND VERIFICATIONS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED
Eff. Date: 24-OCT-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2017-16-01 PARA (G)	APPLIANCE ADP - PERFORM GENERAL VISUAL INSPECTIONS OF THE ELT FOR DISCREPANCIES; CHECKS , TESTS AND VERIFICATIONS AS APPLICABLE, TO ENSURE THE ELT IS FUNCTIONING, AND ALL APPLICABLE CORRECTIVE ACTIONS	MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		Not Applicable - COMPONENTS NOT INSTALLED
FAA 2017-16-01 PARA (J)	APPLIANCE ADP - OPTIONAL TERMINATING ACTION: REPLACE ELT WITH A SERVICEABLE FAA-APPROVED ELT	MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		Not Applicable - COMPONENTS NOT INSTALLED
FAA 2017-19-05	APPLIANCE AD - APPLIANCE AD - FIRE PROTECTION - OPTICAL AND AMBIENT SMOKE DETECTORS - IDENTIFICATION / REPLACEMENT					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 31-OCT-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-19-05 PARA (F)(1)	APPLIANCE ADP - INSPECT EACH SIEMENS SMOKE DETECTOR, OR REVIEW YOUR MAINTENANCE RECORDS, TO DETERMINE IF AN AFFECTED DETECTOR IS INSTALLED					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 31-OCT-2017		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-19-05 PARA (F)(2.1)	APPLIANCE ADP - REPLACE CARGO COMPARTMENT SMOKE DETECTORS, IDENTIFIED IN PARAGRAPH (C) (1), SPECIFIED IN FIGURES 2 AND 3					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 31-OCT-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-19-05 PARA (F)(2.2)	APPLIANCE ADP - REPLACE PASSENGER, CABIN OR ANY OTHER LOCATION SMOKE DETECTORS, IDENTIFIED IN PARAGRAPH (C)(1), SPECIFIED IN FIGURE 4					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 31-OCT-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-19-05 PARA (F)(3)	APPLIANCE ADP - REPLACE REPAIRED SMOKE DETECTOR IDENTIFIED IN PARAGRAPH (C)(2), SPECIFIED FIGURE 1					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 31-OCT-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-19-05 PARA (G)	APPLIANCE ADP - DO NOT INSTALL ON ANY AIRPLANE A SMOKE DETECTOR WITH A MANUFACTURING DATE AND P/N LISTED IN FIGURE 2 OR 3 OR LISTED IN FIGURE 4 TO PARAGRAPH (F) OF THIS AD UNLESS THE DETECTOR IS MARKED "SIL PMC-26-002"					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 31-OCT-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-22-02	APPLIANCE AD - FLIGHT COMPARTMENT EQUIPMENT - IPECO HOLDINGS LTD. -MODIFICATION AND REIDENTIFICATION OF PILOT'S AND CO-PILOT'S SEATS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 12-DEC-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2017-22-02 PARA (F)	APPLIANCE ADP - MODIFY AND RE-IDENTIFY AFFECTED EACH PILOT AND CO-PILOT SEAT					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 12-DEC-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-22-02 PARA (G)	APPLIANCE ADP - DO NOT INSTALL ANY PILOT OR CO-PILOT SEAT IDENTIFIED IN PARAGRAPH (C) OF THIS AD UNLESS THE SEAT IS MODIFIED AND REIDENTIFIED AS SPECIFIED IN PARAGRAPH (F)(2) OF THIS AD					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 12-DEC-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2017-22-14	APPLIANCE AD - NAVIGATION - INSTALLATION OF THE TSSA-4100 FLS UPGRADES ON THE ROCKWELL COLLINS, INC. TSS-4100 TRAFFIC SURVEILLANCE SYSTEM PROCESSING UNITS					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 20-DEC-2017		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2018-03-04	APPLIANCE AD - NAVIGATION - REPLACEMENT OF ROSEMOUNT AEROSPACE INC. MODEL 851AK PITOT PROBES REPAIRED BY CSI AEROSPACE INC					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 16-MAR-2018		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2018-03-04 PARA (G)	APPLIANCE ADP - DETERMINE NUMBER OF AFFECTED PITOT PROBES INSTALLED					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 16-MAR-2018		DAYS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2018-03-04 PARA (H)(1)	APPLIANCE ADP - REPLACE AFFECTED PITOT PROBES					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 16-MAR-2018		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2018-03-04 PARA (H)(2)	APPLIANCE ADP - DO NOT INSTALL ON ANY AIRPLANE A PITOT PROBE HAVING A SERIAL NUMBER LISTED IN PARA (C)(1) OF THIS AD, UNLESS IT HAS BEEN PROPERLY REPAIRED, AND IF REPAIRED BY CSI AEROSPACE, INC., HAS A REPAIR DATE OF AUGUST 1, 2014, OR LATER					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 16-MAR-2018		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2018-16-13	APPLIANCE AD - EQUIPMENT/FURNISHINGS - INSPECT THE SAFETY BELT WEBBING, AND MODIFY AND RE-MARKING EACH AFFECTED CABIN ATTENDANT SEAT					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 26-OCT-2018		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2018-16-13 PARA (G)	APPLIANCE ADP - INSPECT SAFETY BELT WEBBING, MODIFY AND RE-MARK EACH AFFECTED CABIN ATTENDANT SEAT USING ZODIAC SEATS FRANCE SERVICE INFORMATION LETTER 537-01					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 26-OCT-2018		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2018-16-13 PARA (H)	APPLIANCE ADP - DO NOT INSTALL ANY AFFECTED ZODIAC SEATS FRANCE CABIN ATTENDANT SEAT ON ANY AIRCRAFT					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 26-OCT-2018		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2018-19-15	APPLIANCE AD - EQUIPMENT / FURNISHINGS - SAFETY BELT ATTACHMENT BOLTS - INSPECTION / TORQUE VERIFICATION / MODIFICATION					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 14-NOV-2018		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2018-21-14	APPLIANCE AD - OXYGEN - OXYGEN MASK REGULATOR HARNESS INFLATION HOSES - INSPECTION / REPLACEMENT					MANDATORY	Not Applicable - PER PART NUMBER MASK INSTALLED
Eff. Date: 27-MAR-2019		MOS HRS/MSC AFL	-	01-APR-2019 5066:42 4739	-		
FAA 2018-21-14 PARA (G)	APPLIANCE ADP - REQUIRED ACTIONS					MANDATORY	Not Applicable - PER PART NUMBER MASK INSTALLED
Eff. Date: 27-MAR-2019		MOS HRS/MSC AFL	-	01-APR-2019 5066:42 4739	-		
FAA 2018-21-14 PARA (H)	APPLIANCE ADP - DO NOT INSTALL ON ANY AIRPLANE A FLIGHT CREW OXYGEN MASK REGULATOR WITH A P/N LISTED IN PLANNING INFORMATION, PARAGRAPH 1.A.(1), OF ZODIAC SB MC10-35-274 R02, DATED JUNE 25, 2014, UNLESS IT MEETS THE DEFINITION OF A PART ELIGIBLE FOR INSTALLATION IN PARA (I) OF THIS AD					MANDATORY	Not Applicable - PER PART NUMBER MASK INSTALLED
Eff. Date: 27-MAR-2019		MOS HRS/MSC AFL	-	01-APR-2019 5066:42 4739	-		
FAA 2018-23-01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CABIN ATTENDANT SEAT - INSPECTION AND REPLACEMENT					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 28-DEC-2018		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
FAA 2018-23-01 PARA (G)	APPLIANCE ADP - INSPECT THE SEAT PAN STRUCTURE IN BOTH DEPLOYED AND STOWED POSITIONS (IF CRACKS ARE FOUND, REPLACE WITH REINFORCED SEAT PAN P/N F0511530 AND REMARK THE SEAT) (IF NO CRACKS ARE FOUND, REMARK THE SEAT AND REINSPECT OR REPLACE THE SEAT PAN WITH REINFORCED SEAT PAN P/N F0511530)					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 28-DEC-2018		MOS HRS/MSC AFL	- 100	08-FEB-2019 5066:42 4739	-		
FAA 2018-23-01 PARA (H)	APPLIANCE ADP - INSTALLATION OF A REINFORCED SEAT PAN, P/N F0511530, USING PARAGRAPH 2.B., ACCOMPLISHMENT INSTRUCTIONS, OF ZODIAC SEATS FRANCE SB NO. 536-25-003, REV. 3, DATED JUNE 2, 2017, IS TERMINATING ACTION TO THIS AD					MANDATORY	Not Applicable - COMPONENTS NOT INSTALLED.
Eff. Date: 28-DEC-2018		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2019-07-10	APPLIANCE AD - NAVIGATION - LITEF ATTITUDE HEADING AND REFERENCE SYSTEM (AHRS) - REMOVAL					MANDATORY	Not Applicable - AIRCRAFT NOT EQUIPPED. AHRS P/N: 142185-1100 IS INSTALLED ON AIRCRAFT.
Eff. Date: 29-MAY-2019		MOS HRS/MSC AFL	-	17-JUN-2019 5110:47 4774	-		
FAA 2019-07-10 PARA (F)(1)	APPLIANCE ADP - REMOVE THE AHRS UNIT FROM SERVICE					MANDATORY	Not Applicable - AIRCRAFT NOT EQUIPPED. AHRS P/N: 142185-1100 IS INSTALLED ON AIRCRAFT.
Eff. Date: 29-MAY-2019		MOS HRS/MSC AFL	-	17-JUN-2019 5110:47 4774	-		
FAA 2019-07-10 PARA (F)(3)	APPLIANCE ADP - DO NOT INSTALL AN AHRS UNIT P/N 145130-2000, 145130-2001, 145130-7000, 145130-7001, OR 145130-7100 ON ANY AIRCRAFT					MANDATORY	Not Applicable - COMPONENT NOT INSTALLED. AIRCRAFT EQUIPPED WITH AHRS COMPUTER P/N:142185-1100
Eff. Date: 29-MAY-2019		MOS HRS/MSC AFL	-	17-JUN-2019 5110:47 4774	-		
FAA 2021-07-13	APPLIANCE AD - EQUIPMENT AND FURNISHING - SEAT RESTRAINT SYSTEM PLASTIC ROTARY BUCKLE HANDLE - INSPECTION/REPLACEMENT					MANDATORY	Not Applicable - N/A BY PN OF THE PART
Eff. Date: 11-MAY-2021		MOS HRS/MSC AFL	-	14-SEP-2021 6755:02 5707	-		
FAA 2021-07-13 PARA (E)(1)	APPLIANCE ADP - INSPECT THE BUCKLE HANDLE FOR A CRACK AND IF CRACKED, BEFORE FURTHER FLIGHT, REPLACE IT WITH AN AIRWORTHY BUCKLE					MANDATORY	Not Applicable - N/A BY P/N OF THE PART
Eff. Date: 11-MAY-2021		MOS HRS/MSC AFL	-	14-SEP-2021 6755:02 5707	-		
FAA 2021-07-13 PARA (E)(2)	APPLIANCE ADP - MEASURE THE THICKNESS OF THE BUCKLE HANDLE VANE; IF THICKNESS IS 0.125 INCH OR GREATER, BEFORE FURTHER FLIGHT, REMOVE THE BUCKLE FROM SERVICE AND REPLACE IT WITH AN AIRWORTHY BUCKLE					MANDATORY	Not Applicable - N/A BY PN OF THE PART
Eff. Date: 11-MAY-2021		MOS HRS/MSC AFL	-	14-SEP-2021 6755:02 5707	-		
FAA 2021-07-13 PARA (E)(3)	APPLIANCE ADP - DO NOT INSTALL A BUCKLE OR RESTRAINT SYSTEM WITH A BUCKLE P/N 1111430 OR 1111475, ALL DASH NUMBERS, WITH A HANDLE VANE THICKNESS OF 0.125 INCH OR GREATER					MANDATORY	Not Applicable - N/A BY PN OF THE PART
Eff. Date: 11-MAY-2021		MOS HRS/MSC AFL	-	14-SEP-2021 6755:02 5707	-		
FAA 2021-23-12	APPLIANCE AD - INDICATING / RECORDING / NAVIGATION - RADIO (RADAR) ALTIMETER - AFM REVISION TO INCORPORATE LIMITATIONS					MANDATORY	Complied With - PRINTED AND PLACED TO THE AFM.
Eff. Date: 09-DEC-2021		MOS HRS/MSC AFL	-	04-JAN-2022 7081:52 5894	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
FAA 2026-03-09	APPLIANCE AD - OXYGEN - PORTABLE BREATHING EQUIPMENT - REMOVAL FROM SERVICE					MANDATORY	Not Applicable - AS PER S/N
Eff. Date: 12-MAR-2026		MOS			13-MAR-2026		
		HRS/MSC	-		9018:28		
		AFL			7267		
FAA 2026-03-09 PARA (G) EASA (APPLIANCE ADP - ACCOMPLISHMENT OF THE ACTION AS REQUIRED BY PARA (1) OF THIS AD CAN BE DEFERRED IN ACCORDANCE WITH THE APPLICABLE INSTRUCTIONS AND LIMITATIONS OF THE APPLICABLE AIRCRAFT MMEL ITEMS, PROVIDED THAT THOSE MMEL ITEMS ARE INCLUDED IN THE OPERATOR APPROVED MEL, AND THAT THE MINIMUM REQUIRED INSTALLED PBES ARE CONFIRMED NOT AFFECTED BY THIS AD					MANDATORY	Not Applicable
Eff. Date: 12-MAR-2026		MOS			13-MAR-2026		
		HRS/MSC	-		9018:28		
		AFL			7267		
FAA 2026-03-09 PARA (G) EASA (APPLIANCE ADP - PART INSTALLATION: STARTING FROM THE APPLICABILITY DATE AS IDENTIFIED IN TABLE 1 OF THIS AD, AS APPLICABLE, DEPENDING ON PBE LOCATION, DO NOT INSTALL AN AFFECTED PBE ON ANY AIRCRAFT					MANDATORY	Not Applicable
Eff. Date: 12-MAR-2026		DAYS			13-MAR-2026		
		HRS/MSC	-		9018:28		
		AFL			7267		
FAA 2026-03-09 PARA (G) EASA (APPLIANCE ADP - LIFE LIMIT: REMOVE FROM SERVICE					MANDATORY	Not Applicable
		MOS			13-MAR-2026		
		HRS/MSC	-		9018:28		
		AFL			7267		
AIRCRAFT - SB - 560XL - CITATION XL (MSG) 560XL-5230/OK-HAR							
SB 560XL-05-01	TIME LIMITS/MAINTENANCE CHECKS - CONVERSION FROM CALENDAR SCHEDULE MAINTENANCE PROGRAM TO MSG-3 SCHEDULE MAINTENANCE PROGRAM (CANCELLED AND SUPERSEDED BY SL560XL-05-03),, SERVICE BULLETIN					OPTIONAL	
Eff. Date: 05-NOV-2007		MOS					
		HRS/MSC	A/R		-		
SB 560XL-21-04 R01	AIR CONDITIONING - EXHAUST DUCT CONDENSATION CONTAINMENT, SERVICE BULLETIN					RECOMMENDED	Complied With - NOT APPLICABLE
Eff. Date: 30-AUG-2002		MOS			09-MAY-2003		
		HRS/MSC	-		641		
SB 560XL-21-11	AIR CONDITIONING - SERVICE PORT DRIP SHIELD IMPROVEMENT, SERVICE BULLETIN					RECOMMENDED	Complied With - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
Eff. Date: 13-DEC-2001		MOS			11-OCT-2002		
		HRS/MSC	-		329		
SB 560XL-21-15	AIR CONDITIONING - COCKPIT TEMPERATURE SENSOR IMPROVEMENT, SERVICE BULLETIN					DISCRETIONARY	Complied With
Eff. Date: 16-JUN-2003		MOS			29-APR-2005		
		HRS/MSC	-		2059		
SB 560XL-21-16	AIR CONDITIONING - ACM ASPIRATOR TUBING ATTACHMENT IMPROVEMENT, SERVICE BULLETIN					DISCRETIONARY	
Eff. Date: 09-SEP-2004		MOS					
		HRS/MSC	-		-		
SB 560XL-21-18 R01	AIR CONDITIONING - TEMPERATURE CONTROLLER UPGRADE, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 14-MAY-2007		MOS			05-SEP-2008		
		HRS/MSC	A/R		3665		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB 560XL-21-19	AIR CONDITIONING - EMERGENCY PRESSURIZATION OPERATION IMPROVEMENT (SUPERSEDED BY 560XL-21-19 R01), SERVICE BULLETIN	MOS HRS/MSC	A/R		16-MAY-2006 2677	RECOMMENDED	Complied With
SB 560XL-21-23	AIR CONDITIONING - FORWARD EVAPORATOR INSTALLATION AND WIRING MODIFICATION, SERVICE BULLETIN	MOS HRS/MSC	A/R	-	-	OPTIONAL	
SB 560XL-21-24	AIR CONDITIONING - AFT EVAPORATOR INSTALLATION AND WIRING MODIFICATION (SUPERSEDED BY 560XL-21-24 R01), SERVICE BULLETIN	MOS HRS/MSC	A/R	-	-	OPTIONAL	
SB 560XL-21-25	AIR CONDITIONING - BRUSHLESS GASPER AIR BOOST BLOWER INSTALLATION AND WIRING MODIFICATION, SERVICE BULLETIN	MOS HRS/MSC	A/R	-	-	OPTIONAL	
SB 560XL-23-03	COMMUNICATIONS - AIRSHOW CABIN DISPLAY MODIFICATION, SERVICE BULLETIN	MOS HRS/MSC	-	-	-	OPTIONAL	
SB 560XL-23-05	COMMUNICATIONS - RNZ-850 NAVIGATION RADIO UPGRADE (SUPERSEDED BY 560XL-23-05 R01), SERVICE BULLETIN	MOS HRS/MSC	-		15-FEB-2005 1913	MANDATORY	Complied With
SB 560XL-23-07 R03	COMMUNICATIONS - RADIO MANAGEMENT UNIT (RM855) INSTALLATION, SERVICE BULLETIN	MOS HRS/MSC AFL	-		03-NOV-2014 4674:21 4389	OPTIONAL	Complied With - RMU'S REPLACED, C/W SB 560XL-23-07R3
SB 560XL-24-02 R01	ELECTRICAL POWER - CONCORDE BATTERY INSTALLATION, SERVICE BULLETIN	MOS HRS/MSC AFL	-	-	-	OPTIONAL	
SB 560XL-24-07	ELECTRICAL POWER - WING WIRE GROUND IMPROVEMENT (SUPERSEDED BY 560XL-24-07 R01), SERVICE BULLETIN	MOS HRS/MSC	A/R		11-OCT-2002 329	RECOMMENDED	Complied With
SB 560XL-24-14 R02	ELECTRICAL POWER - APU STARTER/GENERATOR WIRING IMPROVEMENT, SERVICE BULLETIN	MOS HRS/MSC AFL	A/R		10-OCT-2011 4149:35 3962	RECOMMENDED	Complied With
SB 560XL-24-15	ELECTRICAL POWER - TAILCONE/STINGER ELECTRICAL CONNECTOR IMPROVEMENT, SERVICE BULLETIN	MOS HRS/MSC	A/R	-	-	DISCRETIONARY	

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As
Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB 560XL-24-19	ELECTRICAL POWER - RIGHT HAND ENGINE WIRE BUNDLE ROUTING IMPROVEMENTS, SERVICE BULLETIN	MOS	-	-	-	RECOMMENDED	
Eff. Date: 08-MAR-2017		HRS/MSC					
SB 560XL-24-20	ELECTRICAL POWER - AC J-BOX WIRE BUNDLE ANCHOR INSTALLATION, SERVICE BULLETIN	MOS	-	27-AUG-2019	-	MANDATORY	Complied With
Eff. Date: 03-OCT-2017		HRS/MSC		5252:35			
		AFL		4867			
SB 560XL-24-21	ELECTRICAL POWER - INSTALL NEW RIGHT ALTERNATOR POWER CONTROL UNIT (PCU) (UE016) MOUNTING BRACKET, SERVICE BULLETIN	MOS	-			RECOMMENDED	Not Applicable - DUE TO A/C SERIAL NUMBER
Eff. Date: 08-NOV-2019		HRS/MSC					
SB 560XL-24-21 R01	ELECTRICAL POWER - INSTALL NEW RIGHT ALTERNATOR POWER CONTROL UNIT (PCU) (UE016) MOUNTING BRACKET, SERVICE BULLETIN	MOS	-			RECOMMENDED	Not Applicable - DUE TO A/C SERIAL NUMBER
Eff. Date: 13-MAR-2020		HRS/MSC					
SB 560XL-25-08	EQUIPMENT/FURNISHINGS - AFT DIVIDER IMPROVEMENT, SERVICE BULLETIN	MOS	-	12-MAR-2004	-	OPTIONAL	Complied With
Eff. Date: 15-MAY-2003		HRS/MSC		1200			
SB 560XL-25-09	EQUIPMENT/FURNISHINGS - GALLEY STORAGE DOOR HINGE IMPROVEMENT, SERVICE BULLETIN	MOS	-	12-MAR-2004	-	RECOMMENDED	Complied With
Eff. Date: 06-NOV-2003		HRS/MSC		1200			
SB 560XL-25-10	EQUIPMENT/FURNISHINGS - AFT DIVIDER DOOR SWITCH IMPROVEMENT (SUPERSEDED BY 560XL-25-10 R01), SERVICE BULLETIN	MOS	A/R	23-JUL-2004	-	OPTIONAL	Complied With
Eff. Date: 01-DEC-2003		HRS/MSC		1489			
SB 560XL-25-11 R01	EQUIPMENT/FURNISHINGS - ARTEX C406-2 THREE-FREQUENCY EMERGENCY LOCATOR TRANSMITTER (ELT) (SUPERSEDED BY 560XL-25-11 R02), SERVICE BULLETIN	MOS	A/R	30-JUN-2022	-	OPTIONAL	Complied With - INCORPORATED AT MANUFACTURE
Eff. Date: 01-JUL-2010		HRS/MSC		7399:24			
		AFL		6143			
SB 560XL-25-11 R02	EQUIPMENT/FURNISHINGS - ARTEX C406-2 THREE-FREQUENCY EMERGENCY LOCATOR TRANSMITTER (ELT) (SUPERSEDED BY 560XL-25-11 R03), SERVICE BULLETIN	MOS	A/R	30-JUN-2022	-	OPTIONAL	Complied With - SUPRESSED BY 560XL-25-11 R01. INCORPORATED AT MANUFACTURE
Eff. Date: 01-JUL-2010		HRS/MSC		7399:24			
		AFL		6143			
SB 560XL-25-11 R03	EQUIPMENT/FURNISHINGS - ARTEX C406-2 THREE-FREQUENCY EMERGENCY LOCATOR TRANSMITTER (ELT), SERVICE BULLETIN	MOS	-	30-JUN-2022	-	OPTIONAL	Complied With - SUPRESSED BY 560XL-25-11 R01. INCORPORATED AT MANUFACTURE
Eff. Date: 18-APR-2012		HRS/MSC		7399:24			
		AFL		6143			
SB 560XL-25-12 R01	EQUIPMENT/FURNISHINGS - GLARESHIELD LEATHER STRIP INSTALLATION, SERVICE BULLETIN	MOS	-		-	OPTIONAL	
Eff. Date: 24-AUG-2005		HRS/MSC					

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB 560XL-26-01	FIRE PROTECTION - TRANSMITTAL OF PACIFIC SCIENTIFIC SERVICE BULLETIN 26-03-35071497, INSPECTION AND REPLACEMENT OF TEMPERATURE COMPENSATED PRESSURE SWITCH (SUPERSEDED BY 560XL-26-01 R01), SERVICE BULLETIN					MANDATORY	Complied With
Eff. Date: 11-APR-2003		MOS HRS/MSC	A/R	09-MAY-2003 641	-		
SB 560XL-26-02 R01	FIRE PROTECTION - FIRE BOTTLE WIRE IDENTIFICATION SLEEVE INSTALLATION, SERVICE BULLETIN					MANDATORY	Complied With
Eff. Date: 22-DEC-2004		MOS HRS/MSC	-	15-FEB-2005 1913	-		
SB 560XL-27-13 R01	FLIGHT CONTROLS - AFT AILERON SECTOR TUBE FINISH IMPROVEMENT (SUPERSEDED BY 560XL-27-13 R02), SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 01-JUL-2003		MOS HRS/MSC	A/R	12-MAR-2004 1200	-		
SB 560XL-27-13 R02	FLIGHT CONTROLS - AFT AILERON SECTOR TUBE FINISH IMPROVEMENT, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 08-APR-2004		MOS HRS/MSC	-	23-JUL-2004 1489	-		
SB 560XL-27-17 R02	FLIGHT CONTROLS - ELEVATOR TRIM TAB INSPECTION/REPAIR, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 19-MAR-2003		MOS HRS/MSC	-	07-OCT-2003 986	-		
SB 560XL-27-19	FLIGHT CONTROLS - STEEP APPROACH CERTIFICATION (SUPERSEDED BY 560XL-27-19 R01), SERVICE BULLETIN					OPTIONAL	Complied With
Eff. Date: 26-NOV-2002		MOS HRS/MSC	A/R	28-JUL-2004 1503	-		
SB 560XL-27-20	FLIGHT CONTROLS - RUDDER FAIRLEAD TUBE SUPPORT MODIFICATION (SUPERSEDED BY 560XL-27-20 R01), SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 20-JAN-2003		MOS HRS/MSC	-	09-MAY-2003 641	-		
SB 560XL-27-21 R01	FLIGHT CONTROLS - AILERON PULLEY BRACKET ACCESS IMPROVEMENT, SERVICE BULLETIN					OPTIONAL	- SERVICE BULLETIN ON HOLD.
Eff. Date: 05-FEB-2008		MOS HRS/MSC	A/R	-	-		
SB 560XL-27-22	FLIGHT CONTROLS - AILERON WING CABLE PULLEY BRACKET REPLACEMENT (SUPERSEDED BY 560XL-27-22 R01), SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 06-JUN-2005		MOS HRS/MSC	-	20-DEC-2005 2464	-		
SB 560XL-27-22 R01	FLIGHT CONTROLS - AILERON WING CABLE PULLEY BRACKET REPLACEMENT, SERVICE BULLETIN					MANDATORY	Complied With
Eff. Date: 31-OCT-2005		MOS HRS/MSC	A/R	16-MAY-2006 2677	-		
SB 560XL-27-26	FLIGHT CONTROLS - ELEVATOR TRIM WHEEL INSTALLATION IMPROVEMENT (SUPERSEDED BY 560XL-27-26 R01), SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 30-MAR-2005		MOS HRS/MSC	A/R	20-DEC-2005 2464	-		
SB 560XL-27-26 R01	FLIGHT CONTROLS - ELEVATOR TRIM WHEEL INSTALLATION IMPROVEMENT, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 18-OCT-2005		MOS HRS/MSC	-	16-MAY-2006 2677	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As
Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB 560XL-27-28	FLIGHT CONTROLS - RUDDER PEDAL POSITION ADJUSTMENT MODIFICATION, SERVICE BULLETIN	MOS				DISCRETIONARY	
Eff. Date: 11-JUL-2007		HRS/MSC	A/R	-	-		
SB 560XL-27-29 R01	FLIGHT CONTROLS - SPEED BRAKE ELECTRICAL CONNECTOR REPLACEMENT, SERVICE BULLETIN	MOS				RECOMMENDED	Declined - DECLINED BY CAMO
Eff. Date: 07-MAR-2009		HRS/MSC	A/R	05-AUG-2011			
		AFL		4149:21	-		
				3962			
SB 560XL-27-31	FLIGHT CONTROLS - FLAP HANDLE AND FLAP HANDLE GUARD IMPROVEMENT, SERVICE BULLETIN	MOS				OPTIONAL	
Eff. Date: 09-NOV-2009		HRS/MSC	A/R	-	-		
SB 560XL-27-32	FLIGHT CONTROLS - RUDDER PEDAL POSITION MODIFICATION (SUPERSEDED BY 560XL-27-32 R01), SERVICE BULLETIN	MOS				RECOMMENDED	Not Applicable - BY SERIAL NUMBER SUPERSEDED BY REVISION 1
Eff. Date: 27-AUG-2010		HRS/MSC	A/R	-	-		
SB 560XL-27-34	FLIGHT CONTROLS - ELEVATOR TRIM CABLE REPLACEMENT, SERVICE BULLETIN	MOS				MANDATORY	Not Applicable - N/A BY PART NR.
Eff. Date: 09-APR-2012		HRS/MSC	-	05-MAY-2012			
		AFL		4272:33	-		
				4072			
SB 560XL-28-02 R01	FUEL - WING FUEL BOOST PUMP FAIRING INSULATION INSTALLATON, SERVICE BULLETIN	MOS				RECOMMENDED	Complied With
Eff. Date: 01-JUL-2005		HRS/MSC	-	20-DEC-2005			
				2464	-		
SB 560XL-28-03	FUEL - WING FUEL BOOST PUMP FAIRING INSULATION INSTALLATON, SERVICE BULLETIN	MOS				MANDATORY	Not Applicable - NOT APPLICABLE
Eff. Date: 17-JAN-2005		HRS/MSC	-	15-FEB-2005			
				1913	-		
SB 560XL-29-03	HYDRAULIC POWER - HYDRAULIC SHUT-OFF VALVE INSTALLATION IMPROVEMENT, SERVICE BULLETIN	MOS				OPTIONAL	
Eff. Date: 10-APR-2003		HRS/MSC	-	-	-		
SB 560XL-29-04	HYDRAULIC POWER - WHEEL WELL HYDRAULIC LINE SUPPORT IMPROVEMENT, SERVICE BULLETIN	MOS				MANDATORY	Complied With
Eff. Date: 10-JUN-2004		HRS/MSC	-	05-NOV-2004			
				1768	-		
SB 560XL-30-04	ICE AND RAIN PROTECTION - WING LEADING EDGE PICCOLO TUBE IMPROVEMENT, SERVICE BULLETIN	MOS				RECOMMENDED	Complied With
Eff. Date: 07-AUG-2002		HRS/MSC	-	09-MAY-2003			
				641	-		
SB 560XL-30-06	ICE AND RAIN PROTECTION - HORIZONTAL STABILIZER DEICE SYSTEM PRESSURE SWITCH INSTALLATION IMPROVEMENT, SERVICE BULLETIN	MOS				DISCRETIONARY	
Eff. Date: 15-SEP-2008		HRS/MSC	A/R	-	-		
SB 560XL-31-02	INDICATING/RECORDING SYSTEMS - STAB MISCOMPARE ANNUNCIATION IMPROVEMENT (SUPERSEDED BY 560XL-31-02 R01), SERVICE BULLETIN	MOS				MANDATORY	Complied With
Eff. Date: 09-FEB-2004		HRS/MSC	A/R	12-MAR-2004			
				1200	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB 560XL-31-02 R01	INDICATING/RECORDING SYSTEMS - STAB MISCOMPARE ANNUNCIATION IMPROVEMENT, SERVICE BULLETIN					MANDATORY	Complied With
Eff. Date: 13-MAY-2004		MOS HRS/MSC	-	16-MAY-2006 2677	-		
SB 560XL-32-18 R02	LANDING GEAR - NLG ACTUATOR ISOLATOR INSTALLATION IMPROVEMENT, SERVICE BULLETIN					OPTIONAL	Complied With
Eff. Date: 15-AUG-2003		MOS HRS/MSC AFL	-	09-SEP-2025 8875:18 7163	-		
SB 560XL-32-20 R02	LANDING GEAR - NOSE GEAR TORQUE-LINK QUICK DISCONNECT, SERVICE BULLETIN					OPTIONAL	Complied With
Eff. Date: 08-MAY-2006		MOS HRS/MSC	A/R	05-SEP-2008 3665	-		
SB 560XL-32-23 R01	LANDING GEAR - UPLOCK SUPPORT FITTING LOCATION, SERVICE BULLETIN					DISCRETIONARY	
Eff. Date: 06-NOV-2003		MOS HRS/MSC	-	-	-		
SB 560XL-32-24	LANDING GEAR - EMERGENCY GEAR EXTENSION BOTTLE ACTUATOR HANDLE PIVOT SCREW REPLACEMENT (SUPERSEDED BY 560XL-32-24 R01), SERVICE BULLETIN					MANDATORY	Complied With
Eff. Date: 14-MAY-2004		MOS HRS/MSC	A/R	05-NOV-2004 1768	-		
SB 560XL-32-26 R02	LANDING GEAR - NOSE LANDING GEAR DOOR MECHANISM IMPROVEMENT, SERVICE BULLETIN					MANDATORY	Complied With
Eff. Date: 15-FEB-2006		MOS HRS/MSC	A/R	16-MAY-2006 2677	-		
SB 560XL-32-27	LANDING GEAR - MAIN LANDING GEAR TRAILING LINK PIVOT PIN RETENTION IMPROVEMENT, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 31-JAN-2006		MOS HRS/MSC	A/R	20-JUL-2007 3274	-		
SB 560XL-32-29	LANDING GEAR - NOSE WHEEL STEERING PULLEY BRACKET IMPROVEMENT, SERVICE BULLETIN					DISCRETIONARY	
		MOS HRS/MSC	A/R	-	-		
SB 560XL-32-32	LANDING GEAR - BRAKE HYDRAULIC PACK FILTER BOWL REPLACEMENT, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 26-APR-2006		MOS HRS/MSC	A/R	05-SEP-2008 3665	-		
SB 560XL-32-37	LANDING GEAR - NOSE LANDING GEAR STEERING HARDWARE REPLACEMENT, SERVICE BULLETIN					DISCRETIONARY	
Eff. Date: 05-NOV-2007		MOS HRS/MSC	A/R	-	-		
SB 560XL-32-40	LANDING GEAR ANNUNCIATION WIRING MODIFICATION, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 31-OCT-2007		MOS HRS/MSC	A/R	05-SEP-2008 3665	-		
SB 560XL-32-41	LANDING GEAR - TRANSMITTAL OF GOODRICH SERVICE BULLETIN 3-1571-32-7 (SUPERSEDED BY 560XL-32-41 R01), SERVICE BULLETIN					MANDATORY	Complied With - PREVIOUSLY SEE R1
Eff. Date: 25-FEB-2011		MOS HRS/MSC AFL	A/R	05-JUN-2012 4272:33 4072	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As
Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB 560XL-32-41 R01	LANDING GEAR - TRANSMITTAL OF GOODRICH SERVICE BULLETIN 3-1571-32-7, SERVICE BULLETIN	MOS			05-JUN-2012	MANDATORY	Complied With - PREVIOUSLY
Eff. Date: 05-MAY-2011		HRS/MSC	A/R		4272:33		
		AFL			4072		
SB 560XL-33-02	LIGHTS - AFT SIDEEDGE DIVIDER LIGHT REPLACEMENT, SERVICE BULLETIN	MOS				RECOMMENDED	Not Applicable - BY S/N
Eff. Date: 04-FEB-2002		HRS/MSC	-		-		
		AFL					
SB 560XL-33-05 R01	LIGHTS - LED TAIL POSITION LIGHT INSTALLATION (SUPERSEDED BY 560XL-33-05 R02), SERVICE BULLETIN	MOS			21-NOV-2008	OPTIONAL	Complied With
Eff. Date: 25-OCT-2005		HRS/MSC	-		3742		
SB 560XL-33-06	LIGHTS - CABIN UPWASH/DOWNWASH INDIRECT LIGHTING IMPROVEMENT (SUPERSEDED BY 560XL-33-06 R01), SERVICE BULLETIN	MOS				OPTIONAL	
Eff. Date: 30-OCT-2003		HRS/MSC	A/R		-		
SB 560XL-33-08 R01	LIGHTS - CHART LIGHT MODIFICATION (SUPERSEDED BY 560XL-33-08 R02), SERVICE BULLETIN	MOS			25-APR-2007	RECOMMENDED	Complied With
Eff. Date: 09-SEP-2005		HRS/MSC	-		3118		
SB 560XL-33-08 R02	LIGHTS - CHART LIGHT MODIFICATION, SERVICE BULLETIN	MOS			22-JAN-2008	RECOMMENDED	Complied With
Eff. Date: 12-APR-2007		HRS/MSC	A/R		3487		
SB 560XL-33-09	LIGHTS - LIGHT EMITTING DIODE (LED) EMERGENCY OVERWING LIGHTING INSTALLATION, SERVICE BULLETIN	MOS			05-SEP-2008	OPTIONAL	Complied With
Eff. Date: 02-MAY-2005		HRS/MSC	-		3665		
SB 560XL-33-11	LIGHTS - DROPPED AISLE LIGHT EMITTING DIODE (LED) INSTALLATION, SERVICE BULLETIN	MOS				OPTIONAL	
		HRS/MSC	A/R		-		
SB 560XL-33-15	LIGHTS - WING TIP NAVIGATION AND ANTI-COLLISION LED LIGHT INSTALLATION, SERVICE BULLETIN	MOS			21-SEP-2023	OPTIONAL	Complied With - WING TIP LIGHT REPLACED
Eff. Date: 15-MAY-2009		HRS/MSC	A/R		8033:12		
		AFL			6602		
SB 560XL-33-16	LIGHTS - GROUND RECOGNITION LIGHT LED UPGRADE, SERVICE BULLETIN	MOS				OPTIONAL	
Eff. Date: 12-JAN-2009		HRS/MSC	A/R		-		
SB 560XL-34-16	NAVIGATION - MEGGITT SECONDARY FLIGHT DISPLAY SYSTEM CIRCUIT BREAKER CHANGE AND 7.5 AMP IN LINE FUSE INSTALLATION (SUPERSEDED BY 560XL-34-16 R01), SERVICE BULLETIN	MOS			17-FEB-2002	RECOMMENDED	Complied With
Eff. Date: 11-JUN-2001		HRS/MSC	A/R		17		
		AFL					
SB 560XL-34-26 R01	NAVIGATION - ENHANCED GROUND PROXIMITY WARNING SYSTEM (EGPWS) COMPUTER SOFTWARE UPGRADE, SERVICE BULLETIN	MOS			12-MAR-2004	RECOMMENDED	Complied With
Eff. Date: 19-SEP-2002		HRS/MSC	-		1200		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As
Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB 560XL-34-27	NAVIGATION - UNIVERSAL AVIONICS PERFORMANCE DATABASE, SERVICE BULLETIN	MOS	-	-	-	OPTIONAL	- SERVICE BULLETIN ON HOLD.
Eff. Date: 13-MAY-2003		HRS/MSC					
SB 560XL-34-28	NAVIGATION - ENHANCED GROUND PROXIMITY WARNING SYSTEM (EGPWS) WIRING UPGRADE TO ENABLE THE -213-213 SOFTWARE FEATURES, SERVICE BULLETIN	MOS	-	-	-	OPTIONAL	
Eff. Date: 15-JAN-2003		HRS/MSC					
SB 560XL-34-29	NAVIGATION - HONEYWELL PRIMUS 1000 PHASE 3.0 SOFTWARE UPGRADE, SERVICE BULLETIN	MOS	-	15-FEB-2005	-	RECOMMENDED	Complied With
Eff. Date: 17-OCT-2002		HRS/MSC		1913			
SB 560XL-34-30	NAVIGATION - HONEYWELL PRIMUS 1000 PHASE 3.0 SOFTWARE UPGRADE, SERVICE BULLETIN	MOS	-	09-MAY-2003	-	RECOMMENDED	Complied With - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
Eff. Date: 21-JAN-2003		HRS/MSC		641			
SB 560XL-34-32 R01	NAVIGATION - CATEGORY II OPERATIONS (SUPERSEDED BY 560XL-34-32 R02), SERVICE BULLETIN	MOS	-	-	-	OPTIONAL	
Eff. Date: 28-MAR-2003		HRS/MSC					
SB 560XL-34-37	NAVIGATION - ENHANCED GROUND PROXIMITY WARNING SYSTEM (EGPWS) STEEP APPROACH SWITCH INSTALLATION, SERVICE BULLETIN	MOS	-	-	-	OPTIONAL	
Eff. Date: 29-MAR-2004		HRS/MSC					
SB 560XL-34-39 R01	NAVIGATION - ENHANCED GROUND PROXIMITY WARNING SWITCH (EGPWS) -219-219 SOFTWARE UPGRADE, SERVICE BULLETIN	MOS	-	-	-	OPTIONAL	
Eff. Date: 02-AUG-2005		HRS/MSC					
SB 560XL-34-40 R01	NAVIGATION - ENHANCED GROUND PROXIMITY WARNING SYSTEM (EGPWS) RUNWAY AWARENESS ADVISORY SYSTEM (RAAS) UPGRADE, SERVICE BULLETIN	MOS	A/R	-	-	OPTIONAL	
Eff. Date: 05-MAR-2008		HRS/MSC					
SB 560XL-34-41 R02	NAVIGATION - HONEYWELL TRANSPONDER UPGRADE FOR ELEMENTARY SURVEILLANCE, SERVICE BULLETIN	MOS	A/R	-	-	OPTIONAL	
Eff. Date: 15-JUN-2006		HRS/MSC					
SB 560XL-34-44	NAVIGATION - HONEYWELL MODE S TRANSPONDER UPGRADE FOR ENHANCED SURVEILLANCE (SUPERSEDED BY 560XL-34-44 R01), SERVICE BULLETIN	MOS	-	06-APR-2007	-	OPTIONAL	Complied With
Eff. Date: 15-SEP-2005		HRS/MSC		3103			
SB 560XL-34-44 R02	NAVIGATION - HONEYWELL MODE S TRANSPONDER UPGRADE FOR ENHANCED SURVEILLANCE (SUPERSEDED BY 560XL-34-44 R03), SERVICE BULLETIN	MOS	A/R	-	-	OPTIONAL	- SERVICE BULLETIN ON HOLD.
Eff. Date: 23-JUN-2008		HRS/MSC					
SB 560XL-34-45 R01	NAVIGATION - ENHANCED VISION SYSTEMS (EVS) INSTALLATION, SERVICE BULLETIN	MOS	A/R	-	-	OPTIONAL	
Eff. Date: 08-NOV-2006		HRS/MSC					

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB 560XL-34-46	NAVIGATION - HONEYWELL CD-820 FLIGHT MANAGEMENT SYSTEM (FMS) WIRING MODIFICATION, SERVICE BULLETIN					RECOMMENDED	Not Applicable
Eff. Date: 21-OCT-2005		MOS HRS/MSC	-	03-AUG-2006 2775	-		
SB 560XL-34-47	NAVIGATION - UNIVERSAL PERFORMANCE DATABASE DISABLEMENT, SERVICE BULLETIN					MANDATORY	Not Applicable - NOT APPLICABLE
Eff. Date: 20-MAY-2005		MOS HRS/MSC	A/R	26-AUG-2005 2353	-		
SB 560XL-34-50	NAVIGATION - IC-615 VERTICAL GLIDE PATH AND FLIGHT DIRECTOR IMPROVEMENTS (SUPERSEDED BY 560XL-34-50 R01), SERVICE BULLETIN					RECOMMENDED	Not Applicable
Eff. Date: 05-APR-2007		MOS HRS/MSC	A/R	29-NOV-2007 3440	-		
SB 560XL-34-50 R02	NAVIGATION - IC-615 VERTICAL GLIDE PATH AND FLIGHT DIRECTOR IMPROVEMENTS, SERVICE BULLETIN					RECOMMENDED	Not Applicable
Eff. Date: 06-AUG-2009		MOS HRS/MSC AFL	A/R	10-OCT-2011 4149:35 3962	-		
SB 560XL-34-52 R01	NAVIGATION - UNIVERSAL PERFORMANCE DATABASE INSTALLATION, SERVICE BULLETIN					OPTIONAL	
Eff. Date: 12-NOV-2007		MOS HRS/MSC	A/R	-	-		
SB 560XL-34-56 R01	NAVIGATION - UNIVERSAL UNS1-ESP AND UNS1-CSP+ UPGRADE TO SOFTWARE CONTROL NUMBER (SCN) 803.0, SERVICE BULLETIN					OPTIONAL	
Eff. Date: 12-JUL-2007		MOS HRS/MSC	A/R	-	-		
SB 560XL-34-58 R01	NAVIGATION - IC-615 FLIGHT DIRECTOR IMPROVEMENTS, SERVICE BULLETIN					DISCRETIONARY	
Eff. Date: 08-MAY-2008		MOS HRS/MSC	A/R	-	-		
SB 560XL-34-60	NAVIGATION - UNIVERSAL UNS-1ESPW FMS WIDE AREA AUGMENTATION SYSTEM (WAAS) UPGRADE, SERVICE BULLETIN					OPTIONAL	Complied With - BOTH FMS UPGRADED
Eff. Date: 17-MAR-2012		MOS HRS/MSC AFL	-	21-SEP-2023 8033:12 6602	-		
SB 560XL-34-66	NAVIGATION - INSTALLATION OF SCN 802.8 FOR UNS-1 FMS (SUPERSEDED BY 560XL-34-66 R01), SERVICE BULLETIN					RECOMMENDED	Not Applicable - SOFTWARE SCN 604.4
Eff. Date: 27-APR-2011		MOS HRS/MSC AFL	-	10-OCT-2011 4149:35 3962	-		
SB 560XL-34-70	NAVIGATION - UNIVERSAL SOLID STATE DATA TRANSFER UNIT (SSDTU) UPGRADE, SERVICE BULLETIN					OPTIONAL	Complied With - PART OF THE FMS UPGRADE
Eff. Date: 15-JUN-2011		MOS HRS/MSC AFL	A/R	21-SEP-2023 8033:12 6602	-		
SB 560XL-34-71	NAVIGATION - TCAS 2000 INTERFERENCE LIMITING FUNCTIONALITY UPGRADE FOR SOFTWARE VERSION 7.0 (SUPERSEDED BY 560XL-34-71 R01), SERVICE BULLETIN					MANDATORY	Not Applicable - N/A NO TCAS 2000 INST.
Eff. Date: 08-AUG-2012		MOS HRS/MSC AFL	-	18-SEP-2012 4325:32 4113	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB 560XL-34-74	NAVIGATION - GPS-4000S SOFTWARE UPDATE, SERVICE BULLETIN	MOS	-			RECOMMENDED	
Eff. Date: 28-APR-2014		HRS/MSC					
SB 560XL-34-75	NAVIGATION - HONEYWELL TRAFFIC ALERT AND COLLISION AVOIDANCE SYSTEM II (TCAS II) VERSION 7.1 SOFTWARE UPDATE (SUPERSEDED BY 560XL-34-75 R01), SERVICE BULLETIN	MOS	-	14-DEC-2015		OPTIONAL	Complied With - TCAS 7.1 UPGRADE PERFORMED
Eff. Date: 16-JUL-2015		HRS/MSC		4899:21			
		AFL		4602			
SB 560XL-34-75 R01	NAVIGATION - HONEYWELL TRAFFIC ALERT AND COLLISION AVOIDANCE SYSTEM II (TCAS II) VERSION 7.1 SOFTWARE UPDATE, SERVICE BULLETIN	MOS	-	14-DEC-2015		OPTIONAL	Complied With - TCAS 7.1 UPGRADE PERFORMED
Eff. Date: 28-OCT-2015		HRS/MSC		4899:21			
		AFL		4602			
SB 560XL-34-78	NAVIGATION - UNIVERSAL UNS-1ESPW FMS SOFTWARE UPGRADE 1000.8, SERVICE BULLETIN	MOS	-	21-SEP-2023		OPTIONAL	Complied With - BOTH FMS UPGRADED
Eff. Date: 20-MAY-2016		HRS/MSC		8033:12			
		AFL		6602			
SB 560XL-34-79 R01	NAVIGATION - LCR-100 W/SYNCHRO AHRS UPGRADE, SERVICE BULLETIN	MOS	-	17-JUN-2019		MANDATORY	Not Applicable
Eff. Date: 21-MAR-2017		HRS/MSC		5110:47			
		AFL		4774			
SB 560XL-34-82	NAVIGATION - STANDBY FLIGHT DISPLAY (SFD) WEIGHT ON WHEELS (WOW) ELECTRICAL WIRING IMPROVEMENT, SERVICE BULLETIN	MOS	-	31-AUG-2023		RECOMMENDED	Not Applicable - N/A BY A/C SERIAL NUMBER
Eff. Date: 22-MAY-2023		HRS/MSC		8033:12			
		AFL		6602			
SB 560XL-36-05 R01	PNEUMATIC - BLEED AIR OVERHEAT ANNUNCIATION IMPROVEMENT, SERVICE BULLETIN	MOS	-	12-MAR-2004		RECOMMENDED	Complied With
Eff. Date: 13-MAY-2003		HRS/MSC		1200			
SB 560XL-38-02	WATER/WASTE - EXTERNALLY SERVICEABLE TOILET IMPROVEMENT (SUPERSEDED BY 560XL-38-02 R01), SERVICE BULLETIN	MOS	-	-		OPTIONAL	
Eff. Date: 10-FEB-2003		HRS/MSC					
SB 560XL-49-02 R01	AUXILIARY POWER - APU MAINTENANCE DATA PORT INSTALLATION, SERVICE BULLETIN	MOS	-	-		OPTIONAL	
Eff. Date: 01-JUN-2004		HRS/MSC					
		AFL					
SB 560XL-49-09	AUXILIARY POWER UNIT PRINTED CIRCUIT BOARD IMPROVEMENT, SERVICE BULLETIN	MOS	-	11-OCT-2002		RECOMMENDED	Complied With
Eff. Date: 24-APR-2002		HRS/MSC		329			
SB 560XL-49-10 R01	AUXILIARY POWER - APU TO ENGINE START IMPROVEMENT, SERVICE BULLETIN	MOS	-	11-OCT-2002		RECOMMENDED	Complied With
Eff. Date: 23-MAY-2002		HRS/MSC		329			

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB 560XL-49-11	AUXILIARY POWER UNIT GENERATOR CONTROL UNIT WIRING IMPROVEMENT (SUPERSEDED BY 560XL-49-11 R01), SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 21-OCT-2002		MOS HRS/MSC	A/R	09-MAY-2003 641	-		
SB 560XL-49-15	AUXILIARY POWER - APU ADD OIL LIGHT REMOVAL, SERVICE BULLETIN					DISCRETIONARY	
Eff. Date: 13-JUN-2006		MOS HRS/MSC	A/R	-	-		
SB 560XL-49-16	AUXILIARY POWER - APU STARTER GENERATOR COOLING KIT INSTALLATION, SERVICE BULLETIN					DISCRETIONARY	
Eff. Date: 09-FEB-2006		MOS HRS/MSC	A/R	-	-		
SB 560XL-52-06	DOORS - CABIN DOOR UPPER LATCH PLATE INSPECTION (SUPERSEDED BY 560XL-52-06 R01), SERVICE BULLETIN					MANDATORY	Complied With
Eff. Date: 20-MAY-2002		MOS HRS/MSC	-	11-OCT-2002 329	-		
SB 560XL-52-13 R02	DOORS - BAGGAGE DOOR HINGE CHANNEL IMPROVEMENT, SERVICE BULLETIN					DISCRETIONARY	Complied With
Eff. Date: 11-MAY-2006		MOS HRS/MSC	A/R	05-SEP-2008 3665	-		
SB 560XL-52-14 R01	DOORS - CABIN DOOR REINFORCEMENT MODIFICATION, SERVICE BULLETIN					DISCRETIONARY	Complied With - CHANGE IN WEIGHT AND BALANCE: WEIGHT INCREASE +0.50 POUNDS, RESULTANT MOMENT +98.98 INCH-POUNDS, MOMENT/100 +1 .00 INCH-POUNDS.
Eff. Date: 23-FEB-2010		MOS HRS/MSC AFL	A/R	08-FEB-2019 5066:42 4739	-		
SB 560XL-52-15 R01	DOORS - CABIN ENTRY DOOR COUNTERBALANCE SPRING REPLACEMENT, SERVICE BULLETIN					DISCRETIONARY	Complied With
Eff. Date: 03-MAY-2007		MOS HRS/MSC AFL	A/R	07-MAR-2013 4403:58 4177	-		
SB 560XL-52-17 R01	DOORS - CABIN ENTRY DOOR OPERATION IMPROVEMENT, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 20-JUN-2008		MOS HRS/MSC	A/R	05-SEP-2008 3665	-		
SB 560XL-52-18	DOORS - AFT BAGGAGE DOOR HINGE MONEL RIVET REPLACEMENT (SUPERSEDED BY 560XL-52-18 R01), SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 30-JUL-2007		MOS HRS/MSC	A/R	05-SEP-2008 3665	-		
SB 560XL-53-05	FUSELAGE - DORSAL FIN INLET SCOOP VANE INSPECTION/REPLACEMENT, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 14-APR-2000		MOS HRS/MSC	-	20-DEC-2005 2464	-		
SB 560XL-53-13	FUSELAGE - NOSE DRIP CAP BOND INSPECTION (SUPERSEDED BY 560XL-53-13 R01), SERVICE BULLETIN					MANDATORY	Complied With
Eff. Date: 20-JUL-2011		MOS HRS/MSC AFL	A/R	10-OCT-2011 4149:35 3962	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB 560XL-53-13 R01	FUSELAGE - NOSE DRIP CAP BOND INSPECTION, SERVICE BULLETIN					MANDATORY	
Eff. Date: 05-OCT-2011		MOS HRS/MSC	A/R	-	-		
SB 560XL-53-16	FUSELAGE - STINGER DRAIN INSTALLATION, SERVICE BULLETIN					MANDATORY	Complied With
Eff. Date: 04-OCT-2011		MOS HRS/MSC AFL	A/R	05-MAY-2012 4272:33 4072	-		
SB 560XL-57-03	WINGS - WING WIRE BUNDLE ANCHOR IMPROVEMENT (SUPERSEDED BY 560XL-57-03 R01), SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 13-MAY-2003		MOS HRS/MSC	A/R	12-MAR-2004 1200	-		
SB 560XL-57-03 R01	WINGS - WING WIRE BUNDLE ANCHOR IMPROVEMENT, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 20-MAY-2004		MOS HRS/MSC	-	16-MAY-2006 2677	-		
SB 560XL-57-04 R02	WINGS - VORTEX GENERATOR ADHESIVE IMPROVEMENT, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 10-JUN-2004		MOS HRS/MSC	-	15-FEB-2005 1913	-		
SB 560XL-71-06	POWER PLANT - COWLING IMPROVEMENT, SERVICE BULLETIN					MANDATORY	Complied With
Eff. Date: 07-MAR-2002		MOS HRS/MSC	-	23-MAY-2002 155	-		
SB 560XL-71-07	POWER PLANT - MOTIVE FLOW FUEL LINE/OIL LINE CLEARANCE IMPROVEMENT (SUPERSEDED BY 560XL-71-07 R01), SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 01-OCT-2004		MOS HRS/MSC	A/R	29-APR-2005 2059	-		
SB 560XL-71-09	POWER PLANT - ENGINE OIL DOOR DOUBLER INSTALLATION, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 09-JUL-2007		MOS HRS/MSC	A/R	05-SEP-2008 3665	-		
SB 560XL-71-11 R01	POWER PLANT - ENGINE FUEL MANIFOLD DRAIN LINE INSTALLATION, SERVICE BULLETIN					OPTIONAL	Complied With
Eff. Date: 02-AUG-2012		MOS HRS/MSC AFL	-	01-APR-2019 5066:42 4739	-		
SB 560XL-73-01	ENGINE FUEL AND CONTROL - ENGINE FUEL LINE FITTING INSPECTION, SERVICE BULLETIN					MANDATORY	Complied With
Eff. Date: 20-SEP-2002		MOS HRS/MSC AFL	-	01-APR-2019 5066:42 4739	-		
SB 560XL-78-02	EXHAUST - THRUST REVERSER THROTTLE STOP SOLENOID GROUND IMPROVEMENT, SERVICE BULLETIN					OPTIONAL	
Eff. Date: 10-MAR-2003		MOS HRS/MSC	-	-	-		
SB 560XL-80-03	STARTING - APU GENERATOR CONTROL UNIT (GCU) CURRENT LIMITING, SERVICE BULLETIN					RECOMMENDED	Complied With
Eff. Date: 13-JAN-2005		MOS HRS/MSC	-	29-APR-2005 2059	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
ASL ASL560XL-26-01	FIRE PROTECTION - TRANSMITTAL OF MEGGITT SAFETY SYSTEMS SERVICE BULLETIN 26-36-THERMISTORS DETECTORS (SUPERSEDED BY ASL560XL-26-01 R01), ALERT SERVICE LETTER					MANDATORY	Not Applicable - NOT APPLICABLE
Eff. Date: 04-APR-2007		MOS HRS/MSC	A/R	25-APR-2007 3118	-		
ASL ASL560XL-27-10	FLIGHT CONTROLS - TRANSMITTAL OF FAA APPROVED AIRPLANE FLIGHT MANUAL TEMPORARY CHANGE 56XFM TC-09-04, ALERT SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 11-DEC-2002		MOS HRS/MSC	-	09-MAY-2003 641	-		
ASL ASL560XL-27-12	FLIGHT CONTROLS - AILERON WING CABLE INSPECTION (SUPERSEDED BY ASL560XL-27-12 R01), ALERT SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 20-NOV-2003		MOS HRS/MSC	A/R	18-DEC-2003 1110	-		
ASL ASL560XL-27-15	ELEVATOR TRIM CABLE INSPECTION, ALERT SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 04-DEC-2006		MOS HRS/MSC	A/R	06-APR-2007 3103	-		
ASL ASL560XL-32-13	LANDING GEAR - EMERGENCY BRAKE, FLAPS, EMERGENCY GEAR AND SPEED BRAKE HYDRAULIC/PNEUMATIC LINE CLAMP INSPECTION, ALERT SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 08-AUG-2003		MOS HRS/MSC	-	19-SEP-2003 943	-		
ASL ASL560XL-32-14	LANDING GEAR - NOSE LANDING GEAR OLEO PRESSURE INSPECTION, ALERT SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 22-DEC-2004		MOS HRS/MSC	A/R	15-FEB-2005 1913	-		
ASL ASL560XL-34-08	NAVIGATION - TRANSMITTAL OF HONEYWELL TECHNICAL NEWSLETTER A23-3850-001, ALERT SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 17-FEB-2003		MOS HRS/MSC	-	09-MAY-2003 641	-		
ASL ASL560XL-53-08	FUSELAGE - AFT CANTED BULKHEAD DRAIN INSTALLATION (SUPERSEDED BY ASL560XL-53-08 R01), ALERT SERVICE LETTER					MANDATORY	- SUPERSEDED BY REVISION 1
Eff. Date: 21-JAN-2011		DAYS HRS/MSC	A/R	-	-		
FAA 2012-06-01							
ASL ASL560XL-53-08 R01	FUSELAGE - AFT CANTED BULKHEAD DRAIN INSTALLATION, ALERT SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 27-JAN-2011		DAYS HRS/MSC AFL	A/R	11-APR-2011 4104:26 3924	-		
ASL ASL560XL-72-19	LEFT ENGINE TRANSMITTAL OF P&WC SERVICE DOCUMENTS - INTERCOMPRESSOR BLEED VALVE/SERVO - VALVE - INSPECTION/REPLACEMENT OF, ALERT SERVICE LETTER					MANDATORY	Not Applicable - SB A30421 N/A (ENG. SN. DB0473 & DB0472 ARE PRE SB 30343 & 30404 . SB 30420 TO BE DONE WHEN ACCESS.
Eff. Date: 01-SEP-2010		MOS HRS/MSC AFL	A/R	19-NOV-2010 4049 3877	-		



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
ASL ASL560XL-72-19	RIGHT ENGINE TRANSMITTAL OF P&WC SERVICE DOCUMENTS - INTERCOMPRESSOR BLEED VALVE/SERVO-VALVE-INSPECTION/REPLACEMENT OF, ALERT SERVICE LETTER					MANDATORY	Not Applicable - SB A30421 N/A (ENG. SN. DB0473 & DB0472 ARE PRE SB 30343 & 30404 . SB 30420 TO BE DONE WHEN ACCESS.
Eff. Date: 01-SEP-2010		MOS HRS/MSC AFL	A/R	19-NOV-2010 4049 3877	-		
ASL ASL560XL-73-11	LEFT ENGINE TRANSMITTAL OF PRATT & WHITNEY CANADA (P&WC) SERVICE BULLETIN A30319 TURBOFAN ENGINE NEW FUEL MANIFOLD-INTRODUCTION OF, ALERT SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 02-JUL-2007		MOS HRS/MSC	A/R	13-NOV-2007 3405	-		
ASL ASL560XL-73-11	RIGHT ENGINE TRANSMITTAL OF PRATT & WHITNEY CANADA (P&WC) SERVICE BULLETIN A30319 TURBOFAN ENGINE NEW FUEL MANIFOLD-INTRODUCTION OF, ALERT SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 02-JUL-2007		MOS HRS/MSC	A/R	13-NOV-2007 3405	-		
SL CIL-26-01	FIRE PROTECTION - FIRE EXTINGUISHER BOTTLE CARTRIDGE GROUND STUD TORQUING (SUPERSEDED BY CIL-26-01 R01), SERVICE LETTER					MANDATORY	
Eff. Date: 10-MAY-2016		MOS HRS/MSC	-	-	-		
SL CIL-26-01 R01	FIRE PROTECTION - FIRE EXTINGUISHER BOTTLE CARTRIDGE GROUND STUD TORQUING, SERVICE LETTER					MANDATORY	Not Applicable - BY DATE CARTRIDGES
Eff. Date: 16-JUN-2016		MOS HRS/MSC AFL	-	26-JAN-2017 4967:11 4654	-		
SL CIL-34-02	NAVIGATION - TRANSMITTAL OF HONEYWELL SIL D201301000032, PRIMUS II INTEGRATED RADIO SYSTEM, SERVICE LETTER					MANDATORY	Complied With - FOUND UNITS INSATLLED & MOD'S CARRIED OUT
Eff. Date: 18-MAR-2013		MOS HRS/MSC AFL	-	18-APR-2013 4410:34 4181	-		
FAA 2010-07-02							
SL CIL-34-03	TRANSMITTAL OF HONEYWELL SERVICE BULLETIN 7014300-22-16, MODIFICATION (MOD) R TO DU-870 DISPLAY UNIT PN 7014300-901 AND -902; DECREASE FAILURE RATE OF HIGH VOLTAGE POWER SUPPLY (HVPS) BECAUSE OF HIGH HUMIDITY (SUPERSEDED BY CIL-34-03 R01), SERVICE LETTER					RECOMMENDED	Not Applicable - SUPERSEDED BY R1
Eff. Date: 10-OCT-2013		MOS HRS/MSC AFL	-	02-NOV-2014 4674:21 4389	-		
SL CIL-34-03 R01	TRANSMITTAL OF HONEYWELL SERVICE BULLETIN 7014300-22-16, MODIFICATION (MOD) R TO DU-870 DISPLAY UNIT PN 7014300-901 AND -902; DECREASE FAILURE RATE OF HIGH VOLTAGE POWER SUPPLY (HVPS) BECAUSE OF HIGH HUMIDITY (SUPERSEDED BY CIL-34-03 R02), SERVICE LETTER					RECOMMENDED	Not Applicable - SUPERSEDED BY R2
Eff. Date: 13-NOV-2013		MOS HRS/MSC AFL	-	02-NOV-2014 4674:21 4389	-		
SL CIL-35-02	OXYGEN - TRANSMITTAL OF ZODIAC AEROTECHNICS SERVICE BULLETIN MC10-35-274, SERVICE LETTER					MANDATORY	
Eff. Date: 12-JUN-2015		MOS HRS/MSC	-	-	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL CIL-35-05	OXYGEN - TRANSMITTAL OF ZODIAC AEROSPACE SB MCF-SBU-35-001, SERVICE LETTER					MANDATORY	Not Applicable - BY PN AND SN OXYGEN MASK
Eff. Date: 08-JAN-2016		DAYS		23-JAN-2016			
		HRS/MSC	-	4914:06	-		
		AFL		4609			
FAA 2015-23-09							
SL CIL-99-02	MISCELLANEOUS - AVOID OPERATIONS ON RUNWAYS TREATED WITH RUNWAY DE-ICE (RDI) FLUIDS. AIRCRAFT WASHING RECOMMENDED AFTER EXPOSURE TO RDI FLUIDS, SERVICE LETTER					RECOMMENDED	
Eff. Date: 23-MAY-2012		MOS					
		HRS/MSC	-				
SL CIL-99-03	MISCELLANEOUS - CORROSION PREVENTION AND CONTROL PROGRAM (CPCP) (SUPERSEDED BY CIL-99-03 R01), SERVICE LETTER					RECOMMENDED	
Eff. Date: 04-JAN-2013		MOS					
		HRS/MSC	-				
SL SL560XL-05-03	TIME LIMITS/MAINTENANCE CHECKS - CONVERSION FROM CALENDAR SCHEDULE MAINTENANCE PROGRAM TO MSG-3 SCHEDULE MAINTENANCE PROGRAM, SERVICE LETTER					OPTIONAL	Complied With - SL560XL-05-03 WAS INCORPORATED ON 560XL-5230 WITHOUT BEING REMOVED FROM SERVICE. FROM THIS DATE FORWARD, THE CITATION XL MSG-3 MAINTENANCE PLAN APPLIES TO 560XL-5230. FOR QUESTIONS, CONTACT TEXTRON AVIATION MAINTENANCE ENGINEERING DEPARTMENT, WICHITA, KS AT +1 316-517-9370
Eff. Date: 17-JAN-2018		MOS		04-APR-2019			
		HRS/MSC	-	5066:42	-		
		AFL		4739			
SL SL560XL-21-03	AIR CONDITIONING - TEMPERATURE SENSOR MODIFICATION, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 16-JAN-2002		MOS		11-OCT-2002			
		HRS/MSC	-	329	-		
SL SL560XL-21-04	AIR CONDITIONING - AIR CYCLE MACHINE ASPIRATOR TUBING INSPECTION, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 14-JUN-2002		MOS		11-OCT-2002			
		HRS/MSC	-	329	-		
SL SL560XL-21-05	AIR CONDITIONING - R-134A AIR CONDITIONING SYSTEM WIRING INSPECTION, SERVICE LETTER					RECOMMENDED	Not Applicable
Eff. Date: 31-MAY-2007		MOS		22-JAN-2008			
		HRS/MSC	A/R	3487	-		
SL SL560XL-21-06	AIR CONDITIONING - DROPPED AISLE DUCT IMPROVEMENT, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 16-JUL-2002		MOS		11-OCT-2002			
		HRS/MSC	-	329	-		
SL SL560XL-21-07	AIR CONDITIONING - TRANSMITTAL OF HONEYWELL SERVICE BULLETIN 2215460-21-2762, ENVIRONMENTAL CONTROL UNIT (ECU) - INSPECT AND REPLACE THE OVER TEMPERATURE SWITCH (SUPERSEDED BY SL560XL-21-07 R01), SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 16-JAN-2003		MOS		09-MAY-2003			
		HRS/MSC	A/R	641	-		
SL SL560XL-22-02	AUTO FLIGHT - TRANSMITTAL OF HONEYWELL SERVICE BULLETIN 4006719-22-0019, SM-200 SERVO DRIVE, SERVICE LETTER					DISCRETIONARY	
		MOS					
		HRS/MSC	A/R	-	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL SL560XL-23-04 R01	COMMUNICATIONS - AIRSHOW RELIABILITY IMPROVEMENTS AND SERVICE PACK SOFTWARE UPGRADE, SERVICE LETTER					RECOMMENDED	Complied With - NOT APPLICABLE
Eff. Date: 11-MAR-2003		MOS HRS/MSC	-	09-MAY-2003 641	-		
SL SL560XL-23-05	COMMUNICATIONS - TRANSMITTAL OF HONEYWELL SERVICE BULLETIN A21-3851-001, RCZ INTEGRATED COMMUNICATION UNIT, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 03-APR-2003		MOS HRS/MSC	-	12-MAR-2004 1200	-		
SL SL560XL-23-07	COMMUNICATIONS - TRANSMITTAL OF HONEYWELL SERVICE BULLETIN 7511001-23-6026 SRZ 850/851 INTEGRATED RADIO SYSTEM - REMOVE THE RISK OF AUDIO FEEDBACK WHEN POWER IS TURNED ON, SERVICE LETTER					DISCRETIONARY	
Eff. Date: 01-JUL-2005		MOS HRS/MSC	-	-	-		
SL SL560XL-24-01	ELECTRICAL POWER - BATTERY DISCONNECT RELAY BUS BAR GROUNDING PLATE INSPECTION, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 24-JUL-2003		MOS HRS/MSC	-	12-MAR-2004 1200	-		
SL SL560XL-24-02	ELECTRICAL POWER - MAIN ENGINE AND APU GROUND INSTALLATION INSPECTION AND BOND CHECK, SERVICE LETTER					DISCRETIONARY	Complied With
Eff. Date: 25-MAR-2004		MOS HRS/MSC	-	29-APR-2005 2059	-		
SL SL560XL-24-07	ELECTRICAL POWER - RIGHT AC GENERATOR WIRE ROUTING VERIFICATION, SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 13-JAN-2017		DAYS HRS/MSC AFL	-	15-FEB-2017 4977:06 4666	-		
FAA 2017-04-14 PARA (G)							
SL SL560XL-25-02	EQUIPMENT/FURNISHINGS - TOILET SHROUD ASSEMBLY INSPECTION, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 02-FEB-2004		MOS HRS/MSC	-	23-JUL-2004 1489	-		
SL SL560XL-25-05	EQUIPMENT/FURNISHINGS - CABIN SYSTEMS AIRSHOW 400 DIGITAL INTERFACE UNIT (DIU) 920040 SERVICE BULLETIN 920040-44-01 SAVE MAIN CPU CMOS SETUP SETTINGS TO FLASH MEMORY, SERVICE LETTER					OPTIONAL	
Eff. Date: 13-FEB-2007		MOS HRS/MSC	A/R	-	-		
SL SL560XL-25-10	EQUIPMENT/FURNISHINGS - TRANSMITTAL OF PACIFIC SCIENTIFIC AEROSPACE SERVICE BULLETIN SB 25-1111432, INFORMATION REGARDING THE POTENTIAL FAILURE OF THE GUARDED ROTARYBUCKLE PLASTIC HANDLE, SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 10-DEC-2007		MOS HRS/MSC	A/R	05-SEP-2008 3665	-		
SL SL560XL-25-11	EQUIPMENT/FURNISHINGS - TRANSMITTAL OF ROCKWELL COLLINS SERVICE BULLETIN 9200XX-44-4 AIRSHOW 400 DIGITAL INTERFACE UNIT (DIU) AND AIRSHOW GENESYS DATA COMMUNICATION UNIT (DCU), SERVICE LETTER					DISCRETIONARY	
Eff. Date: 10-DEC-2007		MOS HRS/MSC	A/R	-	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL SL560XL-25-20	EQUIPMENT/FURNISHINGS - INSPECTION OF THE INERTIAL REEL AND RESTRAINT SYSTEM, SERVICE LETTER					MANDATORY	Not Applicable
Eff. Date: 14-AUG-2023		MOS			31-AUG-2023		
		HRS/MSC	-		8033:12	-	
		AFL			6602		
		APH					
		APS					
SL SL560XL-25-23	EQUIPMENT/FURNISHINGS - PASSENGER SEAT SWIVEL PLATE SWING ARM ASSEMBLY FASTENER INSPECTION FOR PROPER ADHESIVE APPLICATION, SERVICE LETTER					RECOMMENDED	Not Applicable
Eff. Date: 05-APR-2023		MOS			31-AUG-2023		
		HRS/MSC	-		8033:12	-	
		AFL			6602		
		APH					
		APS					
SL SL560XL-26-02 R01	FIRE PROTECTION - FIRE BOTTLE WIRE VERIFICATION AND TEST, SERVICE LETTER					MANDATORY	Complied With - TEST PERFORMED AND WIRES VERIFIED
Eff. Date: 31-JUL-2024		DAYS			26-SEP-2024		
		HRS/MSC	-		8474:32	-	
		AFL			6874		
FAA 2025-11-09							
SL SL560XL-27-06	FLIGHT CONTROLS - ELEVATOR ELECTRIC TRIM TAB ACTUATOR MOUNT INSPECTION, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 01-AUG-2002		MOS			11-OCT-2002		
		HRS/MSC	-		329	-	
SL SL560XL-27-08	FLIGHT CONTROLS - RUDDER ASSEMBLY CONDUIT TUBE INSPECTION, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 20-SEP-2002		MOS			09-MAY-2003		
		HRS/MSC	-		641	-	
SL SL560XL-27-13	FLIGHT CONTROLS - ELEVATOR TRIM CABLE INSPECTION, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 15-OCT-2004		MOS			15-FEB-2005		
		HRS/MSC	-		1913	-	
SL SL560XL-27-17	FLIGHT CONTROLS - ELEVATOR TRIM WHEEL INSPECTION, SERVICE LETTER					RECOMMENDED	Complied With - NO NOTES
Eff. Date: 01-DEC-2008		MOS			13-DEC-2010		
		HRS/MSC	A/R		4060	-	
		AFL			3887		
SL SL560XL-27-20	FLIGHT CONTROLS - RUDDER TORQUE TUBE/SECTOR ASSEMBLY GAP INSPECTION (SUPERSEDED BY SL560XL-27-20 R01), SERVICE LETTER					MANDATORY	
Eff. Date: 05-SEP-2013		MOS					
		HRS/MSC	-			-	
SL SL560XL-27-20 R01	FLIGHT CONTROLS - RUDDER TORQUE TUBE/SECTOR ASSEMBLY GAP INSPECTION (SUPERSEDED BY SL560XL-27-20 R02), SERVICE LETTER					MANDATORY	
Eff. Date: 19-SEP-2013		MOS					
		HRS/MSC	-			-	
SL SL560XL-27-20 R02	FLIGHT CONTROLS - RUDDER TORQUE TUBE/SECTOR ASSEMBLY GAP INSPECTION, SERVICE LETTER					MANDATORY	Complied With - SHIM INSTALLED IAW SL560XL-27-20R2
Eff. Date: 18-JAN-2014		MOS			19-MAR-2014		
		HRS/MSC	-		4566:55	-	
		AFL			4303		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL SL560XL-27-21	FLIGHT CONTROLS - RUDDER TORQUE TUBE/SECTOR ASSEMBLY INSPECTION, SERVICE LETTER					MANDATORY	Complied With - NO PAINT CRACKS OR OTHER OBVIOUS FOUND
Eff. Date: 18-JAN-2014		MOS HRS/MSC AFL	-	14-FEB-2014 4561:51 4299	-		
SL SL560XL-27-33	FLIGHT CONTROLS - ELEVATOR CABLE INSPECTION AT THE AFT CANTED BULKHEAD, SERVICE LETTER					MANDATORY	Complied With - INSPECTED AND FOUND CLEARANCE >0.10"
Eff. Date: 05-NOV-2014		MOS HRS/MSC AFL	-	30-JAN-2015 4675:30 4392	-		
SL SL560XL-27-34	FLIGHT CONTROLS - RIGHT OUTBOARD AILERON WING UP CABLE ASSEMBLY INSPECTION (SUPERSEDED BY SL560XL-27-34 R01), SERVICE LETTER					MANDATORY	Complied With - CABLE WAS REPLACED AND FOUND IN COMPLIANCE
Eff. Date: 09-JAN-2015		MOS HRS/MSC AFL	-	30-JAN-2015 4675:30 4392	-		
SL SL560XL-27-34 R01	FLIGHT CONTROLS - RIGHT OUTBOARD AILERON WING UP CABLE ASSEMBLY INSPECTION, SERVICE LETTER					MANDATORY	Complied With - R0 C/W
Eff. Date: 22-JAN-2015		MOS HRS/MSC AFL	-	30-JAN-2015 4675:30 4392	-		
SL SL560XL-27-34 R02	FLIGHT CONTROLS - RIGHT OUTBOARD AILERON WING UP CABLE ASSEMBLY INSPECTION, SERVICE LETTER					MANDATORY	Not Applicable - NOT APPLICABLE AS PER SL560XL-27-34 R01 COMPLIANCE
Eff. Date: 12-JUN-2019		MOS HRS/MSC AFL	-	08-AUG-2019 5215:27 4849	-		
SL SL560XL-27-35	FLIGHT CONTROLS - AFT AILERON SECTOR ASSEMBLY INSPECTION, SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 16-NOV-2015		DAYS HRS/MSC AFL	-	26-JAN-2017 4967:11 4654	-		
SL SL560XL-27-40	FLIGHT CONTROLS - INSPECTION OF THE RUDDER BIAS ACTUATOR CYLINDER FOR MISSING SAFETY WIRE, SERVICE LETTER					MANDATORY	Not Applicable - AS PER S/N
Eff. Date: 10-MAR-2026		MOS HRS/MSC AFL	-	13-MAR-2026 9018:28 7267	-		
SL SL560XL-28-05	FUEL - FUEL BOOST PUMP INSPECTION (SUPERSEDED BY SL560XL-28-05 R01), SERVICE LETTER					MANDATORY	
Eff. Date: 27-MAR-2013		MOS HRS/MSC	-	-	-		
SL SL560XL-28-05 R01	FUEL - FUEL BOOST PUMP INSPECTION, SERVICE LETTER					MANDATORY	Complied With - C/W FOUND PN LR55505-2 INST
Eff. Date: 12-DEC-2013		MOS HRS/MSC AFL	-	19-MAR-2014 4566:55 4303	-		
SL SL560XL-28-07	FUEL - 6621102-1 LEFT WEB CORROSION PROTECTION, SERVICE LETTER					RECOMMENDED	
Eff. Date: 16-MAY-2022		MOS HRS/MSC	-				

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL SL560XL-29-01	HYDRAULIC POWER - HYDRAULIC RESERVOIR INSPECTION, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 14-MAY-2002		MOS HRS/MSC	-	11-OCT-2002 329	-		
SL SL560XL-29-03	HYDRAULIC POWER - ENGINE HYDRAULIC HOSE INSPECTION, SERVICE LETTER					RECOMMENDED	Complied With - BOTH HOSES , AFFECTED BY THIS SL , REPL. ON LH ENG. (WC2975)
Eff. Date: 10-JUN-2009		MOS HRS/MSC AFL	A/R	23-JUL-2010 3995 3837	-		
SL SL560XL-29-05	HYDRAULIC POWER - ENGINE DRIVEN PUMP HYDRAULIC VERIFICATION, SERVICE LETTER					RECOMMENDED	Not Applicable - BY PN HYDRAULIC PUMP, PN 9912062-4 IS INSTALLED
Eff. Date: 14-JUN-2017		MOS HRS/MSC AFL	-	21-SEP-2017 5052 4732	-		
SL SL560XL-31-03	INDICATING/RECORDING SYSTEMS - INSTRUMENT PANEL INSTALLATION MODIFICATION (SUPERSEDED BY SL560XL-31-03 R01), SERVICE LETTER					DISCRETIONARY	Complied With
Eff. Date: 17-OCT-2005		MOS HRS/MSC	-	16-MAY-2006 2677	-		
SL SL560XL-31-05	INDICATING/RECORDING SYSTEMS - TRANSMITTAL OF L-3 COMMUNICATIONS ALERT BULLETIN NO. CESSNA SB 001, SERVICE LETTER					MANDATORY	Not Applicable - NA BY S/N INSTALLED
Eff. Date: 04-AUG-2011		MOS HRS/MSC AFL	A/R	10-OCT-2011 4149:35 3962	-		
SL SL560XL-31-08	INDICATING/RECORDING SYSTEMS - COLLINS ENVIRONMENTAL CONTROLLER (IEC) AND POWER SUPPLY (PWR) IAPS MODULES INSPECTION/REPLACEMENT, SERVICE LETTER					RECOMMENDED	Not Applicable - N/A BY A/C SERIAL NUMBER
Eff. Date: 14-JUN-2023		MOS HRS/MSC AFL	-	31-AUG-2023 8033:12 6602	-		
SL SL560XL-32-15	LANDING GEAR - TRANSMITTAL OF GOODRICH SERVICE BULLETIN 3-1571-32-1, SERVICE LETTER					OPTIONAL	
Eff. Date: 02-AUG-2007		MOS HRS/MSC	A/R	-	-		
SL SL560XL-32-16	LANDING GEAR - TRANSMITTAL OF GOODRICH SERVICE BULLETIN 2-1601-32-4, LANDING GEAR - BRAKE ASSEMBLY - P/N 2-1601-1, INTRODUCTION OF NEW O-RING, SERVICE LETTER					DISCRETIONARY	
Eff. Date: 11-JAN-2007		MOS HRS/MSC	A/R	-	-		
SL SL560XL-32-18	LANDING GEAR - TRANSMITTAL OF GOODRICH SERVICE BULLETINS 3-1571-32-2 AND 3-1571-32-3, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 02-AUG-2007		MOS HRS/MSC AFL	A/R	05-SEP-2008 3665 3583	-		
SL SL560XL-32-19 R01	LANDING GEAR - TRANSMITTAL OF GOODRICH SERVICE BULLETIN 3-1571-32-4 INTRODUCTION OF IMPROVED THERMAL RELIEF PLUG ASSEMBLY, SERVICE LETTER					DISCRETIONARY	
Eff. Date: 20-NOV-2007		MOS HRS/MSC	A/R	-	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL SL560XL-32-20	LANDING GEAR - TRANSMITTAL OF GOODRICH SERVICE LETTER 2056, SERVICE LETTER	MOS			05-SEP-2008	RECOMMENDED	Complied With
Eff. Date: 02-AUG-2007		HRS/MSC	A/R		3665		
		AFL			3583		
SL SL560XL-32-23	LANDING GEAR - EMERGENCY GEAR RELEASE INSPECTION, SERVICE LETTER	MOS			13-DEC-2010	RECOMMENDED	Complied With - NO NOTES
Eff. Date: 17-AUG-2009		HRS/MSC	A/R		4060		
		AFL			3887		
SL SL560XL-32-26	LANDING GEAR - REPLACEMENT OF THE COTTER PIN FOR THE EMERGENCY GEAR-RELEASE, SERVICE LETTER	MOS			06-JUL-2011	MANDATORY	Complied With
Eff. Date: 06-AUG-2010		HRS/MSC	A/R		4149:21		
		AFL			3957		
SL SL560XL-32-30	LANDING GEAR - BRAKE HYDRAULIC RESERVOIR SIGHT GLASS FASTENER TORQUE INSPECTION, SERVICE LETTER	MOS			22-SEP-2023	RECOMMENDED	Not Applicable
Eff. Date: 11-SEP-2023		HRS/MSC	-		8033:12		
		AFL			6602		
		APH					
		APS					
SL SL560XL-33-04	LIGHTS - AFT EMERGENCY LIGHTING BATTERY PACK COVER REMOVAL, SERVICE LETTER	MOS				OPTIONAL	
Eff. Date: 30-JUL-2003		HRS/MSC	-		-		
SL SL560XL-33-10	LIGHTS - AFT SIDELEDGE DIVIDER LIGHT INSPECTION/REPLACEMENT, SERVICE LETTER	MOS			10-OCT-2011	RECOMMENDED	Complied With
Eff. Date: 06-AUG-2010		HRS/MSC	A/R		4149:35		
		AFL			3962		
SL SL560XL-34-07	NAVIGATION - TRANSMITTAL OF HONEYWELL PUBLICATION NUMBER A21-3440-001, PRIMUS 1000/2000 INTEGRATED AVIONICS SYSTEM- AZ840/850 MICRO AIR DATA COMPUTER (MADC) - INSPECT FOR PRESENCE OF VENDOR SPECIFIC COMPONENTS AND REPLACE AS REQUIRED, SERVICE LETTER	MOS			12-MAR-2004	RECOMMENDED	Complied With
Eff. Date: 27-OCT-2003		HRS/MSC	-		1200		
SL SL560XL-34-11	NAVIGATION - TRANSMITTAL OF HONEYWELL SERVICE BULLETIN 7014700-34-0040, SERVICE LETTER	MOS			12-MAR-2004	RECOMMENDED	Complied With - NOT APPLICABLE
Eff. Date: 30-JUL-2003		HRS/MSC	-		1200		
SL SL560XL-34-13	NAVIGATION - TRANSMITTAL OF HONEYWELL SERVICE BULLETIN 965-0976-XXX-34-70, ENHANCED GROUND PROXIMITY WARNING SYSTEM (EGPWS) (SUPERSEDED BY SL560XL-34-13 R01), SERVICE LETTER	MOS			12-MAR-2004	DISCRETIONARY	Complied With
Eff. Date: 03-NOV-2003		HRS/MSC	A/R		1200		
SL SL560XL-34-14	NAVIGATION - FLUX VALVE INSPECTION CRITERIA, SERVICE LETTER	MOS			08-FEB-2019	INFORMATIONAL	Complied With - NO FLUX VALVE LEAKAGE FOUND AT THIS TIME ON THE LEFT OR RIGHT FLUX VALVES. NO FURTHER ACTION REQUIRED.
Eff. Date: 01-APR-2004		HRS/MSC	-		5066:42		
		AFL			4739		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL SL560XL-34-17	NAVIGATION - TRANSMITTAL OF HONEYWELL SOFTWARE BULLETIN SWB TPU 67A-SW8, SERVICE LETTER	MOS HRS/MSC	A/R	-	-	DISCRETIONARY	
SL SL560XL-34-18	NAVIGATION - ELEMENTARY SURVEILLANCE TRANSPONDER PRODUCT IMPROVEMENT, SERVICE LETTER	MOS HRS/MSC	-	06-APR-2007 3103	-	MANDATORY	Not Applicable
SL SL560XL-35-04	OXYGEN - TRANSMITTAL OF INTERTECHNIQUE SERVICE BULLETIN MXH-35-240 (SUPERSEDED BY SL560XL-35-04 R01), SERVICE LETTER	MOS HRS/MSC AFL	-	10-OCT-2011 4149:35 3962	-	MANDATORY	Not Applicable - NA BY DATE OF MANUFACTURE
SL SL560XL-35-04 R02	OXYGEN - TRANSMITTAL OF INTERTECHNIQUE SERVICE BULLETIN MXH-35-240, SERVICE LETTER	MOS HRS/MSC AFL	-	18-APR-2013 4410:34 4181	-	MANDATORY	Not Applicable - BY SN EQUIPMENT - SN 107073 & SN 93628 ARE INSTALLED
SL SL560XL-36-01 R01	PNEUMATIC - PARTICULATE TRAP DRAIN HOLE ADDITION, SERVICE LETTER	MOS HRS/MSC	-	11-OCT-2002 329	-	RECOMMENDED	Complied With
SL SL560XL-36-02	PNEUMATIC - ENGINE BLEED AIR COUPLING SAFETY WIRE ADDITION, SERVICE LETTER	MOS HRS/MSC	-	23-MAY-2002 155	-	MANDATORY	Complied With
SL SL560XL-36-03	PNEUMATIC - APU BLEED AIR ORIFICE REPLACEMENT, SERVICE LETTER	MOS HRS/MSC	-	-	-	OPTIONAL	
SL SL560XL-38-01	WATER/WASTE - TRANSMITTAL OF MONOGRAM SYSTEMS SERVICE INFORMATION LETTER SIL15900-023, SERVICE LETTER	MOS HRS/MSC AFL	A/R	05-AUG-2011 4149:21 3962	-	RECOMMENDED	Not Applicable - SB560XL-38-02 WAS NOT PREV.COMPLIED WITH.
SL SL560XL-49-11	AUXILIARY POWER - TRANSMITTAL OF HONEYWELL SERVICE BULLETIN RE100-49-7896 OIL DIPSTICK REPLACEMENT, SERVICE LETTER	MOS HRS/MSC	A/R	-	-	DISCRETIONARY	
SL SL560XL-49-15	AUXILIARY POWER - REPLACEMENT OF THE FORWARD INBOARD AND OUTBOARD AUXILIARY POWER UNIT (APU) MOUNT BOLTS, SERVICE LETTER	MOS HRS/MSC	-	-	-	MANDATORY	
SL SL560XL-52-02	DOORS - EMERGENCY EXIT DOOR CHAFING INSPECTION AND REPAIR, SERVICE LETTER	MOS HRS/MSC	-	23-JUL-2004 1489	-	MANDATORY	Complied With

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL SL560XL-52-03	DOORS - CABIN DOOR ANNUNCIATION IMPROVEMENT (SUPERSEDED BY SL560XL-52-03 R01), SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 29-MAR-2005		MOS HRS/MSC	-	29-APR-2005 2059	-		
SL SL560XL-52-08	DOORS - CABIN DOOR LINTEL FASTENER VERIFICATION, SERVICE LETTER					RECOMMENDED	Deferred
Eff. Date: 14-MAY-2020		MOS HRS/MSC AFL	-	16-JUN-2020 5628:59 5080	-		
SL SL560XL-53-05	FUSELAGE STINGER DRAIN HOLE INSTALLATION, SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 01-APR-2005		MOS HRS/MSC	A/R	29-APR-2005 2059	-		
SL SL560XL-53-06	FUSELAGE FS 528.50 FRAME DRAIN HOLE INSTALLATION, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 20-OCT-2005		MOS HRS/MSC	-	16-MAY-2006 2677	-		
SL SL560XL-53-17	FUSELAGE - DORSAL DUCT INSPECTION, SERVICE LETTER					RECOMMENDED	Complied With - NO DAMAGE NOTED DURING THE INSPECTION PHASE OF THE SERVICE LETTER. NO FURTHER ACTION REQUIRED AT THIS TIME.
Eff. Date: 20-NOV-2012		MOS HRS/MSC AFL	-	08-FEB-2019 5066:42 4739	-		
SL SL560XL-53-18 R01	FUSELAGE - TAILCONE MISSING FASTENER INSPECTION AND INSTALLATION, SERVICE LETTER					MANDATORY	
Eff. Date: 22-JUN-2016		DAYS HRS/MSC	-	-	-		
SL SL560XL-55-01	STABILIZERS - PIVOT FITTING INSPECTION (SUPERSEDED BY SL560XL-55-01 R01), SERVICE LETTER					MANDATORY	Not Applicable - SUPERSEDED BY R1
Eff. Date: 31-MAR-2015		MOS HRS/MSC AFL	-	23-SEP-2016 4967:11 4654	-		
SL SL560XL-55-01 R01	STABILIZERS - PIVOT FITTING INSPECTION (SUPERSEDED BY SL560XL-55-01 R02), SERVICE LETTER					MANDATORY	Not Applicable - SUPERSEDED BY R2
Eff. Date: 31-MAR-2015		MOS HRS/MSC AFL	-	23-SEP-2016 4967:11 4654	-		
SL SL560XL-55-01 R02	STABILIZERS - PIVOT FITTING INSPECTION (SUPERSEDED BY SL560XL-55-01 R03), SERVICE LETTER					MANDATORY	Not Applicable - SUPERSEDED BY R3
Eff. Date: 31-MAR-2015		MOS HRS/MSC AFL	-	23-SEP-2016 4967:11 4654	-		
SL SL560XL-55-01 R03	STABILIZERS - PIVOT FITTING INSPECTION, SERVICE LETTER					CANCELLED	Not Applicable - SL CANCELLED
Eff. Date: 09-JUN-2016		MOS HRS/MSC AFL	-	23-SEP-2016 4967:11 4654	-		
SL SL560XL-56-01	WINDOWS - OPENABLE COCKPIT WINDOW HINGE AND LATCH INSPECTION, SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 30-AUG-2006		MOS HRS/MSC	A/R	21-NOV-2006 2908	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL SL560XL-56-03	WINDOWS - OPENABLE COCKPIT WINDOW HINGE AND LATCH INSPECTION, SERVICE LETTER					MANDATORY	Not Applicable - BY SERIAL NUMBER SEE SERVICE LETTER FOR APPLICABILITY.
Eff. Date: 07-DEC-2010		MOS HRS/MSC	A/R				
SL SL560XL-57-02	WINGS - MAIN LANDING GEAR WHEEL WELL COR-BAN 23 APPLICATION, SERVICE LETTER					RECOMMENDED	
Eff. Date: 19-FEB-2026		MOS HRS/MSC	-				
SL SL560XL-71-02 R01	POWER PLANT - ENGINE ELECTRICAL GROUND INSPECTION FOR RTV, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 14-JAN-2003		MOS HRS/MSC	-	09-MAY-2003 641	-		
SL SL560XL-71-03	POWER PLANT - ENGINE MOUNT BOLT TORQUE INSPECTION, SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 21-MAR-2003		MOS HRS/MSC	-	09-MAY-2003 641	-		
SL SL560XL-71-04	POWER PLANT - TRANSMITTAL OF PRATT & WHITNEY CANADA SERVICE BULLETIN 30240 REPLACEMENT OF THE ALTERNATOR SHAFT PLAIN SEAL, SERVICE LETTER					DISCRETIONARY	Complied With
Eff. Date: 25-JUN-2004		MOS HRS/MSC	-	20-DEC-2005 2464	-		
SL SL560XL-71-06	POWER PLANT - TRANSMITTAL OF PRATT & WHITNEY CANADA SERVICE BULLETIN PW500-72-30248 TURBOFAN ENGINE FRONT FAN CASE ASSEMBLY VIBRATION DAMPER RING-INSTALLATION, SERVICE LETTER					RECOMMENDED	Not Applicable
Eff. Date: 14-JUN-2005		MOS HRS/MSC	A/R	03-AUG-2006 2775	-		
SL SL560XL-71-07	POWER PLANT - TRANSMITTAL OF PRATT AND WHITNEY CANADA (P&WC) SPECIAL INSTRUCTION NUMBER 17 -2005, PW500 AUTO SHUT - OFF MECHANISM INSPECTION., SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 20-DEC-2005		MOS HRS/MSC	A/R	16-MAY-2006 2677	-		
SL SL560XL-71-08	POWER PLANT - BLEED AIR TUBE SLEEVING INSTALLATION IMPROVEMENT, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 30-MAR-2006		MOS HRS/MSC	-	21-NOV-2006 2908	-		
SL SL560XL-71-09	POWER PLANT - TRANSMITTAL OF PRATT AND WHITNEY CANADA (P&WC) SB NUMBER 30294R2, TURBOFAN ENGINE OIL TANK FILLER CAP INSPECTION, SERVICE LETTER					INFORMATIONAL	Complied With
Eff. Date: 15-JUN-2006		MOS HRS/MSC	A/R	10-OCT-2006 2842	-		
SL SL560XL-71-11 R01	POWER PLANT - INSPECT THE LEFT AND RIGHT ENGINE FORWARD UPPER AND LOWER ISOLATOR ASSEMBLY MOUNT BOLT HEADS FOR SAFETY WIRE HOLES, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 29-AUG-2019		MOS HRS/MSC AFL	-	11-OCT-2019 5321:40 4913	-		
SL SL560XL-71-11 R02	POWER PLANT - INSPECT THE LEFT AND RIGHT ENGINE FORWARD UPPER AND LOWER ISOLATOR ASSEMBLY MOUNT BOLT HEADS FOR SAFETY WIRE HOLES, SERVICE LETTER					RECOMMENDED	Complied With - COMPLIED WITH AS PER SL560XL-71-11 R01 PERFORMED ON 11OCT 2019
Eff. Date: 23-OCT-2019		MOS HRS/MSC AFL	-	02-DEC-2019 5396:52 4953	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL SL560XL-72-03 R03	ENGINE - TRANSMITTAL OF PRATT & WHITNEY CANADA (P&WC) PW500-72-30196, REVISION 3, TURBOFAN ENGINE - REPLACEMENT OF P3 BELLOWS SEALS, SERVICE LETTER					RECOMMENDED	Not Applicable - BY ENGINE SERIAL NUMBER
Eff. Date: 14-SEP-2004		MOS HRS/MSC AFL	-	16-APR-2013 4410:34 4181	-		
SL SL560XL-72-04	ENGINE - TRANSMITTAL OF P&WC SERVICE BULLETIN PW500-72-30110R1, TURBOFAN ENGINE- OIL LEVEL INDICATOR- REPLACEMENT OF, SERVICE LETTER					RECOMMENDED	Not Applicable - BY ENGINE SERIAL NUMBER
Eff. Date: 15-MAR-2001		MOS HRS/MSC AFL	-	16-APR-2013 4410:34 4181	-		
SL SL560XL-72-05	ENGINE - TRANSMITTAL OF P&WC SERVICE BULLETIN PW500-72-30135R1, TURBOFAN ENGINE- OIL FILLER CAP- REPLACEMENT OF, SERVICE LETTER					RECOMMENDED	Not Applicable - BY ENGINE SERIAL NUMBER
Eff. Date: 15-MAR-2001		MOS HRS/MSC AFL	-	16-APR-2013 4410:34 4181	-		
SL SL560XL-72-08	ENGINE - TRANSMITTAL OF P&WC SERVICE BULLETIN PW500-72-30203 REPLACEMENT OF ALTERNATOR SHAFT PLAIN SEAL, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 01-MAY-2002		MOS HRS/MSC	-	18-MAY-2004 1323	-		
SL SL560XL-72-09	ENGINE - TRANSMITTAL OF PRATT & WHITNEY CANADA (P&WC) SERVICE BULLETIN PW500-72-30217, TURBOFAN ENGINE FUEL TUBE - INSPECTION OF, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 03-JUN-2002		MOS HRS/MSC	A/R	22-AUG-2002 280	-		
SL SL560XL-72-11 R01	LEFT ENGINE TRANSMITTAL OF PRATT & WHITNEY CANADA SERVICE BULLETIN PW500-72-30252 NUMBER FOUR BEARING OIL PRESSURE AND OIL SCAVENGE TUBES - REPLACEMENT OF, SERVICE LETTER					CANCELLED	
		MOS HRS/MSC	300	-	-		
SL SL560XL-72-11 R01	RIGHT ENGINE TRANSMITTAL OF PRATT & WHITNEY CANADA SERVICE BULLETIN PW500-72-30252 NUMBER FOUR BEARING OIL PRESSURE AND OIL SCAVENGE TUBES - REPLACEMENT OF, SERVICE LETTER					CANCELLED	
		MOS HRS/MSC	300	-	-		
SL SL560XL-72-12	ENGINE - TRANSMITTAL OF PRATT AND WHITNEY CANADA SERVICE BULLETIN PW500-72-30331 MODIFICATION OF FUEL PRESSURE HOSE AND TUBE ROUTING, SERVICE LETTER					OPTIONAL	
Eff. Date: 03-OCT-2007		MOS HRS/MSC	A/R	-	-		
SL SL560XL-72-13	LEFT ENGINE TRANSMITTAL OF PRATT AND WHITNEY CANADA SERVICE BULLETIN PW500-72-30335 TURBOFAN ENGINE GAS-GENERATOR-CASE TO INTERMEDIATE-CASE RETAINING-BOLTS BORESCOPEINSPECTION OF, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 27-NOV-2007		MOS HRS/MSC	A/R	05-SEP-2008 3665	-		
SL SL560XL-72-13	RIGHT ENGINE TRANSMITTAL OF PRATT AND WHITNEY CANADA SERVICE BULLETIN PW500-72-30335 TURBOFAN ENGINE GAS-GENERATOR-CASE TO INTERMEDIATE-CASE RETAINING-BOLTS BORESCOPEINSPECTION OF, SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 27-NOV-2007		MOS HRS/MSC	A/R	05-SEP-2008 3665	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL SL560XL-72-14	LEFT ENGINE TRANSMITTAL OF PRATT & WHITNEY CANADA SERVICE BULLETIN PW500-72-30306 TURBOFAN ENGINE NEW TRANSFER TUBES WITH HEAT SHIELD, SERVICE LETTER					RECOMMENDED	Complied With - SB 30306R4 C/W
Eff. Date: 27-NOV-2007		MOS HRS/MSC AFL	A/R	17-JUN-2012 4272:33 4072	-		
SL SL560XL-72-14	RIGHT ENGINE TRANSMITTAL OF PRATT & WHITNEY CANADA SERVICE BULLETIN PW500-72-30306 TURBOFAN ENGINE NEW TRANSFER TUBES WITH HEAT SHIELD, SERVICE LETTER					RECOMMENDED	Complied With - SB 30306R4 PERFORMED
Eff. Date: 27-NOV-2007		MOS HRS/MSC AFL	A/R	12-AUG-2011 4149:35 3962	-		
SL SL560XL-72-17	LEFT ENGINE TRANSMITTAL OF PRATT AND WHITNEY CANADA (P&WC) SERVICE BULLETIN PW500-72-30409, TURBOFAN ENGINE HYDROMECHANICAL FUEL CONTROL UNIT- REPLACEMENT,MODIFICATION OF, SERVICE LETTER					MANDATORY	Complied With - CESCO ADJUSTED IAW LATEST REV. OF P&WC SB. 30409
Eff. Date: 18-DEC-2009		MOS HRS/MSC AFL	A/R	26-FEB-2010 3945 3796	-		
SL SL560XL-72-17	RIGHT ENGINE TRANSMITTAL OF PRATT AND WHITNEY CANADA (P&WC) SERVICE BULLETIN PW500-72-30409, TURBOFAN ENGINE HYDROMECHANICAL FUEL CONTROL UNIT- REPLACEMENT,MODIFICATION OF, SERVICE LETTER					MANDATORY	Complied With - CESCO ADJUSTED IAW LATEST REV. OF P&WC SB. 30409
Eff. Date: 18-DEC-2009		MOS HRS/MSC AFL	A/R	26-FEB-2010 3945 3796	-		
SL SL560XL-73-03	ENGINE FUEL AND CONTROL - TRANSMITTAL OF P&WC SERVICE BULLETIN 30249 TURBOFAN ENGINE FUEL MANIFOLD - INSPECTION/REPLACEMENT OF AND COMMERCIAL SUPPORT PROGRAM NOTIFICATION (CSPN) A03008, SERVICE LETTER					RECOMMENDED	Not Applicable - NOT APPLICABLE
Eff. Date: 15-JAN-2004		MOS HRS/MSC	-	29-APR-2005 2059	-		
SL SL560XL-73-04	ENGINE FUEL AND CONTROL - TRANSMITTAL OF PRATT & WHITNEY CANADA SERVICE BULLETIN 30253: TURBOFAN ENGINE FUEL PRESSURE TUBE REPLACEMENT AND ATTENUATOR INTRODUCTION OF MODEL APPLICATION PW545A AND COMMERCIAL SUPPORT PROGRAM NOTIFICATION (CSPN) A03012 (SUPERSEDED BY SL560XL-73-04 R01), SERVICE LETTER					RECOMMENDED	Complied With
Eff. Date: 03-DEC-2003		MOS HRS/MSC	A/R	06-JAN-2004 1130	-		
SL SL560XL-73-08	ENGINE FUEL AND CONTROL - TRANSMITTAL OF PRATT & WHITNEY CANADA SERVICE BULLETIN NUMBER 30296R1, TURBOFAN ENGINE HFC RATIO UNIT SETSCREW ADJUSTMENT - INSPECTION OF, SERVICE LETTER					MANDATORY	Complied With
Eff. Date: 24-MAR-2006		MOS HRS/MSC	-	07-MAY-2006 2677	-		
SL SL560XL-73-12	ENGINE FUEL AND CONTROL - TRANSMITTAL OF PRATT AND WHITNEY CANADA SERVICE BULLETIN PW500-72-30381R2, FUEL MANIFOLD AND FUEL SHUT-OFF CABLE GROMMETS AND COVERPLATE/FAIRING/REPLACEMENT OF (SUPERSEDED BY SL560XL-73-12 R01), SERVICE LETTER					RECOMMENDED	Not Applicable - SUPERSEDED BY R1
Eff. Date: 10-NOV-2009		MOS HRS/MSC AFL	A/R	17-JUN-2012 4272:33 4072	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SL SL560XL-73-12 R01	ENGINE FUEL AND CONTROL - TRANSMITTAL OF PRATT AND WHITNEY CANADA SERVICE BULLETINPW500-72-30381R2, FUEL MANIFOLD AND FUEL SHUT-OFF CABLE GROMMETS AND COVER PLATE/FAIRING/REPLACEMENT OF, SERVICE LETTER	MOS HRS/MSC AFL	A/R	17-JUN-2012 4272:33 4072	-	RECOMMENDED	Complied With - SB 30381R2 C/W ON LH ENG AT 17 JUN 2012 ON RH ENG AT 12 AUG 2011
SL SL560XL-76-04	ENGINE CONTROLS - THROTTLE QUADRANT RVDT LINKAGE INSPECTION, SERVICE LETTER	MOS HRS/MSC AFL	-	17-JUN-2022 7366:02 6120	-	MANDATORY	Not Applicable - N/A BY AIRCRAFT S/N
SL SL560XL-76-04 R01	ENGINE CONTROLS - THROTTLE QUADRANT RVDT LINKAGE INSPECTION, SERVICE LETTER	MOS HRS/MSC AFL	-	17-JUN-2022 7366:02 6120	-	MANDATORY	Not Applicable - N/A BY AIRCRAFT S/N
SL SL560XL-76-05	ENGINE CONTROLS - INSPECTION OF THE RIGHT ENGINE THROTTLE QUADRANT ROTARY VARIABLE DIFFERENTIAL TRANSFORMER (RVDT) ELECTRICAL WIRING, SERVICE LETTER	MOS HRS/MSC AFL	-	29-SEP-2023 8033:12 6602	-	MANDATORY	Not Applicable - N/A BY A/C SERIAL NUMBER
APU - SB - RE100 (XL) P-268/3800722-1							
SB 3615880-49-8149 R01	APU - AIRBORNE AUXILIARY POWER - GAS TURBINE ENGINE - BALANCE REPAIR OF THE TURBINE ROTORS, PN3615880-1, PN 3615880-002, PN 3615880-3, AND PN 3615880-4, ON MULTIPLE APUS, SERVICE BULLETIN	MOS HRS/MSC APUS	-	26-OCT-2015 2642:18 4898	-	RECOMMENDED	Not Applicable - BY PN TURBINE ROTOR
SB 3822101-49-8148 R01	APU - AIRBORNE AUXILIARY POWER - GAS TURBINE ENGINE - BALANCE REPAIR OF COMPRESSOR ROTORS, PN 3822101-1, ON MULTIPLE APUS, SERVICE BULLETIN	MOS HRS/MSC APUS	-	26-OCT-2015 2642:18 4898	-	RECOMMENDED	Not Applicable - BY PN COMPRESSOR ROTOR
SB 70721598-49-8168 R01	APU - AIRBORNE AUXILIARY POWER - GAS TURBINE ENGINE - BALANCE REPAIR OF COMPRESSOR ROTOR, PN 70721598-1, ON MULTIPLE APUS, SERVICE BULLETIN	MOS HRS/MSC APUS	-	26-OCT-2015 2642:18 4898	-	RECOMMENDED	Not Applicable - BY PN COMPRESSOR ROTOR
SB 70721725-49-8152 R01	APU - AIRBORNE AUXILIARY POWER - GAS TURBINE ENGINE - BALANCE REPAIR OF THE DUAL PILOT TURBINE ROTORS, PN 70721725-2 AND PN 70721725-5, ON MULTIPLE APUS, SERVICE BULLETIN	MOS HRS/MSC APUS	-	26-OCT-2015 2642:18 4898	-	RECOMMENDED	Not Applicable - BY PN TURBINE ROTOR

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
ENGINE NO. 1 - AD - PW545A PCE-DB0473/31J1900-01							
FAA 2003-03-21	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - ONE-TIME VISUAL INSPECTION AND RE-MARKING, OR IN LIEU OF INSPECTION, REPLACEMENT OF CERTAIN PART NUMBERS (P/N'S) OF THE FLEXIBLE FUEL TUBE LOCATED BETWEEN THE FUEL/OIL HEAT EXCHANGER AND THE INTEGRAL FUEL CONTROL UNIT-FUEL PUMP						Complied With
		MOS HRS/MSC	-		07-APR-2003 567		
FAA 2010-18-09	NO. 1 ENGINE - INTERCOMPRESSOR BLEED VALVE/SERVO VALVE					MANDATORY	Not Applicable - NA ENGINE SN DB 0473 AND SN DB 0472 ARE PRE SB 30343 AND PRE 30404
Eff. Date: 10-SEP-2010		MOS HRS/MSC ENC	-		09-NOV-2010 4049 3877		
FAA 2010-18-09 PARA (E)(2)	NO. 1 ENGINE - ACCOMPLISH INTERCOMPRESSOR BLEED VALVE/SERVO VALVE REMOVE					MANDATORY	Not Applicable - NA ENGINE SN DB 0473 AND SN DB 0472 ARE PRE SB 30343 AND PRE 30404
Eff. Date: 10-SEP-2010		MOS HRS/MSC ENC	-		09-NOV-2010 4049 3877		
FAA 2010-18-09 PARA (E)(3)	NO. 1 ENGINE - ACCOMPLISH INTERCOMPRESSOR BLEED VALVE/SERVO VALVE ENGINE TESTING					MANDATORY	Not Applicable - NA ENGINE SN DB 0473 AND SN DB 0472 ARE PRE SB 30343 AND PRE 30404
Eff. Date: 10-SEP-2010		MOS HRS/MSC ENC	-		09-NOV-2010 4049 3877		
TCCA CF-2002-42	NO. 1 ENGINE - PRATT & WHITNEY CANADA (P&WC) PW530A, PW535A, AND PW545A ENGINES - INSPECTION OF FLEXIBLE FUEL TUBES					MANDATORY	Complied With - SUPERSEDED BY FAA 2003-03-21
Eff. Date: 30-SEP-2002		MOS HRS/MSC ENC	-		09-JUN-2022 7350 6101		
TCCA CF-2010-19	NO. 1 ENGINE - INTERCOMPRESSOR BLEED VALVE/SERVO VALVE MALFUNCTION					MANDATORY	Not Applicable - SUPERSEDED BY ASB PW500-72-A30421N/A - ENGINE S/N IS PRE SB 30343 AND SB 30404 REF. W.C 4201
Eff. Date: 22-JUL-2010		MOS HRS/MSC ENC	A/R		09-JUN-2022 7350 6101		
TCCA CF-2010-19 STEP A,B,C,D,E	NO. 1 ENGINE - INCORPORATION INTERCOMPRESSOR BLEED VALVE/SERVO VALVE MALFUNCTION OF ASB A30421					MANDATORY	Not Applicable - SUPERSEDED BY ASB PW500-72-A30421N/A - ENGINE S/N IS PRE SB 30343 AND SB 30404 REF. W.C 4201
Eff. Date: 22-JUL-2010		MOS HRS/MSC ENC	A/R		09-JUN-2022 7350 6101		
TCCA CF-2010-19 STEP H.	NO. 1 ENGINE - TEST INTERCOMPRESSOR BLEED VALVE/SERVO VALVE MALFUNCTION PROCEDURE PART A					MANDATORY	Not Applicable - SUPERSEDED BY ASB PW500-72-A30421N/A - ENGINE S/N IS PRE SB 30343 AND SB 30404 REF. W.C 4201
Eff. Date: 22-JUL-2010		MOS HRS/MSC ENC	A/R		09-JUN-2022 7350 6101		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
TCCA CF-2025-08	NO. 1 ENGINE - ENGINE - HIGH PRESSURE TURBINE (HPT) DISK - IMPROPER REWORK					MANDATORY	Not Applicable - AS PER HP TURBINE DISK S/N
Eff. Date: 24-FEB-2025		MOS		23-FEB-2025			
		HRS/MSC	-	8471:31	-		
		ENC		6865			
TCCA CF-2025-08 PART I	NO. 1 ENGINE - ACCOMPLISH INSPECTION OF THE ENGINE TECHNICAL RECORDS (LOG BOOK) OR THE HP TURBINE DISK TO IDENTIFY THE SERIAL NUMBER IN ACCORDANCE WITH THE ACCOMPLISHMENT INSTRUCTIONS OF THE P&WC SB SECTION 3.A.					MANDATORY	Not Applicable - AS PER HP TURBINE DISK S/N
Eff. Date: 24-FEB-2025		MOS		23-FEB-2025			
		HRS/MSC	-	8471:31	-		
		ENC		6865			
TCCA CF-2025-08 PART I.A.	NO. 1 ENGINE - REMOVE THE AFFECTED HPT DISK IN ACCORDANCE WITH THE ACCOMPLISHMENT INSTRUCTIONS OF THE P&WC SB SECTION 3.D.(1)					MANDATORY	Not Applicable - AS PER HP TURBINE DISK S/N
		MOS		23-FEB-2025			
		HRS/MSC	-	8471:31	-		
		ENC		6865			
ENGINE NO. 2 - AD - PW545A PCE-DB0472/31J1900-01							
FAA 2003-03-21	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - ONE-TIME VISUAL INSPECTION AND RE-MARKING, OR IN LIEU OF INSPECTION, REPLACEMENT OF CERTAIN PART NUMBERS (P/N'S) OF THE FLEXIBLE FUEL TUBE LOCATED BETWEEN THE FUEL/OIL HEAT EXCHANGER AND THE INTEGRAL FUEL CONTROL UNIT-FUEL PUMP						Complied With
		MOS		07-APR-2003			
		HRS/MSC	-	567	-		
FAA 2010-18-09	NO. 2 ENGINE - INTERCOMPRESSOR BLEED VALVE/SERVO VALVE					MANDATORY	Not Applicable - NA ENGINE SN DB 0473 AND SN DB 0472 ARE PRE SB 30343 AND PRE 30404
Eff. Date: 10-SEP-2010		MOS		09-NOV-2010			
		HRS/MSC	-	4049	-		
		ENC		3877			
FAA 2010-18-09 PARA (E)(2)	NO. 2 ENGINE - ACCOMPLISH INTERCOMPRESSOR BLEED VALVE/SERVO VALVE REMOVE					MANDATORY	Not Applicable - NA ENGINE SN DB 0473 AND SN DB 0472 ARE PRE SB 30343 AND PRE 30404
Eff. Date: 10-SEP-2010		MOS		09-NOV-2010			
		HRS/MSC	-	4049	-		
		ENC		3877			
FAA 2010-18-09 PARA (E)(3)	NO. 2 ENGINE - ACCOMPLISH INTERCOMPRESSOR BLEED VALVE/SERVO VALVE ENGINE TESTING					MANDATORY	Not Applicable - NA ENGINE SN DB 0473 AND SN DB 0472 ARE PRE SB 30343 AND PRE 30404
Eff. Date: 10-SEP-2010		MOS		09-NOV-2010			
		HRS/MSC	-	4049	-		
		ENC		3877			
TCCA CF-2002-42	NO. 2 ENGINE - PRATT & WHITNEY CANADA (P&WC) PW530A, PW535A, AND PW545A ENGINES - INSPECTION OF FLEXIBLE FUEL TUBES					MANDATORY	Complied With - SUPERSEDED BY FAA 2003-03-21
Eff. Date: 30-SEP-2002		MOS		09-JUN-2022			
		HRS/MSC	-	7350	-		
		ENC		6101			

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
TCCA CF-2010-19	NO. 2 ENGINE - INTERCOMPRESSOR BLEED VALVE/SERVO VALVE MALFUNCTION					MANDATORY	Not Applicable - SUPERSEDED BY ASB PW500-72-A30421N/A - ENGINE S/N IS PRE SB 30343 AND SB 30404 REF. W.C 4201
Eff. Date: 22-JUL-2010		MOS HRS/MSC ENC	A/R		09-JUN-2022 7350 6101	-	
TCCA CF-2010-19 STEP A,B,C,D,E	NO. 2 ENGINE - INCORPORATION INTERCOMPRESSOR BLEED VALVE/SERVO VALVE MALFUNCTION OF ASB A30421					MANDATORY	Not Applicable - SUPERSEDED BY ASB PW500-72-A30421N/A - ENGINE S/N IS PRE SB 30343 AND SB 30404 REF. W.C 4201
Eff. Date: 22-JUL-2010		MOS HRS/MSC ENC	A/R		09-JUN-2022 7350 6101	-	
TCCA CF-2010-19 STEP H.	NO. 2 ENGINE - TEST INTERCOMPRESSOR BLEED VALVE/SERVO VALVE MALFUNCTION PROCEDURE PART A					MANDATORY	Not Applicable - SUPERSEDED BY ASB PW500-72-A30421N/A - ENGINE S/N IS PRE SB 30343 AND SB 30404 REF. W.C 4201
Eff. Date: 22-JUL-2010		MOS HRS/MSC ENC	A/R		09-JUN-2022 7350 6101	-	
TCCA CF-2025-08	NO. 2 ENGINE - ENGINE - HIGH PRESSURE TURBINE (HPT) DISK - IMPROPER REWORK					MANDATORY	Not Applicable - AS PER HP TURBINE DISK S/N
Eff. Date: 24-FEB-2025		MOS HRS/MSC ENC	-		23-FEB-2025 8524:53 6907	-	
TCCA CF-2025-08 PART I	NO. 2 ENGINE - ACCOMPLISH INSPECTION OF THE ENGINE TECHNICAL RECORDS (LOG BOOK) OR THE HP TURBINE DISK TO IDENTIFY THE SERIAL NUMBER IN ACCORDANCE WITH THE ACCOMPLISHMENT INSTRUCTIONS OF THE P&WC SB SECTION 3.A.					MANDATORY	Not Applicable - AS PER HP TURBINE DISK S/N
Eff. Date: 24-FEB-2025		MOS HRS/MSC ENC	-		23-FEB-2025 8524:53 6907	-	
TCCA CF-2025-08 PART I.A.	NO. 2 ENGINE - REMOVE THE AFFECTED HPT DISK IN ACCORDANCE WITH THE ACCOMPLISHMENT INSTRUCTIONS OF THE P&WC SB SECTION 3.D.(1)					MANDATORY	Not Applicable - AS PER HP TURBINE DISK S/N
		MOS HRS/MSC ENC	-		23-FEB-2025 8524:53 6907	-	
ENGINE NO. 1 - SB - PW545A PCE-DB0473/31J1900-01							
SB PW500-72-30110 R01	NO. 1 ENGINE - REPLACEMENT OF OIL LEVEL INDICATOR, SERVICE BULLETIN					CATEGORY 6	Not Applicable - BY ENGINE SERIAL NUMBER
Eff. Date: 09-NOV-2000		MOS HRS/MSC ENC	-		16-APR-2013 4410:34 4181	-	
SB PW500-72-30135 R01	NO. 1 ENGINE - REPLACEMENT OF OIL FILLER CAP, SERVICE BULLETIN					CATEGORY 6	Not Applicable - BY ENGINE SERIAL NUMBER
Eff. Date: 09-NOV-2000		MOS HRS/MSC ENC	-		16-APR-2013 4410:34 4181	-	
SB PW500-72-30196 R03	NO. 1 ENGINE - REPLACEMENT OF P3 BELLOW SEALS, SERVICE BULLETIN					CATEGORY 3	Not Applicable - BY ENGINE SERIAL NUMBER
Eff. Date: 23-JUN-2004		MOS HRS/MSC ENC	-		16-APR-2013 4410:34 4181	-	

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB PW500-72-30217 R03	NO. 1 ENGINE - INSPECTION OF FUEL TUBE, SERVICE BULLETIN					CATEGORY 3	Complied With - E1 NOT AFFECTED DUE TO P/N: 30J2757-01
Eff. Date: 20-JUN-2018		MOS HRS/MSC ENC	-	27-AUG-2019 5252:35 4867	-		
SB PW500-72-30306 R04	NO. 1 ENGINE - NEW TRANSFER TUBES WITH HEAT SHIELD (SUPERSEDED BY PW500-72-30306 R05), SERVICE BULLETIN					CATEGORY 5	Complied With
Eff. Date: 18-MAY-2007		MOS HRS/MSC ENC	-	17-JUN-2012 4272 4072	-		
SB PW500-72-30340 R02	NO. 1 ENGINE - REPLACEMENT OF IGNITERS AND IGNITION CABLES, SERVICE BULLETIN					CATEGORY 7	Complied With
Eff. Date: 26-SEP-2008		MOS HRS/MSC ENC	-	23-JUL-2010 3995:13 3837	-		
SB PW500-72-30381 R02	NO. 1 ENGINE - REPLACEMENT OF FUEL MANIFOLD AND FUEL SHUT-OFF CABLE GROMMETS AND COVER PLATE FAIRING, SERVICE BULLETIN						Complied With
Eff. Date: 06-AUG-2009		MOS HRS/MSC ENC	-	17-JUN-2012 4272:33 4072	-		
SB PW500-72-30409 R06	NO. 1 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT (SUPERSEDED BY PW500-72-30409 R07), SERVICE BULLETIN					CATEGORY 7	Complied With
Eff. Date: 18-DEC-2009		MOS HRS/MSC ENC	-	10-OCT-2011 4149:35 3962	-		
SB PW500-72-30409 R10	NO. 1 ENGINE - REPLACEMENT / MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN					CATEGORY 3	Not Applicable - NO EFFECT PREVIOUS REVISION C/W
Eff. Date: 16-NOV-2015		MOS HRS/MSC ENC	-	22-NOV-2015 4882:22 4589	-		
SB PW500-72-30419	NO. 1 ENGINE - REPLACEMENT OF COMBUSTION CHAMBER LINER (SUPERSEDED BY PW500-72-30419 R01), SERVICE BULLETIN					CATEGORY 7	Complied With - NEW COMBUSTION LINER INST. BY H&S WO 6448687
Eff. Date: 28-SEP-2010		MOS HRS/MSC ENC	-	18-JUN-2012 4272:33 4072	-		
SB PW500-72-30420	NO. 1 ENGINE - REPLACEMENT/MODIFICATION OF INTERCOMPRESSOR BLEED VALVE/ SERVO-VALVE (SUPERSEDED BY PW500-72-30420 R01), SERVICE BULLETIN					CATEGORY 3	Not Applicable - SUPERSEDED SUPERSEDED BY REVISION 1
		MOS HRS/MSC	-				
SB PW500-72-30420 R01	NO. 1 ENGINE - REPLACEMENT/MODIFICATION OF INTERCOMPRESSOR BLEED VALVE/ SERVO-VALVE (SUPERSEDED BY PW500-72-30420 R02), SERVICE BULLETIN					CATEGORY 6	- -SUPERSEDED BY REVISION 2
		MOS HRS/MSC	-				

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB PW500-72-30420 R03	NO. 1 ENGINE - REPLACEMENT/MODIFICATION OF INTERCOMPRESSOR BLEED VALVE/ SERVO-VALVE (SUPERSEDED BY PW500-72-30420 R04), SERVICE BULLETIN					CATEGORY 3	Complied With - REPL BLEED VALVE SERVO VALVE
Eff. Date: 14-MAR-2013		MOS HRS/MSC ENC	-	19-MAR-2014 4566:55 4303	-		
SB PW500-72-30479 R06	NO. 1 ENGINE - REPLACEMENT OF NO. 4 BEARING FRONT COVER, HPT ROTOR SEAL, COLD START VALVE ASSEMBLY AND THE OIL TRANSFER TUBE, SERVICE BULLETIN					CATEGORY 3	Complied With - SB 72-30479 R06 CARRIED OUT DURING ENGINE OVERHAUL
Eff. Date: 20-MAY-2016		MOS HRS/MSC	-	19-MAR-2019			
SB PW500-72-30505 R01	NO. 1 ENGINE - REPLACEMENT OF BLEED OFF VALVE (BOV) GASKETS (SUPERSEDED BY PW500-72-30505 R02), SERVICE BULLETIN					CATEGORY 3	Complied With - REPLACED GASKETS & ATTACHMENT HARDWARE
Eff. Date: 07-NOV-2014		MOS HRS/MSC ENC	-	24-APR-2015 4732:50 4450	-		
SB PW500-72-30512	NO. 1 ENGINE - INSPECTION/REPLACEMENT OF HYDROMECHANICAL FUEL CONTROL (SUPERSEDED BY PW500-72-30512 R01), SERVICE BULLETIN					CATEGORY 3	
Eff. Date: 11-DEC-2014		MOS HRS/MSC	-	-	-		
SB PW500-72-30512 R02	NO. 1 ENGINE - INSPECTION/ REPLACEMENT OF HYDROMECHANICAL FUEL CONTROL (SUPERSEDED BY PW500-72-30512 R03), SERVICE BULLETIN					CATEGORY 3	Not Applicable - N/A - ENGINE IS PRE SB 30442
Eff. Date: 29-APR-2015		MOS HRS/MSC ENC	-	08-MAY-2015 4740:52 4460	-		
SB PW500-72-30512 R03	NO. 1 ENGINE - INSPECTION/REPLACEMENT OF HYDROMECHANICAL FUEL CONTROL, SERVICE BULLETIN					CATEGORY 3	
Eff. Date: 14-FEB-2017		MOS HRS/MSC	-	-	-		
SB PW500-72-30545	NO. 1 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN					CATEGORY 3	Not Applicable - SB PW500-72-30545 IS NOT APPLICABLE AS PER R02 PERFORMED ON 19MAR19
Eff. Date: 28-SEP-2018		MOS ENC HRS/MSC	-	19-MAR-2019 4739			
SB PW500-72-30545 R01	NO. 1 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN					CATEGORY 3	Not Applicable - SB PW500-72-30545 R01 IS NOT APPLICABLE AS PER R02 PERFORMED ON 19MAR19
		MOS ENC HRS/MSC	-	19-MAR-2019 4739			
SB PW500-72-30545 R02	NO. 1 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN					CATEGORY 3	Complied With
Eff. Date: 11-MAR-2019		MOS ENC HRS/MSC	-	19-MAR-2019 4739			

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB PW500-72-30545 R03	NO. 1 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN					CATEGORY 3	Not Applicable - SB PW500-72-30545 R03 IS NOT APPLICABLE AS PER R02 PERFORMED ON 19MAR19
Eff. Date: 28-MAY-2019		MOS ENC HRS/MSC	-	19-MAR-2019 4739			
SB PW500-72-30545 R04	NO. 1 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN					CATEGORY 3	Not Applicable - SB PW500-72-30545 R04 IS NOT APPLICABLE AS PER R02 PERFORMED ON 19MAR19
Eff. Date: 09-AUG-2019		MOS HRS/MSC	-	19-MAR-2019 5066:42			
ASB PW500-72-A30421	NO. 1 ENGINE - INSPECTION/REPLACEMENT OF INTERCOMPRESSOR BLEED VALVE/SERVO-VALVE (SUPERSEDED BY PW500-72-A30421 R01), ALERT SERVICE BULLETIN					CATEGORY 3	Not Applicable - NA ENGINE SN DB 0473 AND SN DB 0472 ARE PRE SB 30343 AND PRE SB 30404 REF W.C 4201
		MOS HRS/MSC ENC	-	09-NOV-2010 4049 3877			
ASB PW500-72-A30421 R01	NO. 1 ENGINE - INSPECTION/REPLACEMENT OF INTERCOMPRESSOR BLEED VALVE/SERVO-VALVE (SUPERSEDED BY PW500-72-A30421 R02), ALERT SERVICE BULLETIN					CATEGORY 3	Not Applicable - NA ENGINE SN DB 0473 AND SN 0472 ARE PRE SB 30343 AND PRE SB 30404 REF W.C 4201
		MOS HRS/MSC ENC	-	09-NOV-2010 4049 3877			
ENGINE NO. 2 - SB - PW545A PCE-DB0472/31J1900-01							
SB PW500-72-30110 R01	NO. 2 ENGINE - REPLACEMENT OF OIL LEVEL INDICATOR, SERVICE BULLETIN					CATEGORY 6	Not Applicable - BY ENGINE SERIAL NUMBER
Eff. Date: 09-NOV-2000		MOS HRS/MSC ENC	-	16-APR-2013 4410:34 4181			
SB PW500-72-30135 R01	NO. 2 ENGINE - REPLACEMENT OF OIL FILLER CAP, SERVICE BULLETIN					CATEGORY 6	Not Applicable - BY ENGINE SERIAL NUMBER
Eff. Date: 09-NOV-2000		MOS HRS/MSC ENC	-	16-APR-2013 4410:34 4181			
SB PW500-72-30196 R03	NO. 2 ENGINE - REPLACEMENT OF P3 BELLOWS SEALS, SERVICE BULLETIN					CATEGORY 3	Not Applicable - BY ENGINE SERIAL NUMBER
Eff. Date: 23-JUN-2004		MOS HRS/MSC ENC	-	16-APR-2013 4410:34 4181			
SB PW500-72-30217 R03	NO. 2 ENGINE - INSPECTION OF FUEL TUBE, SERVICE BULLETIN					CATEGORY 3	Complied With - E2 NOT AFFECTED DUE TO P/N: 30J2757-01
Eff. Date: 20-JUN-2018		MOS HRS/MSC ENC	-	27-AUG-2019 5252:35 4867			
SB PW500-72-30218 R01	NO. 2 ENGINE - REPLACEMENT/MODIFICATION OF FOKKER ELMO ENGINE HARNESS, SERVICE BULLETIN					CATEGORY 8	Complied With
Eff. Date: 14-JUN-2002		MOS HRS/MSC ENC	-	12-AUG-2011 4149:18 3962			

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB PW500-72-30288 R01	NO. 2 ENGINE - MODIFICATION OF TURBINE CASE ASSEMBLY (SUPERSEDED BY PW500-72-30288 R02), SERVICE BULLETIN					CATEGORY 6	Complied With
Eff. Date: 22-FEB-2005		MOS HRS/MSC ENC	-	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30306 R04	NO. 2 ENGINE - NEW TRANSFER TUBES WITH HEAT SHIELD (SUPERSEDED BY PW500-72-30306 R05), SERVICE BULLETIN					CATEGORY 5	Complied With
Eff. Date: 18-MAY-2007		MOS HRS/MSC ENC	-	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30316 R01	NO. 2 ENGINE - REPLACEMENT OF TRANSFER TUBE ASSEMBLY, SERVICE BULLETIN					CATEGORY 5	Complied With
Eff. Date: 18-JAN-2007		MOS HRS/MSC ENC	-	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30331	NO. 2 ENGINE - MODIFICATION OF FUEL PRESSURE HOSE & TUBE ROUTING, SERVICE BULLETIN					CATEGORY 5	Complied With
Eff. Date: 05-JUN-2007		MOS HRS/MSC ENC	-	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30335 R01	NO. 2 ENGINE - BORESCOPE INSPECTION OF GAS-GENERATOR-CASE TO INTERMEDIATE-CASE RETAINING-BOLTS, SERVICE BULLETIN					CATEGORY 3	Complied With
Eff. Date: 21-JAN-2008		MOS HRS/MSC ENC	-	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30340 R02	NO. 2 ENGINE - REPLACEMENT OF IGNITERS AND IGNITION CABLES, SERVICE BULLETIN					CATEGORY 7	Complied With
Eff. Date: 26-SEP-2008		MOS HRS/MSC ENC	-	23-JUL-2010 3995:13 3837	-		
SB PW500-72-30362	NO. 2 ENGINE - REPLACEMENT HP TURBINE DISK BALANCING ASSEMBLY WITH THICKER FEATHER SEALS, SERVICE BULLETIN					CATEGORY 6	Complied With
Eff. Date: 05-JUN-2008		MOS HRS/MSC ENC	-	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30381 R02	NO. 2 ENGINE - REPLACEMENT OF FUEL MANIFOLD AND FUEL SHUT-OFF CABLE GROMMETS AND COVER PLATE FAIRING, SERVICE BULLETIN					CATEGORY 3	Complied With
Eff. Date: 06-AUG-2009		MOS HRS/MSC ENC	A/R	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30384	NO. 2 ENGINE - REPLACEMENT OF AIR/OIL SEPARATOR (SUPERSEDED BY PW500-72-3084 R01), SERVICE BULLETIN					CATEGORY 6	Complied With
Eff. Date: 02-FEB-2009		MOS HRS/MSC ENC	-	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30409 R06	NO. 2 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT (SUPERSEDED BY PW500-72-30409 R07), SERVICE BULLETIN					CATEGORY 7	Complied With
Eff. Date: 18-DEC-2009		MOS HRS/MSC ENC	-	10-OCT-2011 4149:35 3962	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB PW500-72-30409 R10	NO. 2 ENGINE - REPLACEMENT / MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN					CATEGORY 3	Not Applicable - NO EFFECT PREVIOUS REVISION C/W
Eff. Date: 16-NOV-2015		MOS HRS/MSC ENC	-	22-NOV-2015 4882:22 4589	-		
SB PW500-72-30413 R03	NO. 2 ENGINE - INTRODUCTION OF DEEPER SUMP (SUPERSEDED BY PW500-72-30413 R04), SERVICE BULLETIN					CATEGORY 6	Complied With
Eff. Date: 15-JUN-2011		MOS HRS/MSC ENC	A/R	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30416	NO. 2 ENGINE - REPLACEMENT OF NO.4 BEARING CARBON SEAL (SUPERSEDED BY PW500-72-30416 R01), SERVICE BULLETIN						Complied With
Eff. Date: 29-APR-2010		MOS HRS/MSC ENC	A/R	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30420	NO. 2 ENGINE - REPLACEMENT/MODIFICATION OF INTERCOMPRESSOR BLEED VALVE/ SERVO-VALVE (SUPERSEDED BY PW500-72-30420 R01), SERVICE BULLETIN					CATEGORY 3	Not Applicable - SUPERSEDED SUPERSEDED BY REVISION 1
		MOS HRS/MSC	-				
SB PW500-72-30420 R01	NO. 2 ENGINE - REPLACEMENT/MODIFICATION OF INTERCOMPRESSOR BLEED VALVE/ SERVO-VALVE (SUPERSEDED BY PW500-72-30420 R02), SERVICE BULLETIN					CATEGORY 6	- -SUPERSEDED BY REVISOIN 2
		MOS HRS/MSC	-				
SB PW500-72-30420 R03	NO. 2 ENGINE - REPLACEMENT/MODIFICATION OF INTERCOMPRESSOR BLEED VALVE/ SERVO-VALVE (SUPERSEDED BY PW500-72-30420 R04), SERVICE BULLETIN					CATEGORY 3	Complied With - REPL BLEED VALVE SERVO VALVE
Eff. Date: 14-MAR-2013		MOS HRS/MSC ENC	-	19-MAR-2014 4566:55 4303	-		
SB PW500-72-30425	NO. 2 ENGINE - REPLACEMENT OF NO. 4 BEARING CARBON SEAL (SUPERSEDED BY PW500-72-30425 R01), SERVICE BULLETIN					CATEGORY 3	Complied With
Eff. Date: 02-NOV-2010		MOS HRS/MSC ENC	A/R	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30429 R01	NO. 2 ENGINE - REPLACEMENT/MODIFICATION INTERMEDIATE CASE ASSEMBLY (SUPERSEDED BY PW500 -72-30429 R02), SERVICE BULLETIN					CATEGORY 6	Complied With
Eff. Date: 15-JUN-2011		MOS HRS/MSC ENC	A/R	12-AUG-2011 4149:18 3962	-		
SB PW500-72-30440 R02	NO. 2 ENGINE - REPLACEMENT OF TURBOFAN ENGINE NEW OR MODIFIED OIL TANK VENT TUBE ASSEMBLY (SUPERSEDED BY PW500-72-30440 R03), SERVICE BULLETIN					CATEGORY 6	Complied With
Eff. Date: 04-NOV-2011		MOS HRS/MSC ENC	A/R	18-JUN-2012 4272:33 4072	-		

?-Insufficient Information +- Task exists in Inspection Manual (S)-Suppressed Requirement (Ex)-Excluded Tasks *-Estimated Due(New Requirement) (EFF)-Effective C/W (EBT)-Estimated Base Time



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB PW500-72-30479 R06	NO. 2 ENGINE - REPLACEMENT OF NO. 4 BEARING FRONT COVER, HPT ROTOR SEAL, COLD START VALVE ASSEMBLY AND THE OIL TRANSFER TUBE, SERVICE BULLETIN					CATEGORY 3	Complied With - SB 72-30479 R06 CARRIED OUT DURING ENGINE OVERHAUL
Eff. Date: 20-MAY-2016		MOS HRS/MSC	-	19-MAR-2019			
SB PW500-72-30482	NO. 2 ENGINE - INSPECTION OF COMBUSTION CHAMBER LINER COOLING RING SEGMENTS SELF-LOCKING NUT (SUPERSEDED BY PW500-72-30482 R01), SERVICE BULLETIN					CATEGORY 3	Not Applicable - PRE SB 30419
Eff. Date: 18-OCT-2013		MOS HRS/MSC	-				
SB PW500-72-30482 R02	NO. 2 ENGINE - INSPECTION OF COMBUSTION CHAMBER LINER COOLING RING SEGMENTS SELF-LOCKING NUT (SUPERSEDED BY PW500-72-30482 R03), SERVICE BULLETIN					CATEGORY 3	Not Applicable - PRE SB 30419
Eff. Date: 26-FEB-2014		MOS HRS/MSC ENC	-	27-FEB-2014 4566:55 4303	-		
SB PW500-72-30505 R01	NO. 2 ENGINE - REPLACEMENT OF BLEED OFF VALVE (BOV) GASKETS (SUPERSEDED BY PW500-72-30505 R02), SERVICE BULLETIN					CATEGORY 3	Complied With - REPLACED GASKETS & ATTACHMENT HARDWARE
Eff. Date: 07-NOV-2014		MOS HRS/MSC ENC	-	24-APR-2015 4732:50 4450	-		
SB PW500-72-30512	NO. 2 ENGINE - INSPECTION/REPLACEMENT OF HYDROMECHANICAL FUEL CONTROL (SUPERSEDED BY PW500-72-30512 R01), SERVICE BULLETIN					CATEGORY 3	
Eff. Date: 11-DEC-2014		MOS HRS/MSC	-	-	-		
SB PW500-72-30512 R02	NO. 2 ENGINE - INSPECTION/ REPLACEMENT OF HYDROMECHANICAL FUEL CONTROL (SUPERSEDED BY PW500-72-30512 R03), SERVICE BULLETIN					CATEGORY 3	Not Applicable - N/A - ENGINE IS PRE SB 30442
Eff. Date: 29-APR-2015		MOS HRS/MSC ENC	-	08-MAY-2015 4740:52 4460	-		
SB PW500-72-30512 R03	NO. 2 ENGINE - INSPECTION/REPLACEMENT OF HYDROMECHANICAL FUEL CONTROL, SERVICE BULLETIN					CATEGORY 3	
Eff. Date: 14-FEB-2017		MOS HRS/MSC	-	-	-		
SB PW500-72-30545	NO. 2 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN					CATEGORY 3	Not Applicable - SB PW500-72-30545 IS NOT APPLICABLE AS PER R02 PERFORMED ON 19MAR19
Eff. Date: 28-SEP-2018		MOS ENC HRS/MSC	-	19-MAR-2019 4739			
SB PW500-72-30545 R01	NO. 2 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN						Not Applicable - SB PW500-72-30545 R01 IS NOT APPLICABLE AS PER R02 PERFORMED ON 19MAR19
		MOS ENC HRS/MSC	-	19-MAR-2019 4739			



MASTER AD/SI REPORT

Model: 560XL - CITATION XL (MSG) Serial: 560XL-5230 RegNo: OK-HAR HRS: 9055:06 AFL: 7284 As Of: 05-May-2026

AIRCRAFT
All Bulletins With Compliance or Due
05-May-2026 05:35 AM

TaskNbr	Task Description	Unit	Interval	C/W	NextDue	Disposition	MOC
SB PW500-72-30545 R02	NO. 2 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN					CATEGORY 3	Complied With
Eff. Date: 11-MAR-2019		MOS ENC HRS/MSC	-	19-MAR-2019 4739			
SB PW500-72-30545 R03	NO. 2 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN					CATEGORY 3	Not Applicable - SB PW500-72-30545 R03 IS NOT APPLICABLE AS PER R02 PERFORMED ON 19MAR19
Eff. Date: 28-MAY-2019		MOS ENC HRS/MSC	-	19-MAR-2019 4739			
SB PW500-72-30545 R04	NO. 2 ENGINE - REPLACEMENT/MODIFICATION OF HYDROMECHANICAL FUEL CONTROL UNIT, SERVICE BULLETIN					CATEGORY 3	Not Applicable - SB PW500-72-30545 R04 IS NOT APPLICABLE AS PER R02 PERFORMED ON 19MAR19
Eff. Date: 09-AUG-2019		MOS HRS/MSC	-	19-MAR-2019 5066:42	-		
ASB PW500-72-A30421	NO. 2 ENGINE - INSPECTION/REPLACEMENT OF INTERCOMPRESSOR BLEED VALVE/SERVO-VALVE (SUPERSEDED BY PW500-72-A30421 R01), ALERT SERVICE BULLETIN					CATEGORY 3	Not Applicable - NA ENGINE SN DB 0473 AND SN DB 0472 ARE PRE SB 30343 AND PRE SB 30404 REF W.C 4201
		MOS HRS/MSC ENC	-	09-NOV-2010 4049 3877	-		
ASB PW500-72-A30421 R01	NO. 2 ENGINE - INSPECTION/REPLACEMENT OF INTERCOMPRESSOR BLEED VALVE/SERVO-VALVE (SUPERSEDED BY PW500-72-A30421 R02), ALERT SERVICE BULLETIN					CATEGORY 3	Not Applicable - NA ENGINE SN DB 0473 AND SN DB 0472 ARE PRE SB 30343 AND PRE 30404
		MOS HRS/MSC ENC	-	09-NOV-2010 4049 3877	-		
ASB PW500-72-A30452	NO. 2 ENGINE - TURBOFAN ENGINE OIL SYSTEM - SPECIAL INSPECTION OF MOP (SUPERSEDED BY PW500-72-A30452 R01), ALERT SERVICE BULLETIN					CATEGORY 3	
Eff. Date: 16-JAN-2012		MOS HRS/MSC	-	-	-		
ASB PW500-72-A30452 R01	NO. 2 ENGINE - TURBOFAN ENGINE - OIL SYSTEM - SPECIAL INSPECTION OF MOP (SUPERSEDED BY PW500-72-A30452 R02), ALERT SERVICE BULLETIN					CATEGORY 3	Complied With
Eff. Date: 16-MAR-2012		MOS HRS/MSC ENC	-	18-JUN-2012 4272:33 4072	-		