TECH TIP

PRODUCT: QUEST JUICE

SUBJECT: CABINET DRAIN TUBE MODIFICATION

DATE: AUGUST 2, 2004

Units built starting the week of May 21, 2004 had a clear tube added to the cabinet drain to assure all condensation from the cabinet ran into the drip tray. Since the length to this tube extended into the drip tray itself, (Figure1) it was necessary to tip the drip tray when replacing it on the unit to assure the tube was completely in the tray. If this tipping of the tray did not happen the tube would be pushed behind the tray and the cabinet condensation would then run onto the counter (Figure 2). The recommended action to correct this is in 2 steps.

1. Bend the drain support bracket up about 20 degrees. This moves the outlet forward so it is aimed at the tray. (Figure 3, Detail B)
2. Cut the extension tube back so it inserts through the bracket but does not interfere with removing and replacing the drip tray itself. (Figure 3, Detail A)

FIGURE 1. Cabinet drain hose extended into drip tray

FIGURE 2. Drip tray in front of hose condensation will run under unit on the counter

DETAIL A. Tube cut just above the metal plate

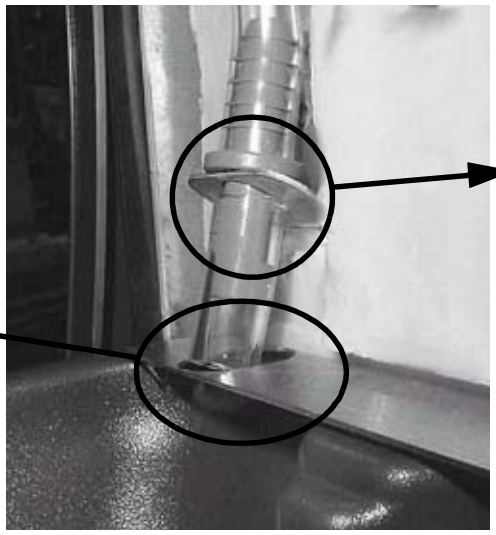

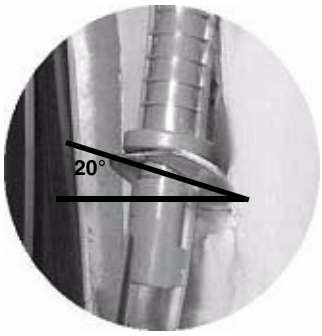

DETAIL B. 20 degree bend up on the bracket

FIGURE 3

© 2004, IMI Cornelius Inc.