

Baseline Assessment – Stream Attributes

Reach S-H25 (Timber Mat Crossing)

Perennial

Spread I

Franklin County, Virginia

Data	Included
Photos	✓
SWVM Form	✓
FCI Calculator and HGM Form	N/A – Perennial stream
RBP Physical Characteristics Form	✓
Water Quality Data	✓
RBP Habitat Form	✓
RBP Benthic Form	✓
Benthic Identification Sheet	N/A – Too deep
Wolman Pebble Count	✓
RiverMorph Data Sheet	✓
USM Form (Virginia Only)	✓
Longitudinal Profile and Cross Sections	✓

Spread I Stream S-H25 (Timber Mat Crossing) Franklin County

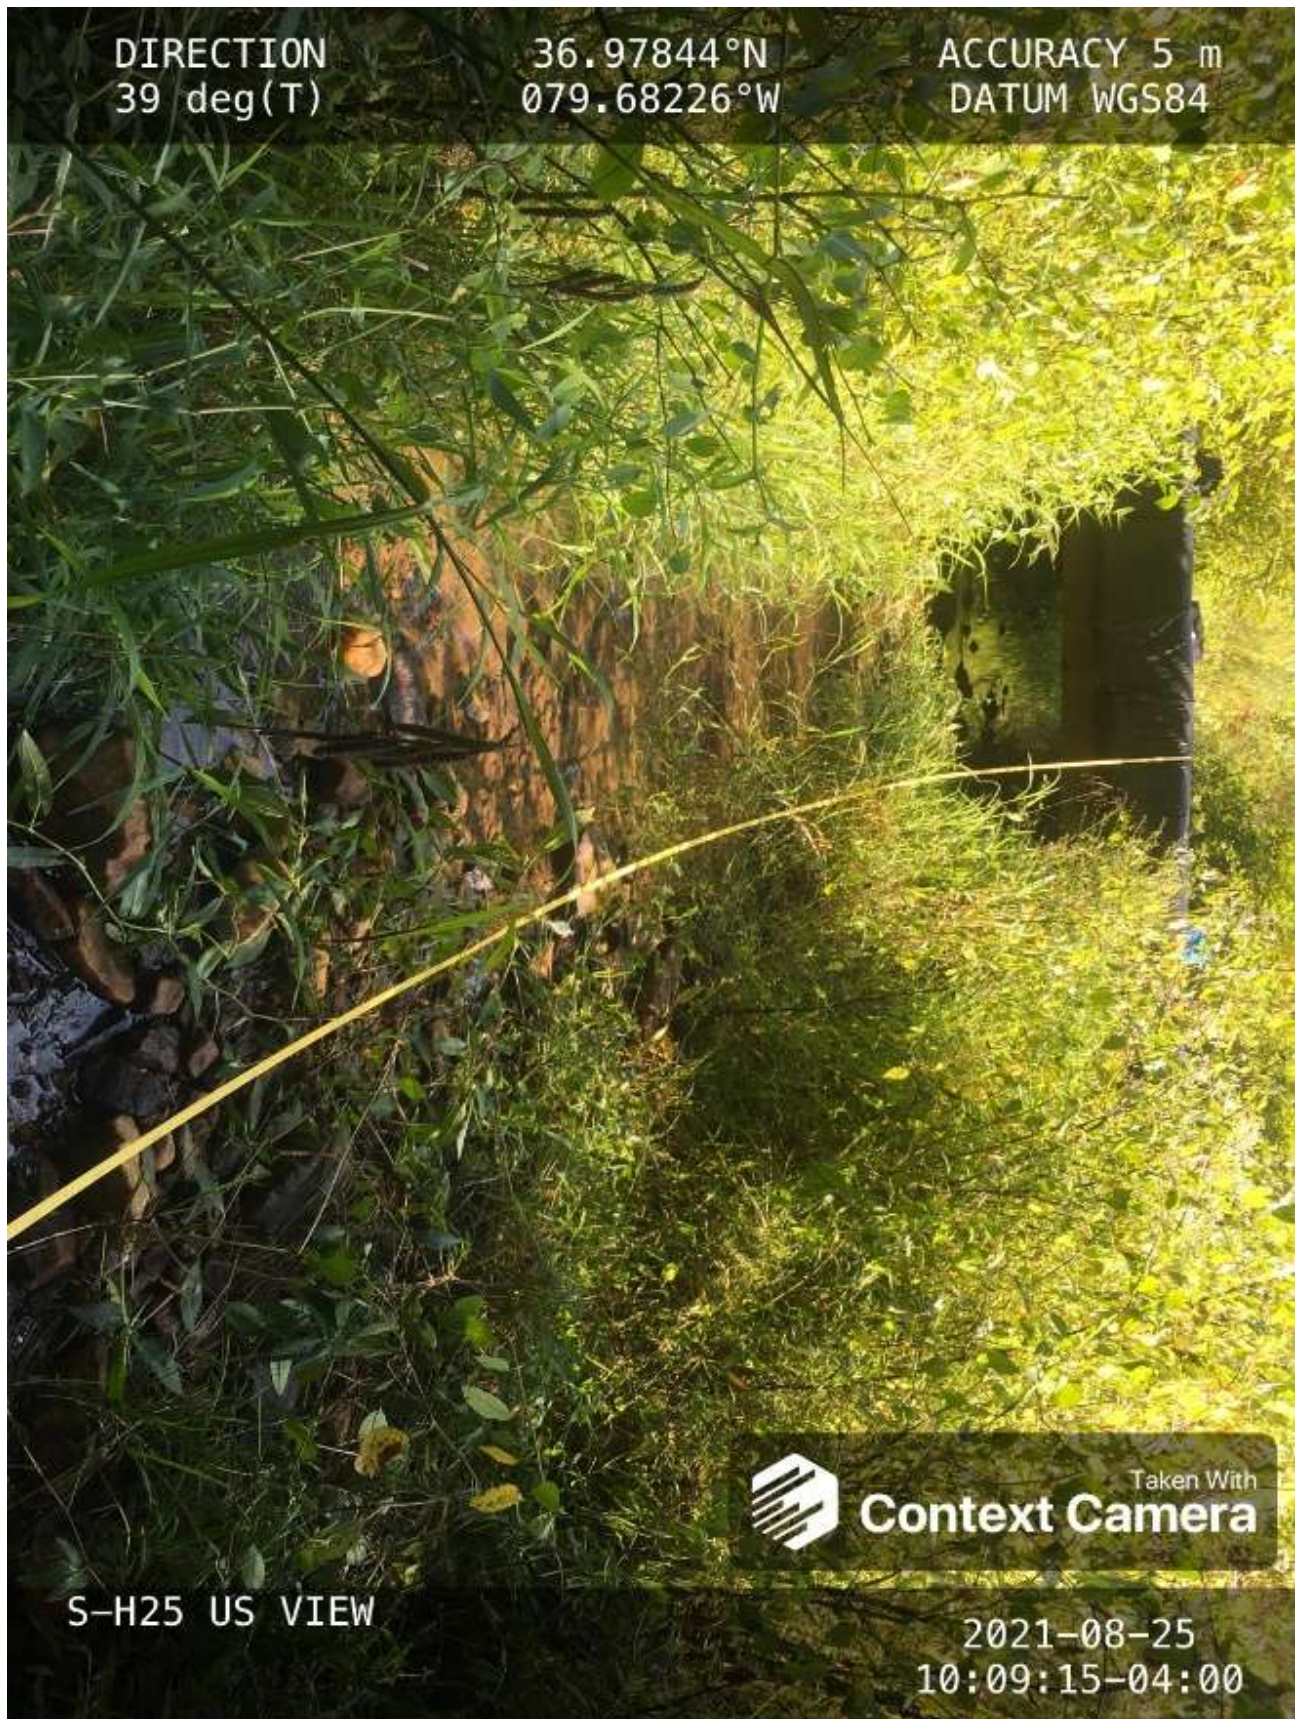


Photo Type: US VIEW

Location, Orientation, Photographer Initials: Downstream at ROW/LOC looking NE upstream, VM

Spread I Stream S-H25 (Timber Mat Crossing) Franklin County



Photo Type: DS COND DS
Location, Orientation, Photographer Initials: Downstream at ROW/LOC looking SW downstream, VM

Spread I Stream S-H25 (Timber Mat Crossing) Franklin County



Photo Type: LB CL

Location, Orientation, Photographer Initials: On thalweg at pipe centerline looking SE at left streambank, VM

Spread I Stream S-H25 (Timber Mat Crossing) Franklin County



Photo Type: RB CL

Location, Orientation, Photographer Initials: On thalweg at pipe centerline looking NW at right streambank, VM

Spread I Stream S-H25 (Timber Mat Crossing) Franklin County

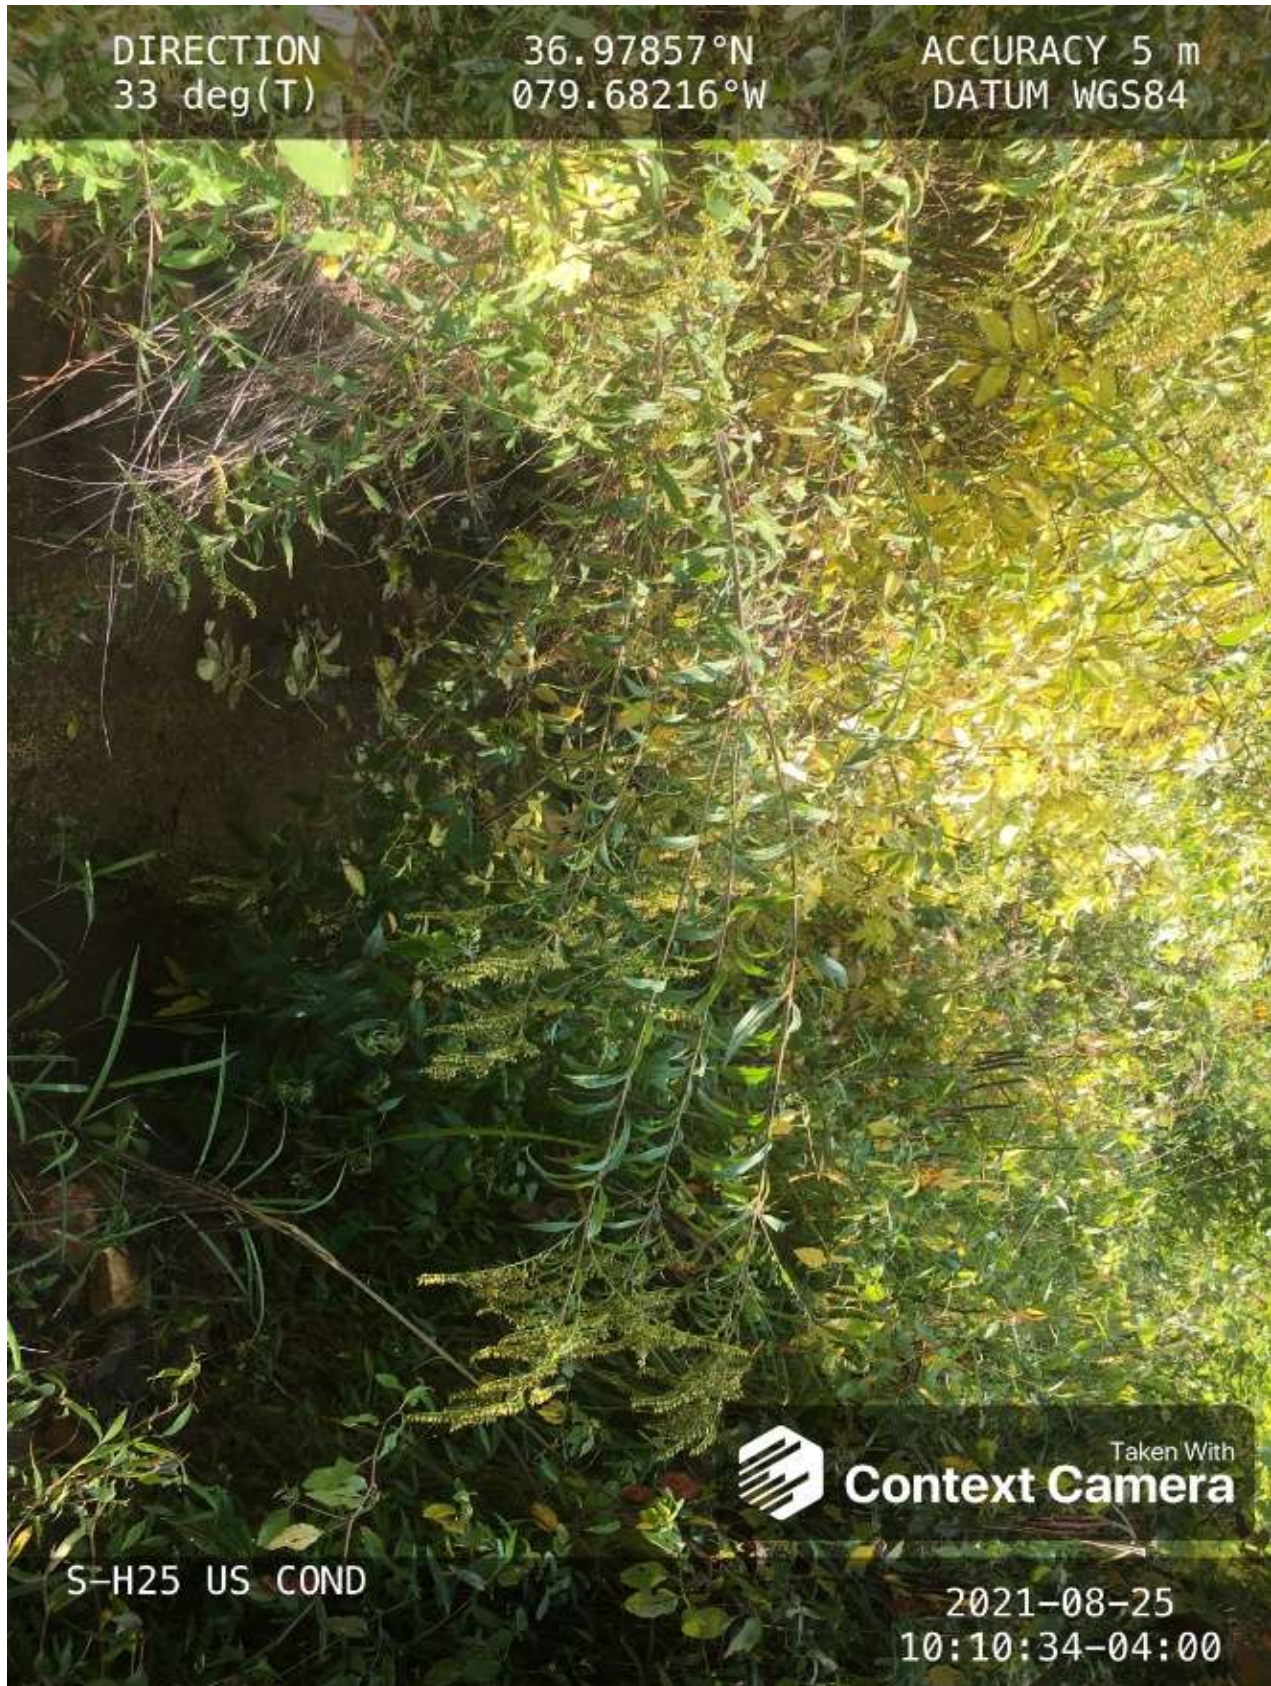


Photo Type: US COND

Location, Orientation, Photographer Initials: Upstream at ROW/LOC looking NE upstream, VM

Spread I Stream S-H25 (Timber Mat Crossing) Franklin County



Photo Type: DS VIEW

Location, Orientation, Photographer Initials: Upstream at ROW/LOC looking SWdownstream, VM

<L:\22000s\22800\22865.06\Admin\05-ENVR\Field Data\Template Forms\Photo Document Template.docx>

USACE FILE NO./ Project Name: (v2.1, Sept 2015)				Mountain Valley Pipeline				IMPACT COORDINATES: (In Decimal Degrees)				Lat.	36.978529				Lon.	-79.682186				WEATHER:				Sunny				DATE:				August 25, 2021																									
IMPACT STREAM/SITE ID AND SITE DESCRIPTION: (watershed size (acreage), unaltered or impairments)												S-H25/152.31 ac												MITIGATION STREAM CLASS./SITE ID AND SITE DESCRIPTION: (watershed size (acreage), unaltered or impairments)												Comments:																							
STREAM IMPACT LENGTH:				20				FORM OF MITIGATION:				RESTORATION (Levels I-III)				MIT COORDINATES: (In Decimal Degrees)				Lat.					Lon.					PRECIPITATION PAST 48 HRS:								Mitigation Length:																					
Column No. 1- Impact Existing Condition (Debit)												Column No. 2- Mitigation Existing Condition - Baseline (Credit)												Column No. 3- Mitigation Projected at Five Years Post Completion (Credit)												Column No. 4- Mitigation Projected at Ten Years Post Completion (Credit)												Column No. 5- Mitigation Projected at Maturity (Credit)											
Stream Classification:				Perennial				Stream Classification:								Stream Classification:				0				Stream Classification:				0				Stream Classification:				0																							
Percent Stream Channel Slope								Percent Stream Channel Slope								Percent Stream Channel Slope				0				Percent Stream Channel Slope				0				Percent Stream Channel Slope				0																							
HGM Score (attach data forms):												HGM Score (attach data forms):												HGM Score (attach data forms):												HGM Score (attach data forms):												HGM Score (attach data forms):											
Average												Average												Average												Average												Average											
Hydrology								Hydrology								Hydrology								Hydrology								Hydrology																											
Biogeochemical Cycling				0				Biogeochemical Cycling				0				Biogeochemical Cycling				0				Biogeochemical Cycling				0				Biogeochemical Cycling				0																							
Habitat								Habitat								Habitat								Habitat								Habitat																											
PART I - Physical, Chemical and Biological Indicators												PART I - Physical, Chemical and Biological Indicators												PART I - Physical, Chemical and Biological Indicators												PART I - Physical, Chemical and Biological Indicators												PART I - Physical, Chemical and Biological Indicators											
				Points Scale				Range				Site Score								Points Scale				Range				Site Score								Points Scale				Range				Site Score															
PHYSICAL INDICATOR (Applies to all streams classifications)												PHYSICAL INDICATOR (Applies to all streams classifications)												PHYSICAL INDICATOR (Applies to all streams classifications)												PHYSICAL INDICATOR (Applies to all streams classifications)												PHYSICAL INDICATOR (Applies to all streams classifications)											
USEPA RBP (High Gradient Data Sheet)												USEPA RBP (Low Gradient Data Sheet)												USEPA RBP (High Gradient Data Sheet)												USEPA RBP (High Gradient Data Sheet)												USEPA RBP (High Gradient Data Sheet)											
1. Epifaunal Substrate/Available Cover				0-20				14				1. Epifaunal Substrate/Available Cover				0-20								1. Epifaunal Substrate/Available Cover				0-20								1. Epifaunal Substrate/Available Cover				0-20																			
2. Embeddedness				0-20				13				2. Embeddedness				0-20								2. Embeddedness				0-20								2. Embeddedness				0-20																			
3. Velocity/ Depth Regime				0-20				9				3. Velocity/ Depth Regime				0-20								3. Velocity/ Depth Regime				0-20								3. Velocity/ Depth Regime				0-20																			
4. Sediment Deposition				0-20				13				4. Sediment Deposition				0-20								4. Sediment Deposition				0-20								4. Sediment Deposition				0-20																			
5. Channel Flow Status				0-20				12				5. Channel Flow Status				0-20								5. Channel Flow Status				0-20								5. Channel Flow Status				0-20																			
6. Channel Alteration				0-20				10				6. Channel Alteration				0-20								6. Channel Alteration				0-20								6. Channel Alteration				0-20																			
7. Frequency of Riffles (or bends)				0-20				11				7. Frequency of Riffles (or bends)				0-20								7. Frequency of Riffles (or bends)				0-20								7. Frequency of Riffles (or bends)				0-20																			
8. Bank Stability (LB & RB)				0-20				18				8. Bank Stability (LB & RB)				0-20								8. Bank Stability (LB & RB)				0-20								8. Bank Stability (LB & RB)				0-20																			
9. Vegetative Protection (LB & RB)				0-20				14				9. Vegetative Protection (LB & RB)				0-20								9. Vegetative Protection (LB & RB)				0-20								9. Vegetative Protection (LB & RB)				0-20																			
10. Riparian Vegetative Zone Width (LB & RB)				0-20				14				10. Riparian Vegetative Zone Width (LB & RB)				0-20								10. Riparian Vegetative Zone Width (LB & RB)				0-20								10. Riparian Vegetative Zone Width (LB & RB)				0-20																			
Total RBP Score				Suboptimal				128				Total RBP Score				Poor				0				Total RBP Score				Poor				0				Total RBP Score				Poor				0															
Sub-Total								0.64				Sub-Total								0				Sub-Total								0				Sub-Total								0															
CHEMICAL INDICATOR (Applies to Intermittent and Perennial Streams)												CHEMICAL INDICATOR (Applies to Intermittent and Perennial Streams)												CHEMICAL INDICATOR (Applies to Intermittent and Perennial Streams)												CHEMICAL INDICATOR (Applies to Intermittent and Perennial Streams)												CHEMICAL INDICATOR (Applies to Intermittent and Perennial Streams)											
WVDEP Water Quality Indicators (General)												WVDEP Water Quality Indicators (General)												WVDEP Water Quality Indicators (General)												WVDEP Water Quality Indicators (General)												WVDEP Water Quality Indicators (General)											
Specific Conductivity								62.6				Specific Conductivity												Specific Conductivity												Specific Conductivity																							

PHYSICAL CHARACTERIZATION/WATER QUALITY FIELD DATA SHEET (FRONT)

STREAM NAME _____	LOCATION _____	
STATION # _____ RIVERMILE _____	STREAM CLASS _____	
LAT _____ LONG _____	RIVER BASIN _____	
STORET # _____	AGENCY _____	
INVESTIGATORS _____		
FORM COMPLETED BY _____	DATE _____ TIME _____	REASON FOR SURVEY _____

WEATHER CONDITIONS	Now storm (heavy rain) _____ rain (steady rain) _____ showers (intermittent) _____ %cloud cover _____ clear/sunny _____ Past 24 hours _____% _____% Has there been a heavy rain in the last 7 days? Yes _____ No _____ Air Temperature _____ °C Other _____	
SITE LOCATION/MAP	Draw a map of the site and indicate the areas sampled (or attach a photograph)	
STREAM CHARACTERIZATION	Stream Subsystem Perennial _____ Intermittent _____ Tidal _____ Stream Type Coldwater _____ Warmwater _____ Stream Origin Glacial _____ Non-glacial montane _____ Swamp and bog _____ Spring-fed _____ Mixture of origins _____ Other _____ Catchment Area _____ km²	

PHYSICAL CHARACTERIZATION/WATER QUALITY FIELD DATA SHEET (BACK)

WATERSHED FEATURES	Predominant Surrounding Landuse Forest _____ Field/Pasture _____ Agricultural _____ Residential _____ Commercial _____ Industrial _____ Other _____	Local Watershed NPS Pollution No evidence ☐ Some potential sources Obvious sources _____ Local Watershed Erosion None _____ Moderate _____ Heavy _____
RIPARIAN VEGETATION (18 meter buffer)	Indicate the dominant type and record the dominant species present Trees _____ Shrubs _____ Grasses _____ Herbaceous _____ Dominant species present _____	
INSTREAM FEATURES	Estimated Reach Length _____ m Estimated Stream Width _____ m Sampling Reach Area _____ m² Area in km² (m²x1000) _____ km² Estimated Stream Depth _____ m Surface Velocity (at thalweg) _____ m/sec Canopy Cover Partly open _____ Partly shaded _____ Shaded _____ High Water Mark _____ m Proportion of Reach Represented by Stream Morphology Types Riffle _____ % Run _____ % Pool _____ % Channelized Yes _____ No _____ Dam Present Yes _____ No _____	
LARGE WOODY DEBRIS	LWD _____ m ² Density of LWD _____ m ² /km ² (LWD/ reach area)	
AQUATIC VEGETATION	Indicate the dominant type and record the dominant species present Rooted emergent _____ Rooted submergent _____ Rooted floating _____ Free floating _____ Floating Algae _____ Attached Algae _____ Dominant species present _____ Portion of the reach with aquatic vegetation _____ %	
WATER QUALITY	Temperature _____ °C Specific Conductance _____ Dissolved Oxygen _____ pH _____ Turbidity _____ WQ Instrument Used _____ Water Odors Normal/None _____ Sewage _____ Petroleum _____ Chemical _____ Fishy _____ Other _____ Water Surface Oils Slick _____ Sheen _____ Globs _____ Flecks _____ None _____ Other _____ Turbidity (if not measured) Clear ☐ Slightly turbid _____ Turbid _____ Opaque _____ Stained _____ Other _____	
SEDIMENT/ SUBSTRATE	Odors Normal _____ Sewage _____ Petroleum _____ Chemical _____ Anaerobic _____ None _____ Other _____ Oils Absent _____ Slight _____ Moderate _____ Profuse _____ Deposits Sludge _____ Sawdust _____ Paper fiber _____ Sand _____ Relict shells _____ Other _____ Looking at stones which are not deeply embedded, are the undersides black in color? Yes _____ No _____	

INORGANIC SUBSTRATE COMPONENTS (should add up to 100%)			ORGANIC SUBSTRATE COMPONENTS (does not necessarily add up to 100%)		
Substrate Type	Diameter	% Composition in Sampling Reach	Substrate Type	Characteristic	% Composition in Sampling Area
Bedrock			Detritus	sticks, wood, coarse plant materials (CPOM)	
Boulder	> 256 mm (10")				
Cobble	64-256 mm (2.5"-10")		Muck-Mud	black, very fine organic (FPOM)	
Gravel	2-64 mm (0.1"-2.5")				
Sand	0.06-2mm (gritty)		Marl	grey, shell fragments	
Silt	0.004-0.06 mm				
Clay	< 0.004 mm (slick)				

HABITAT ASSESSMENT FIELD DATA SHEET - HG - USE ON ALL STREAMS (FRONT)

STREAM NAME		LOCATION	
STATION # _____ RIVERMILE _____		STREAM CLASS	
LAT _____ LONG _____		RIVER BASIN	
STORET #		AGENCY	
INVESTIGATORS			
FORM COMPLETED BY		DATE _____ TIME _____ AM PM	REASON FOR SURVEY

Parameters to be evaluated in sampling reach	Habitat Parameter	Condition Category																				
		Optimal					Suboptimal					Marginal					Poor					
	1. Epifaunal Substrate/ Available Cover	Greater than 70% of substrate favorable for epifaunal colonization and fish cover; mix of snags, submerged logs, undercut banks, cobble or other stable habitat and at stage to allow full colonization potential (i.e., logs/snags that are <u>not</u> new fall and <u>not</u> transient).					40-70% mix of stable habitat; well-suited for full colonization potential; adequate habitat for maintenance of populations; presence of additional substrate in the form of newfall, but not yet prepared for colonization (may rate at high end of scale).					20-40% mix of stable habitat; habitat availability less than desirable; substrate frequently disturbed or removed.					Less than 20% stable habitat; lack of habitat is obvious; substrate unstable or lacking.					
		SCORE	20	19	18	17	16	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1
	2. Embeddedness	Gravel, cobble, and boulder particles are 0-25% surrounded by fine sediment. Layering of cobble provides diversity of niche space.					Gravel, cobble, and boulder particles are 25-50% surrounded by fine sediment.					Gravel, cobble, and boulder particles are 50-75% surrounded by fine sediment.					Gravel, cobble, and boulder particles are more than 75% surrounded by fine sediment.					
		SCORE	20	19	18	17	16	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1
	3. Velocity/Depth Regime	All four velocity/depth regimes present (slow-deep, slow-shallow, fast-deep, fast-shallow). (Slow is < 0.3 m/s, deep is > 0.5 m.)					Only 3 of the 4 regimes present (if fast-shallow is missing, score lower than if missing other regimes).					Only 2 of the 4 habitat regimes present (if fast-shallow or slow-shallow are missing, score low).					Dominated by 1 velocity/depth regime (usually slow-deep).					
		SCORE	20	19	18	17	16	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1
	4. Sediment Deposition	Little or no enlargement of islands or point bars and less than 5% of the bottom affected by sediment deposition.					Some new increase in bar formation, mostly from gravel, sand or fine sediment; 5-30% of the bottom affected; slight deposition in pools.					Moderate deposition of new gravel, sand or fine sediment on old and new bars; 30-50% of the bottom affected; sediment deposits at obstructions, constrictions, and bends; moderate deposition of pools prevalent.					Heavy deposits of fine material, increased bar development; more than 50% of the bottom changing frequently; pools almost absent due to substantial sediment deposition.					
		SCORE	20	19	18	17	16	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1
	5. Channel Flow Status	Water reaches base of both lower banks, and minimal amount of channel substrate is exposed.					Water fills >75% of the available channel; or <25% of channel substrate is exposed.					Water fills 25-75% of the available channel, and/or riffle substrates are mostly exposed.					Very little water in channel and mostly present as standing pools.					
		SCORE	20	19	18	17	16	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1

HABITAT ASSESSMENT FIELD DATA SHEET—HIGH GRADIENT STREAMS (BACK)

Habitat Parameter	Condition Category																				
	Optimal					Suboptimal					Marginal					Poor					
6. Channel Alteration	Channelization or dredging absent or minimal; stream with normal pattern.					Some channelization present, usually in areas of bridge abutments; evidence of past channelization, i.e., dredging, (greater than past 20 yr) may be present, but recent channelization is not present.					Channelization may be extensive; embankments or shoring structures present on both banks; and 40 to 80% of stream reach channelized and disrupted.					Banks shored with gabion or cement; over 80% of the stream reach channelized and disrupted. Instream habitat greatly altered or removed entirely.					
SCORE	20	19	18	17	16	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	0
7. Frequency of Riffles (or bends)	Occurrence of riffles relatively frequent; ratio of distance between riffles divided by width of the stream <7:1 (generally 5 to 7); variety of habitat is key. In streams where riffles are continuous, placement of boulders or other large, natural obstruction is important.					Occurrence of riffles infrequent; distance between riffles divided by the width of the stream is between 7 to 15.					Occasional riffle or bend; bottom contours provide some habitat; distance between riffles divided by the width of the stream is between 15 to 25.					Generally all flat water or shallow riffles; poor habitat; distance between riffles divided by the width of the stream is a ratio of >25.					
SCORE	20	19	18	17	16	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	0
8. Bank Stability (score each bank)	Banks stable; evidence of erosion or bank failure absent or minimal; little potential for future problems. <5% of bank affected.					Moderately stable; infrequent, small areas of erosion mostly healed over. 5-30% of bank in reach has areas of erosion.					Moderately unstable; 30-60% of bank in reach has areas of erosion; high erosion potential during floods.					Unstable; many eroded areas; "raw" areas frequent along straight sections and bends; obvious bank sloughing; 60-100% of bank has erosional scars.					
Note: determine left or right side by facing downstream.																					
SCORE ____ (LB)	Left Bank	10		9		8	7		6		5	4		3		2	1		0		
SCORE ____ (RB)	Right Bank	10		9		8	7		6		5	4		3		2	1		0		
9. Vegetative Protection (score each bank)	More than 90% of the streambank surfaces and immediate riparian zone covered by native vegetation, including trees, understory shrubs, or nonwoody macrophytes; vegetative disruption through grazing or mowing minimal or not evident; almost all plants allowed to grow naturally.					70-90% of the streambank surfaces covered by native vegetation, but one class of plants is not well-represented; disruption evident but not affecting full plant growth potential to any great extent; more than one-half of the potential plant stubble height remaining.					50-70% of the streambank surfaces covered by vegetation; disruption obvious; patches of bare soil or closely cropped vegetation common; less than one-half of the potential plant stubble height remaining.					Less than 50% of the streambank surfaces covered by vegetation; disruption of streambank vegetation is very high; vegetation has been removed to 5 centimeters or less in average stubble height.					
SCORE ____ (LB)	Left Bank	10		9		8	7		6		5	4		3		2	1		0		
SCORE ____ (RB)	Right Bank	10		9		8	7		6		5	4		3		2	1		0		
10. Riparian Vegetative Zone Width (score each bank riparian zone)	Width of riparian zone >18 meters; human activities (i.e., parking lots, roadbeds, clear-cuts, lawns, or crops) have not impacted zone.					Width of riparian zone 12-18 meters; human activities have impacted zone only minimally.					Width of riparian zone 6-12 meters; human activities have impacted zone a great deal.					Width of riparian zone <6 meters; little or no riparian vegetation due to human activities.					
SCORE ____ (LB)	Left Bank	10		9		8	7		6		5	4		3		2	1		0		
SCORE ____ (RB)	Right Bank	10		9		8	7		6		5	4		3		2	1		0		

Total Score _____

BENTHIC MACROINVERTEBRATE FIELD DATA SHEET

STREAM NAME _____	LOCATION _____	
STATION # _____ RIVERMILE _____	STREAM CLASS _____	
LAT _____ LONG _____	RIVER BASIN _____	
STORET # _____	AGENCY _____	
INVESTIGATORS _____		LOT NUMBER _____
FORM COMPLETED BY _____	DATE _____ TIME _____	REASON FOR SURVEY _____

HABITAT TYPES	Indicate the percentage of each habitat type present Cobble _____% Snags _____% Vegetated Banks _____% Sand _____% Submerged Macrophytes _____% Other (_____) _____%
SAMPLE COLLECTION	Gear used D-frame kick-net Other _____ How were the samples collected? wading from bank from boat Indicate the number of jabs/kicks taken in each habitat type. Cobble _____ Snags _____ Vegetated Banks _____ Sand _____ Submerged Macrophytes _____ Other (_____) _____
GENERAL COMMENTS	

QUALITATIVE LISTING OF AQUATIC BIOTA

Indicate estimated abundance: 0 = Absent/Not Observed, 1 = Rare, 2 = Common, 3= Abundant, 4 = Dominant

Periphyton	0	1	2	3	4	Slimes	0	1	2	3	4
Filamentous Algae	0	1	2	3	4	Macroinvertebrates	0	1	2	3	4
Macrophytes	0	1	2	3	4	Fish	0	1	2	3	4

FIELD OBSERVATIONS OF MACROBENTHOS

Indicate estimated abundance: 0 = Absent/Not Observed, 1 = Rare (1-3 organisms), 2 = Common (3-9 organisms), 3= Abundant (>10 organisms), 4 = Dominant (>50 organisms)

Porifera	0	1	2	3	4	Anisoptera	0	1	2	3	4	Chironomidae	0	1	2	3	4
Hydrozoa	0	1	2	3	4	Zygoptera	0	1	2	3	4	Ephemeroptera	0	1	2	3	4
Platyhelminthes	0	1	2	3	4	Hemiptera	0	1	2	3	4	Trichoptera	0	1	2	3	4
Turbellaria	0	1	2	3	4	Coleoptera	0	1	2	3	4	Other	0	1	2	3	4
Hirudinea	0	1	2	3	4	Lepidoptera	0	1	2	3	4						
Oligochaeta	0	1	2	3	4	Sialidae	0	1	2	3	4						
Isopoda	0	1	2	3	4	Corydalidae	0	1	2	3	4						
Amphipoda	0	1	2	3	4	Tipulidae	0	1	2	3	4						
Decapoda	0	1	2	3	4	Empididae	0	1	2	3	4						
Gastropoda	0	1	2	3	4	Simuliidae	0	1	2	3	4						
Bivalvia	0	1	2	3	4	Tabinidae	0	1	2	3	4						
						Culcidae	0	1	2	3	4						

WOLMAN PEBBLE COUNT FORM

County: Franklin County
Stream Name: UNT to Little Jacks Creek
HUC Code: 03010101
Survey Date: 8/25/2021
Surveyors: AJ,VM
Type: Representative

Stream ID: S-H25

Basin: Upper Roanoke

PEBBLE COUNT							
Inches	PARTICLE	Millimeters		Particle Count	Total #	Item %	% Cum
	Silt/Clay	< .062	S/C	▲ ▼	10	10.00	10.00
	Very Fine	.062-.125	S A N D	▲ ▼	0	0.00	10.00
	Fine	.125-.25		▲ ▼	7	7.00	17.00
	Medium	.25-.5		▲ ▼	3	3.00	20.00
	Coarse	.50-1.0		▲ ▼	10	10.00	30.00
.04-.08	Very Coarse	1.0-2		▲ ▼	0	0.00	30.00
.08 -.16	Very Fine	2 -4		G R A V E L	▲ ▼	0	0.00
.16 - .22	Fine	4 -5.7	▲ ▼		0	0.00	30.00
.22 - .31	Fine	5.7 - 8	▲ ▼		0	0.00	30.00
.31 - .44	Medium	8 -11.3	▲ ▼		0	0.00	30.00
.44 - .63	Medium	11.3 - 16	▲ ▼		0	0.00	30.00
.63 - .89	Coarse	16 -22.6	▲ ▼		5	5.00	35.00
.89 - 1.26	Coarse	22.6 - 32	▲ ▼		4	4.00	39.00
1.26 - 1.77	Vry Coarse	32 - 45	▲ ▼		1	1.00	40.00
1.77 -2.5	Vry Coarse	45 - 64	▲ ▼		0	0.00	40.00
2.5 - 3.5	Small	64 - 90	C O B B L E		▲ ▼	23	23.00
3.5 - 5.0	Small	90 - 128		▲ ▼	32	32.00	95.00
5.0 - 7.1	Large	128 - 180		▲ ▼	3	3.00	98.00
7.1 - 10.1	Large	180 - 256		▲ ▼	2	2.00	100.00
10.1 - 14.3	Small	256 - 362	B O U L D E R	▲ ▼	0	0.00	100.00
14.3 - 20	Small	362 - 512		▲ ▼	0	0.00	100.00
20 - 40	Medium	512 - 1024		▲ ▼	0	0.00	100.00
40 - 80	Large	1024 -2048		▲ ▼	0	0.00	100.00
80 - 160	Vry Large	2048 -4096		▲ ▼	0	0.00	100.00
	Bedrock		BDRK	▲ ▼	0	0.00	100.00
				Totals:	100		
	Total Tally:						

RIVERMORPH PARTICLE SUMMARY

River Name: Little Jacks Creek
Reach Name: S-H25
Sample Name: Representative
Survey Date: 08/25/2021




Size (mm)	TOT #	ITEM %	CUM %
0 - 0.062	10	10.00	10.00
0.062 - 0.125	0	0.00	10.00
0.125 - 0.25	7	7.00	17.00
0.25 - 0.50	3	3.00	20.00
0.50 - 1.0	10	10.00	30.00
1.0 - 2.0	0	0.00	30.00
2.0 - 4.0	0	0.00	30.00
4.0 - 5.7	0	0.00	30.00
5.7 - 8.0	0	0.00	30.00
8.0 - 11.3	0	0.00	30.00
11.3 - 16.0	0	0.00	30.00
16.0 - 22.6	5	5.00	35.00
22.6 - 32.0	4	4.00	39.00
32 - 45	1	1.00	40.00
45 - 64	0	0.00	40.00
64 - 90	23	23.00	63.00
90 - 128	32	32.00	95.00
128 - 180	3	3.00	98.00
180 - 256	2	2.00	100.00
256 - 362	0	0.00	100.00
362 - 512	0	0.00	100.00
512 - 1024	0	0.00	100.00
1024 - 2048	0	0.00	100.00
Bedrock	0	0.00	100.00
D16 (mm)	0.23		
D35 (mm)	22.6		
D50 (mm)	75.3		
D84 (mm)	114.94		
D95 (mm)	128		
D100 (mm)	256		
Silt/Clay (%)	10		
Sand (%)	20		
Gravel (%)	10		
Cobble (%)	60		
Boulder (%)	0		
Bedrock (%)	0		

Total Particles = 100.

Stream Assessment Form (Form 1)

Unified Stream Methodology for use in Virginia

For use in Wadeable channels classified as intermittent or perennial

Project #	Project Name (Applicant)	Locality	Cowardin Class.	HUC	Date	SAR #	Impact Length	Impact Factor
22865.06	Mountain Valley Pipeline (Mountain Valley Pipeline, LLC)	Franklin County	R3	03010101	8/25/2021	S-H25	20	1
Name(s) of Evaluator(s)		Stream Name and Information					SAR Length	
AJ, VM		S-H25; Spread I; Franklin County					77	
1. Channel Condition: Assess the cross-section of the stream and prevailing condition (erosion, aggradation)								
Conditional Category								
Channel Condition	Optimal	Suboptimal	Marginal	Poor	Severe			
	 Very little incision or active erosion; 80-100% stable banks. Vegetative surface protection or natural rock, prominent (80-100%). AND/OR Stable bankfull benches are present. Access to their original floodplain or fully developed wide bankfull benches. Mid channel bars and transverse bars few. Transient sediment deposition covers less than 10% of bottom.	 Slightly incised, few areas of active erosion or unprotected banks. Majority of banks are stable (60-80%). Vegetative protection or natural rock prominent (60-80%) AND/OR Depositional features contribute to stability. The bankfull and low flow channels are well defined. Stream likely has access to bankfull benches, or newly developed portions of the reach. Transient sediment covers 10-40% of the stream bottom.	 Often incised, but less than Severe or Poor. Banks more stable than Severe or Poor due to lower bank slopes. Erosion may be present on 40-60% of both banks. Vegetative protection on 40-60% of banks. Streambanks may be vertical or undercut. AND/OR 40-60% Sediment may be temporary / transient, contribute instability. Deposition that contribute to stability, may be forming/present. AND/OR V-shaped channels have vegetative protection on > 40% of the banks and depositional features which contribute to stability.	 Overwidened/incised. Vertically / laterally unstable. Likely to widen further. Majority of both banks are near vertical. Erosion present on 60-banks. Vegetative protection present on 20-40% of banks, and is insufficient to prevent erosion. AND/OR 60-80% the stream is covered by sediment. Sediment is temporary / transient in nature, and contributing to instability. AND/OR V-shaped channels have vegetative protection is present on > 40% of the banks and stable sediment deposition is absent.	 Deeply incised (or excavated), vertical/lateral instability. Severe incision, flow contained within the banks. Streambed below average majority of banks vertical/undercut. Vegetative protection present on less than 20% of banks, is not preventing erosion. Obvious bank sloughing present. Erosion/raw banks on 80-100%. AND/OR Aggrading channel. than 80% of stream bed is covered by deposition, contributing to instability. Multiple thread channels and/or subterranean flow.			
Scores	3	2.4	2	1.6	1	CI		
NOTES>> Assessment is limited to areas within the temporary ROW.								
2. RIPARIAN BUFFERS: Assess both bank's 100 foot riparian areas along the entire SAR. (rough measurements of length & width may be acceptable)								
Conditional Category								
Riparian Buffers	Optimal	Suboptimal	Marginal	Poor	NOTES>>			
	Tree stratum (dbh > 3 inches) present, with > 60% tree canopy cover. Wetlands located within the riparian areas.	High Suboptimal: Riparian areas with tree stratum (dbh > 3 inches) present, with 30% to 60% tree canopy cover and containing both herbaceous and shrub layers or a non-maintained understory. Low Suboptimal: Riparian areas with tree stratum (dbh > 3 inches) present, with 30% to 60% tree canopy cover and a maintained understory. Recent cutover (dense vegetation).	High Marginal: Non-maintained, dense herbaceous vegetation with either a shrub layer or a tree layer (dbh > 3 inches) present, with <30% tree canopy cover. Low Marginal: Non-maintained, dense herbaceous vegetation, riparian areas lacking shrub and tree stratum, hay production, ponds, open water. If present, tree stratum (dbh > 3 inches) present, with <30% tree canopy cover with maintained understory.	High Poor: Lawns, mowed, and maintained areas, nurseries; no-till cropland; actively grazed pasture, sparsely vegetated non-maintained area, recently seeded and stabilized, or other comparable condition. Low Poor: Impervious surfaces, mine spoil lands, denuded surfaces, row crops, active feed lots, trails, or other comparable conditions.				
Scores	1.5	High 1.2 Low 1.1	High 0.85 Low 0.75	High 0.6 Low 0.5				
1. Delineate riparian areas along each stream bank into Condition Categories and Condition Scores using the descriptors. 2. Determine square footage for each by measuring or estimating length and width. Calculators are provided for you below. 3. Enter the % Riparian Area and Score for each riparian category in the blocks below.					Ensure the sums of % Riparian Blocks equal 100			
Right Bank	% Riparian Area>	100%					100%	
	Score >	0.85						
								CI= (Sum % RA * Scores*0.01)/2
Left Bank	% Riparian Area>	100%					100%	
	Score >	0.85						
								Rt Bank CI > 0.85 Lt Bank CI > 0.85
3. INSTREAM HABITAT: Varied substrate sizes, water velocity and depths; woody and leafy debris; stable substrate; low embeddedness; shade; undercut banks; root mats; SAV; riffle/pool complexes, stable features.								
Conditional Category								
Instream Habitat/ Available Cover	Optimal	Suboptimal	Marginal	Poor	NOTES>>			
	Habitat elements are typically present in greater than 50% of the reach.	Stable habitat elements are typically present in 30-50% of the reach and are adequate for maintenance of populations.	Stable habitat elements are typically present in 10-30% of the reach and are adequate for maintenance of populations.	Habitat elements listed above are lacking or are unstable. Habitat elements are typically present in less than 10% of the reach.				
Scores	1.5	1.2	0.9	0.5	Stream Gradient High / Low CI 0.90			

Stream Impact Assessment Form Page 2

Project #	Project Name (Applicant)	Locality	Cowardin Class.	HUC	Date	SAR # / Data Point	Impact / SAR length	Impact Factor
22865.06	Mountain Valley Pipeline (Mountain Valley Pipeline, LLC)	Franklin County	R3	03010101	8/25/2021	S-H25	20	1

4. CHANNEL ALTERATION: Stream crossings, riprap, concrete, gabions, or concrete blocks, straightening of channel, channelization, embankments, spoil piles, constrictions, livestock

Channel Alteration	Conditional Category					NOTES>>	CI
	Negligible	Minor	Moderate		Severe		
	Channelization, dredging, alteration, or hardening absent. Stream has an unaltered pattern or has naturalized.	Less than 20% of the stream reach is disrupted by any of the channel alterations listed in the parameter guidelines.	20-40% of the stream reach is disrupted by any of the channel alterations listed in the parameter guidelines.	40 - 60% of reach is disrupted by any of the channel alterations listed in the parameter guidelines. If stream has been channelized, normal stable stream meander pattern has not recovered.	60 - 80% of reach is disrupted by any of the channel alterations listed in the parameter guidelines. If stream has been channelized, normal stable stream meander pattern has not recovered.	Greater than 80% of reach is disrupted by any of the channel alterations listed in the parameter guidelines AND/OR 80% of banks shored with gabion, riprap, or cement.	
Scores	1.5	1.3	1.1	0.9	0.7	0.5	1.50

REACH CONDITION INDEX and STREAM CONDITION UNITS FOR THIS REACH

NOTE: The CIs and RCI should be rounded to 2 decimal places. The CR should be rounded to a whole number.

THE REACH CONDITION INDEX (RCI) >>	1.13
RCI= (Sum of all CI's)/5, except if stream is ephemeral RCI = (Riparian CI/2)	
COMPENSATION REQUIREMENT (CR) >>	23




CR = RCI X L_i X IF

INSERT PHOTOS:




DESCRIBE PROPOSED IMPACT:

PROVIDED UNDER SEPARATE COVER

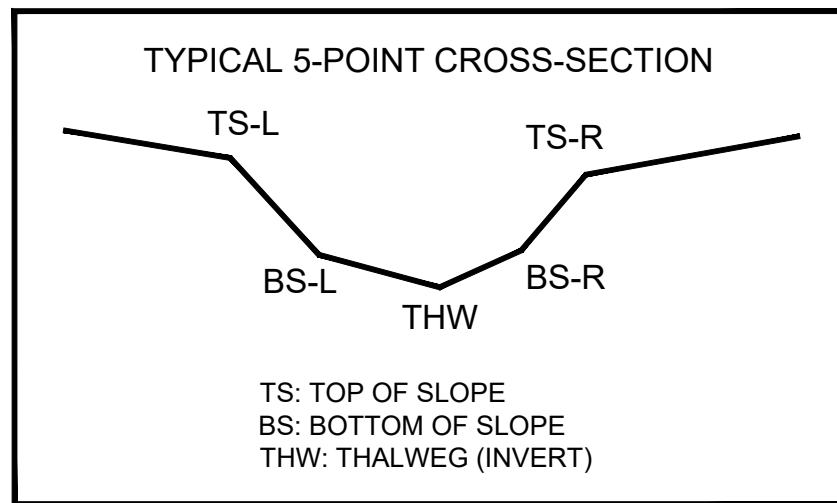
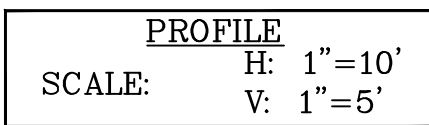
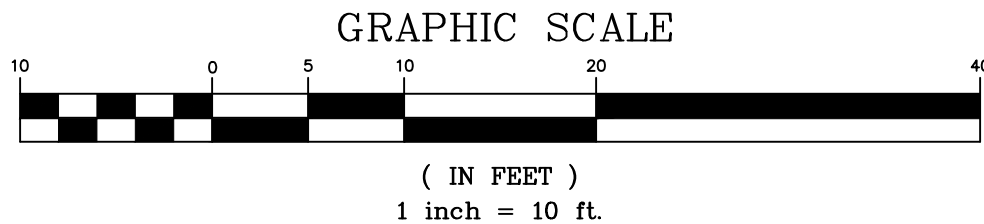


CL STAKEOUT POINTS: 5-H25 CROSS SECTION B (PIPE CL)					
PT. LOC.	PRE-CROSSING			POST-CROSSING	
	NORTHING	EASTING	ELEV	VERT. DIFF.	HORZ. DIFF.
TS-L	13429436.82	2025231.96	843.98	----	----
BS-L	13429439.24	2025225.00	841.38	----	----
THW	13429439.74	2025233.98	840.80	----	----
BS-R	13429440.26	2025222.41	841.68	----	----
TS-R	13429443.97	2025212.54	844.93	----	----

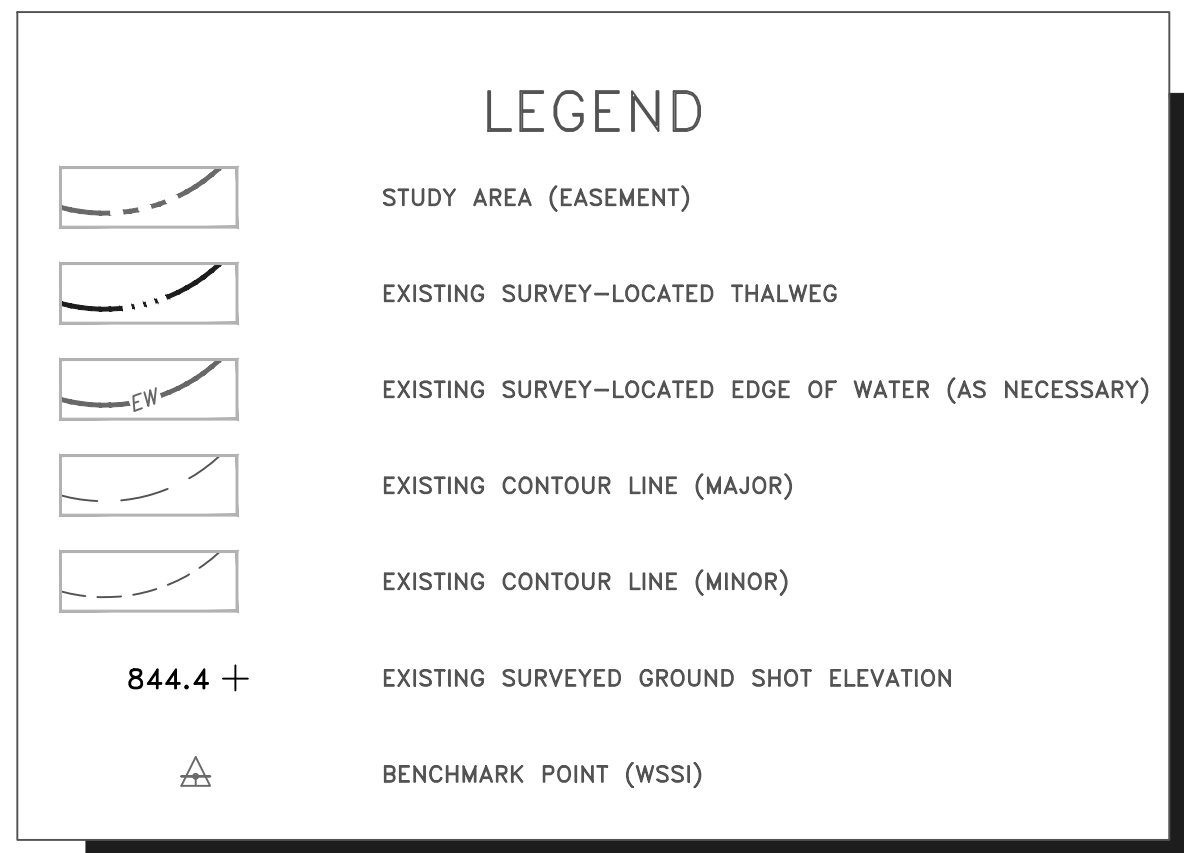


SURVEY NOTES:

1. This map has been oriented to NAD 1983 UTM Zone 17N, and vertically to The North American Vertical Datum of 1988 (NAVD 88), using a Real Time Network (RTN) GPS. Field locations were completed on December 3, 2018.
2. Monumentation, including traverse stations and fly points, shown on this drawing should be used to orient any future boundary, topographic, or location survey.
3. Easement lines shown on plan view were provided by Mountain Valley Pipeline (MVP).
4. WSSI Contour Interval = 2.0'. Contours within the channel were interpolated using stream channel breaklines (i.e. top of slopes, toe of slopes, thalweg) and cross-sectional points. Contours outside the channel were interpolated using cross-sectional spot shots.
5. All section views shown are left to right facing downstream.
6. Cross-section B shot at location of pipe centerline (based on best professional judgement).

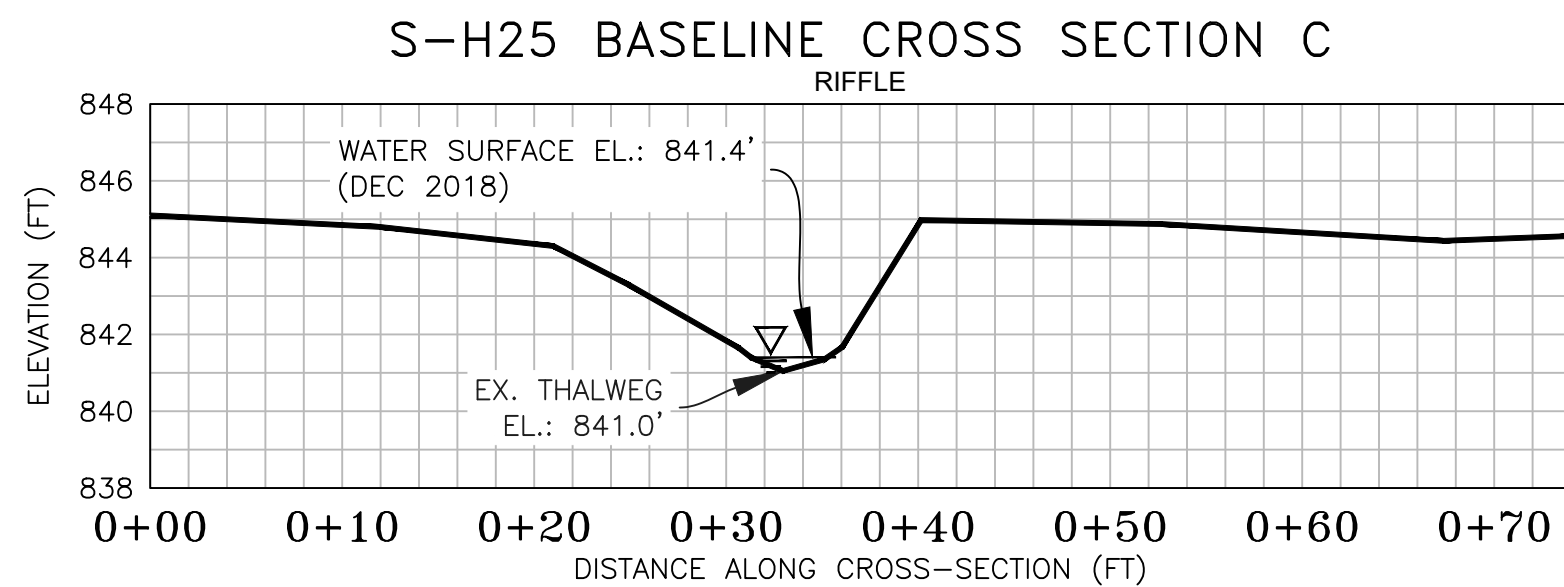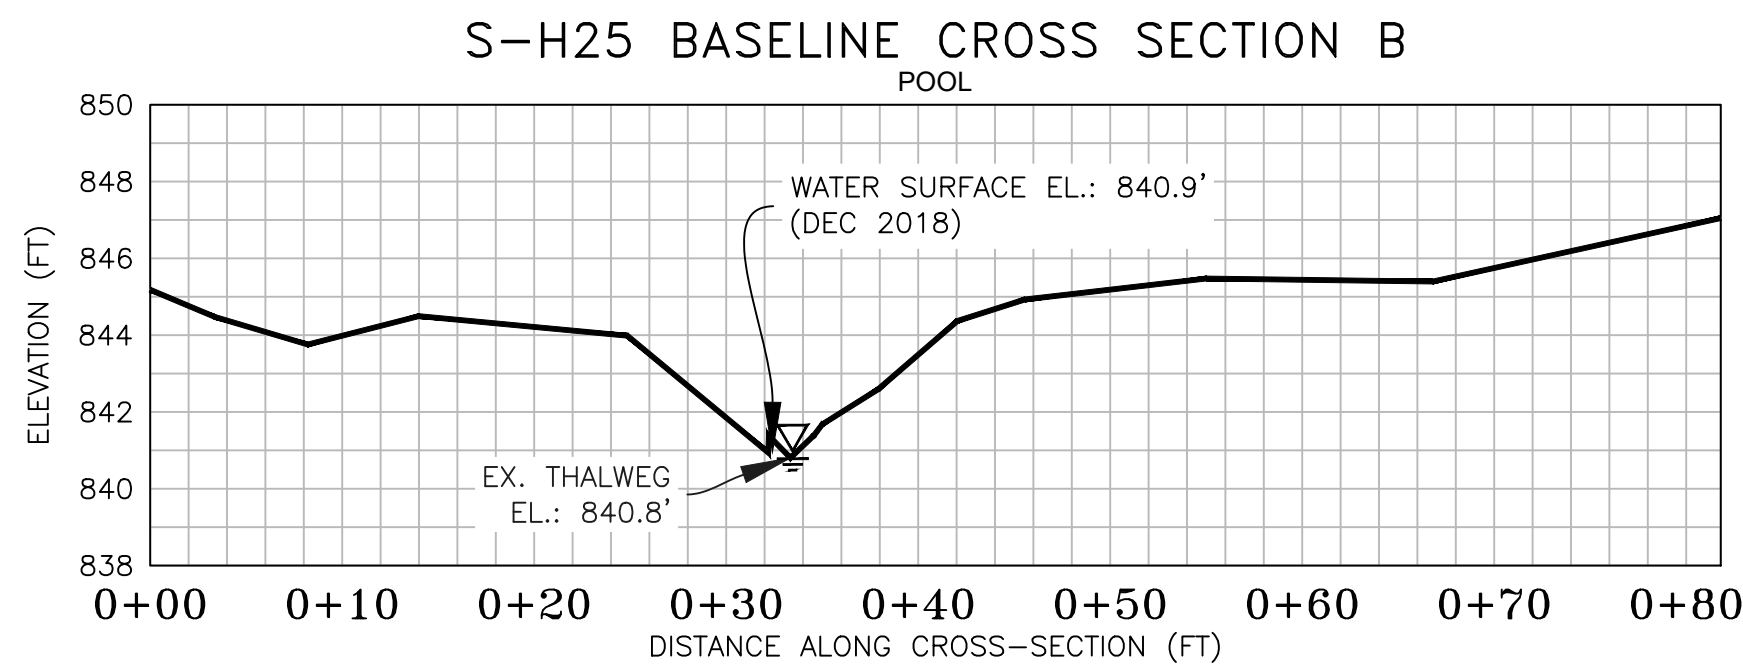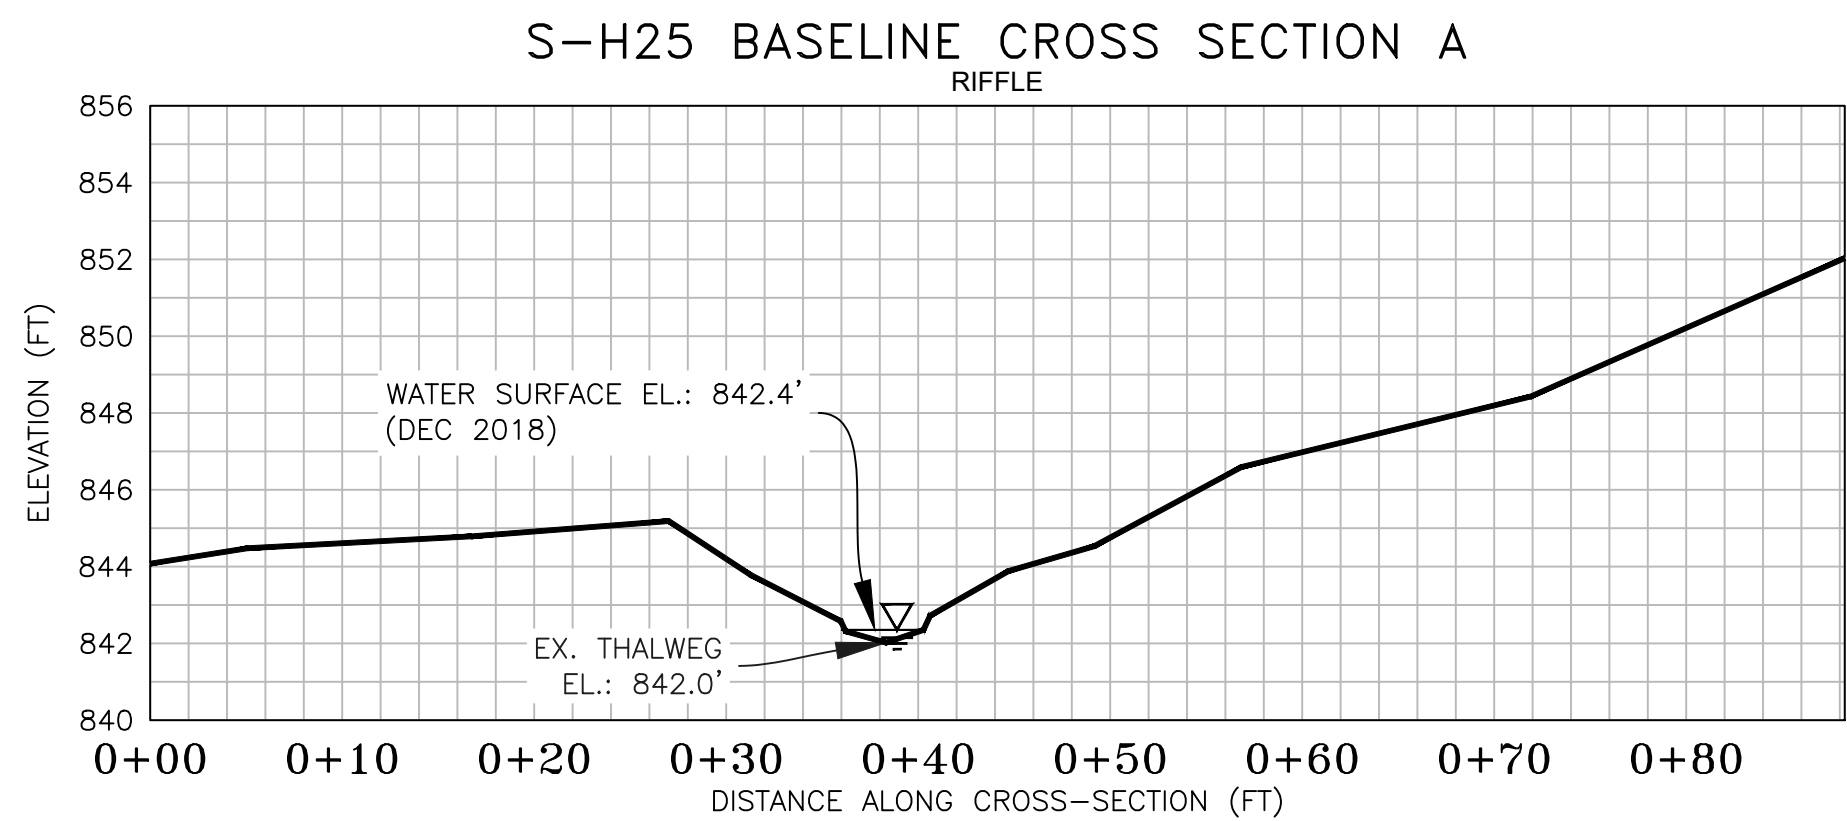

NOTE: ALL SECTION VIEWS SHOWN LEFT TO RIGHT FACING DOWNSTREAM.

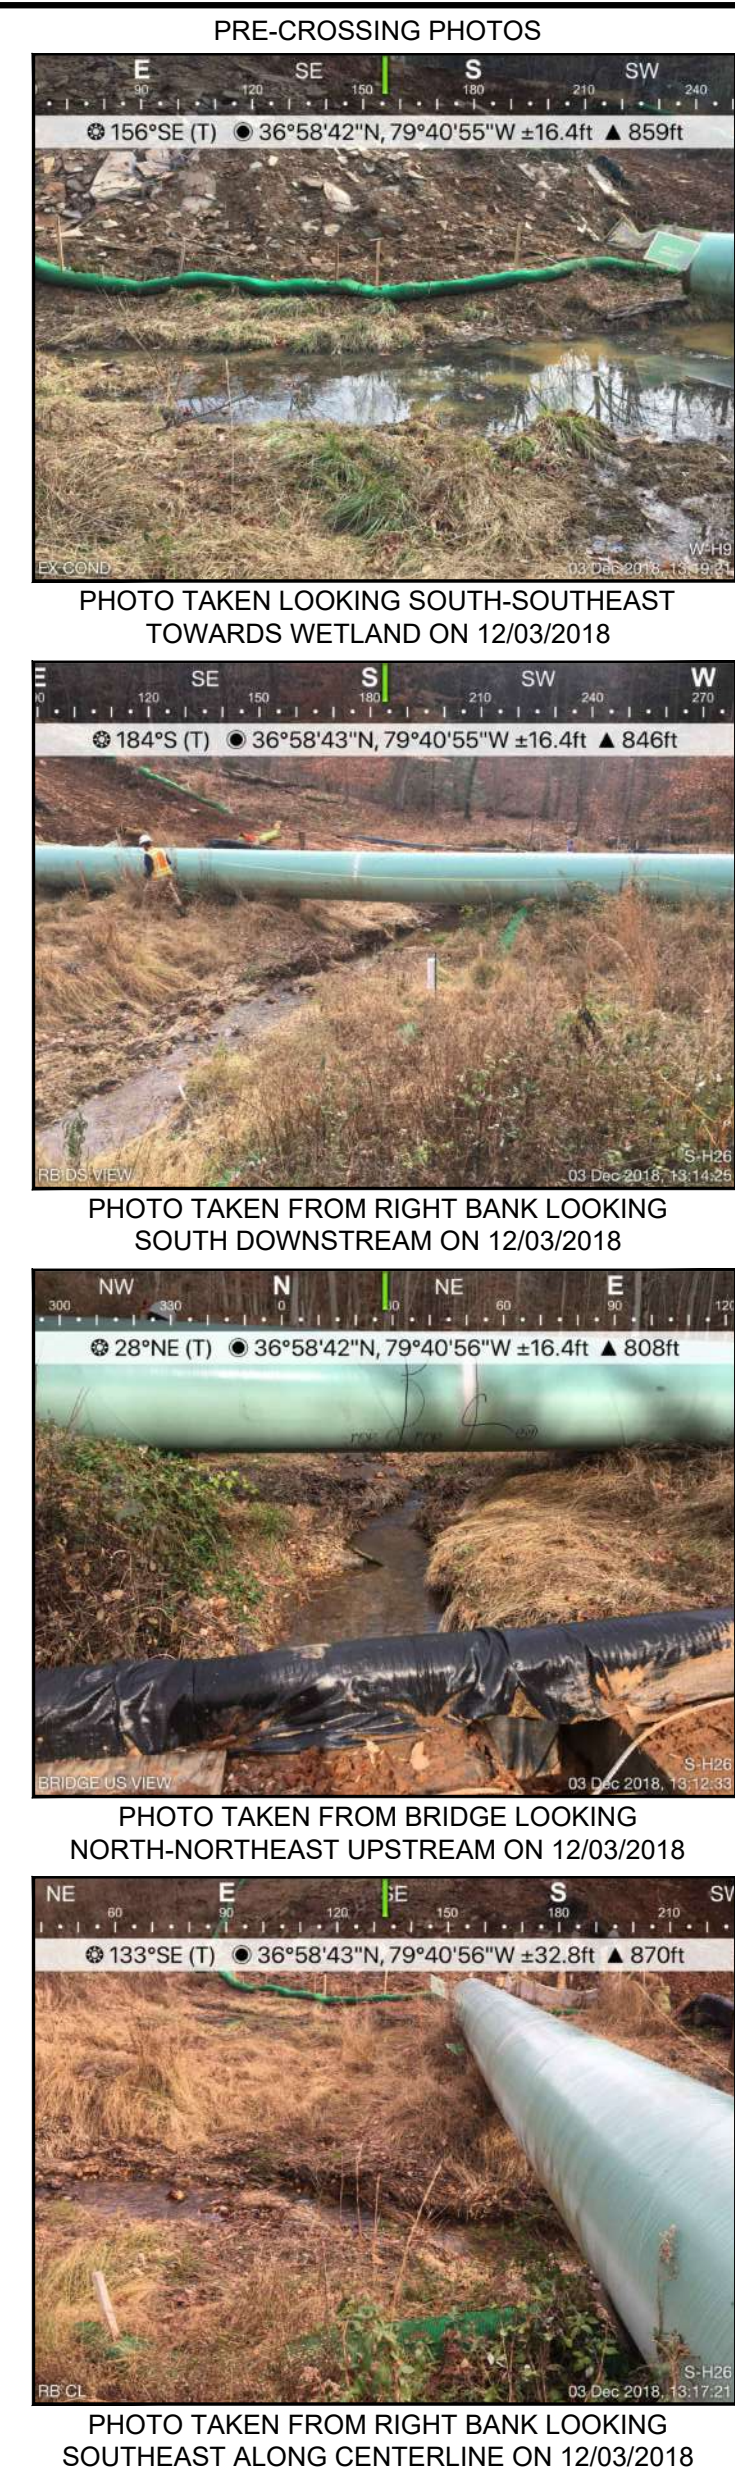

POST-CROSSING PHOTOS

PENDING CROSSING

PHOTO TAKEN LOOKING

PENDING CROSSING

PHOTO TAKEN LOOKING

PENDING CROSSING

PHOTO TAKEN LOOKING

Profile and Cross-Sections Baseline Survey

Prepared For: MVP

Crossing S-H25 & W-H9 -- Little Jacks Creek (MP 279.6)

Franklin County, Virginia
Copyright © 2021 Wetland Studies and Solutions, Inc.

REVISIONS			
No.	Date	Description	Rev. By
DATE: September, 2021		SCALE: AS NOTED	

Horizontal Datum: NAD 1983 UTM ZONE 17N

Vertical Datum: NAVD 88

Boundary and Topo Source:

MVP

Design	Draft	Approved
EJC	JSF	PFS

Sheet #
1 of 1

Computer File Name:
L:\Survey\22000\22800\22865.03\Spread 1 Work Days
22865_03 S-I MP 279-291 Sheets.dwg