WA
Wootton Automotive Ltd


WA Vehicle Inspection Report Ver. 1.1 Jan25

Veh. Ref. No.	TYG013

Due Diligence

Report Date	19/11/2026	Inspected By	RONAK	Supervisor	RONAK
Y.O.M	2014	Make & Model	TOYOTA FORTUNER	Model Code	1KD
Reg. No. (if appl.)	KBY 312V	VIN Number	AHTY25G20826013	Engine No.	1KD-A803614
Mileage (Km)	224,211km	Mileage Verified	✓	Use Country	KENYA
Logbook Ver. (If appl).	✓	Previous Owners	3	Priv. / comm	—
Spare Tyre, Jack, Tools	✓ / ✓ ✓	Original Handbook	—	Spare Key	TBC
Service History Ver.	PARTIAL	Last Service (Km)	218, 239km	Next Service (Km)	223,239km - Due

Body/Exterior Inspection

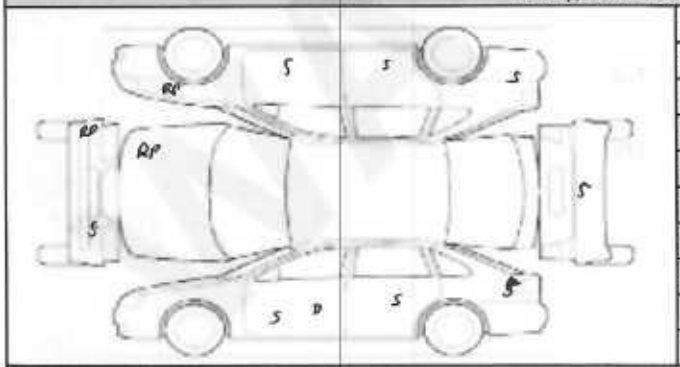

D = Dent	General Comments: REPAINTED PANELS SCRATCHES & DENTS VISIBLE ACCIDENT REPAIR
S = Scratch	
M = Missing Trim	
RP = Repainted	
SR = Surface Rust	Structural & Underbody Comments: MINOR SURFACE RUST FRONT SUMP GUARD DAMAGED / DENTED
R = Moderate Rust	
CR = Corrosion	
C = Crack / Chip	

Exterior Grade (%)	70%
Structural & Underbody Grade (%)	75%

Interior Inspection

Upholstery	COMMENTS	Dash & Plastics	COMMENTS	Smoked In	NO
Seats Fuct. (inc belts)	✓	Floor Mats	✓	**Interior Grade (%)**	70%

Comments: SCRATCHES ON DASH & PLASTICS, WEAR & TEAR ON UPHOLSTERY

Mechanical Inspection

Exterior Lights	COMMENTS	Wipers	✓	Tyre Tread Depth	COMMENTS / 40%
Elec. Interior Equip.	✓	Infotainment	✓	HVAC System	✓
Eng. Ancillary Cpnts.	✓	Eng. Blowby	ACCEPTABLE	Eng. Oil Leaks	NO
Cooling System Test	✓	Heat Exchangers	✓	Other leaks	NO
Fuses & relays	✓	Fluids	✓	Exhaust System	✓
Shocks & Springs	✓	Sus. Bushings	COMMENTS	Boots & Shafts	✓
Ball Joints / Tie Rods	✓	Column & Rack	✓	Hubs & W.Brgs	✓
Rubber Mountings	✓	Brake Pads (F/R)	50% / —	Brake Discs (F/R)	60% / —
Comments: NEW REAR SHOCKS				Modifications	Y / (N)
				Mech Grade (%)	

Road Test Report

Engine Start Up	✓	Braking	✓	NVH	COMMENTS
Engine Perf. & Acc.	✓	Gear Shifting	✓	Warning Lights	—
4WD / L. Range	✓ / ✓	Diff Locks(s)	REAR ✓	Steering Feedback	✓

Comments: .

Recommended Repairs and/or Final Comments

SPARE TYRE WORN
REAR PANHARD ROD BUSHES WORN
REAR PARKING BRAKE REQUIRES ADJUSTMENT / LININGS / DRUMS
ALARM NOT WORKING
RHS HEADLIGHT REPLACED

Vibration from gearbox / drivetrain especially in reverse
HEADLIGHT WASHERS DONT WORK
LHS LOW BEAM BULB - REPLACE (FLICKERING)

WA Final Assessment / %

Practically As-new/	Excellent /	Good. /	Fair / 75%	Needs Work /	WA Warranty
					—