

June 16, 2026 Primary Election



Access the Vote

VOTING ACCESSIBILITY IN THE DISTRICT OF COLUMBIA
DURING THE JUNE 16, 2026 PRIMARY ELECTION

DISABILITY RIGHTS DC AT UNIVERSITY LEGAL SERVICES
220 I STREET NE, SUITE 130, WASHINGTON, DC 20002 | PHONE: 202-547-0198

INTRODUCTION

Disability Rights DC at University Legal Services (DRDC) is the Protection & Advocacy (P&A) organization for the District of Columbia. We are federally-mandated to represent people with disabilities and ensure their access to facilities, services, and programs in DC. The Help America Vote Act of 2002 (HAVA) charged P&A organizations throughout the nation, including DRDC, to “ensure full participation in the electoral process for individuals with disabilities, including registering to vote, casting a vote and accessing polling places.” 52 U.S.C. § 21061. As a result of a settlement agreement in *American Association of People with Disabilities v. District of Columbia*, DC agreed to make all polling places accessible to persons with disabilities by the 2004 Presidential Primary.

Since 2004, DRDC has surveyed polling places during Presidential and DC major elections and reported on the results of those surveys to the DC Board of Elections (BOE) and the public to promote 100% voting accessibility for DC voters with disabilities.¹ In addition to conducting surveys and

¹ See, e.g., DRDC, Access the Vote: Voting Accessibility During the July 15, 2025 Special Election (2025), ([2025 Special Election Report](#)); DRDC, DC Voting Access Report: Voting Accessibility During the June 4, 2024 Primary Election (2024), ([2024 Primary Election Report](#)); DRDC, DC Voting Access Report on the November 8, 2022 General Election (2022), ([2022 General Election Report](#)); DRDC, DC Voting Access Report on the June 21, 2022 Primary Election (2022) ([2022 Primary Election Report](#)); DRDC, DC Voting Access Report on the November 3, 2020 General Election (2020) ([2020 General Election Report](#)); DRDC, DC Voting Access Report on the June 2, 2020 Primary Election (2020) ([2020 Primary Election Report](#)); DRDC, DC Voting Access Report on the June 19, 2018 Primary Election (2018) ([2018 Primary Election Report](#)); DRDC, DC Voting Access Report on the June 14, 2016 Presidential Primary Election (2016) ([2016 Primary Election Report](#)); DRDC, DC Voting Access: The November 4, 2014 Mayoral Election (2014) (on file with DRDC); DRDC, DC Voting Access: The April 1, 2014 Mayoral Primary (2014) (on file with DRDC); DRDC, DC Voting Access: The April 23, 2013 Special Election (2013) (on file with DRDC); DRDC, DC Voting Access: The November 6, 2012 Presidential Election (2012) (on file with DRDC); DRDC, DC Voting Access: Behind Closed Doors, The April 3, 2012 Presidential Primary (2012) (on file with DRDC); DRDC, DC Voting Access during the April 26, 2011 Special Election (2011) (on file with DRDC); DRDC, No Parity at the Polls: Four Years Later, Accessibility Survey for the February 12, 2008 Presidential Primary Election (2008) (on file with DRDC).

producing reports, DRDC meets and works with BOE officials, testifies before the DC Council about voter accessibility issues, and assists with accessibility training for election day workers and surveyors. For over 20 years, DRDC has provided BOE a checklist to help poll workers ensure vote center accessibility. DRDC's accessibility checklist was adopted as a national model by the former national disability voting rights organization, Project Vote. DRDC also advocates to resolve accessibility barriers during early voting and on Election Day and recommends solutions to BOE and poll workers.

This report analyzes the accessibility of vote centers and ballot drop boxes utilized during early voting and on Election Day for the June 16, 2026 Primary Election and identifies issues that hindered access by voters with disabilities to enter voting areas and cast their ballots. It is authored by Elizabeth Myerholtz (DRDC Staff Attorney) and Grace Wurzer (DRDC Law Clerk).

ACKNOWLEDGEMENTS

DRDC thanks the individuals who graciously volunteered their time to survey DC's vote centers and ballot drop boxes during early voting and on Election Day. DRDC could not have completed the surveys without the assistance of our 20 volunteers who donated their time by traveling to vote centers and drop box locations and conducting accessibility surveys.

SURVEY METHODOLOGY

DRDC's surveyors evaluated vote centers and ballot drop boxes throughout the District for accessibility, consistent with the requirements of the Americans with Disabilities Act and the U.S. Department of Justice's 2010 ADA Standards for Accessible Design.² Based on the results of the surveys,

² 42 U.S.C. § 12130 *et seq.*; 28 C.F.R. Part 35 *et seq.*; U.S. Dep't of Just., 2010 ADA Standards for Accessible Design, available at <https://www.ada.gov/law-and-regs/design-standards/2010-stds/#2010-standards-for-state-and-local-government-facilities-title-ii> (last visited Sep. 2, 2026); U.S. Dep't of Just., ADA Checklist for Polling Places, available at <https://www.ada.gov/resources/polling-places-checklist/> (last visited Sep. 2, 2026).

vote centers and ballot drop boxes found to be out of compliance with these requirements are labelled as either structurally inaccessible or operationally inaccessible (or in some cases, both structurally and operationally inaccessible). Vote centers and ballot drop boxes are labelled **structurally inaccessible** if voters with disabilities could not independently³ get to the voting area or vote due to issues that BOE staff or poll workers *could not* have remedied (e.g., stairs, ramps that did not comply with ADA requirements, broken elevators, and/or narrow doorways). Vote centers and ballot drop boxes are labelled **operationally inaccessible** if voters with disabilities could not get to the voting area or vote due to issues that BOE staff or poll workers *could* have remedied (e.g., impermanent barriers in the path to the drop box or vote center's accessible entrance that were not removed, incorrect or missing signage, and/or for vote centers with no available assistive equipment).

³ In addition to the standard definition of "independent," as used in this report, the term encompasses whether a voter can reach a doorbell or automatic door opener without assistance, and/or enter the voting area by virtue of responsive vote center staff or automatic door activation.

RESULTS OF ACCESSIBILITY SURVEYS

During the June 16, 2026 Primary Election cycle, DRDC volunteers surveyed all 75 vote centers designated by BOE (100% of the total). **60% (45/75) of the vote centers surveyed were found to be structurally inaccessible, operationally inaccessible, or both structurally and operationally inaccessible.** Specifically, 14.67% of all vote centers surveyed were structurally inaccessible (11/75), 54.67% of all vote centers surveyed were operationally inaccessible (41/75), and 10.67% of all vote centers surveyed were both structurally and operationally inaccessible (8/75). This is similar to the most recent District-wide election, the 2024 General Election, where 61.64% of all vote centers surveyed were structurally inaccessible, operationally inaccessible, or both.

There is a detailed analysis of reasons vote centers were found inaccessible and recommendations to increase accessibility beginning on page 14 of this report. For a complete list of inaccessible vote centers, see Appendix B.

The following are the criteria DRDC used to analyze accessibility at the vote centers, including data of the vote centers that were found inaccessible under each criteria. Complete lists of the vote centers found to be inaccessible under each criteria can be found in Appendix C.

BARRIERS IN VOTE CENTER PARKING AREAS

Lack of Designated Accessible Parking Spaces – Operationally Inaccessible

DRDC documented 10 vote centers (13.33% of all vote centers) that failed to provide accessible parking. (Appendix C, Table 2). A vote center was considered operationally inaccessible due to providing insufficient accessible parking if it had less than 2 designated accessible parking spaces, either in the parking lot or the street parking area, or if it failed to provide

signage designating accessible parking spaces.⁴ Of these 10 vote centers, 4 were early vote centers (16% of all early vote centers) and 6 were election day vote centers (12% of all election day vote centers). This is a decrease in the percentage of vote centers lacking accessible parking during the 2024 General Election, where 20.55% of surveyed vote centers failed to provide accessible parking. DRDC applauds BOE's efforts to generate a significant drop in parking accessibility issues.

Lack of Accessible Route from Parking Area to Vote Center Entrance – Structurally or Operationally Inaccessible

DRDC documented 18 vote centers (24% of all vote centers) that failed to provide an accessible route from the parking area to the vote center entrance. (Appendix C, Table 3). 6 of these vote centers were early vote centers (24% of all early vote centers) and 12 were election day vote centers (24% of all election day vote centers). This is significantly more than the percentage of vote centers lacking accessible parking during the 2024 General Election, where 4.11% of all vote centers failed to provide an accessible route from the parking area to the vote center entrance and is also an increase from the 2024 Primary Election, where 14.67% of all vote centers failed to provide an accessible route from the parking area to the vote center entrance.

Missing and/or Misplaced Signage – Operationally Inaccessible

DRDC documented 11 vote centers (14.67% of all total vote centers) that failed to appropriately place adequate signage. (Appendix C, Table 4). Of these 11 vote centers, 4 were early vote centers (16% of all early vote centers) and 7 were election day vote centers (14% of all election day vote

⁴ Reserving street spaces right outside the accessible entrance and near a curb cut is essential to ensure voters with mobility devices can travel from the parking space to the vote center entrance without issue. These spaces should provide sufficient space for vehicles with wheelchair lifts to set out vehicle ramps (side or rear). In cases where a curb cut was not near the accessible entrance, the BOE should provide a temporary ramp next to the parking space and entrance or provide an accessible passenger drop off area to remedy this barrier.

centers). This is similar to the 2024 General Election, where 17.8 % of all total vote centers had inadequate or misplaced signage and is a decrease from the 2024 Primary Election, where 37.33% of surveyed vote centers had inadequate and/or misplaced signage.

Unstaffed Curbside Voting – Operationally Inaccessible

DRDC documented 6 vote centers (8% of all vote centers) that offered curbside voting but failed to staff the curbside voting area.

(Appendix C, Table 5). Of these 6 total vote centers, 2 were early vote centers (8% of all early vote centers surveyed) and 4 were election day vote centers (8% of all election day vote centers surveyed). This is similar to the 2024 General Election, where 10.96% of all vote centers surveyed failed to properly staff the curbside voting area.

BARRIERS TO ACCESSING THE VOTING AREA

DRDC documented 29 total vote centers (38.67% of all vote centers) that had barriers that made it difficult or impossible for people with disabilities to travel from the parking area to the voting area inside the vote centers. This is a slight increase from the 2024 General Election, where 32.88% of all vote centers surveyed presented accessibility barriers from the parking lot to the voting area. Common, recurring accessibility issues were found, from obstacles and abrupt rises in the accessible path to inaccessible elevators and ramps.

Inaccessible Ramp – Structurally Inaccessible

DRDC documented 4 total vote centers (5.33% of all vote centers) that had an inaccessible ramp. (Appendix C, Table 11). 1 of these was an early vote center (4% of all early vote centers) and 3 were election day vote centers (6% of all election day vote centers). This is similar to the 2024 General Election, where 5 total vote centers (6.85% of all vote centers surveyed) had an inaccessible ramp.

Narrow Doorways – Structurally and/or Operationally Inaccessible

DRDC documented 7 vote centers (9.33% of all vote centers) that had doorways that were narrower than 32 inches wide. (Appendix C, Table 9). 4 of these vote centers were early vote centers (16% of all early vote centers) and 3 were election day vote centers (6% of all election day vote centers). Sometimes this issue may be remedied by opening a second door in a set of double doors, but in other circumstances, doorways may simply be constructed too narrowly or have obstructions preventing the door from opening wider. These numbers are an increase from the 2024 General Election, where only 1 vote center surveyed presented a narrow doorway.

Obstructed Paths to the Voting Area – Structurally and/or Operationally Inaccessible

DRDC documented 7 total vote centers (9.33% of all vote centers) that had obstructions in the pathway along the route from the parking area to the main voting area. (Appendix C, Table 6). Of these 7 total vote centers, 4 were early vote centers (16% of all early vote centers) and 3 were election day vote centers (6% of all election day vote centers). This is similar to the 2024 General Election, where 10.96% of all vote centers surveyed were inaccessible due to obstructions in the pathway to the voting area.

Abrupt Rise – Structurally and/or Operationally Inaccessible

DRDC documented 8 total vote centers (10.67% of all vote centers) that had an abrupt rise over ½ inch tall in the pathway to the voting area. (Appendix C, Table 7). 2 of these vote centers were early vote centers (8% of all early vote centers) and 6 were election day vote centers (12% of all election day vote centers). This is similar to the 2024 General Election, where 9.59% of all vote centers surveyed had an abrupt rise.

Closed Doors, Lack of Backup System – Operationally Inaccessible

DRDC documented 6 total vote centers (8% of all vote centers) that had closed doors and lacked any sort of backup system (i.e., poll worker stationed at the door, working doorbell, working automatic door opener),

rendering the vote center operationally inaccessible. (Appendix C, Table 8). 3 were early vote centers (12% of all early vote centers) and 3 were election day vote centers (6% of all election day vote centers). This is a significant increase from the 2024 General Election, where 2.74% of all vote centers surveyed had closed, heavy doors without a working backup system. DRDC urges BOE to ensure that doors are propped open at election day and early vote centers.

Loose Mats – Operationally Inaccessible

DRDC documented 6 vote centers (8% of all vote centers) that had loose mats that presented an obstacle for individuals with mobility disabilities. (Appendix C, Table 10). 1 of these was an early vote center (4% of all early vote centers) and 5 were election day vote centers (10% of all election day vote centers). This is a significant increase from the 2024 General Election, where only 1 vote center (1.37% of all vote centers surveyed) had a loose mat.

Inaccessible Elevators – Operationally Inaccessible⁵

DRDC documented 7 total vote centers (9.33% of all vote centers) that lacked an accessible elevator. (Appendix C, Table 12). These elevators were inaccessible for various reasons, including that they were too narrow, they lacked Braille indicators, or they lacked audible floor indicators. 3 of these vote centers were early vote centers (12% of all early vote centers) and 4 were election day vote centers (8% of all election day vote centers). This is an increase from the 2024 General Election, where only 4 total vote centers required the use of an inaccessible elevator.

⁵ DRDC considers this to be an operational accessibility issue because often, there are other areas at the vote center that could serve as the voting area or alternative entrances that could be identified that do not require the use of an elevator.

BARRIERS TO VOTING IN THE VOTING AREA

Lack of Assistive Technology – Operationally Inaccessible

DRDC documented 4 total vote centers (5.33% of all vote centers surveyed) that failed to have an audio headset readily available for voters with disabilities. (Appendix C, Table 13). 1 of these vote centers was an early vote center (4% of all early vote centers) and 3 were election day vote centers (6% of all election day vote centers). DRDC also surveyed to ensure that vote centers had magnifying glasses readily available for voters with disabilities. Fortunately, all vote centers had magnifying glasses available. This is a significant decrease from the 2024 General Election, where 10.96% of all vote centers surveyed failed to have either an audio headset, magnifying glasses, or both readily available for voters with disabilities.

Lack of Clear Floor Space for Voters Using Wheelchairs – Operationally Inaccessible

DRDC documented 3 total vote centers (4% of all vote centers) that had less than five feet of turning radius available at electronic ballot marking devices, presenting a barrier for voters using wheelchairs. (Appendix C, Table 14). 1 of these vote centers was an early vote center (4% of all early vote centers) and 2 were election day vote centers (4% of all election day vote centers). This is similar to the 2024 General Election, where 4.11% of all vote centers surveyed lacked five feet of turning space in front of the electronic ballot marking devices and is also similar to the 2024 Primary Election, where 5.33% of all vote centers lacked the requisite clear floor space.

Lack of Privacy at Electronic Ballot Marking Devices⁶

DRDC documented 3 total vote centers (4% of all vote centers surveyed) that lacked privacy at the electronic ballot marking devices.

⁶ DRDC does not consider a vote center to be inaccessible if there is a lack of privacy at the electronic ballot marking devices, however we believe it is important to note as HAVA guarantees the right to a private vote.

(Appendix C, Table 15). 2 of these vote centers were early vote centers (8% of all early vote centers) and 1 was an election day vote center (2% of all election day vote centers). This is a significant decrease from the 2024 General Election, where 10.96% of all vote centers surveyed lacked privacy at the electronic ballot marking devices, and continues the downward trend from the 2024 Primary Election, where 25.33% of vote centers failed to ensure privacy. DRDC applauds BOE for taking steps to uphold the right to a private vote for all voters.

VOTE BY MAIL

During the Primary Election, DRDC successfully surveyed all 55 (100%) BOE ballot drop boxes. (Appendix D). **9 of the 55 ballot drop boxes (16.36%) were either structurally inaccessible or operationally inaccessible, or both.** (Appendix E). Similar to the vote centers, ballot drop boxes were marked as structurally inaccessible if voters with disabilities could not access the ballot drop box due to issues that BOE staff could not have remedied and were marked as operationally inaccessible if voters with disabilities could not access the ballot drop box due to issues that BOE staff could have remedied. 4 of the ballot drop boxes (7.27%) were structurally inaccessible and 7 (12.72%) were operationally inaccessible. This is a decrease from the 2024 General Election, where 24.07% of ballot drop boxes surveyed were either structurally inaccessible, operationally inaccessible, or both. DRDC appreciates the efforts BOE has taken to increase ballot drop box accessibility in this election. For breakdowns of ballot drop boxes by reason of inaccessibility, see Appendix F.

VOTING AT THE DC JAIL AND THE CENTRAL TREATMENT FACILITY

The District restored the vote to all qualified DC residents, regardless of criminal conviction, in 2021. D.C. Law 23-277. In 2022, the DC Council passed the Elections Modernization Amendment Act, which requires that the District operate a vote center for District residents incarcerated in the DC Department of Corrections' (DOC) care and custody at the Central Detention Facility (CDF)

and Correctional Treatment Facility (CTF). To advance that promise, BOE partnered with the DOC to implement vote centers at CDF and CTF. DRDC applauds BOE's efforts to ensure that all DC residents who want to vote are able to exercise that right.

DRDC staff surveyed the vote centers at CDF and CTF on June 9, 2026. At CDF, DRDC's surveyor noted that the electronic ballot marking device was not positioned to allow the requisite 5-foot turning radius for voters using wheelchairs. This was fixed upon request.

During the day of the 2024 General Election, DRDC staff received concerning reports from residents at CDF's men's Mental Health Unit during a regular monitoring visit. The residents reported that they had never been offered the chance to vote at CDF's vote center and that no one came to the unit during the days of voting at CDF to take people to vote. Prior to the 2026 Primary Election, DRDC renewed its recommendation that DOC and BOE ensure all eligible individuals in its care and custody are offered an opportunity to vote. In response to our recommendation, DOC and BOE reported that during the three-day election period BOE staff, accompanied by DOC staff, visited each Special Management Unit (SMU) at both CTF and CDF, including the 29 residents on the mental health unit at CDF on South 3, to either collect mail-in ballots or print the ballots for those voters whose mail-in ballot was sent to their home address. According to the DOC and BOE, same day registration was also made available (9 of 29 residents were already registered).

BOE'S RESPONSE TO DRDC'S RECOMMENDATIONS

DRDC staff consistently work to bring any prevalent voting barriers identified by voters with disabilities to BOE staff. In January 2026, DRDC submitted comments on BOE's proposed vote center locations to be used for the Primary Election. DRDC's comments noted several vote centers that had been deemed structurally inaccessible during previous election cycles and urged BOE to remedy structural issues prior to the Primary Election. DRDC subsequently met with BOE leadership to discuss our comments further and

offered to conduct site visits with BOE at the locations identified in our comments or at potential new vote center sites to address accessibility barriers ahead of the Primary Election cycle.⁷

Prior to the 2026 Primary Election, DRDC conducted a training for BOE staff, including for individuals who train BOE's site coordinators. This training went over DRDC's survey used to assess accessibility during the election and included several photo examples of issues we've documented in past elections. DRDC presented suggestions of how to remedy common accessibility barriers and answered BOE staff's questions regarding accessibility concerns.

During early voting and on Election Day, DRDC staff and volunteers made on-the-spot recommendations to poll workers and BOE staff with the goal of immediately resolving accessibility barriers. These efforts and BOE's responses are noted for each vote center below. BOE poll workers and staff at least partially responded to DRDC's recommendations to correct accessibility barriers at 25 vote centers.

The next section details each of the vote centers and ballot drop boxes found to be structurally and/or operationally inaccessible, along with specific recommendations for improved accessibility. DRDC has also provided recommendations to improve vote centers that were not found to be inaccessible but still presented accessibility concerns.

⁷ Though no vote centers were relocated as a result of DRDC's comments, BOE did incorporate some of DRDC's suggestions. For example, DRDC urged that BOE relocate the Powell Elementary vote center, or in the alternative, that BOE "identify an alternative, accessible entrance complete with accessible parking and an accessible pathway from the parking area," which BOE did for this election. Additionally, DRDC reiterated our suggestion from several prior reports that BOE move the drop box at Benning (Dorothy I. Height) Library from the back parking lot of the Library to the front of the building so it would be accessible 24 hours a day. DRDC was pleased to see that BOE implemented this suggestion for the June 2026 Primary Election.

INACCESSIBLE VOTE CENTERS

I. INACCESSIBLE ELECTION DAY VOTE CENTERS

Columbia Heights Education Campus – 3101 16th Street, NW

This vote center was ***operationally inaccessible*** due to issues with parking. Due to construction in the surrounding area, the street parking utilized for the vote center was inaccessible. Voters had to walk in the street in traffic to reach the end of the block to access the curb cut, or else traverse the abrupt rise of the curb cut. DRDC's surveyor requested that the site coordinator contact BOE to request a temporary ramp to place next to the designated accessible parking to remedy this issue.

Additionally, the electronic ballot marking devices were not arranged in a way that protected voters' privacy. Though DRDC's surveyor suggested that the site coordinator change the direction of the machines, the site coordinator refused.

Recommendations: Designate accessible parking close to a curb cut (or a ramp) and away from construction. Ensure the route to the vote center entrance is free from abrupt rises and obstacles. Ensure electronic ballot marking devices are placed to protect voters' privacy.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	Abrupt rise (street parking without curb cut).
November 8, 2022 General Election	Abrupt rise (curbside voting being used as parking not near curb cut).

Marie Reed Elementary School – 2201 18th Street, NW

The doors at this vote center were unpropped, though there was a working automatic door opener, making the entrance accessible.

Recommendation: Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 21, 2022 Primary Election	Unpropped doors.
November 3, 2020 General Election	Unpropped doors.
June 19, 2018 Primary Election	Closed, heavy doors without working backup system. Broken or no doorbell.
April 1, 2014 Primary Election	Inoperable doorbell.

H.D. Cooke Elementary School – 2525 17th Street, NW

This vote center was **operationally inaccessible** due to signage issues. The vote center utilized a parking lot for accessible parking, but the location of the parking lot was unclear from the street and there was insufficient signage to indicate where voters should park. DRDC’s surveyor suggested to the site coordinator that they place additional signs to indicate the location of the accessible parking and the issue was remedied promptly.

Recommendation: Ensure signage indicating the location of the accessible parking is visible from the street.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 21, 2022 Primary Election	Inadequate signage.
--------------------------------	---------------------

Fifteenth Street Presbyterian Church – 1701 15th Street, NW

This vote center was both **structurally inaccessible** and **operationally inaccessible**. DRDC’s surveyor noted that several vote center volunteers expressed that they did not believe this site was accessible. Fifteenth Street Presbyterian Church was **structurally inaccessible** due to an abrupt rise of over half an inch caused by uneven pavement.

The vote center was **operationally inaccessible** for several reasons. First, there was loose gravel and uneven paving in the parking lot, which created obstructions for individuals with mobility disabilities. A volunteer told

DRDC's surveyor they witnessed a woman attempt to push a stroller through the parking lot and leave instead of voting because it was too difficult.

Second, the accessible route to access the voting area required the use of an inaccessible elevator. The elevator lacked controls marked in Braille, lacked audible floor indicators, and did not possess a doorway that was 36 inches wide. Because of the inaccessibility of the elevator, there was not a fully accessible route to the voting area for individuals with disabilities. BOE has been aware of the issues with this elevator for at least 14 years and has previously admitted that the elevator here does not conform to ADA requirements.⁸ Nevertheless, BOE still designated this location to be used as a vote center for the 2026 Primary Election.

Third, misplaced signage on the accessible entrance indicated that the main entrance, which was down a steep stairway, was the accessible entrance. The site coordinator fixed this upon DRDC's surveyor's request.

Additionally, the door which served as the accessible entrance was unpropped. There was a doorbell, but it was too high for a wheelchair user to use and did not work. DRDC's surveyor brought this up to the site coordinator, who expressed that the door could not be propped open. The site coordinator instead indicated that the staffer working the curbside voting would open the door for voters. When DRDC's surveyor asked the curbside voting attendant if she was responsible for opening the doors, she said that she would.

⁸ DC BOE, Oversight Responses FY22-23, Question 67 (p. 126), available at: [2023-Performance-Oversight-Responses-DC-BOE.pdf](#).



This photo, taken June 16, 2026, shows what was designated as the accessible entrance at Fifteenth Street Presbyterian Church. As shown in the picture, the closed, heavy doors had no doorbell or automatic door opener, nor was there a poll worker stationed at the door to open it for voters.

Recommendations: Ensure the route to the vote center entrance is free from abrupt rises and obstacles. Ensure that elevators are accessible to voters with disabilities. Ensure all signage is appropriately placed. Prop open heavy doors. ***Due to the longstanding structural issues at this site, DRDC urges BOE to relocate this vote center.***

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	Abrupt rise (uneven pavement). Inaccessible elevator.
June 4, 2024 Primary Election	Inaccessible elevator. Unpropped doors.
November 8, 2022 General Election	Abrupt rise (divots in pavement). Inaccessible elevator.
June 21, 2022 Primary Election	Pathway obstructions and uneven pavement. Inaccessible elevator.
June 14, 2016 Primary Election	Unpropped doors.
November 4, 2014 General Election	Inaccessible elevator. Unpropped doors.

April 1, 2014 Primary Election	Inaccessible elevator. Closed, heavy doors with no working backup system. Inoperable doorbell.
November 6, 2012 General Election	Inaccessible elevator.
April 3, 2012 Primary Election	Inaccessible elevator. Unpropped doors. Inoperable doorbell.

Janney Elementary School – 4130 Albemarle Street, NW

This vote center was **operationally inaccessible** due to a lack of accessible parking and obstructions in the pathway to the vote center entrance. Though BOE had designated accessible street parking, it was far from a curb cut. Additionally, there were permanent barriers surrounding the curb cut which meant that individuals had to enter the lane of traffic to maneuver around the barriers to access the curb cut. Therefore, there was no safe way for individuals to accessibly navigate from the street parking to the entrance. Instead, individuals had to traverse the abrupt rise of the curb to go from the parking area to the vote center entrance. The permanent barriers around the curb cut therefore rendered any designated parking inaccessible, presented an obstruction in the pathway from the parking area to the vote center entrance, resulting in a lack of an accessible route from the parking area to the vote center.

This photo, taken June 16, 2026, shows the barriers around the curb cut. As demonstrated in the photo, the accessible street parking is designated behind the barriers.



There was also an obstruction in the pathway to the vote center entrance, though this was fixed upon request. The path to get to the vote center entrance had a sign in the middle, blocking the path for wheelchair users. BOE staff moved one at the request of DRDC's surveyor.

Recommendations: Remove barriers around the curb cut or provide this vote center with a temporary ramp to allow voters to transfer from the street parking to the sidewalk without an abrupt rise.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 4, 2024 Primary Election	No accessible parking. Obstructions in pathway.
November 3, 2020 General Election	No designated accessible parking.
April 3, 2012 Primary Election	Abrupt rise or pathway obstruction.
February 12, 2008 Primary Election	No designated accessible parking.

Murch Elementary School – 4810 36th Street, NW

This vote center was ***operationally inaccessible*** due to the presence of loose mats in the pathway to the vote center. DRDC's surveyor noted this to the site coordinator and requested that the mats be either moved or taped down. The site coordinator refused.

DRDC's surveyor also noted that the curbside voting and accessible parking areas could have easily been swapped so that the accessible parking was closer to the vote center entrance, increasing the accessibility for voters with mobility disabilities. When the surveyor suggested this to the site coordinator, BOE's site coordinator again refused and told her that she could put her suggestion "straight up her nose[.]"

Additionally, the doors at this vote center were unpropped, but there was a poll worker stationed at the door, making the entrance accessible.

Recommendations: Secure or remove all loose mats. Ensure accessible parking is close to and has an accessible path to the vote center entrance.

Instruct site coordinators on the role of DRDC surveyors. Prop open heavy doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 3, 2020 General Election	Unsecured mat. Unpropped doors.
June 2, 2020 Primary Election	Unsecured mats.

Horace Mann Elementary School – 4430 Newark Street, NW

This vote center was ***operationally inaccessible*** for two reasons. First, though it offered curbside voting, there was no one staffing the curbside voting area. Second, there was not initially the requisite 5-foot turning radius at the electronic ballot marking device, though this was fixed upon the request of DRDC’s surveyor.

Recommendations: Ensure curbside voting areas are staffed. Ensure electronic ballot marking devices are positioned to allow 5-feet of turning radius for voters using wheelchairs.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 6, 2012 General Election	Insufficient turning space at machines.
-----------------------------------	---

Oyster-Adams Elementary School – 2801 Calvert Street, NW


This vote center was ***operationally inaccessible*** for several reasons. First, there was initially not a separately designated accessible parking area. This vote center utilized street parking. The accessible parking and curbside voting areas were initially merged as one area, but this was corrected at the request of DRDC’s surveyor. Second, the path from the parking area to the vote center entrance required that voters traverse a gate with lots of loose dirt and a large metal grate with large holes, creating an unstable surface for individuals with mobility disabilities or individuals using canes. Third, there was initially less than the requisite 5-foot turning radius at the electronic

ballot marking device, though this was fixed upon the request of DRDC's surveyor.

Recommendations: Designate accessible parking areas separate from curbside voting areas. Ensure the path to the vote center entrance is a stable, nonslip surface. Ensure electronic ballot marking devices are positioned to allow 5-feet of turning radius for voters using wheelchairs.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 21, 2022 Primary Election	No designated accessible parking.
November 6, 2012 General Election	Insufficient turning space at machines.
February 12, 2008 Primary Election	No designated accessible parking. Insufficient turning space at machines.

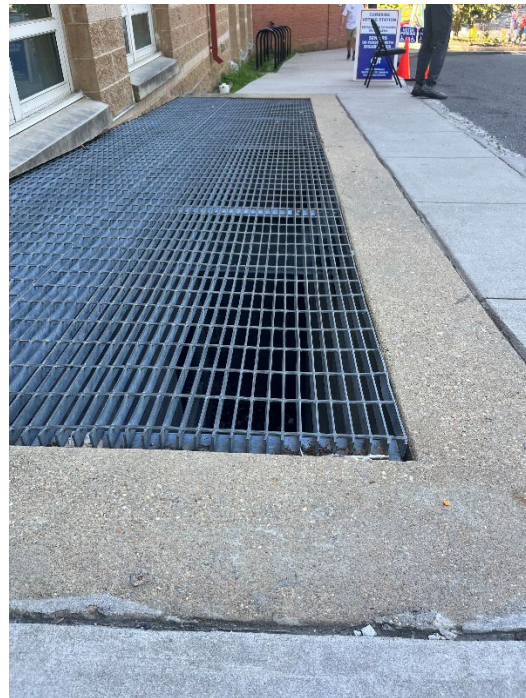

These photos, taken June 16, 2026, show the dirt path and large metal grate along the route to the accessible entrance at Oyster-Adams Elementary School.

Fort Stevens Recreation Center – 1327 Van Buren Street, NW

This vote center was ***operationally inaccessible*** for two reasons. First, the designated vote center entrance was not 32-inches wide, though the main entrance of the building itself was 32-inches wide. Because there was an entrance that was accessible and could have been designated for voter use, this made the entrance operationally inaccessible. Second, an audio headset was not readily available at the electronic ballot marking devices, but was available upon request.

Additionally, the doors were not propped open but there was a poll worker stationed by the door and a working automatic door opener.

Recommendations: Ensure all doorways serving the vote center are 32-inches wide. Make audio headsets readily available at electronic ballot marking devices. Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 8, 2022 General Election	Unpropped doors.
November 3, 2020 General Election	Unpropped doors.

Powell Elementary School – 1350 Upshur Street, NW

Powell Elementary School was ***operationally inaccessible*** due to a lack of signage. Specifically, there were no signs indicating the location of the accessible parking or the accessible entrance. The main entrance at the front of the vote center has a very large, steep ramp that has an abrupt rise of over half an inch at the top. Therefore, the main entrance is inaccessible. DRDC reported the accessibility issues with the main entrance to BOE on several occasions, and we were pleased to see that the main entrance was not used as the accessible entrance for this election.



This photo, taken June 16, 2026, shows the abrupt rise at the top of the ramp that serves Powell Elementary's main entrance.

This year, an entrance at the back of the building with a door that led directly into the vote center was used as the accessible entrance. There was a small parking lot right outside the entrance, complete with accessible parking. However, this parking area and entrance were only accessible down a long alley and was not visible from the street or sidewalk.⁹ Further, there were no signs indicating where people should go to access the accessible parking and entrance at the front of the vote center where the main entrance and parking area were located. The only signs regarding the accessible entrance were posted behind the building, completely out of sight of the main entrance and parking area. DRDC's surveyor only became aware of this entrance and parking area upon the direction of the site coordinator when she inquired about the lack of designated accessible parking.

⁹ Though this entrance and parking area itself were accessible, DRDC notes that it was only accessible by car. The alleyway leading to the parking lot and entrance was very long and had lots of potholes, uneven pavement, and debris that would make it inaccessible to pedestrians with mobility disabilities. Because DRDC's survey only inquires about the route from the parking area to the vote center entrance, we do not consider this as inaccessible for our results. However, we urge BOE to ensure that this vote center is accessible to pedestrians as well.

Additionally, the headsets were not initially plugged into the electronic ballot marking devices, though this was fixed at the request of DRDC's surveyor. As the surveyor was leaving, the site coordinator wanted to close the door to the accessible entrance. The surveyor advised that the door should be left open for accessibility. The site coordinator said that due to the heat, he wanted to close the door, but that he would post a worker at the door.



The above photos, taken June 16, 2026, show the accessible parking area and accessible entrance, as well as the route to travel to the accessible parking area from the sidewalk. Though the parking area and entrance were accessible themselves, as demonstrated in the picture on the left, the route to the area was replete with potholes and gravel, making it inaccessible for pedestrians with mobility disabilities.

Recommendations: Ensure sufficient signage is clearly posted to make the alternative entrance and accessible parking areas obvious to voters. Ensure that ramps at all vote centers are ADA-compliant. Plug in headphones at ballot marking devices. Prop open heavy doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	Inaccessible ramp. Inaccessible parking.
-----------------------------------	--

June 4, 2024 Primary Election	Inaccessible ramp. Inaccessible parking.
November 8, 2022 General Election	Inaccessible ramp. No signage indicating accessible parking.
November 3, 2020 General Election	Inaccessible ramp. No accessible parking.

St. John's College High School – 2607 Military Road, NW

St. John's College High School was **operationally inaccessible** for two reasons. First, the elevator serving the accessible route to the voting area lacked audible floor indicators. Second, the accessible parking and curbside voting were initially the same area. The vote center has a large parking lot with several permanently designated accessible parking spaces, which were all used as both curbside voting and accessible parking. DRDC's surveyor brought this to the attention of the site coordinator, who placed signage to indicate that two of the spaces were accessible parking and two spaces were reserved for curbside voting.

Additionally, the headsets were not initially plugged in to the electronic ballot marking devices, but this was fixed upon the request of DRDC's surveyor.

Recommendations: Ensure elevators are ADA-compliant. Designate accessible parking separate from curbside voting areas.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 4, 2024 Primary Election	Inaccessible elevator.
November 3, 2022 General Election	Inaccessible elevator.

Shepherd Recreation Center – 7800 14th Street, NW

This vote center was both **structurally inaccessible** and **operationally inaccessible**. The vote center was **structurally inaccessible** because the ramp that served as the accessible path from the parking area to the vote

center entrance did not have handrails. Because the ramp was not accessible, there was not an accessible entrance to the vote center.



This photo, taken on June 16, 2026, shows the driveway that served as the curb cut from the parking area to the route to the vote center entrance at Shepherd Recreation Center. As seen in the photo, there is an abrupt rise at the bottom of the driveway, making the path inaccessible.

This vote center was **operationally inaccessible** due to inaccessible parking that could have been fixed. The vote center utilized street parking and had designated accessible parking near a driveway, which had a curb cut to serve as the accessible path to the vote center. However, the bottom of the driveway had an abrupt rise of about 1 inch, making this an inaccessible path. There was a temporary ramp located around the corner from the parking area, which DRDC's surveyor suggested to BOE officials be moved to provide an accessible path over the abrupt rise.

Recommendations: Ensure ramps are ADA-compliant. Ensure pathway from parking area to vote center entrance is free from abrupt rises (this could be done by moving the temporary ramp to be in front of the vote center entrance).


Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	Non-ADA compliant ramp. Inaccessible entrance.
-----------------------------------	---

June 4, 2024 Primary Election	Non-ADA-compliant ramp. Inaccessible entrance. Abrupt rise. No designated accessible parking.
November 8, 2022 General Election	No designated accessible parking.
November 3, 2020 General Election	No designated accessible parking.
February 12, 2008 Primary Election	Inadequate designated accessible parking.

Bunker Hill Elementary School – 1401 Michigan Avenue, NE

Bunker Hill Elementary School was both **structurally inaccessible** and operationally inaccessible. It was **structurally inaccessible** because the ramp leading into the vote center was inaccessible due to cracked concrete, making it an uneven surface. Second, there was an abrupt rise of over half an inch in the pathway to the entrance.

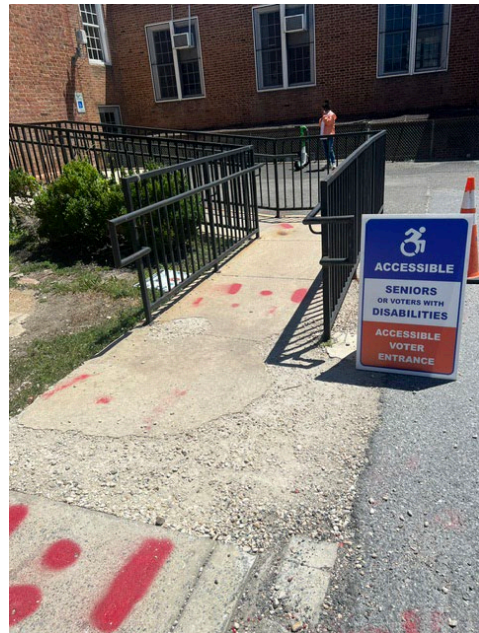

These photos, taken June 16, 2026, show the ramp leading to the entrance of Bunker Hill Elementary School's vote center. As shown in the photo on the left, there was an abrupt rise of over 1/2 an inch along the route. As shown in the photo on the right, there was broken concrete and uneven surfaces along the route.

The vote center was **operationally inaccessible** due to a narrow doorway inside the vote center. Though one interior door was propped open, the other was closed. Both of the doors would need to be propped open for the doorway to be 32 inches wide (with only one door open, the doorway was only 30 inches wide). The site coordinator directed DRDC's surveyor to building security to see if they could open the closed interior door. Security staff told the surveyor that they could not open the second door because it blocked the security office entrance, which was true. Security said she would prop open the door for anyone who could not pass.

Recommendations: Work with DCPS and DGS to repair the ramp. Ensure all paths are clear of abrupt rises. Ensure all doorways are at least 32 inches wide, consistent with the ADA.

Mt. Horeb Baptist Church – 3015 Earl Place, NE

Mt. Horeb Baptist Church was **operationally inaccessible** because there were fewer than 2 accessible parking spots designated for voter use. There was one permanently designated parking space and then the BOE-designated curbside voting area. DRDC's surveyor discussed this with the site coordinator who agreed to separate the accessible parking and curbside voting signage to make it clear that there was a separate accessible parking space. However, the new designated accessible parking space had an abrupt rise of about 2 inches at the curb cut, making the designated space inaccessible.



This photo, taken June 16, 2026, shows an abrupt rise at the base of the curb cut along the accessible route to Mt. Horeb Baptist Church's vote center entrance. As seen in the photo, the abrupt rise was over 2 inches tall.

Recommendations: Ensure at least two accessible parking spaces are designated for voter use. Separate accessible parking from curbside voting. Ensure the route from designated parking areas are free from abrupt rises.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 14, 2016 Primary Election	No designated accessible parking.
--------------------------------	-----------------------------------

Noyes Education Campus – 2725 10th Street, NE

The Noyes Education Campus was ***operationally inaccessible*** for multiple reasons. First, the vote center had misplaced signage from the parking area to the accessible entrance. The vote center utilized a parking lot with permanently designated parking spots that had an accessible path from the main sidewalk to the accessible entrance, but the location of the parking was not clear from the main voter entrance. Nevertheless, BOE’s signage directed voters to the accessible entrance via an inaccessible route – one that required the use of stairs.



This photo, taken June 16, 2026, shows the pathway indicated by the accessible entrance sign posted on the building. The bottom right corner of the picture shows a flight of stairs voters would traverse should they follow the posted signage.

Second, there was an obstruction as the door to the accessible entrance was propped open with a bag, partially blocking the opening. The site coordinator fixed this at the request of DRDC’s surveyor by replacing the bag with a door stopper. When doing this, the site coordinator said the obstruction did not pose an issue to voters in wheelchairs because those voters should vote at the curbside area. The site coordinator further made a

problematic comment that “normal voters” use the main entrance. The surveyor educated the site coordinator that voters with disabilities also vote inside the vote center, and that curbside voting is only an option if voters with disabilities wish to vote curbside.

This photo, taken June 19, 2026, shows the door to the Noyes Education Campus vote center propped open with a large sandbag. Though DRDC applauds BOE for propping open the door, the large sandbag obstructed the doorway.



Recommendations: Ensure all signage is appropriately placed. Remove all obstructions from the path. Educate site coordinators and volunteers regarding the rights of all voters to vote inside the vote center.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	Inadequate signage re: route from parking to accessible entrance.
June 4, 2024 Primary Election	Misplaced signage indicating location of accessible parking.
November 8, 2022 General Election	Inadequate signage.
April 1, 2014 Primary Election	No signage.

Lamond-Riggs/Lillian J. Huff Library – 5401 South Dakota Avenue, NE

The Lamond-Riggs/Lillian J. Huff Library was ***operationally accessible*** because the vote center used a parking lot but only had one designated accessible parking space.

Recommendations: Ensure at least two accessible parking spaces are designated at each vote center.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 4, 2024 Primary Election	Insufficient designated accessible parking.
-------------------------------	---

Eastern Market – 225 7th Street, SE

Though not considered inaccessible for purposes of this report, this vote center initially failed to have an audio headset readily available at the electronic ballot marking devices, though they were available for voters. This was fixed at the request of DRDC’s surveyor.

Jefferson Middle School Academy – 801 7th Street, SW

This vote center was ***operationally inaccessible*** for three reasons. First, the doors were not propped open and there was not an accessible, working backup system. While there were two poll workers stationed at the entrance doors, they made clear to DRDC’s surveyor that they would not open the doors. Instead, they instructed the surveyor to speak with security inside the center. The security staff advised the surveyor that a voter must ring the doorbell on the furthest door from the ramp and then security personnel would buzz the individual into the building. However, the doorbell only unlocks the door and a user still needs to pull the handle towards themselves in order to open the door, which then opens the rest of the way automatically once the user pulls it open. DRDC’s surveyor brought this to the attention of the site coordinator, who then went to speak with the poll workers stationed at the door about opening doors for voters.

Second, the elevator that voters had to use to access the voting area did not have audible floor indicators, in violation of the ADA. The site coordinator informed DRDC's surveyor that they were originally going to set up the voting area in the school's gym, which would not have required that voters use the elevator. However, she shared that they were instructed the night before that they could no longer use the gym and instead had to use an area on the school's lower level.

Third, there were no signs near or inside the elevator indicating which floor the voting area was on, though there were several levels. This was fixed at the suggestion of DRDC's surveyor by placing a sign inside the elevator instructing voters to the school's lower level.

Recommendations: Prop open all doors. Ensure the elevator is ADA-compliant or use the gymnasium instead as the voting area. Ensure adequate signage instructing voters to the location of the voting area.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	Inaccessible elevator. Unpropped doors.
June 4, 2024 Primary Election	Inaccessible elevator.
November 8, 2022 General Election	Closed, heavy doors without working backup system. Inaccessible elevator.
June 21, 2022 Primary Election	Unpropped doors.
November 3, 2020 General Election	Closed, heavy doors without working backup system.

Calvary Episcopal Church – 820 6th Street, NE

This vote center was both **structurally inaccessible** and **operationally inaccessible**. It was **structurally inaccessible** because the ramp that serviced the accessible route did not have handrails, in violation of the ADA.

The vote center was **operationally inaccessible** because it did not have audio headsets available to voters.

Recommendations: Ensure all ramps are ADA compliant. Make audio headsets readily available at all electronic ballot marking devices.

Payne Elementary School – 1445 C Street, SE

This vote center was **operationally inaccessible** for several reasons. First, there was not a separately designated area for accessible parking. The vote center utilized street parking and had sectioned off an area for voters but had not separated an area for accessible parking and curbside voting. Additionally, this area that had been sectioned off was in the middle of the block far from a curb cut. Voters using the accessible parking would have to walk in traffic a significant distance to the closest curb cut or else traverse the abrupt rise of the curb. DRDC's surveyor suggested to the site coordinator that the accessible parking area be separated from the curbside voting area and be moved to the end of the block, next to the curb cut. The site coordinator complained about this suggestion and initially refused the request, saying that she did not have enough cones. DRDC's surveyor suggested that the site coordinator contact BOE to request additional cones. At this suggestion, the site coordinator raised her voice at the surveyor, though she ultimately moved some of, though not all, the accessible parking signs closer to the curb cut.

Second, there were no poll workers staffing the curbside voting area.

Third, there were issues with the vote center's accessible entrance. The main entrance to the vote center can only be reached by stairs. The accessible entrance was moved from previous years to an entrance around the back of the school through a closed parking lot and picnic area. This entrance was out of sight of the sidewalk or the road and far from the designated accessible parking. The door at this entrance was closed without a doorbell. There was a sign on the door saying that voters could call for assistance, but there was no phone number listed. There was a poll worker stationed at the sidewalk who the site coordinator stated was supposed to

follow individuals from the sidewalk around the corner of the school to the door at the rear of the building.



This photo, taken on June 16, 2026, shows the designated accessible entrance at the Payne Elementary vote center. As demonstrated by the picture, the door was closed, there was no one stationed within line of sight of the door to prop it open, there was no doorbell or automatic door opener, nor was there a phone number on the help sign posted on the door.

Finally, there was a loose mat immediately inside the accessible entrance. Because no one was monitoring the entrance, DRDC's surveyor moved the mat away from the door so it would not be a hazard for voters with mobility disabilities.

Recommendations: Ensure accessible parking is separately designated from curbside voting areas. Designate accessible parking near a curb cut or install a temporary ramp to traverse the curb. Ensure curbside voting is staffed. Prop open all doors. Relocate the accessible entrance to the front of the building. Secure or remove all loose mats.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	No designated accessible parking separate from curbside voting. Parking not near curb cut. Unpropped doors.
June 4, 2024 Primary Election	Unpropped heavy doors without working backup system. Loose mats.

November 8, 2022 General Election	Abrupt rise (accessible parking not near curb cut). Unpropped doors.
June 19, 2018 Primary Election	Closed, heavy doors with no working backup system.
April 3, 2012 Primary Election	Unpropped doors.

Stuart-Hobson Elementary School – 410 E Street, NE

This vote center was **operationally inaccessible** for several reasons. First, the location of the accessible parking was unsafe. The vote center utilized street parking but had designated accessible parking in the middle of the block far away from the curb cut. There was no clear path from the parking to the curb cut at either end of the block without traveling in the lane of traffic, presenting safety concerns for voters with mobility disabilities.

This photo, taken June 16, 2026, shows the designated accessible street parking at the Stuart-Hobson Elementary School vote center. As shown in the photo, there was no curb cut near the accessible parking area.



Second, there was no one staffing the curbside voting area when DRDC surveyed this site at 11:20am. The site coordinator explained that someone was on the way to the site to staff curbside voting, but that they had not yet arrived.

Third, there were loose mats in the pathway to the voting area, presenting a hazard for individuals with mobility disabilities. DRDC's surveyor brought this to the attention of the site coordinator, who stated she would have a school security officer remove them.

Recommendations: Designate accessible parking close to a curb cut. Ensure sufficient staffing to cover curbside voting. Tape down or remove loose mats.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 4, 2024 Primary Election	Accessible parking sign far from curb cut.
-------------------------------	--

Kelly Miller Middle School – 301 49th Street, NE

This vote center was ***operationally inaccessible*** for two reasons. First, the parking area was not on firm and stable ground. The vote center utilized a parking lot, but there was significant gravel and broken concrete in the lot, presenting safety concerns for voters with mobility disabilities.

Second, the entrance that had been designated for voter use was inaccessible due to an abrupt rise of over ½ an inch (a step). There originally was no designated accessible entrance at this vote center. DRDC's surveyor helped the site coordinator identify an alternative entrance to serve as the accessible entrance and propped open those doors and adjusted the accessible entrance signs accordingly. The accessible entrance was further from the parking area, but did not require that voters traverse a step.

Recommendations: Ensure the designated accessible parking is on firm and stable ground. Install a ramp at the main entrance to make it accessible.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 3, 2020 General Election	Pathway obstructions. Abrupt rise.
November 4, 2014 General Election	No accessible entrance.
November 6, 2012 General Election	No accessible entrance.

Kimball Elementary School – 3375 Minnesota Avenue, SE

This vote center was **operationally inaccessible** because there were no poll workers staffing the curbside voting area. This was fixed at the request of DRDC’s surveyor.

Additionally, the doors at this vote center were not propped open, though there was a poll worker stationed at the door, making it accessible.

Recommendations: Ensure curbside voting is staffed. Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	Unpropped doors.
June 4, 2024 Primary Election	Unpropped doors.

Cesar Chavez Public Charter School – 3701 Hayes Street, NE

This vote center was **structurally inaccessible** because there was an abrupt rise of over ½ an inch that voters had to traverse. The designated parking area had a curb without a curb cut. The vote center had attempted to place a makeshift ramp using some plywood and 2x4s but this was wholly unsafe for voters.



This photo, taken on June 16, 2026, shows the makeshift “ramp” erected in the parking lot of the Cesar Chavez Public Charter School vote center.

Additionally, the doors at this vote center were not propped open, though there was a poll worker stationed at the doors, making them accessible.

Recommendations: Install a curb cut in the parking area. Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 14, 2016 Primary Election	Abrupt rise.
November 6, 2012 General Election	Unpropped doors.
April 3, 2012 Primary Election	Unpropped doors.

St. Timothy's Episcopal Church – 3601 Alabama Avenue, SE

This vote center was ***operationally inaccessible*** because the accessible street parking was not located near a curb cut. Therefore, voters needed to enter traffic in order to access the curb cut, presenting safety concerns. Additionally, though not inaccessible for purposes of this report, the doors at this vote center were not propped open, though there was a poll worker stationed at the door, making it accessible.

Recommendations: Locate the accessible parking close to the curb cut. Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 4, 2024 Primary Election	Unpropped doors.
November 3, 2020 General Election	Unpropped doors.
April 1, 2014 Primary Election	Unpropped doors.
April 3, 2012 Primary Election	Unpropped doors.

Allen A.M.E. Church – 2498 Alabama Avenue, SE

This vote center was ***operationally inaccessible*** for several reasons. First, the accessible parking for this vote center utilized a parking lot which was behind the building, but the location of the parking lot was not obvious from the street. There were signs marking the accessible entrance and

curbside voting areas were behind the building, but no signs alerting voters to the location of the accessible parking.

Additionally, to get to the accessible voter entrance from the street, individuals had to traverse a long driveway that served the vote center parking lot. DRDC's surveyor witnessed a voter using a wheelchair approach the inaccessible main voter entrance at the front of the building and be told that they had to go around to the back of the building to enter. Because there was no sidewalk to access the back of the building from the front entrance, the voter had to enter the driveway for the parking lot to access the accessible entrance, presenting safety concerns for pedestrians.

The path to the voting area had a loose floor mat, though this was removed at the request of DRDC's surveyor.

Additionally, the accessible entrance was served by a set of double doors, but only one of the doors was propped open. There was a poll worker stationed at the doors to open the second door, and that door was ultimately also propped open at the request of DRDC's surveyor.

Recommendations: Ensure signs indicating the location of accessible parking are visible from the street. Ensure a safe path for pedestrians to access the accessible entrance from the sidewalk. Secure or remove loose mats. Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	No signage re: location of parking area. Loose carpet along accessible path.
June 4, 2024 Primary Election	Loose carpet. Unpropped doors.
November 8, 2022 General Election	Inadequate signage. Closed, heavy doors without working backup system.
November 14, 2014 General Election	Closed, heavy doors without working backup system.
April 3, 2012 Primary Election	Unpropped doors.

Ballou High School – 3401 4th Street, SE

The doors at this vote center were unpropped, though there was a poll worker stationed at the door, making it accessible.

Recommendation: Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 4, 2024 Primary Election	Unpropped doors.
November 8, 2022 General Election	Unpropped doors.
April 3, 2012 Primary Election	Unpropped doors.

Turner Elementary School – 3264 Stanton Road, SE

DRDC was unable to complete our survey at this vote center. Though the vote center was accessible on the outside, when the surveyor entered the vote center the site coordinator told the surveyor that DRDC was not permitted inside the vote center. The surveyor tried to explain the role of DRDC and our surveying work, but the site coordinator still denied our surveyor access. DRDC subsequently contacted BOE's counsel, who assured us that we should be granted access and stated that BOE would send a notice to site coordinators reaffirming DRDC's access to survey.

Recommendation: Instruct site coordinators on the role of DRDC surveyors.

Covenant Baptist Church– 3845 South Capitol Street, SW

This vote center was ***operationally inaccessible*** due to loose mats in the pathway, though they were secured at the request of DRDC's surveyor.

Additionally, the doors at this vote center were not propped open, though there was a poll worker stationed at the door, making it accessible.

Recommendations: Secure or remove loose mats. Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

July 15, 2025 Special Election	Unpropped doors.
--------------------------------	------------------

June 4, 2024 Primary Election	Unpropped doors.
November 8, 2022 General Election	Unpropped doors.
November 3, 2020 General Election	Closed, heavy doors without working backup system.
June 19, 2018 Primary Election	Unpropped doors.
June 14, 2016 Primary Election	Unpropped door.
November 4, 2014 General Election	Closed, heavy doors without working backup system.

Hendley Elementary School – 425 Chesapeake Street, SE

This vote center was ***operationally inaccessible*** for two reasons. First, there was insufficient accessible parking. The vote center utilized a parking lot but only one space had been designated as accessible parking. The parking lot was mostly full because a neighboring organization was having a meeting and taking up all the spaces, so poll workers were not immediately able to designate a new spot. The site coordinator offered to designate part of the curbside voting section in the meantime to add extra space. The surveyor noted that there was more than enough space to have 2 spaces designated for curbside voting and to add an accessible parking space. The surveyor asked the staffers to designate a spot in the parking lot when the meeting was over, and voting staffers agreed.

Second, there was a wide crack in the sidewalk about an inch deep, with loose gravel. This created an obstruction for individuals with mobility disabilities.



The above photos, taken on June 16, 2026, show a large crack in the sidewalk along the route to the Hendley Elementary vote center entrance. As shown in the picture on the right, the crack is over 1 inch deep.

Recommendations: Ensure at least 2 accessible parking spaces are designated for voter use. Ensure pathways are free from obstructions.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	No designated accessible parking. Obstructions (broken concrete).
June 4, 2024 Primary Election	Insufficient accessible parking. Obstructions in pathway (broken concrete).
November 3, 2020 General Election	No designated accessible parking.

The ARC – 1901 Mississippi Avenue, SE

This vote center was ***operationally inaccessible*** for two reasons. First, the curbside voting sign was not placed in plain view from the road. This was immediately fixed at the request of DRDC’s surveyor.

Second, audio headsets were not readily available for voters, though the site coordinator brought them out at the request of DRDC’s surveyor.

Recommendations: Ensure signage is appropriately placed. Ensure audio headsets are readily available at electronic ballot marking machines.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	No audio headset.
November 8, 2022 General Election	Inadequate signage.
June 21, 2022 Primary Election	No audio headset.

Union Temple Baptist Church – 1225 W Street, SE

This vote center was ***operationally inaccessible*** for two reasons. First, the elevator serving the voting area was inaccessible because it lacked audible floor indicators.

Second, there was a narrow doorway. There was a set of double doors along the accessible route, but only one door was propped open, making the doorway less than 32 inches wide. The other door was closed and locked. DRDC’s surveyor was assured that a security office would unlock the double door and be able to widen the entryway for wheelchair users if needed, but they did not open the door.

Recommendations: Ensure all elevators are ADA-compliant. Prop open all doors. Ensure all doorways are at least 32 inches wide.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

July 15, 2025 Special Election	Inaccessible elevator.
November 5, 2024 General Election	Unpropped doors.

June 16, 2026 Primary Election


June 4, 2024 Primary Election	Inaccessible elevator. Unpropped doors.
November 8, 2022 General Election	Inaccessible elevator. Unpropped doors.
June 21, 2022 Primary Election	Inaccessible elevator.
November 3, 2020 General Election	Inaccessible elevator. Unpropped doors.
June 14, 2016 Primary Election	Inaccessible elevator. Closed, heavy doors with no working backup system.
November 4, 2014 General Election	Inaccessible elevator. Closed, heavy doors without working backup system.
April 1, 2014 Primary Election	Closed, heavy doors without working backup system.
April 23, 2013 Special Election	Closed, heavy doors without working backup system.
November 6, 2012 General Election	Inaccessible elevator.
April 3, 2012 Primary Election	Unpropped doors.
April 26, 2011 Special Election	Narrow doorway. Unpropped doors.

II. INACCESSIBLE EARLY VOTE CENTERS

Columbia Heights Community Center – 1480 Girard Street, NW

This vote center was **operationally inaccessible** for two reasons. First, the vote center utilized street parking, but the curb cut was far away from the designated parking area. The vote center installed a temporary ramp to remedy this issue, but the ramp was placed in a location that did not have a firm landing surface. Instead, the landing area was gravel. The site coordinator explained to DRDC’s surveyor that this was not the intended ramp spot, but that multiple cars had been parked in the area they intended to use for designated accessible parking and the cars had blocked the intended ramp location. The site coordinator further explained that the District had not responded to their request to tow the offending cars. DRDC recognizes that BOE attempted to remedy the issue with the cars and that the city was not responsive, but the lack of a firm landing surface presented an obstruction for individuals with mobility disabilities.

This photo, taken on June 16, 2026, shows the temporary ramp at Columbia Heights Community Center. As shown in the photo, there was not a solid surface at the top of the ramp, creating an obstruction for voters with disabilities.

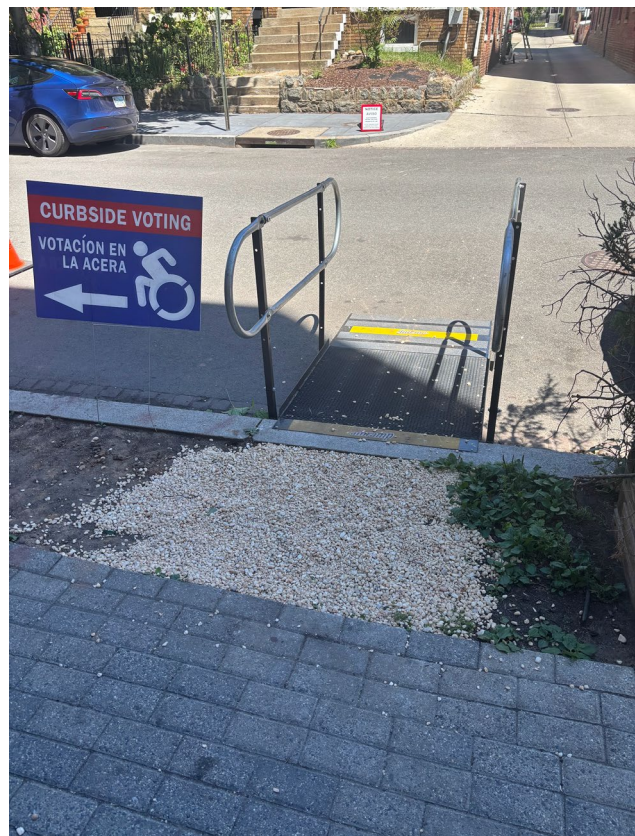

Second, the elevator along the accessible route lacked audible floor indicators, in violation of the ADA.

Additionally, the doors at this vote center were unpropped, though there was a poll worker stationed to make it accessible.

Recommendations: DRDC recognizes that BOE attempted to remedy the issue with the cars and that the city was not responsive, but the lack of a firm landing surface still presented an accessibility barrier. BOE should have used a longer ramp to traverse the uneven surface. Ensure elevators are ADA-compliant. Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	Inaccessible elevator.
June 4, 2024 Primary Election	Inaccessible elevator.
November 8, 2022 General Election	Designated accessible parking not near curb cut. Inaccessible elevator. Unpropped doors.
June 21, 2022 Primary Election	Inaccessible elevator. Unpropped doors.
November 3, 2020 General Election	Designated accessible parking not near curb cut.
June 14, 2016 Primary Election	Closed heavy doors without working backup system.
April 1, 2014 Primary Election	Closed locked heavy doors without working backup system.

Prince Hall Masonic Temple – 1000 U Street, NW

This vote center was ***operationally inaccessible*** for two reasons. First, the elevator along the accessible route lacked audible floor indicators.

Second, there was a loose mat along the accessible route. The poll workers agreed to secure the mat at the suggestion of DRDC’s surveyor.

Additionally, the doors were not propped open but there was a poll worker stationed at the door, making it accessible.

Recommendations: Ensure all elevators are ADA-compliant. Secure or remove all loose mats. Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 4, 2024 Primary Election	Inaccessible elevator.
November 8, 2022 General Election	Unpropped doors.
November 3, 2020 General Election	Unpropped doors.
June 2, 2020 Primary Election	Closed, heavy doors without working backup system. Pathway obstruction (unsecured mats).

Georgetown Neighborhood Library – 3260 R Street, NW

This vote center was both ***structurally inaccessible*** and ***operationally inaccessible***. It was ***structurally inaccessible*** because the long ramp leading from the sidewalk to the vote center entrance did not have handrails.

The vote center was ***operationally inaccessible*** for several reasons. First, there was insufficient accessible parking. There was both street parking and a parking lot at this location. The parking lot had only one designated accessible parking space and the street parking area presented an abrupt rise greater than ½ inch. The site coordinator agreed to request a temporary ramp to correct the street parking issue.

Second, though the location of the entrance was clear from the street parking area, the route from the parking lot to the vote center entrance was not clear, nor was it marked with signs.

Third, there were obstructions in the path to the vote center entrance both from the parking lot and the street parking area. The route from the parking lot had broken flagstone in the path and the route from the street had the abrupt rise of the curb and a wagon parked in the pathway. The obstructions in the pathway, abrupt rise from the parking lot, and inaccessible ramp from the street parking area meant that this vote center did not have an accessible entrance.

Fourth, the elevator that was along the accessible route to the voting area lacked audible floor indicators.

Fifth, there were no audio headsets inside the vote center. When DRDC's surveyor asked about this, the site coordinator responded that the poll worker staffing the curbside voting area had the headset, but that they would make it available if a voter needed it inside the vote center.

Finally, only two of the three accessible ballot marking devices had the required 5-foot turning radius in front of the machine.

Additionally, the accessible ballot marking devices were not arranged to allow privacy at all machines. The doors at this vote center were not propped open, though there was a poll worker stationed at the door, making the entrance accessible.

Recommendations: Ensure all ramps are ADA-compliant. Ensure the route from the parking area to the vote center entrance is clearly marked with signs. Designate at least two accessible parking spaces for voter use. Ensure the accessible route is free of abrupt rises greater than ½ an inch. Remove all obstructions along the accessible route. Ensure the accessible route is a firm and flat surface. Ensure all elevators are ADA-compliant. Supply sufficient audio headsets at each vote center. Arrange all electronic ballot marking devices to allow for sufficient turning radius and privacy at machines.

Past Reports that Noted Relevant Problem(s) at this Drop Box:

November 5, 2024 General Election	Obstructions in pathway.
June 4, 2024 Primary Election	Ramp lacking handrails. Insufficient accessible parking.
November 8, 2022 General Election	Pathway obstruction (crumbling flagstones).
June 14, 2016 Primary Election	Insufficient turning space at machines. No privacy.

M.L.K. Jr. Memorial Library – 901 G Street, NW

This vote center was **operationally inaccessible** due to issues with the accessible parking. The vote center utilized street parking and had not initially designated accessible parking spaces separately from the curbside voting area. The location of the parking was in the middle of the block, far from any curb cuts. This was corrected upon the suggestion of DRDC’s surveyor, and the site coordinator set up one accessible parking space at the end of the block, near the curb cut. The surveyor also suggested that the site coordinator contact BOE to ask for a temporary ramp so accessible parking spaces could be closer to the vote center’s entrance, and the site coordinator agreed to do that.

Recommendations: Ensure sufficient accessible parking separate from curbside voting areas. Locate accessible parking near curb cut or install ramp/curb cut closer to vote center entrance.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	No accessible parking designated separate from curbside voting area. Accessible parking sign far from curb cut.
June 21, 2022 Primary Election	No designated accessible parking. Abrupt rise.

West End Public Library – 2301 L Street, NW

This vote center was **operationally inaccessible** for two reasons. First, the accessible parking had originally been designated far from a curb cut. The vote center utilized street parking but the parking was designated in the middle of the block and the curb cut was at the end of the block. The site coordinator agreed to relocate the accessible parking to be close to the curb cut.

Second, though the vote center offered curbside voting, there were not any poll workers staffing the curbside voting area.

Recommendations: Designate accessible parking close to a curb cut. Ensure sufficient staffing at curbside voting area.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 21, 2022 Primary Election	Unstaffed curbside voting.
--------------------------------	----------------------------

Cleveland Park Library – 3310 Connecticut Avenue, NW

This vote center was ***operationally inaccessible*** because the accessible parking was not originally designated separately from the curbside voting area. This was fixed at the suggestion of DRDC’s surveyor.

Additionally, the doors at this vote center were not propped open, though there was a poll worker stationed at the door, making it accessible.

Recommendation: Designate at least 2 accessible parking spaces separate from curbside voting. Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Drop Box:

November 5, 2024 General Election	Unpropped doors.
November 8, 2022 General Election	Unpropped doors.

Chevy Chase Community Center – 5601 Connecticut Avenue, NW

This vote center was ***operationally inaccessible*** for a few reasons. First, the doors at this vote center were not fully propped open. The entrance required that voters navigate two sets of double doors. The interior set of double doors were unpropped but had a working automatic door opener. The exterior had two sets of double doors, but only one set had a single door propped open, rather than all the doors. All the other doors were locked. There was no poll worker stationed at the door, no working automatic door opener, and no doorbell for these doors. Therefore, there were closed, heavy doors

without a working backup system. Second, the single door that was propped open allowed for an entrance that was only 27 inches wide. Therefore, the entrance was inaccessible due to the narrow doorway. DRDC's surveyor suggested that the site coordinator correct these issues by propping open all the exterior doors, and the site coordinator agreed.

Third, there was no signage indicating the location of the accessible entrance from the accessible parking area. When the surveyor arrived, there was no sign near the parking spaces that would direct voters to the accessible entrance. At the surveyor's recommendation, the site coordinator moved an accessible entrance sign to direct people from the parking spaces to the accessible entrance.

Recommendations: Prop open all doors. Ensure sufficient signage to direct voters to the location of the accessible entrance.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 4, 2024 Primary Election	Unpropped doors.
November 8, 2022 General Election	Unpropped doors.
November 3, 2020 General Election	Inadequate signage. Closed, heavy doors without working backup system.

University of the District of Columbia – 4200 Connecticut Avenue, NW

This vote center was ***operationally inaccessible*** due to issues with the entrance doors. The doors were not initially propped open and there was no poll worker stationed at the doors. There was an automatic door opener, but when DRDC's surveyor tested it, it did not initially work. DRDC's surveyor tested it a few more times and it eventually did work. DRDC's surveyor brought this to the attention of the site coordinator, who also came outside to test the door opener. It also took several tries for the automatic door opener to work. The surveyor fixed this issue by stationing a poll worker at the door to open it for voters.

Recommendation: Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Drop Box:

June 4, 2024 Primary Election	Unpropped doors.
November 8, 2022 General Election	Unpropped doors.
June 21, 2022 Primary Election	Unpropped doors.

Takoma Community Center – 300 Van Buren Street, NW

This vote center was ***operationally inaccessible*** due to misplaced signage. There were many signs designating an entrance around the back of the building to serve as the accessible entrance. However, the entrance that had been designated as “accessible” required that voters navigate an abrupt rise from the parking lot (due to crumbling pavement), an overhanging tree protruding in the pathway, and a narrow ramp. The doors at this entrance were not propped open and did not have a working backup system.

The main entrance at the front of the building was accessible. BOE had designated street parking at the front of the building, including accessible parking. The path to the main entrance from the street parking was accessible as well. Though doors were not propped open at this entrance, there was a poll worker stationed at the door, making it accessible. DRDC’s surveyor suggested to the site coordinator that they make the main, front entrance the accessible entrance as well and remove the accessible entrance signs from the back of the building.

Recommendations: Designate the main front entrance as the accessible entrance. Ensure accessible entrances are free from obstructions. Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Drop Box:

November 5, 2024 General Election	Unpropped doors.
November 8, 2022 General Election	Unpropped doors.

Raymond Recreation Center – 3725 10th Street, NW

This vote center was **structurally inaccessible** due to issues with the pathway to the vote center entrance. The path was made with brick pavers, but several were missing in large chunks, creating holes in the surface and abrupt rises in the pathway.

The doors at this vote center were not propped open, but there was a poll worker at the door, making the entrance accessible. Additionally, the electronic ballot marking devices were not arranged to protect the voter's privacy.

Recommendations: Ensure the path from the parking area to the vote center entrance is a firm, stable surface free from abrupt rises. Prop open all doors. Arrange electronic ballot marking devices to protect voter's privacy.

Past Reports that Noted Relevant Problem(s) at this Drop Box:

November 5, 2024 General Election	Obstructions in pathway (missing bricks).
November 4, 2014 General Election	Pathway obstruction or abrupt rise.

Turkey Thicket Recreation Center–1100 Michigan Avenue, NE

The Turkey Thicket Recreation Center was **operationally inaccessible** because the entrance to the vote center had closed doors without a working back-up system. The external doors at both entrances were not propped open, and the automatic door opener was broken. Upon request, the site coordinator propped open both doors but warned that they would not remain propped open because it would create issues with the air conditioning. This issue has been noted in past reports, and BOE's staff made similar complaints about the broken automatic door opener and air conditioning then. The site coordinator said they would try to have staff let people into the main entrance, and they have a sign for people to call to get into the voting center. The site coordinator noted that they did not have enough staff to

always have someone at the door. The surveyor explained to the site coordinator why the sign was not an adequate back-up, and the site coordinator understood.

Additionally, though there were two permanent accessible parking spaces in the vote center parking lot, there was a car without an accessible parking tag parked in one of those spaces, causing an obstruction. The staff at the curbside voting said the car had been parked there since before she arrived.

Recommendations: Prop open all doors. Fix the automatic door opener. Ensure at least two accessible parking spaces are available for voter use by designating new, accessible spaces close to the entrance or coordinate with local parking enforcement or facility management to have unauthorized vehicles towed immediately.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 4, 2024 Primary Election	Heavy, unpropped doors without working backup system.
November 8, 2022 General Election	Unpropped doors.
November 3, 2020 General Election	Inadequate designated accessible parking.
June 2, 2020 Primary Election	Unpropped doors.

King Greenleaf Recreation Center – 201 N Street, SW

The King Greenleaf Recreation Center was ***operationally inaccessible*** because the curb cuts were originally far from the accessible parking. The surveyor recommended that the site coordinator switch the curbside voting with the parking, and the site coordinator said he would.

Additionally, the doors at the vote center entrance were not propped open, though there was a poll worker stationed at the door, making the entrance accessible. Also, the audio headset was not plugged in, but the site coordinator plugged it in upon request.

Recommendations: Designate accessible parking near curb cut or use a temporary ramp to traverse the curb from the parking area. Prop open all doors. Plug in audio headsets.

Deanwood Recreation Center – 1350 49th Street, NE

The Deanwood Recreation Center was both **structurally inaccessible** and **operationally inaccessible**. It was **structurally inaccessible** because there was an abrupt rise over ½ and inch along the path from the parking area to the vote center entrance.



This photo, taken June 10, 2026, shows a large abrupt rise between the parking area and the vote center entrance at Deanwood Recreation Center.

The vote center was **operationally inaccessible** for two reasons. First, there was insufficient signage indicating the route from the accessible parking to the accessible entrance. The location of the parking lot was also unclear from the street. The site coordinator agreed to move signs to make the path clearer to voters. Second, there were no staffers working curbside voting. The surveyor raised the lack of staffers with the site coordinator, who cited the heat. The site coordinator said that the vote center would be vigilant when someone approached.

Recommendations: Ensure the path to the vote center is free from abrupt rises. Place signage to clearly mark the path from the parking area to the vote

center entrance and clearly mark the location of the designated accessible parking. Ensure sufficient staffing for curbside voting.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

June 4, 2024 Primary Election	Unstaffed curbside voting.
June 2, 2020 Primary Election	Unstaffed curbside voting.

Benning Stoddert Recreation Center – 100 Stoddert Place, SE

The Benning Stoddert Recreation Center was **structurally inaccessible** because the door was not 32 inches wide. There were two doors side by side, but they were separated by a door frame, so the only largest available openings were 30.5 inches, making it inaccessible.

Recommendation: Ensure all doorways are at least 32 inches wide.

Fort Stanton Recreation Center - 1812 Erie Street, SE

This vote center had two entrances – one at the front and one at the back. The doors at the main entrance (at the front) were propped open, but the doors at the back entrance (where the parking lot was located) were closed and locked. There was a doorbell for poll workers to respond remotely to unlock the door, but not to actually open it. DRDC’s surveyor instructed the site coordinator that poll workers need to respond to open the door if someone uses the rear entrance. DRDC’s surveyor also noted that it would be difficult to park in the lot and then go to the main entrance at the front of the building because of the large slope of the sidewalk.

Recommendation: Prop open all doors.

Ferebee Hope Recreation Center – 700 Yuma Street, SE

This vote center was both **structurally inaccessible** and **operationally inaccessible**. It was **structurally inaccessible** due to a narrow doorway. The bar to open the door made it only about 31 inches; less than the 32 inches required.

The Ferebee Hope Recreation Center was **operationally inaccessible** due to obstructions at the accessible parking. Though BOE had designated two accessible parking spaces for voters, both spots were filled by DC government vehicles and therefore unusable.

Additionally, when the surveyor arrived, the electricity in the entire building was out and none of the touch machines or the automatic door opener were working. There was a crew there to fix it.

Recommendations: Ensure at least two accessible parking spaces are available for voter use by designating new, accessible spaces close to the entrance or coordinate with local parking enforcement or facility management to have unauthorized vehicles towed immediately.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 5, 2024 General Election	Insufficient accessible parking.
June 4, 2024 Primary Election	Insufficient accessible parking.
November 3, 2020 General Election	No designated accessible parking.

Arthur Capper Community Center – 1000 5th Street, SW

This vote center was both **structurally inaccessible** and **operationally inaccessible**. It was **structurally inaccessible** due to a narrow doorway (less than 32 inches wide).

The Arthur Capper Community Center was **operationally inaccessible** because there were fewer than two accessible parking spaces. People had torn down the signs to not park and people thus parked in the spots. To resolve the issue, the site coordinator planned to call the District to have the cars towed. There was not enough room to park at the time of DRDC's survey.

Additionally, the doors at this vote center were not propped open and the automatic door opener was not working, but poll workers were at the door to open it for entry.

Recommendations: Ensure all doorways are at least 32 inches wide.
Designate sufficient accessible parking. Prop open all doors.

Past Reports that Noted Relevant Problem(s) at this Vote Center:

November 8, 2022 General Election	Unpropped doors.
June 21, 2022 Primary Election	No designated accessible parking. Unpropped doors.
November 3, 2020 General Election	Unpropped doors.

III. INACCESSIBLE BALLOT DROP BOXES

Georgetown Library – 3260 R Street, NW

This drop box was both **structurally** and **operationally inaccessible** because there was no accessible pathway to the drop box. From the street, it was **structurally inaccessible** because voters had to traverse a ramp that lacked handrails, making it out of compliance with the ADA. There was a parking lot up the hill by the Library, but the path from the parking lot to the drop box was **operationally inaccessible** because it was obstructed by broken flagstone and a wagon filled with debris.

Recommendations: Ensure the path to the drop box is free from obstructions and abrupt rises. Ensure all ramps are ADA-compliant.

Past Reports that Noted Relevant Problem(s) at this Drop Box:

November 5, 2024 General Election	Obstructions.
June 4, 2024 Primary Election	Non-ADA-compliant ramp.

Foggy Bottom/GWU Metro – 2301 I Street, NW

This drop box was **operationally inaccessible** due to a ramp out of compliance with the ADA. There was construction going on around the drop box and a temporary ramp had been placed as a result. However, this ramp lacked handrails.

Recommendation: Relocate drop boxes that are made inaccessible by surrounding construction.

Second District Police Station – 3320 Idaho Avenue, NW

This drop box was **structurally inaccessible** due to an abrupt rise of 1 inch in the pathway from the parking area to the drop box. The abrupt rise was created by broken pavement at the curb cut.



This photo, taken June 16, 2026, shows an abrupt rise from the parking area to the sidewalk along the route to the ballot drop box.

Recommendation: Ensure pathways to drop boxes are free of abrupt rises.

Past Reports that Noted Relevant Problem(s) at this Drop Box:

November 5, 2024 General Election	Abrupt rise.
-----------------------------------	--------------

Petworth Library – 4200 Kansas Avenue, NW

This drop box was both **structurally inaccessible** and **operationally inaccessible** due to issues with ongoing construction. The path to the drop box was not free of projecting objects or obstructions and was unstable. There was also not 30 x 48 inches of clearance at the front of the drop box and voters would have reach more than 10 inches from the floor to the drop box.

Recommendation: Relocate ballot drop boxes that are made inaccessible by surrounding construction.

Past Reports that Noted Relevant Problem(s) at this Drop Box:

November 8, 2022 General Election	Pathway obstruction.
-----------------------------------	----------------------

Shepherd Park (Juanita E. Thornton) Library –7420 Georgia Avenue, NW

The Shepherd Park (Juanita E. Thornton) Library was **operationally inaccessible** because there was an obstruction in the pathway. The surveyor noted that someone had parked directly in front of the ramp from the lot to the ballot box. The surveyor spoke to the librarian inside, who knew the person who owned the car. The librarian said they would ask the driver to move the car. The surveyor waited a few minutes but did not see the driver move the car.

Recommendation: Ensure pathways to drop boxes remain unobstructed.

Southwest Library – 900 Wesley Place, SW

This drop box was **operationally inaccessible** because a large sidewalk paver was missing, creating an obstruction in the pathway.



This photo, taken June 10, 2026, shows the large gap in the pavement near the Southwest Library ballot drop box.

Recommendations: Ensure the path to ballot drop boxes are free from obstructions. Relocate this drop box to another part of the Library that is not near the missing paver.

Deanwood Library – 1350 49th Street, NE

The Deanwood Library ballot box was **structurally inaccessible**. There is a one-inch rise¹⁰ in the sidewalk on the route from the accessible parking to the ballot drop box.

Recommendation: Ensure the pathway to the drop box is free from abrupt rises.

Past Reports that Noted Relevant Problem(s) at this Drop Box:

November 5, 2024 General Election	Abrupt rise.
-----------------------------------	--------------

Benning (Dorothy I. Height) Library – 3935 Benning Road, NE

BOE remedied past issues with the location of this drop box. In previous elections, the drop box had been located behind the library and, due to the steep slope of the parking lot, was only accessible during the library’s operating hours. This year, BOE remedied this issue by relocating the drop box to the front of the library, consistent with DRDC’s past recommendations. However, this drop box was **operationally inaccessible** because there was a Lime scooter parked directly in front of the drop box upon DRDC’s survey, but the surveyor removed this obstruction.

Recommendation: Ensure all drop boxes remain free from obstructions.

Hendley Elementary School – 425 Chesapeake Street, SE

This drop box was **operationally inaccessible** because it was not on firm, stable ground. There was a significant amount of gravel in front of the drop box, obstructing the path for voters with mobility disabilities.

Recommendation: Ensure drop boxes and the pathways to them are on firm and stable ground.

¹⁰ A photograph of the abrupt rise is included in the Deanwood Recreation Center vote center summary on page 55.

Past Reports that Noted Relevant Problem(s) at this Drop Box:

November 5, 2024 General Election	Obstructions (broken concrete).
June 4, 2024 Primary Election	Obstructions (broken concrete).
June 21, 2022 Primary Election	Pathway obstruction.

APPENDICES

APPENDIX A: VOTE CENTERS SURVEYED

DRDC successfully surveyed all 75 (100%) of the available vote centers during the Primary Election cycle.

Vote Center	Address
Columbia Heights Education Campus	3101 16th Street, NW
Marie Reed Elementary School	2201 18th Street, NW
H.D. Cooke Elementary School	2525 17th Street, NW
Bancroft Elementary School	1755 Newton Street, NW
Shiloh Baptist Church	1500 9th Street, NW
Fifteenth Street Presbyterian Church	1701 15th Street, NW
Hardy Middle School	1819 35th Street, NW
Annunciation Church	3810 Massachusetts Avenue, NW
Janney Elementary School	4130 Albemarle Street, NW
Murch Elementary School	4810 36th Street, NW
Palisades Recreation Center	5200 Sherier Place, NW
Horace Mann Elementary School	4430 Newark Street, NW
Oyster-Adams Bilingual School	2801 Calvert Street, NW
Barnard Elementary School	430 Decatur Street, NW
Fort Stevens Recreation Center	1327 Van Buren Street, NW
Ida B. Wells Middle School	405 Sheridan Street, NW
Lasalle-Backus Education Campus	501 Riggs Road, NE
Powell Elementary School	1350 Upshur Street, NW
St. John's College High School	2607 Military Road, NW
Shepherd Recreation Center	7800 14th Street, NW
Takoma Education Campus	7010 Piney Branch Road, NW
Bunker Hill Elementary School	1401 Michigan Avenue, NE
Dunbar Senior High School	101 N Street, NW
Joseph H. Cole Recreation Center	1299 Neal Street, NE
Mt. Horeb Baptist Church	3015 Earl Place, NE
Noyes Education Campus	2725 10th Street, NE
Lamond-Riggs/Lillian J. Huff Library	5401 South Dakota Avenue, NE
McKinley Technology High School	371 T Street, NE

June 16, 2026 Primary Election

Eastern Market	225 7th Street, SE
Jefferson Middle School Academy	801 7th Street, SW
Calvary Episcopal Church	820 6th Street, NE
Payne Elementary School	1445 C Street, SE
Stuart-Hobson Middle School	410 E Street, NE
Watkins Elementary School	420 12th Street, SE
Kelly Miller Middle School	301 49th Street, NE
Kimball Elementary School	3375 Minnesota Avenue, SE
Miner Elementary School	601 15th Street, NE
Nalle Elementary School	219 50th Street, SE
Randle Highlands Elementary School	1650 30th Street, SE
River Terrace Education Campus	405 Anacostia Avenue, NE
Cesar Chavez Public Charter School	3701 Hayes Street, NE
St. Timothy's Episcopal Church	3601 Alabama Avenue, SE
Allen A.M.E. Church	2498 Alabama Avenue, SE
Anacostia High School	1601 16th Street, SE
Ballou High School	3401 4th Street, SE
Turner Elementary School	3264 Stanton Road, SE
Covenant Baptist Church	3845 South Capitol Street, SW
Hendley Elementary School	425 Chesapeake Street, SE
The ARC	1901 Mississippi Avenue, SE
Union Temple Baptist Church	1225 W Street, SE
^ Columbia Heights Community Center	1480 Girard Street, NW
^ Prince Hall Masonic Temple	1000 U Street, NW
^ Georgetown Neighborhood Library	3260 R Street, NW
^ M.L.K. Jr. Memorial Library	901 G Street, NW
^ West End Public Library	2301 L Street, NW
^ Stead Recreation Center	1625 P Street, NW
^ Cleveland Park Library	3310 Connecticut Avenue, NW
^ Chevy Chase Community Center	5601 Connecticut Avenue, NW
^ University of the District of Columbia	4200 Connecticut Avenue, NW
^ Emery Heights Community Center	5701 Georgia Avenue, NW
^ Takoma Community Center	300 Van Buren Street, NW

June 16, 2026 Primary Election

^ Raymond Recreation Center	3725 10th Street, NW
^ Turkey Thicket Recreation Center	1100 Michigan Avenue, NE
^ Woodridge Neighborhood Library	1801 Hamlin Street, NE
^ Walker Jones MS/RH Terrell Recreation Center	155 L Street, NW
^ Sherwood Recreation Center	640 10th Street, NE
^ King Greenleaf Recreation Center	201 N Street, SW
^ Rosedale Recreation Center	1701 Gales Street, NE
^ Deanwood Recreation Center	1350 49th Street, NE
^ Benning Stoddert Recreation Center	100 Stoddert Place, SE
^ Hillcrest Recreation Center	3100 Denver Street, SE
^ Fort Stanton Recreation Center	1812 Erie Street, SE
^ Ferebee-Hope Recreation Center	700 Yuma Street, SE
^ Arthur Capper Community Center	1000 5th Street, SE
^ Bald Eagle Recreation Center	100 Joliet Street, SW

^denotes early vote center

APPENDIX B: Inaccessible Vote Centers

Vote Center	Address
Columbia Heights Education Campus	3101 16th Street, NW
H.D. Cooke Elementary School	2525 17th Street, NW
Fifteenth Street Presbyterian Church	1701 15th Street, NW
Janney Elementary School	4130 Albemarle Street, NW
Murch Elementary School	4810 36th Street, NW
Horace Mann Elementary School	4430 Newark Street, NW
Oyster-Adams Bilingual School	2801 Calvert Street, NW
Fort Stevens Recreation Center	1327 Van Buren Street, NW
Powell Elementary School	1350 Upshur Street, NW
St. John's College High School	2607 Military Road, NW
Shepherd Recreation Center	7800 14th Street, NW
Bunker Hill Elementary School	1401 Michigan Avenue, NW
Mt. Horeb Baptist Church	3015 Earl Place, NE
Noyes Education Campus	2725 10th Street, NE
Lamond-Riggs/Lillian J. Huff Library	5401 South Dakota Avenue, NE
Jefferson Middle School Academy	801 7th Street, SW
Calvary Episcopal Church	820 6th Street, NE
Payne Elementary School	1445 C Street, SE
Stuart-Hobson Elementary School	410 E Street, NE
Kelly Miller Middle School	301 49th Street, NE
Kimball Elementary School	3375 Minnesota Avenue, SE
Cesar Chavez Public Charter School	3701 Hayes Street, NE
St. Timothy's Episcopal Church	3601 Alabama Avenue, SE
Allen A.M.E. Church	2498 Alabama Avenue, SE
Covenant Baptist Church	3845 South Capitol Street, SW
Hendley Elementary School	425 Chesapeake Street, SE
The ARC	1901 Mississippi Avenue, SE
Union Temple Baptist Church	1225 W Street, SE
^ Columbia Heights Community Center	1480 Girard Street, NW
^ Prince Hall Masonic Temple	1000 U Street, NW
^Georgetown Neighborhood Library	3260 R Street, NW
^ M.L.K. Jr. Memorial Library	901 G Street, NW

June 16, 2026 Primary Election

^ West End Public Library	2301 L Street, NW
^Cleveland Park Library	3310 Connecticut Avenue, NW
^ Chevy Chase Community Center	5601 Connecticut Avenue, NW
^University of the District of Columbia	4200 Connecticut Avenue, NW
^Takoma Community Center	300 Van Buren Street, NW
^Raymond Recreation Center	3725 10th Street, NW
^ Turkey Thicket Recreation Center	1100 Michigan Avenue, NE
^ King Greenleaf Recreation Center	201 N Street, SW
^ Deanwood Recreation Center	1350 49th Street, NE
^ Benning Stoddert Recreation Center	100 Stoddert Place, SE
^ Ferebee-Hope Recreation Center	700 Yuma Street, SE
^ Arthur Capper Community Center	1000 Fifth Street, SW
^ Bald Eagle Recreation Center	100 Joliet Street, SW

APPENDIX C: Tables of Vote Centers by Reason of Inaccessibility
Table 1: Vote Centers that were Structurally Inaccessible

Vote Center	Address
Fifteenth Street Presbyterian Church	1701 15th Street, NW
Shepherd Recreation Center	7800 14th Street, NW
Bunker Hill Elementary School	1401 Michigan Avenue, NW
Calvary Episcopal Church	820 6th Street, NE
Cesar Chavez Public Charter School	3701 Hayes Street, NE
^ Georgetown Neighborhood Library	3260 R Street, NW
^Raymond Recreation Center	3725 10th Street, NW
^ Deanwood Recreation Center	1350 49th Street, NE
^ Benning Stoddert Recreation Center	100 Stoddert Place, SE
^Ferebee-Hope Recreation Center	700 Yuma Street, SE
^ Arthur Capper Community Center	1000 Fifth Street, SW

Table 2: Vote Centers that were Operationally Inaccessible due to Insufficient Accessible Parking

Vote Center	Address
Janney Elementary School	4130 Albemarle Street, NW
Oyster Adams Elementary School	2801 Calvert Street, NW
St. John's College High School	2607 Military Road, NW
Lamond-Riggs/Lillian J. Huff Library	5401 South Dakota Avenue, NE
Payne Elementary School	1445 C Street, SE
Hendley Elementary School	425 Chesapeake Street, SE
^Georgetown Neighborhood Library	3260 R Street, NW
^ MLK Jr. Memorial Library	901 G Street, NW
^Cleveland Park Library	3310 Connecticut Avenue, NW
^ Arthur Capper Community Center	1000 Fifth Street, SW

Table 3: Vote Centers that were Structurally or Operationally Inaccessible due to Lack of Accessible Route from Parking Area to Vote Center Entrance

Vote Center	Address
Columbia Heights Education Campus	3101 16th Street, NW
Fifteenth Street Presbyterian Church	1701 15th Street, NW
Janney Elementary School	4130 Albemarle Street, NW
Oyster-Adams Bilingual School	2801 Calvert Street, NW
Shepherd Recreation Center	7800 14th Street, NW
Mt. Horeb Baptist Church	3015 Earl Place, NE
Payne Elementary School	1445 C Street, SE
Stuart-Hobson Elementary School	410 E Street, NE
Kelly Miller Middle School	301 49th Street, NE
Cesar Chavez Public Charter School	3701 Hayes Street, NE
St. Timothy's Episcopal Church	3601 Alabama Avenue, SE
Hendley Elementary School	425 Chesapeake Street, SE
^ Columbia Heights Community Center	1480 Girard Street, NW
^Georgetown Neighborhood Library	3260 R Street, NW
^ M.L.K. Jr. Memorial Library	901 G Street, NW
^ West End Public Library	2301 L Street, NW
^Raymond Recreation Center	3725 10th Street, NW
^ King Greenleaf Recreation Center	201 N Street, SW

Table 4: Vote Centers that were Operationally Inaccessible due to Missing and/or Misplaced Signage

Vote Center	Address
H.D. Cooke Elementary School	2525 17th Street, NW
Fifteenth Street Presbyterian Church	1701 15th Street, NW
Powell Elementary School	1350 Upshur Street, NW
Noyes Education Campus	2725 10th Street, NE
Jefferson Middle School Academy	801 7th Street, SW
Allen A.M.E. Church	2498 Alabama Avenue, SE

The ARC	1901 Mississippi Avenue, SE
^Georgetown Neighborhood Library	3260 R Street, NW
^ Chevy Chase Community Center	5601 Connecticut Avenue, NW
^Takoma Community Center	300 Van Buren Street, NW
^ Deanwood Recreation Center	1350 49th Street, NE

Table 5: Vote Centers that were Operationally Inaccessible due to Lack of Poll Workers at Curbside Voting

Vote Center	Address
Horace Mann Elementary School	4430 Newark Street, NW
Payne Elementary School	1445 C Street, SE
Stuart-Hobson Elementary School	410 E Street, NE
Kimball Elementary School	3375 Minnesota Avenue, SE
^West End Public Library	2301 L Street, NW
^ Deanwood Recreation Center	1350 49th Street, NE

Table 6: Vote Centers that were Operationally or Structurally Inaccessible due to an Obstruction in the Pathway to the Voting Area

Vote Center	Address
Fifteenth Street Presbyterian Church	1701 15th Street, NW
Janney Elementary School	4130 Albemarle Street, NW
Noyes Education Campus	2725 10th Street, NE
^Georgetown Neighborhood Library	3260 R Street, NW
^Raymond Recreation Center	3725 10th Street, NW
^ Turkey Thicket Recreation Center	1100 Michigan Avenue, NE
^ Ferebee-Hope Recreation Center	700 Yuma Street, SE

Table 7: Vote Centers that were Operationally or Structurally Inaccessible due to an Abrupt Rise in the Pathway to the Voting Area

Vote Center	Address
Fifteenth Street Presbyterian Church	1701 15th Street, NW
Shepherd Recreation Center	7800 14th Street, NW

Bunker Hill Elementary School	1401 Michigan Avenue, NW
Mt. Horeb Baptist Church	3015 Earl Place, NE
Kelly Miller Middle School	301 49th Street, NE
Cesar Chavez Public Charter School	3701 Hayes Street, NE
^ Georgetown Neighborhood Library	3260 R Street, NW
^ Deanwood Recreation Center	1350 49th Street, NE

Table 8: Vote Centers that were Operationally Inaccessible due to Closed, Heavy Doors with No Working Backup System

Vote Center	Address
Fifteenth Street Presbyterian Church	1701 15th Street, NW
Jefferson Middle School	801 7th Street, SW
Payne Elementary School	1445 C Street, SE
^Chevy Chase Community Center	5601 Connecticut Avenue, NW
^University of the District of Columbia	4200 Connecticut Avenue, NW
^ Turkey Thicket Recreation Center	1100 Michigan Avenue, NE

Table 9: Vote Centers that were Structurally or Operationally Inaccessible due to Narrow Doorways

Vote Center	Address
Fort Stevens Recreation Center	1327 Van Buren Street, NW
Bunker Hill Elementary School	1401 Michigan Avenue, NE
Union Temple Baptist Church	1225 W Street, SE
^Chevy Chase Community Center	5601 Connecticut Avenue, NW
^Benning Stoddert Recreation Center	100 Stoddert Place, SE
^ Ferebee-Hope Recreation Center	700 Yuma Street, SE
^ Arthur Capper Community Center	1000 Fifth Street, SW

Table 10: Vote Centers that were Operationally Inaccessible due to Loose Mats

Vote Center	Address
Murch Elementary School	4810 36th Street, NW
Payne Elementary School	1445 C Street, SE
Stuart Hobson Elementary School	410 E Street, NE
Allen A.M.E. Church	2498 Alabama Avenue, SE
Covenant Baptist Church	3845 South Capitol Street, SW
^ Prince Hall Masonic Temple	1000 U Street, NW

Table 11: Vote Centers that were Structurally Inaccessible due to Non-ADA-Compliant Ramp

Vote Center	Address
Shepherd Recreation Center	7800 14th Street, NW
Bunker Hill Elementary School	1401 Michigan Avenue, NE
Calvary Episcopal Church	820 6th Street, NE
^ Georgetown Neighborhood Library	3260 R Street, NW

Table 12: Vote Centers that were Operationally Inaccessible due to Inaccessible Elevators

Vote Center	Address
Fifteenth Street Presbyterian Church	1701 15th Street, NW
St. John's College High School	2607 Military Road, NW
Jefferson Middle School	801 7th Street, SW
Union Temple Baptist Church	1225 W Street, SE
^ Columbia Heights Community Center	1480 Girard Street, NW
^ Prince Hall Masonic Temple	1000 U Street, NW
^ Georgetown Neighborhood Library	3260 R Street, NW

Table 13: Vote Centers that were Operationally Inaccessible due to Lack of a Readily Available Audio Headset

Vote Center	Address
Fort Stevens Recreation Center	1327 Van Buren Street, NW
Calvary Episcopal Church	820 6th Street, NE
The ARC	1901 Mississippi Avenue, SE
^Georgetown Neighborhood Library	3260 R Street, NW

Table 14: Vote Centers that were Operationally Inaccessible due to Lack of 5-Foot Turning Radius at Accessible Electronic Ballot Marking Devices

Vote Center	Address
Horace Mann Elementary School	4430 Newark Street, NW
Oyster-Adams Bilingual School	2801 Calvert Street, NW
^ Georgetown Neighborhood Library	3260 R Street, NW

Table 15: Vote Centers that Lacked Privacy at Accessible Electronic Ballot Marking Devices

Vote Center	Address
Columbia Heights Education Campus	3101 16th Street, NW
^Georgetown Neighborhood Library	3260 R Street, NW
^Raymond Recreation Center	3725 10th Street, NW

Appendix D: Ballot Drop Boxes Surveyed

DRDC successfully surveyed all of the 55 available ballot drop boxes (100% of the total).

Vote Center	Address
Frank D. Reeves Center	2000 14th Street, NW
Mt. Pleasant Library	3160 16th Street, NW
Columbia Heights Shopping Center	3100 14th Street, NW
Truist Bank	1801 Adams Mill Road, NW
Banneker Community Center	2500 Georgia Avenue, NW
Georgetown Library	3260 R Street, NW
Martin Luther King Library	901 G Street, NW
West End Library	2301 L Street, NW
Stead Recreation Center	1625 P Street, NW
Foggy Bottom/GWU Metro	2301 I Street, NW
Shaw (Watha T. Daniel) Library	1630 7th Street, NW
Chevy Chase Library	5625 Connecticut Avenue, NW
Tenley-Friendship Library	4450 Wisconsin Avenue, NW
Cleveland Park Library	3310 Connecticut Avenue, NW
Palisades Library	4901 V Street, NW
Second District Police Station	3320 Idaho Avenue, NW
Guy Mason Recreation Center	3600 Calvert Street, NW
Hattie Holmes Wellness Center	324 Kennedy Street, NW
Petworth Library	4200 Kansas Avenue, NW
Shepherd Park (Juanita E. Thornton) Library	7420 Georgia Avenue, NW
Fourth District Police Station	6001 Georgia Avenue, NW
Lamond Recreation Center	20 Tuckerman Street, NE
Takoma Park Neighborhood Library	416 Cedar Street, NW
Woodridge Library	1801 Hamlin Street, NE
UDC Community College @ Backus	5171 South Dakota Avenue, NE
Perry Street Prep Charter School	1800 Perry Street, NE
Joseph H. Cole Recreation Center	1299 Neal Street, NE
Dunbar Senior High School	101 N Street, NW
Union Market DC	1309 5th Street, NE
Monroe Street Market	625 Monroe Street, NE

June 16, 2026 Primary Election

Harry Thomas Recreation Center	1743 Lincoln Road, NE
Northeast Library	330 7th Street, NE
Southwest Library	900 Wesley Place, SW
Eastern Market	225 7th Street, SE
DCPS Headquarters	1200 First Street, NE
Payne Elementary School	1445 C Street, SE
BOE Headquarters	1015 Half Street, SE
Capital View Library	5001 Central Avenue, SE
Deanwood Library	1350 49th Street, NE
Benning (Dorothy Height) Library	3935 Benning Road, NE
Francis A. Gregory Library	3660 Alabama Avenue, SE
Sixth District Police Station	5002 Hayes Street, NE
Benning Ridge Service Center	4525 Benning Road, SE
Penn Branch Center	3200 Pennsylvania Avenue, SE
Ridge Road Community Center	830 Ridge Road, SE
Rosedale Library	1701 Gales Street, NE
Anacostia Library	1800 Good Hope Road, SE
Parklands-Turner Library	1547 Alabama Avenue, SE
Bellevue (William O. Lockridge) Library	115 Atlantic Street, SW
Seventh District Police Station	2455 Alabama Avenue, SE
The ARC	1901 Mississippi Avenue, SE
Department of Human Services	2100 Martin Luther King Jr. Avenue, SE
Hendley Elementary School	425 Chesapeake Street, SE
Patterson Elementary School	4399 South Capitol Terrace, SW
Fort Stanton Recreation Center	1812 Erie Street, SE

Appendix E: Inaccessible Ballot Drop Boxes

Vote Center	Address
Georgetown Library	3260 R Street, NW
Foggy Bottom/GWU Metro	2301 I Street, NW
Second District Police Station	3320 Idaho Avenue, NW
Petworth Library	4200 Kansas Avenue, NW
Shepherd Park (Juanita E. Thornton) Library	7420 Georgia Avenue, NW
Southwest Library	900 Wesley Place, SW
Deanwood Library	1350 49th Street, NW
Benning (Dorothy I. Height) Library	3935 Benning Road, NE
Hendley Elementary School	425 Chesapeake Street, SE

Appendix F: Tables of Ballot Drop Boxes by Reason of Inaccessibility

Table 1: Ballot Drop Boxes that were Structurally Inaccessible

Vote Center	Address
Georgetown Library	3260 R Street, NW
Second District Police Station	3320 Idaho Avenue, NW
Petworth Library	4200 Kansas Avenue, NW
Deanwood Library	1350 49th Street, NE

Table 2: Ballot Drop Boxes that were Operationally Inaccessible due to an Obstruction in the Pathway

Vote Center	Address
Georgetown Library	3260 R Street, NW
West End Library	2301 L Street, NW
Petworth Library	4200 Kansas Avenue, NW
Shepherd Park (Juanita E. Thornton) Library	7420 Georgia Avenue, NW
Southwest Library	900 Wesley Place, SW
Benning (Dorothy I. Height) Library	3935 Benning Road, NE

Table 3: Ballot Drop Boxes that were Inaccessible due to an Abrupt Rise

Vote Center	Address
Second District Police Station	3320 Idaho Avenue, NW
Deanwood Library	1350 49th Street, NE

Table 4: Ballot Drop Boxes that were Operationally Inaccessible due to a Nonstable Surface

Vote Center	Address
Petworth Library	4200 Kansas Avenue, NW
Hendley Elementary School	425 Chesapeake Street, SE