IMI CORNELIUS INC.
One Cornelius Place
Anoka, MN 55303–6234
Telephone (800) 238–3600
Facsimile (612) 422–3255

Equipment Updates

3rd Qtr 1995

➠**PRODUCT:** POST MIX VALVES

➠**Subject:** SF-1 Flow Control Retainer Redesign

The design of the flow control retainer changed to provide a more positive and even pressure on the water and syrup sides of the valve. The new design applies pressure to both the water and syrup flow control housings at the same time. It is necessary to remove all four screws when removing the retainer to gain access to either or both flow controls (after the valve is removed from the dispenser). The new design, P/N 4147, will be a direct replacement for all old styles.

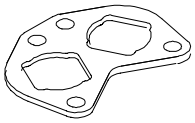

P/N 4147

RB

➠**PRODUCT:** UNIVERSALS

➠**Subject:** Universal 750, Pre-Mix, Electrical Safety

When plugging in the Universal 750 use only the cord supplied on the unit. **If an extension cord must be used**, please conform to the following:

- UL Approved
- Approved for outdoor use
- Use only a grounded cord with the ground lead intact
- Conform to all local and federal codes
- Use minimum length possible
- Use 12 gauge with a 100′ cord (Maximum recommended length)
- Inspect cords frequently for damage, do not use damaged or frayed cords

RB

➠**PRODUCT:** ICE MAKERS

➠**Subject:** Water Reservoir Screen

On “I” series ice makers shipped after August 1, 1995, we have installed a water pan screen in the reservoir to prevent foreign material from entering the internal water system.

It is recommended that these screens be installed on all “I” series ice makers shipped prior to August 1, 1995. Screen kits may be ordered at No Charge through any Sales/ Service administrator . The part number for the screen kit is 161456-061.

JC

➠**PRODUCT:** FCB

➠**Subject:** New Water Pressure Switch

The old water pressure switch, P/N 325777-000 has been replaced with P/N 3159.

The new switch is not a direct replacement for the old switch. If the old switch is being replaced with the new one, kit P/N 3811 must be used.

Please note this information on your FCB Illustrated parts pages

- Discontinued Switch (Ranco) 325777-000
- New Switch (Shurflo) 3159
- Replacement Kit 3811

Kit 3811 Contents	
Switch	3159
Fitting, 1/4 MPT	183047-000
Sealant	000225858

BS