

ILYA Consulting Limited
Vehicle Engineering
DARJAC Racing
101 Crow Green Road
Pilgrims Hatch
Brentwood
Essex CM15 9RP
Mobile 07807 689538

15/03/2011

Customer Account Number :- TKING04-150909
Vehicle : E34 //M5 3.8 Touring
Colour : Metallic Sterling Silver
Registration Identity : M934 YWL
Chasis : BLO 1619
Mileage : 202,700 kms

Further to our recent discussions, please find those tasks completed or investigated at your request.

Inspection 1 service

Oil service inclusive of oil, filter	£370.00
Air filter	
Brake fluid	
Coolant change.	
Spark plugs.	

Additional service items :

2 x front accessory drive belts to water pump / alternator & pas steering	£ 22.00
Cabin Microfilter	£28.00

Clutch slipping & loose gear shift.

Clutch assembly	£303.00
Clutch bolts	£ 1.98
Flywheel- Dual mass.	£ 592.00
Flywheel bolts @ £3.60 ea	£ 28.80
Transmission shift kit repair kit inc linkage & bushings.	£ 58.00
Transmission to prop-shaft damper (guibo flex disc)	£ 74.00
6 x self locking nuts, re the above.	£ 3.98
4 cans of degreaser & brake cleaner to remove sludge from transmission & rear of engine area behind flywheel	£24.00

Exhaust repair kit = seal rings & bolts to rear & nuts self locking front & rear	£ 48.00
2 x rear exhaust hangers rubbers	£ 7.48

1 x nsr body mounted hanger	£ 7.42
-----------------------------	--------

Oil leaks

Crankshaft rear main oil seal	£ 14.95
Cylinder head drain tube gasket & O rings	£ 7.92
Drei-bond gasket sealant	£ 9.01

Air leaks:

EGR valve	£31.05
Sealant / threadlock	
Engine mount	£ 48.65

Headlamp & foglamp washer /electrical assembly repairs:

3 non return valves & O rings	£ 27.75
Repair off side front body wiring & replace damaged light capsule to ballast damaged By impact	£ 55.10

Fit rear discs & adjust @ £46.20 ea	£ 92.40
-------------------------------------	---------

Materials	£ 2.50
-----------	--------

£1857.99

V.A.T @ 20%	£ 371.60
-------------	----------

Parts & V.A.T inc	<u>£2229.59</u>
-------------------	-----------------

We hope we have provided the service you expect of us.

Yours Sincerely
DARJAC Racing.

Other incidentals found on inspection.

Sump & front timing cover leaking considerably. Replacement is advised.

I believe that the chain tensioner that is weeping is best attended to in the course of this job or pay twice for doing so.

Differential output seals weeping.

Some corrosion evident on bottom of offside front door.

Tailgate glass supporting dampers are failed.


15th Sept 2009

Customer Account Number :- TKING04-150909
Vehicle : E34 /M5 3.8 Touring
Colour : Metallic Sterling Silver
Registration Identity : M934 YWL
Chassis : B10 1619
Mileage : 187,890 kms



Work Order ID R009681
Customer Number 9428
Name BMW M5
License M934 YWL
Technician DARJAC
Mileage 202750
Time Printed 9.3.11

BMW : 5 Series - E34 (1/88 - 1997) ; M5 : 18" Wheel

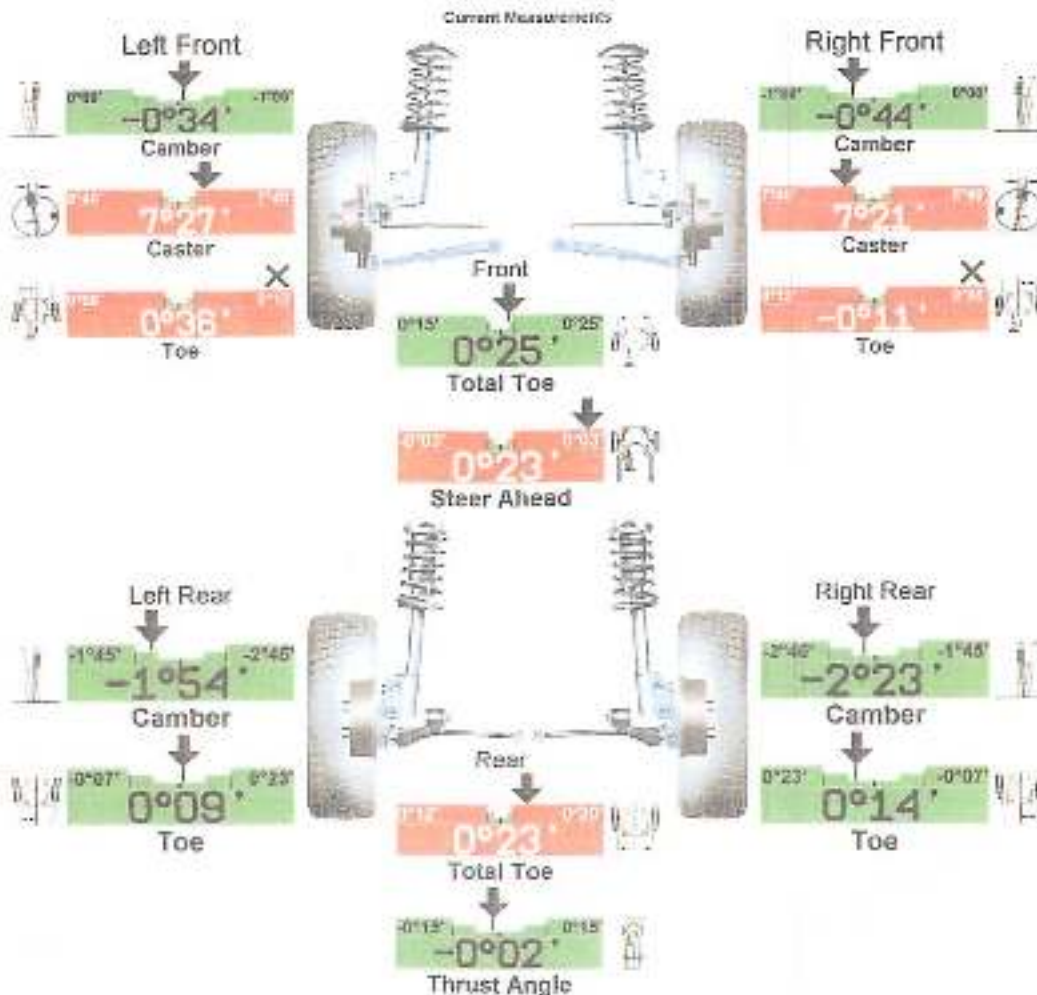

VT32 ADVISORY NOTICE

616148861061

BMW

202668 Km

M934YWL

WBSHJ91030BL01619

Advisory Items

- 001 Nearside rear Shock absorber has a slightly reduced damping effect [2.7.5]
- 002 Nearside rear Shock absorber has a light misting of oil [2.7.3]
- 003 Offside rear Shock absorber has a light misting of oil [2.7.3]
- 004 Nearside rear Brake pipe slightly corroded [3.6.B.2c]
- 005 Offside rear Brake pipe slightly corroded [3.6.B.2c]
- 006 (front to rear) Brake pipe slightly corroded [3.6.B.2c]
- 007 Nearside rear Tyre worn close to the legal limit [4.1.E.1]
- 008 Offside rear Tyre worn close to the legal limit [4.1.E.1]

page 1

D. OATES

09/03/2011 11:42

1ALS91

SWAN COACHWORKS LIMITED
UNIT 1 PAYCOCKE MEWS
BASILDON
SS14 3HU

01268533993

ILYA Consulting Limited
Vehicle Engineering
DARJAC Racing
101 Crow Green Road
Pilgrims Hatch
Brentwood
Essex CM15 9RP
Mobile 07807 689538

15th Sept 2009

Customer Account Number :- TKING04-150909
Vehicle : E34 //M5 3.8 Touring
Colour : Metallic Sterling Silver
Registration Identity : M934 YWL
Chasis : BLO 1619
Mileage : 187,890 kms

Dear Mr Kingswell

Further to our recent discussions, please find those tasks completed or investigated at your request.

Scope of work :

Repair rear bumper mounting to offside rear.	£ 17.82
Remove & trim & bumper bar. Strip & rebuild	£ 40.00

Valve clearances :

Nominal service labour =	£ 140.00
4 part Valve cover gasket set	£ 43.00
All clearances within spec. 5 on lower limit these will require change at next inspection service.	
Replace 6 x Bremi ignition coil pack modules @ £57.00 ea	£342.00
Replace 6 x spark plug extensions & isolaters @ £ 4.84 ea	£29.84
Spark plugs x 6 Bosch Y6DC	£ 33.00

Service items :

Oil service inclusive of oil, filter	£ 70.00
Engine air-filter replaced as very dirty	£ 17.00

Steering :

Replace centre tie rod	£ 117.00
Replace idler arm bush.	£ 13.70
5 x self locking nuts @ 0.68p = £3.40	No charge
Labour	£ 120.00

KDS alignment:

£140.00

Replace engine compartment hood liner	£ 73.14
8 off new hood fasteners @ 0.48p ea supplied	No charge
Labour	£ 20.00

Intake manifold.

You can't see what's going on until the manifold chamber is removed.

Once the intake chamber was removed, it was clear that investigation had taken place previously. What a mess.

No fewer than 7 hoses were split, perished or not even attached to the valves, check valve or air charge chamber.

One valve was not actuating when powered up with a multi-meter.

The parts were replaced & new hoses cut to length.

However, I am sad to say that the problem goes further than the initial work that normally resolves the resonance charge issues on the B38.

However, getting the vacuum tubes, check valve & one electric solenoid valve operative was required to confirm that the issue is definitely electrical signal based from DME.

This is not ideal, but a process of servicing those failed parts was unavoidable.

Another check of the circuit was used by taking a 2 pin power & ground feed from the idle charge valve & connected to the solenoid valve controlling the vacuum feed to the resonance flap.

At start up the valve operated & resonance flap turned but did not reset to its stop.

This confirmed the valve & vacuum circuit is operative but not cycling.

All supporting relays to DME were swapped from an fully operative vehicle to support diagnosis.

Re-connection & voltage check is indicating a DME fault. The B36 3.6 has a separate control unit to operate the resonance flap. The B38 3.8 is integrated into the Bosch 3.3 DME unfortunately.

I spent some 9 hrs over two days on 15th / 16th Sept 2009 on the intake manifold work to tell us what we know at this point.

Road test was delayed due to Parts to secure bumper bar arriving for the wrong vehicle chassis no.

I would ask that the required parts cost is met & 4 of the 9 plus hrs is covered as this was necessary work to support the initial service of the intake parts & vacuum lines.

I had not agreed the further diagnosis work so I will not ask you to meet this cost as there is more work to do which is very disappointing.

I won't even put numbers to the time spent going through the E34 M5 1992 on electrical trouble shooting diagrams to find that these UK manuals do not correspond with the wiring colours on LHD only Touring !

Further work to establish whether the DME can be repaired or just replaced.

Parts, Intake

I would ask you to meet the cost of the parts used which were failed for perished.

Valve discharge	22.82
Hoses vacuum & check valve	42.20
Labour	<u>£140.00</u>
Parts	<u>£ 751.52</u>
V.A.T on parts @ 15 %	<u>£ 112.73</u>
Total labour	<u>£ 670.00</u>
Total amount of you including V.A.T	<u>£ 1534.25</u>

Other incidentals found on inspection.

Exhaust shield found to be vibrating at certain rpm.

This was removed & repaired.

No charge

The off side intermediate exhaust hanger has failed due to an impact.

The rubber is missing.

£ 14.95 plus V.A.T

This will need addressing when the exhaust is welded.

The front main engine under-shield is missing or is torn off. Replacement should be made sooner rather than later. Part is Germany only @

£ 69.20 plus V.A.T

Fastener kit @

£ 5.00 plus V.A.T

EGR valve supporting emission control has corroded & split in half. This will affect idle & emission control. Replace at earliest opportunity.

£ 140 plus V.A.T

Labour to fit @ 1 hrs.

KDS & rear suspension.

The vehicles geometry is good. However, there is no more adjustment left within the eccentric bolts that adjust the trailing arms toe setting.

In the future, removal & service of the trailing arm bushes = intensive labour or

Complete trailing arm replacement will be necessary to maintain correct geometry.

Many M5 E34 are now at this stage in the vehicles life, including my own M5.

Consider this for future reference & budget for this over the next couple of yrs.

We hope we have provided the service you expect of us.

Yours Sincerely
DARJAC Racing

ILYA Consulting Limited
Vehicle Engineering
DARJAC Racing
101 Crow Green Road
Pilgrims Hatch
Brentwood
Essex CM15 9RP
Mobile 07807 689538

28th August 2008

Customer Account Number :- TKING01-130308

Vehicle : E34 //M5 3.8 Touring

Colour : Metallic Sterling Silver

Registration Identity : M934 YWL

Chasis : BLO 1619

Mileage : 182,000 Kms

Dear Mr Kingswell

Further to our recent discussions, please find those tasks completed or investigated at your request.

Scope of work :

- 1. EDC suspension evaluation & most cost effective repair solution.**
- 2. Brakes not fully operational & hand brake ineffective.**
- 3. Address poor general running of engine- address electronic sensors prior to intake manifold vacuum overhaul.**
- 4. Align suspension using full KDS alignment methods.**
- 5. Address minor items like LED side lights & bonnet dampers etc.**

EDC :

Vehicle inspected & a decision has been taken to leave the rear axle EDC.

Whilst not new, it has not failed.

Unfortunately the considerable period of time that front EDC has been failed has impacted on other suspension & steering related components.

Parts – suspension strut assembly

2 x front axle EDC damper units @ £808.51 ea – 7.5% = £121.28	£1496.02
2 x front axle spring set @ 76.17 ea – 5% = £7.62	£ 144.72
2 x front axle guide supports @ £42.22 ea – 5% = £4.22	£ 80.22
4 x front axle guide upper & lower washer / dust seal	£ 2.42
2 x additional shock rubbers @ 10.90 ea	£ 21.80
2 x rubber boot cover @ £ 8.77	£ 17.54
4 x upper & lower spring pads @ 2.51 ea	£ 10.04

4 x holder spring pad isolator @ £3.32	£ 13.28
4 x upper & lower spring seat rubber dampers @ £7.96 ea	£ 31.84
2 x wheel bearing dust shields	£ 2.64
2 x nut- hub, wheel bearing	£ 6.98
Parts – suspension strut assembly cont'd	
2 x damper gland nuts M14 X 1.5	£ 2.98
1 x tube loctite 271 locking thread compound	£ 4.95

Parts – suspension links & bushes front	
2 x front stab links & self locking nuts @ £25.54 ea – 10% = £ 5.11	£ 45.97
2 x front Upper brake force thrust control arms @ £ 40 .38 ea	£ 80.76
4 x Power flex black //M-Sport thrust arm inserts for the above	£ 80.00
4 x thrust washers	
2 x alignment inserts – steel.	
4 x M14 x 1.5 self locking nuts – upper thrust arm & ball joint end.	£ 5.96

Parts – suspension links & bushes rear.	
2 x connector links – trailing arm to rear axle subframe carrier	£ 120.28
4 x M14 carrier bolts	£ 7.98
2 x M14 x 1.5 self locking nuts	£ 2.98
2 x rear subframe beam bushes @ £22.50 ea.	£ 45.00

Brakes – front & rear axle.	
2 x front discs @ £111.00 ea – 10% = 22.20	£ 199.80
2 x rear disc made good & compound sanded *	
Front & rear axle set – Endurance compound Kevlar pad	£ 179.00
Rear axle set – hand brake shoes.	£ 48.01
1 x front ABS sensor	£ 9.96
1 x rear ABS sensor	£ 6.51
Brake fluid @ 2 litres	£ 14.00
Brake cleaner @ 2 x 500ml	£ 12.00

KDS alignment.	
No parts reqd, just set labour price	£ 100.00

Engine electrical / electronic.	
1 x throttle position sensor	£ 48.21
1 x MAF air flow meter @ £512.00 – 10%	£ 461.00

Lighting front	
1 pair of M-Tech led side light upgrade	£ 10.00

Body & trim	
1 pair of hood front damper @ £20 ea -10%	£ 36.00
1 x interior trim piece EDC switch housing.	£ 2.16

Total cost of parts	£ 3351.00
V.A.T on the above	<u>£ 586.43</u>
Total inclusive of V.A.T	<u>£ 3937.44</u>

Complementary oil service @ £65.00, not charged to customer.

Labour to undertake the above tasks

Suspension front :

Struts ,links & bushes, many of which reqd cutting off the vehicle.

12 hrs @ 35.00 ph £ 420.00

Upper thrust arm labour to prep & install powerflex bushes

3 hrs @ £35.00 £ 105.00

Suspension bushes & links rear

6 hrs @ 35.00 ph £ 210.00

Brake service.

Rebuild front & rear callipers.

Rebuild hand brake actuation parts & refit new hand brake shoes.

Bleed brakes.

8 hrs @ 35.00 per hr. £ 280.00

Fit hood dampers, throttle position sensor, MAF & side lights.

1 hr @ 35.00 £ 35.00

Total labour cost = 30 hrs @ £ 35 ph £ 1050.00

Paint work.

Total cost inclusive of all labour & materials. £ 1000.00

Repair & paint hood & blend into front wings as necessary

Repair front bumper & paint

Repair ns rear & offside rear quarters & paint, blending as necessary.

The intake manifold is work out standing.

The air conditioning could not be inspected due to overrun of timings to repair vehicle & then some extra hrs reqd to resolve bumper repair & paint.

As with all works undertaken above, its guaranteed.

We hope that our service to you has been satisfactory.

Should you have any quieries, please do not hesitate to contact us.

Yours Sincerely


DARJAC Racing

SUPER TYRES
PERFORMANCE ALIGNMENT SPECIALIST

ADVISE CHECK ALIGNMENT EVERY 10,000 MILES

Work Order ID R008441
Customer Number 8124
Name BMW M5
License M834 YWL
Technician LEE
Mileage 178845
Time Printed 23.8.08 11:13

BMW : 5 Series - E34 (1/88 - 1997) : M5 Touring : 17" Wheel

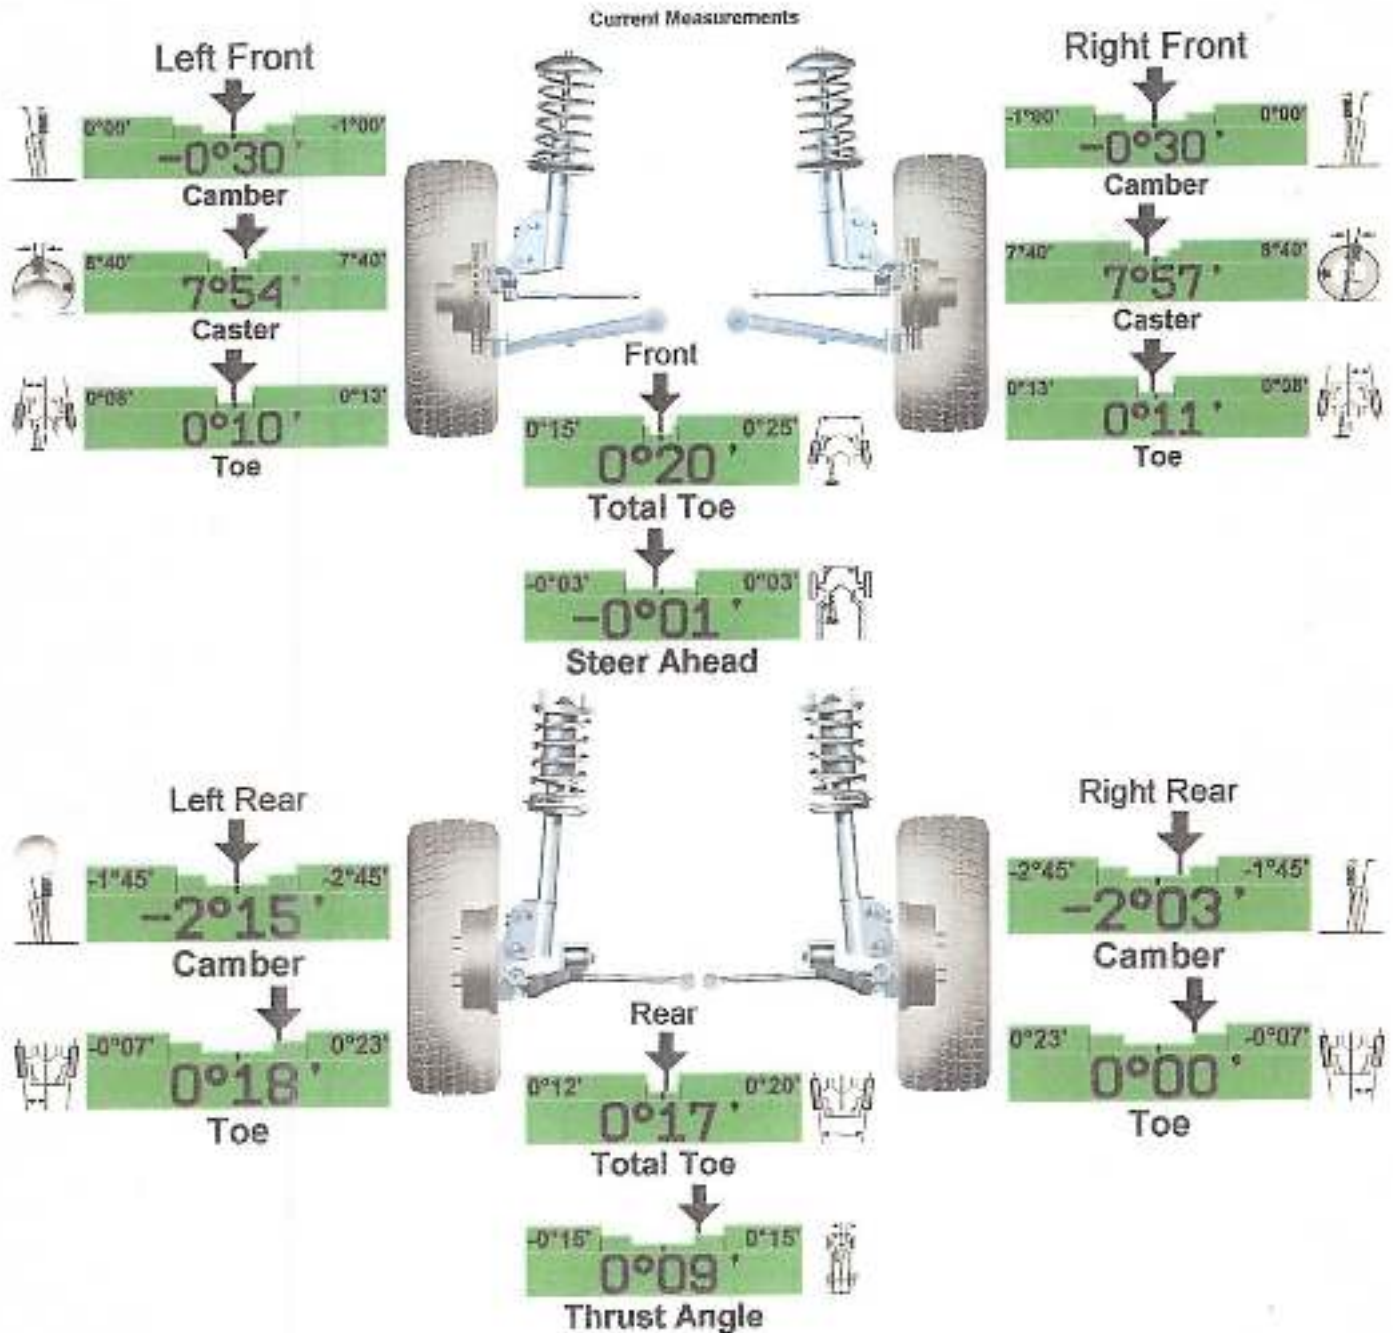


SUPER TYRES PERFORMANCE ALIGNMENT SPECIALIST

ADVISE CHECK ALIGNMENT EVERY 10,000 MILES

Work Order ID	R008441
Customer Number	8124
Name	BMW M5
License	M934 YWL
Technician	LEE
Mileage	178845
Time Printed	23.8.08 10:26

BMW : 5 Series - E34 (1/88 - 1997) : M5 Touring : 17" Wheel

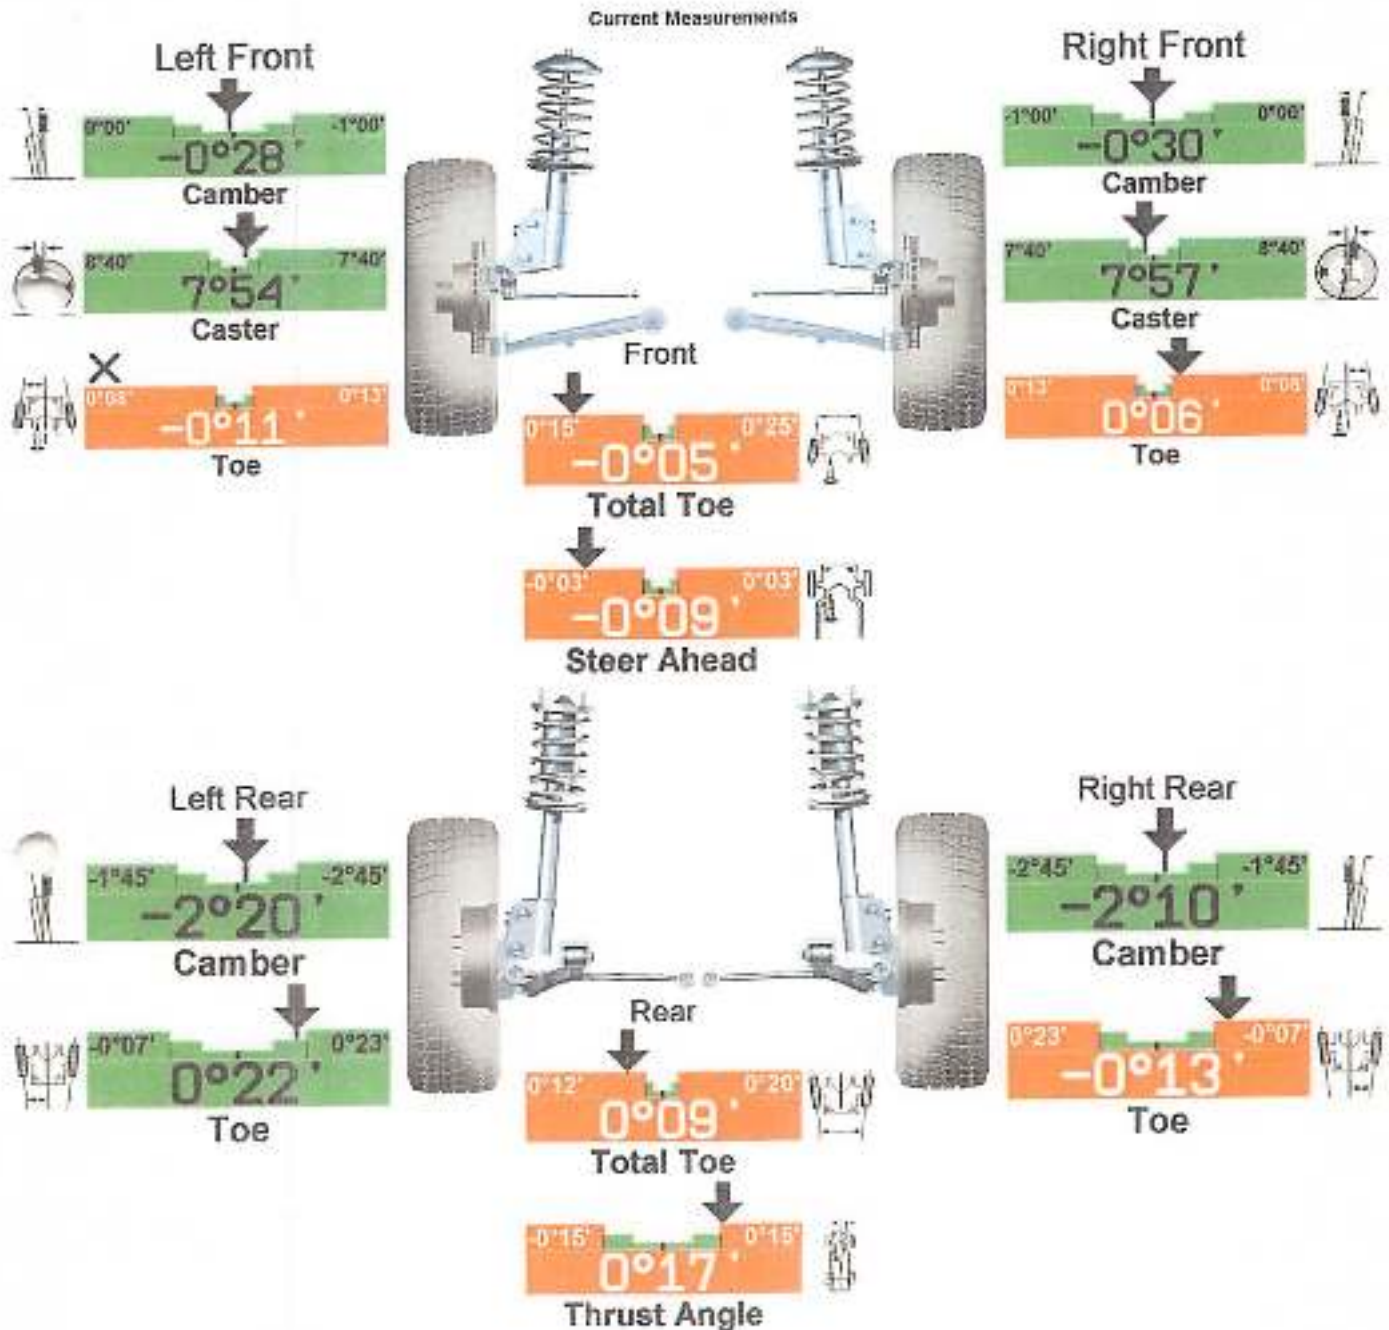

ILYA Consultant Engineers Limited

13TH March 2008

Customer Account Number :- TKING01-130308

Vehicle : E34 //M5 3.8 Touring

Colour : Metallic Sterling Silver

Registration Identity : M934 YWL

Chasis : BLO 1619

Mileage : 171172 Kms

Further to our recent discussions, please find those tasks completed or investigated at your request.

Scope of work :

Inspection of vehicle including fault code read out & reset £ 105.00

Cooling overhaul :

Drain coolant

Replace coolant & de-ionised water @ 12 x 1 litre £ 45.00

Replace De-gas header tank £ 41.40

Replace cooling pack top hose. £ 30.73

Replace blocked additional electric water pump £ 91.86

Labour :

Remove all hoses & from engine, heater matrix, water valve assembly & flush with coolant.

Remove thermostat housing & clean.

Remove blocked breather nipple from exhaust side of engine & clean.

Unblock & flush all breather hoses terminating a@ neck of De-gas header tank.

Repair wiring to heater valve assembly.

The set menu cost of this service. 8 hrs @ £35.00 ph £ 280.00

Valve clearances :

Nominal service labour = £ 120.00

6 new shims added @ £4.76 ea & 2 moved. £ 28.56

4 part Valve cover gasket set £ 39.00

Litronic head lamp conversion :

2 x complete pairs fitted to dip beam lights & fog lamp units replacing both std H1 units. £ 500.00

Repair faulty corroded & brittle wiring to both dip light units.

Replace off side front fog lamp backing cover due to failed compression seal causing internal wiring to corrode.

Labour £ 105.00

Backing cover for fog lamp @ 1 unit £ 18.01

Service items :

Oil service inclusive of oil, filter £ 70.00

Engine air-filter replaced as existing part was black ! £ 15.00

6 off Bosch Y6DC spark plugs £ 30.00

Air conditioning :

Replace passenger compartment micro-filter £ 24.00

Labour £ 50.00

Air conditioning vacuum check & recharge £ 70.00

£ 1663.56

V.A.T @ 17.5 % £ 291.12

Total amount of you including V.A.T £ 1954.68

Test drive & future works on the vehicle :

The vehicles cooling system is good.

The engine is set up mechanically.

Power is flat below 4000 rpm.

The intake resonance flap is not turning.

The intake manifold requires removal to service the system.

Once attended to, the vehicle will be transformed.

The suspension...damn !

The front axle has none what so ever !

Axle pair of EDC dampers, top mounts, springs, bump rubbers & dust shields.

Vertical stab links very worn.

Ant-roll bar bushes are worn.

Rear axle requires sub-frame bushe's, Pitman arm links & vertical drop links.

Transmission & drive-line :

There is noticeable whine & drag in the lower rpm range in all gears from initial take up on the clutch to move off & subsequently at low engine speeds.

This requires investigation.

I would suggest that either the clutch release bearing is failing or the noise is transmission first motion input shaft.

I hope it's the former !

Sump is weeping but not badly enough to require changing.

Oil gravity drain pipe from head to sump is weeping where "O" ring has perished. (normal)

Front bumper bar requires strip down plasti-weld, primer & paint.

The repair currently undertaken amounts to some glass re-inforced plastic matting to the inside face.

Fault codes :

DME is clear.

All heater fault codes are no longer present.

Legend air bag fault codes cleared.

Conclusion :

With suspension & intake addressed, what more could you want.

The car will hold it's value once the minor cosmetics & suspension have been addressed.

Yours Sincerely

J.R. Richardson

Managing Director


ILYA Consulting Engineers Limited

101 Crow Green Road

Pilgrims Hatch

Brentwood

Essex CM15 9RP



TAX DATE	INVOICE NO.
29/02/2008	10522

VAT REG NO
750 1749 40

Cash Sale

QUANTITY	DESCRIPTION	RATE	NET AMOUNT	VAT%
1	Alpine SWE-1000 Speaker	127.65	127.65	17.50%
1	Connection BEST 2 Channel RCA Cable (500cm)	17.87	17.87	17.50%
1	Dark Grey Accoustic Carpet (Std)	17.12	17.12	17.50%
3.5	Workshop Labour	42.55	148.93	17.50%

VAT%	VAT AMOUNT	VAT%	VAT AMOUNT		
				SUBTOTAL	£311.57
@ 17.5%	54.53			VAT	£54.53
Cheques should be made payable to ACCUTEK. All goods remain the property of ACCUTEK until payment has been made in full. Interest will be charged @ 8% per month if payment has not been received within 60 days of invoice date.				TOTAL	£366.10



Unit B, Foundry Yard, London Road,
Kings Worthy,
Winchester, SO23 7QG
Tel: 01962 886900 Fax: 01962 886933

Invoice

TAX DATE	INVOICE NO.
23/08/2007	9917

VAT REG NO
750 1749 40

INVOICE TO:

P.O. NUMBER	TERMS	PROJECT
	Due on receipt	A

QUANTITY	DESCRIPTION	RATE	NET AMOUNT	VAT%
1	Audison SRx 4 Four Channel Amplifier	238.30	238.30	17.50%
1	Focal Polyglass 130mm Slim 130mm 2 Way Comp Set 60w	187.23	187.23	17.50%
1	Focal Polyglass 130mm 2-way Component Set 60w	127.65	127.65	17.50%
1	Connection BEST 4 Channel RCA Cable (500cm)	27.24	27.24	17.50%
1	Connection BEST Amp Power Kit	25.52	25.52	17.50%
1	Connection BEST Speaker Cable 10m	8.51	8.51	17.50%
3.75	Workshop Labour to install above	42.55	159.56	17.50%
1	Install Customers H/Unit	41.28	41.28	17.50%
1	Celsus AHU3106 Yellow Mini ISO to 4 RCA	11.03	11.03	17.50%

VAT%	VAT AMOUNT	VAT%	VAT AMOUNT	SUBTOTAL	£826.32
@ 17.5%	144.61			VAT	£144.61
goods should be made payable to ACCUTEK goods remain the property of ACCUTEK until payment has been made in full. rest will be charged @ 5% per month if payment has not been received within 60 of invoice date.				TOTAL	£970.93

FAB Recycling Ltd.

Broadmoor Road
Cinderford
Gloucestershire
GL14 2YL

www.fabdirect.com

sales@fabdirect.com

Tel: 01594 827333

Fax: 01594 829455

VAT Invoice No.: 82934
VAT Invoice Date: 14.02.2008 10:21
VAT Invoice To:

PostCode:
Telephone:

Delivery Details

F.A.O.:

PostCode:
Telephone:

Tag No	Part Location	Our Ref	Description	Ex. VAT	VAT@ 17.5%	Inc. VAT
53821	No Location	12694	5 Series E34, BMW, Boot Carpet, 1996, Touring, 518i M43	£25.00	£4.38	£29.38
	No Location	PP	Postage & Packing	£9.50	£1.66	£11.16
Totals:				£34.50	£6.04	£40.54

Seller: Helen Perry
Comments:

Parts Ready By: 3:00PM Thursday 14 February 2008

Payment Method: Debit Card
Card No: **** *3504 Card Issue No: 9 Expires End: 03/10



Parts CORRECTLY SUPPLIED and then returned are subject to a 25% HANDLING CHARGE. PROOF OF PURCHASE REQUIRED.

All parts returned by COURIER must be CLEAN and FREE FROM OIL, CORRECTLY LABELED and PROPERLY PACKAGED to avoid damage. Items not meeting these requirements WILL FORFEIT SURCHARGE REFUND.

Items returned for REFUND MUST HAVE COPY OF INVOICE or a COVERING LETTER stating ORIGINAL INVOICE NUMBER.

WARRANTIES COVER PARTS ONLY, and only apply IF PARTS ARE FITTED BY A RECOGNISED INDEPENDENT SPECIALIST OR APPROVED DEALER.

PLEASE NOTE: ALL OUR PARTS ARE SECURITY MARKED,
ES&CE

Registered Office: Broadmoor Road, Cinderford, Gloucestershire, GL14 2YL
Company Number: 4421786 VAT Registration Number: 594 4209 21

BDAY

- £300
- hot
- layers
- dinnies
- licence + passport
- mac?
- baguettes

CASH SALE INVOICE

Invoice Name & Address	Customer Name & Address

Order Number		You were served by:		Operator:	
		Jason Vines		JV	
Account No.		Document Number		Date & Tax Point	
C0006		40020033		19/05/2007	
				16/05/2007	
Make & Model		Chassis No.		Mileage	
M5 LHD		BL01619		158188	
				12:02	
				1	
Reference No.		Reg No.		Reg Date.	
		M934YWL		11/08/1994	
				VSB No.	
				W.I.P. No.	
				Job No.	
				W 12037	
				30308	

****WE SUPPLY & FIT TYRES** *OUR PRICES ARE COMPETITIVE***
PLEASE GIVE US THE OPPORTUNITY TO PROVIDE A QUOTATION.

	Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
C	1153421 Replacing Vacuum Switch due to hesitation may have damaged the DME Control unit, check wiring & Connections DME control unit poor, requires new - ESTIMATE IN POST			4.00	28.80	S
X	B11.74.1.742.711 VALVE	10	20.60	2	18.54	S
X	B12.52.1.427.615 019745/BOUSING	10	0.77	0	0.70	S
X	B12.52.1.732.694 PROTEC COVE	10	0.90	0	0.81	S
X	B12.52.1.427.608 019745/CONTACT	20	0.21	0	0.36	S
				Sub-total	49.23	
C	6210000 Check function of instrument cluster checked wiring & connections all good removed cluster to check top speed regulation motor, reg new & poss control unit			12.00	86.40	S
				Sub-total	86.40	

	V	Rate	Service/Goods	V.A.T.	Net	
Parts	S	17.50	135.63	23.74	135.63	
Surcharge					23.74	
Labour					159.37	
Sublet					159.37	
Menus					0.00	
					Owing	

Address: Papyrus Road
 Warrington, Peterborough
 PE4 5HA
 Telephone: 01733 707070
 Fax: 01733 707071
 e-mail: info@sycamorebmw.co.uk
 Internet: www.sycamorebmw.co.uk

Registered Office: Sycamore (Peterborough) Ltd
 5 Ward Walk
 Leicester
 LE1 8LT
 216664
 GB 120 409328

CASH SALE INVOICE

Invoice Name & Address

Customer Name & Address

Order Number		You were served by:		Operator:	
		Jason Vines		JV	
Account No.	Document Number	Date & Tax Point		Repair Date	
C0006	40019495	26/04/2007		18/04/2007	
Make & Model	Chassis No.	Mileage		Time	Page
M5 LBD	BL01619	156597		17:29	1
Reference No.	Reg No.	Reg Date	VSF No.	W.I.P. No.	Job No.
	M934YWL	11/08/1994		W 11393	29378

****WE SUPPLY & FIT TYRES** *OUR PRICES ARE COMPETITIVE***
NEW MODEL LAUNCH X5 28/04/07 3 SERIES CONVERTIBLE 24/03/07

	Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
T	1199000 oil wasp from engine bay, pls investigate			0.00	0.00	S
				Sub-total	0.00	
C	0011359 investigate oil leak, r/h/f of engine, remove wash tank & Trims to access			6.00	43.20	S
				Sub-total	43.20	
C	1200009 clean & identify leak as blank plug next to chain tensioner as loose, R&R fit new seal, steam clean engine & undertrays to clean of oil			6.00	43.20	S
	B34.11.1.123.072 Screw	20	0.60	0	1.08	S
				Sub-total	44.28	
C	3411220 replace both front brake discs & Pads as non-gen BMW & Worn			10.00	72.00	S
X	B34.35.1.179.820 Brake Pad Sensor	10	5.37	0	4.84	S
X	B34.11.1.159.279 REPAIR KIT	10	47.00	4	42.30	S
X	B34.11.2.226.385 019110/BRAKE DISK	20	105.54	21	189.98	S
X	B81.22.9.407.103 Lube	20	0.59	0	1.07	S
X	B83.11.9.407.848 Brake Cleaner	10	4.29	0	3.87	S
				Sub-total	314.06	

E & O E

V	Rate	Service/Goods	V.A.T.

Address: Poynton Road
 Warrington, Peterborough
 PE4 5W
 Telephone: 01723 707070
 Fax: 01723 707071
 e-mail: mail@sycamorebmw.co.uk
 11/02/01 www.sycamorebmw.co.uk

Registered Office: Sycamore (Peterborough) Ltd
 3 West Walk
 Leicester
 LE1 9AT
 210564
 GB 120 407325

CASH SALE INVOICE

Invoice Name & Address

Customer Name & Address

Order Number		You were served by:		Operator:	
		Jason Vines		JV	
Account No.	Document Number	Date & Tax Point		Repair Date	
C0006	40019495	26/04/2007		18/04/2007	
Make & Model	Chassis No.	Mileage	Time	Page	
M5 LHD	BL01619	156597	17:29	2	
Reference No.	Reg No.	Reg Date.	VS# No.	W.I.P. No.	Job No.
	M934YWL	11/08/1994		W 11393	29378

****WE SUPPLY & FIT TYRES** *OUR PRICES ARE COMPETITIVE***

NEW MODEL LAUNCH X5 28/04/07 3 SERIES CONVERTIBLE 24/03/07

	Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
T	6199000 uk o/s drivers door pin does not lock/unlock from remote, okay manually, pls investigate			0.00	0.00	S
				Sub-total	0.00	
C	5100001 investigate front right door central locking inop remove trims & Check signals to actuator, requires new			2.00	14.40	S
				Sub-total	14.40	
C	5126500 Replace right Fr door actuator B67.11.1.387.726 Door Lock Actuator	10	54.05	5	48.65	S
				Sub-total	91.85	
T	1199000 slight hesitation between 2-4rpm from warm or cold, cust suspects coil packs, pls investigate			0.00	0.00	S
				Sub-total	0.00	
C	0000005 Calling fault memory in diagnosing system no faults stored for hesitation or misfires			3.00	21.60	S

£ 80.4

V	Rate	Service/Goods	V.A.T.

Address: Robert Road
Wellingborough, Peterborough
PE4 5JN
Telephone: 01733 400000
Fax: 01733 702071
e-mail: info@sycamorebmw.co.uk
www.sycamorebmw.co.uk

Registered Office: Sycamore BMW Service Ltd.
3 West Way
Lancaster
LA1 5LT
216604
01525 40773 28

Registered &
VAT Registered No.

CASH SALE INVOICE

Invoice Name & Address

Customer Name & Address

Order Number		You were served by:		Operator:	
		Jason Vines		JV	
Account No.	Document Number	Date & Tax Point		Repair Date	
C0006	40019495	26/04/2007		18/04/2007	
Make & Model	Chassis No.	Mileage	Time	Page	
M5 LHD	BL01619	156597	17:29	3	
Reference No.	Reg No.	Reg Date.	VSB No.	W.I.P. No.	Job No.
	M934YWL	11/08/1994		W 11393	29378

****WE SUPPLY & FIT TYRES** *OUR PRICES ARE COMPETITIVE***
NEW MODEL LAUNCH X5 28/04/07 3 SERIES CONVERTIBLE 24/03/07

	Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
				Sub-total	21.60	
C	1213009 Check all ignition coils & test all okay			8.00	57.60	S
				Sub-total	57.60	
C	4100009 Roadtest to identify hesitation around 2-4000rpm light throttle			2.00	14.40	S
				Sub-total	14.40	
C	0055912 Function test, check throttle pot signals & DME Control unit okay			5.00	36.00	S
				Sub-total	36.00	
C	6100000 Check intake, identified air flap inop, check vacuum hoses okay & Actuator unit okay, traced fault to electro pneumatic valve failed nb. possible damage to DME Control unit			5.00	36.00	S
				Sub-total	36.00	
C	6450509 Discharge, evacuate & fill air condition			12.00	86.40	S
L	9998			1.00	35.00	S

E & O. E

V	Rate	Service/Goods	V.A.T.

Address: Poplar Road
 Workington, Peterborough
 PE4 5HA
 Telephone: 01733 707070
 Fax: 01733 707071
 e-mail: info@sycamorebmw.co.uk
 Internet: www.sycamorebmw.co.uk

Registered Office: Sycamore (Peterborough) Ltd
 8 West Walk
 Leicestershire
 LE1 8LT
 Registered in
 VAT Registration No. 210564
 GB 120409325

CASH SALE INVOICE

Invoice Name & Address

Customer Name & Address

Order Number		You were served by:		Operator:	
		Jason Vines		JV	
Account No.	Document Number	Date & Tax Point		Repair Date	
C0006	40019495	26/04/2007		18/04/2007	
Make & Model	Chassis No.	Mileage	Time	Page	
M5 LHD	BL01619	156597	17:29	4	
Reference No.	Reg No.	Reg Date	VSF No.	W.I.P. No.	Job No.
	M934YWL	11/08/1994		W 11393	29378

****WE SUPPLY & FIT TYRES** *OUR PRICES ARE COMPETITIVE***
NEW MODEL LAUNCH X5 20/04/07 3 SERIES CONVERTIBLE 24/03/07

	Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
	Air Conditioning Gas- R134a			Sub-total	121.40	
T	1199000			0.00	0.00	S
	Fan belts squeaks cust reports, plse inv			Sub-total	0.00	
C	1200009			1.00	7.20	S
	Check tension of belts and nip up - condition good			Sub-total	7.20	
C	5400001			6.00	43.20	S
	Lubricate pivots & Joints for sunroof - all okay after function test			Sub-total	43.20	

E&OE

	V	Rate	Service/Goods	V.A.T.	Net	
Parts	S	17.50	845.19	147.91	845.19	
Surcharge					147.91	
Labour					993.10	
Sublet					993.10	
Menus					0.00	

Address: Papyrus Road
 Wellingborough, Peterborough
 PE14 5HW
 Telephone: 01733 707070
 Fax: 01733 707071
 e-mail: info@sycamorebmw.co.uk
 Website: www.sycamorebmw.co.uk

Registered Office: Sycamore (Peterborough) Ltd
 8 Wood Walk
 Lutterworth
 LE15 1LT
 210554
 VAT Registration No: GB 120 4073 08

NOTIFICATION/DEPOSIT

Invoice Name & Address

Customer Name & Address

Order Number		You were served by:		Operator:	
		Dan Cumberland		04	
Account No.		Document Number		Date & Tax Point	
C0001		0		02/02/2007	
Make & Model	Chassis No.	Mileage	Time	Page	
LBD	BL01619	0	16:10	1	
Notes	Reg No.	Reg Date	W.I.P. No.	Job No.	
	M934YWL	11/08/1994	P 60882	0	

Parts Dept Direct Phone Number 01733 570570

Part No.	Description	Bin Loc.	Qty.	Unit Price	Unit Desc.	Disc.	Net Total	V
B51.16.2.237.023	FLOOR PLATE		1	38.90	EACH		ON ORDER	
B25.11.2.231.550	SHIFT KNOB		1	53.43	EACH		ON ORDER	
B25.11.1.221.073	BELLOW		1	39.66	EACH		ON ORDER	
DEPOSIT PAID							155.09	

*Paid in full
Mastro DL*

E & O. E

V	Rate	Service/Goods	V.A.T.	Parts	
				Surcharge	0.00
				Discount	0.00
				Net	0.00
				V.A.T.	0.00
				Total	0.00
				Paid	155.09
				Owing	-155.09

Address: Papworth Road
Werrington, Peterborough
PE4 5HW
Telephone: 01733 707000
Fax: 01733 707071
e-mail: mail@sycamorebmw.co.uk
Internet: www.sycamorebmw.co.uk

Registered Office: Sycamore (Peterborough) Ltd
B.Wer/Wer
Lancaster
LE1 5LT
216564
GB 120 4073 28

CASH SALE INVOICE

Invoice Name & Address

Customer Name & Address

Order Number	You were served by:		Operator:	
	James Wheeler		JW	
Account No.	Document Number	Date & Tax Point	Repair Date	
C0006	40016980	15/01/2007	29/12/2006	
Make & Model	Chassis No.	Mileage	Time	Page
M5 LHD	BL01619	153502	15:34	1
Reference No.	Reg No.	Reg Date.	VSF No.	W.I.P. No.
	M934YWL	11/08/1994	W 58023	25141

	Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
C	3499000 Check condition of brakes front and rear pads and			1.00	7.20	S
	Sub-total				7.20	
C	3421320 replace both rear brake discs & Pads			12.00	86.40	S
C	3441660 replace all parking brake shoes (discs removed)			5.00	36.00	S
X	B34.21.1.158.221 015876/M3 Rear Pads	1@	38.30	3	34.47	S
X	B34.21.1.165.265 015876/BRAKE DISC	2@	43.24	8	77.84	S
X	B34.35.1.179.820 Brake Pad Sensor	1@	5.19	0	4.68	S
X	B34.41.0.304.724 Repair Kit	1@	5.41	0	4.87	S
X	B34.41.6.761.294 Brake Shoe	1@	43.41	4	39.07	S
	Sub-total				283.33	
C	1800008 Replace exhaust mounts as broken & weak			6.00	43.20	S
C	1800508 Loosen/align exhaust assembly			5.00	36.00	S
X	B18.21.1.177.708 015876/Support Ring	2@	1.92	0	3.46	S
X	B18.21.1.178.340 Holder	2@	3.45	0	6.21	S
X	B18.21.1.178.343 Bracket E34	2@	0.77	0	1.39	S
X	B18.21.1.712.838 Rubber Ring	2@	2.39	0	4.31	S
	Sub-total				94.57	
C	6452001			3.00	21.60	S

E & O.E

V	Rate	Service/Goods	V.A.T.

Address Papyrus Road
Wemington, Peterborough
PE4 5HW
Telephone 01733 707070
Fax 01733 707071
e-mail mail@sycamorebmw.co.uk
Internet www.sycamorebmw.co.uk

Registered Office Sycamore (Peterborough) Ltd.
8 West Walk
Leicester
LE1 9LT
216564
GB 120 4073 28
Registered in
VAT Registration No.

CASH SALE INVOICE

Invoice Name & Address

Customer Name & Address

Order Number		You were served by:		Operator:	
		James Wheeler		JW	
Account No.	Document Number	Date & Tax Point		Repair Date	
C0006	40016980	15/01/2007		29/12/2006	
 Make & Model	Chassis No.	Mileage	Time	Page	
M LHD	BL01619	153502	15:34	2	
Reference No.	Reg No.	Reg Date,	VSF No.	W.I.P. No.	Job No.
	M934YWL	11/08/1994		W 58023	25141

	Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
C	Replace air compressor drive belt 3241100			4.00	28.80	S
X	replace power steering Belt B11.72.1.315.356 015876/FAN BELT	1@	9.71	0	8.74	S
X	B32.42.1.706.825 015876/FAN BELT	1@	8.12	0	7.31	S
				Sub-total	66.45	
C	5124320			6.00	43.20	S
C	replace both boot lid/tailgate gas pressure 5124322			7.00	50.40	S
C	replace both gas pressure props for rear window 5199000			3.00	21.60	S
	Check operation of tailgate glass and boot lid ope found struts for both weak - check struts - requir					
	B51.24.8.120.172 015876/SPRING	2@	18.57	3	33.43	S
	B51.24.8.149.327 015876/SPRING	1@	33.16	3	29.85	S
X	B51.24.8.149.328 015876/SPRING	1@	33.16	3	29.85	S
				Sub-total	208.33	
C	6100009			2.00	14.40	S
	initialize keys to car x2					
				Sub-total	14.40	
C	6100009			2.00	14.40	S
	Check outside temperature readings, check sensor a contacts - new sensor required					

E & O.E.

V	Rate	Service/Goods	V.A.T.

Address Papyrus Road
Werrington, Peterborough
PE4 5HW
Telephone 01733 707070
Fax 01733 707071
e-mail mail@sycamorebmw.co.uk
Internet www.sycamorebmw.co.uk

Registered Office Sycamore (Peterborough) Ltd
8 West Walk
Leicester
LE1 9LT
Registered in 216564
VAT Registration No. GB 120 4073 28

CASH SALE INVOICE

Invoice Name & Address

Customer Name & Address

Order Number	You were served by:		Operator:	
	James Wheeler		JW	
Account No.	Document Number	Date & Tax Point	Repair Date	
C0006	40016980	15/01/2007	29/12/2006	
Make & Model	Chassis No.	Mileage	Time	Page
M5 LHD	BL01619	153502	15:34	3
Reference No.	Reg No.	Reg Date.	VSF No.	W.I.P. No.
	M934YWL	11/08/1994	W 58023	25141

	Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
C	6581560 replace air temperature sensor			2.00	14.40	S
C	6199000 Strtrip back wiring for external temperature sensor (corroded) - retrofit additional wiring to make go required			10.00	72.00	S
X	B61.13.0.007.441 015876/SOCKET	2@	2.00	0	3.60	S
X	B61.13.0.007.442 015876/SOCKET	2@	2.00	0	3.60	S
X	B65.81.8.350.779 015876/Sender	1@	14.90	1	13.41	S
X	B61.13.1.379.833 Shrink Wrap	4@	0.65	0	2.34	S
X	B61.13.8.353.746 Cable Connector	4@	0.26	0	0.94	S
				Sub-total	124.69	
C	WINTER CHECK Winter Check.			3.66	26.35	S
				Sub-total	26.35	
C	0012125 Replace coolant			6.00	43.20	S
X	B34.11.1.123.072 Screw	2@	0.60	0	1.08	S
X	B81.22.9.407.454 Anti-Freeze	2@	6.80	1	12.24	S
X	B17.11.1.719.384 Rad Drain Plug	1@	3.41	0	3.07	S
X	B81.22.9.407.454 Anti-Freeze	2@	6.80	1	12.24	S
X	B17.11.1.712.963 Rivet	1@	0.12	0	0.11	S
				Sub-total	71.94	

E & O. E.

V	Rate	Service/Goods	V.A.T.

Address Papyrus Road
Werrington, Peterborough
PE4 5H-W
Telephone 01733 707070
Fax 01733 707071
e-mail mail@sycamorebmw.co.uk
Internet www.sycamorebmw.co.uk

Registered Office Sycamore (Peterborough) Ltd
8 West Walk
Leicester
LE1 9LT
216564
Registered in GB 120 4073 28
VAT Registration No.

CASH SALE INVOICE

Invoice Name & Address

Customer Name & Address

Order Number	You were served by:		Operator:	
	James Wheeler		JW	
Account No.	Document Number	Date & Tax Point	Repair Date	
C0006	40016980	15/01/2007	29/12/2006	
Make & Model	Chassis No.	Mileage	Time	Page
M5 LHD	BL01619	153502	15:34	4
Reference No.	Reg No.	Reg Date.	VSF No.	W.I.P. No.
	M934YWL	11/08/1994	W 58023	25141

	Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
C	1711535 Replace fan coupling			7.00	50.40	S
X	B07.11.9.927.022 Nut	2@	0.12	0	0.22	S
X	B07.11.9.932.822 015876/Circlip	2@	0.12	0	0.22	S
X	B11.52.7.831.619 015932/Fan Coup	1@	126.81	12	114.13	S
				Sub-total	164.97	
C	3199000 Check suspension dampers operation - no leaks - o.k (working o.k. when checked)			3.00	21.60	S
				Sub-total	21.60	
C	0000231 BMW Inspection II (including body insp)			44.00	316.80	S
	0000235 Additional jobs 2nd Inspection			2.00	14.40	S
C	0000270 Body inspection Two			3.00	21.60	S
C	0000410 Inspection 2 (M5 Specification additional items)			10.00	72.00	S
L	8883 Castrol TWS Motorsport			5.75	82.80	S
L	9993 Synthetic Axle Oil- OSP			1.90	24.17	S
L	8882 E39 M5 and sealed manual gearbox oil MTF-LT1			1.25	18.00	S

E & O.E.

V	Rate	Service/Goods	V.A.T.

Address Papyrus Road
Werrington, Peterborough
PE4 5HW
Telephone 01733 707070
Fax 01733 707071
e-mail mail@sycamorebmw.co.uk
Internet www.sycamorebmw.co.uk

Registered Office Sycamore (Peterborough) Ltd.
8 West Walk
Leicester
LE1 9LT
216564
GB 120 4073 28
Registered in
VAT Registration No.

CASH SALE INVOICE

Invoice Name & Address

Customer Name & Address

Order Number		You were served by:		Operator:	
		James Wheeler		JW	
Account No.	Document Number	Date & Tax Point	Repair Date		
C0006	40016980	15/01/2007	29/12/2006		
 Make & Model	Chassis No.	Mileage	Time	Page	
M3 LHD	BL01619	153502	15:34	5	
Reference No.	Reg No.	Reg Date.	VSF No.	W.I.P. No.	Job No.
	M934YWL	11/08/1994		W 58023	25141

	Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
C	1133062 Replace all hydr valve clearance compensators spac required (cover rem) (during Inspection II service)			47.00	338.40	S
X	B07.11.9.963.355 Diff Washer	20	0.15	0	0.27	S
X	B07.12.9.952.104 Hose Clip	20	0.47	0	0.85	S
X	B11.12.1.312.172 015978/GASKET	10	23.07	2	20.77	S
X	B11.12.1.312.173 015978/Gasket	30	4.26	1	11.51	S
X	B11.42.9.063.138 M30 Oil Filter	10	6.12	0	5.51	S
X	B12.12.9.061.867 Spark Plugs	60	8.49	5	45.85	S
X	B13.32.1.270.038 Fuel Filter	10	13.00	1	11.70	S
X	B13.72.1.726.916 Air Filter	10	12.83	1	11.55	S
X	B64.31.1.390.836 015978/FILTER	10	20.22	2	18.20	S
X	B11.15.1.312.757 016018/GASKET	10	0.68	0	0.62	S
X	B11.12.1.317.019 016018/COVER	10	195.75	19	176.18	S
X	B11.32.1.308.211 016018/SPACER	30	3.41	1	9.21	S
X	B11.32.1.308.212 016018/SPACER	10	3.41	0	3.07	S
X	B11.32.1.308.213 016018/SPACER	70	3.41	2	21.49	S
X	B11.32.1.308.214 016018/SPACER	40	4.39	1	15.81	S
X	B23.11.7.527.440 Bolt	10	2.47	0	2.23	S
				Sub-total	1242.99	
C	5172510 Replace edge protection for left or right Fr door			3.00	21.60	S
X	B51.72.1.946.393 016019/EDGE PROTEC	10	35.07	3	31.57	S

E. & O. E.

V	Rate	Service/Goods	V.A.T.

Address Papyrus Road
Werrington, Peterborough
PE4 5HW
Telephone 01733 707070
Fax 01733 707071
e-mail mail@sycamorebmw.co.uk
Internet www.sycamorebmw.co.uk

Registered Office Sycamore (Peterborough) Ltd.
8 West Walk
Leicester
LE1 9LT
216564
Registered in
VAT Registration No. GB 120 4073 28

CASH SALE INVOICE

Invoice Name & Address	Customer Name & Address

CASH SALE INVOICE

Invoice Name & Address	Customer Name & Address

Order Number		You were served by:		Operator:	
		James Wheeler		JW	
Account No.	Document Number	Date & Tax Point	Repair Date		
C0006	40016980	15/01/2007	29/12/2006		
 Make & Model	Chassis No.	Mileage	Time	Page	
M5 LHD	BL01619	153502	15:34	6	
Reference No.	Reg No.	Reg Date.	VSB No.	W.I.P. No.	Job No.
	M934YWL	11/08/1994		W 58023	25141

	Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
				Sub-total	53.17	
C	6321680			2.00	14.40	S
	Replace o/s/r lamp unit					
X	B63.21.8.351.648 016019/TAIL LIGHT	1@	77.88	7	70.10	S
				Sub-total	84.50	
C	5112657			5.00	36.00	S
	Replace rear bumper seal (bumper removed)					
C	5112500			2.00	14.40	S
	Remove and install rear bumper assembly #					
X	B51.12.8.149.267 016019/GASKET	1@	18.81	1	16.93	S
				Sub-total	67.33	
	3400522			4.00	28.80	S
	Replace ABS braking system hydraulic fluid					
				Sub-total	28.80	
C	6121511			4.00	28.80	S
	Replace battery					
X	B61.21.8.381.754 85 Ah Battery	1@	82.00	8	73.80	S
				Sub-total	102.60	
C	1199000			6.00	43.20	S
	Steam clean off engine oil leaks , carry out					
	extensive roadtest to run engine to normal operati					

E.&O.E.

V	Rate	Service/Goods	V.A.T.

Address Papyrus Road
Werrington, Peterborough
PE4 5HW
Telephone 01733 707070
Fax 01733 707071
e-mail mail@sycamorebmw.co.uk
Internet www.sycamorebmw.co.uk

Registered Office Sycamore (Peterborough) Ltd
8 West Walk
Leicester
LE1 9LT
216564
GB 120 4073 28
Registered n
VAT Registration No.

CASH SALE INVOICE

[illegible]

Customer Name & Address

Order Number		You were served by:		Operator:	
		James Wheeler		JW	
Account No.		Document Number		Date & Tax Point	
C0006		40016980		15/01/2007	
				Repair Date	
				29/12/2006	
Make & Model		Chassis No.		Mileage	
M5 LHD		BL01619		153502	
				Time	
				15:34	
				Page	
				7	
Reference No.		Reg No.		Reg Date.	
		M934YWL		11/08/1994	
				VSB No.	
				W.I.P. No.	
				W 58023	
				Job No.	
				25141	

Description of Goods / Services	Qty.	Unit Price	AW	Net Total	V
temperature and recheck. - signs of oil leaks right hand side of engine sti (will require stripping down to locate exact areas leaking from)					
			Sub-total	43.20	

E. & O. E.

E. & O. E.		V	Rate	Service/Goods	V.A.T.		
Parts	999.90	S	17.50	2706.42	473.62	Net	2706.42
Surcharge	0.00					V.A.T.	473.62
Labour	1,706.52					Total	3180.04
Sublet	0.00					Paid	0.00
Menus	0.00					Owing	3180.04

Address Papyrus Road
Warrington, Peterborough
PE4 5HW
Telephone 01733 707070
Fax 01733 707071
e-mail mail@sycamorebmw.co.uk
Internet www.sycamorebmw.co.uk

Registered Office Sycamore (Peterborough) Ltd
8 West Walk
Leicester
LE1 9LT
Registered in 216564
VAT Registration No. GB 120 4073 28

CASH SALE INVOICE

Invoice Name & Address	Customer Name & Address

Order Number	You were served by:	Operator:
	Adrian Dowd	AD
Account No.	Document Number	Date & Tax Point
C0001	30012686	29/12/2006
Make & Model	Chassis No.	Mileage
5 I X TOURING	BL01619	0
Time	Page	
13:23	1	
Notes	Reg No.	Reg Date.
	M934YWL	11/08/1994
	W.I.P. No.	Job No.
	P 58024	0

Part No.	Description	Bin Loc.	Qty.	Unit Price	Unit Des.	Disc.	Net Total	V
P B51.21.8.354.410	015740/Code Mast		2	68.09	EACH	0.00	136.18	

E & O. E.

V	Rate	Service/Goods	V.A.T.	Parts	
S	17.50	136.18	23.83	Surcharge	0.00
				Discount	0.00
				Net	136.18
				V.A.T.	23.83
				Total	160.01
				Paid	160.01
				Owing	0.00

Address Papyrus Road
Werrington, Peterborough
PE4 5HW
Telephone 01733 707070
Fax 01733 707071
e-mail mail@sycamorebmw.co.uk
Internet www.sycamorebmw.co.uk

Registered Office Sycamore (Peterborough) Ltd.
8 West Walk
Leicester
LE1 9LT
216564
Registered in
VAT Registration No. GB 120 4073 28

SERVICE SCHEDULE INSPECTION II (SHEET 2)

- ☒ Replace sootbed carburettor (M20 engine, every 2nd inspection II or at least 4 years).

ENGINE TEST

- ☒ Cars with distributor: check the dwell angle and adjust, ignoring timing if necessary.
- ☒ Call up information on defects stored in the diagnosis system, print off and attach to inspection sheets.
- ☒ Check EML safety path circuit.
- ☒ Check idle speed except on vehicles with idle speed control.
- ☒ Check CO reading (except catalyst version).
- ☒ Check ALL exterior lights.
- ☒ Check ALL instrument and control lighting and ALL other interior courtesy lighting.
- ☒ Check operation of heater / vent controls and blower.
- ☒ Check operation of door mirrors.
- ☒ Check horn all segments.
- ☒ Check operation of sunroof.
- ☒ Check operation of convertible roof.
- ☒ Check condition, operation of seat belts.
- ☒ Check wipers, blades, jet arm on windscreen and headlight washer systems.
- ☒ Check door garnet & boot locks and striker plates adjustment and lubrication.

ROAD TEST

- ☒ Check engine operation.
- ☒ Check clutch operation.

- ☒ Check transmission operation including EH gearbox.

- ☒ Check steering operation.

- ☒ Check steering wheel alignment.

- ☒ Check foot brake operation.

- ☒ Check hand brake balance on cars fitted with rear discs; bed in handbrake.

- ☒ Check wheel balance.

- ☒ Check propshaft balance.

- ☒ Check speedometer operation.

- ☒ Check distance and trip recorder operation.

- ☒ Check engine revolution counter operation.

- ☒ Check temperature gauge operation.

- ☒ Check fuel gauge operation.

- ☒ Check fuel consumption gauge operation.

- ☒ Check heater / air conditioning operation.

- ☒ Check on-board computer operation including head-up display.

- ☒ Check for wind noise, rattles etc.

FINAL ITEMS

- ☒ Check ATF level.
- ☒ Activate Service Interval Indicator.
- ☒ Ensure handbook service record is completed.

COMMENTS

NO SERVICE WORK
STILL IN WORK

Tyres: check and enter (including spare wheel)	FL	FR	RL	RR	S
Tread depth (Min MOT requirement: 1.6mm in a continuous band comprising the centre three-quarters of tread width and round the entire circumference) 1.6mm is minimum requirement & wheel segment tread	3	7	7	7	
Tyre condition: Check for any cuts, lumps, bulges, or other damage.					
Tread pattern: (groove or full)	P/F	P/F	P/F	P/F	P/F
Correct tyre pressure spare wheel max load +0.3 bar (i.e. max. occupants + luggage) except Spacesaver					
Correct and fill tyre pressure slider					

Technician's Signature

[Signature]

Date

15.1.07

Winter Routine Maintenance Check (Optional)

BMW

Customer:	Telephone:
Mobile:	Model:
Reg. No:	Chassis No: <i>GL01619</i>
R.O. No:	Mileage: <i>153502 km</i>

☐ Inform customer of vehicle status via text message

Date:

PRIOR TO COMMENCING THIS INSPECTION

Check for any outstanding Quality Enhancements/Recalls using the service website facility and complete as necessary. (Costs incurred should be claimed via the instructions for the specific action and are not included in the time allowance for this inspection)

Check each item in turn and when completed mark in the box provided as follows:-

- ☒ OK. Item completed and in order. Corrected as necessary.
☐ Item requires attention

Dealer Stamp

Check all lights.	☒
Check warning lights and heat blower.	☒
Check operation of horn, headlight flasher and hazard warning lights.	☒
Check engine oil level.*	☒
Check fluid level and concentration of screen wash reservoir including intensive cleaning system and top up if necessary.	☒
Steering oil reservoir: check level.	☒
Check coolant level.	☒
Check fluid level in brake and clutch hydraulic system and top up if necessary. Renew brake fluid according to Service Indicator (no later than years stated, item charged additionally).	☒
Check steering for freedom from play, damage, leakage and wear.	☒
Tyres: Check pressures and adjust if necessary including spare wheel.	☒
Check tread depth and for any damage.	☒
Check drivebelt condition.	☒
Check battery condition.	☒
Check anti-freeze content.	☒
Check wiper blades.	☒
Check exhaust condition.	☒

* If carried out as part of the Oil Service the cost is accounted for within the Oil Service charge.

Notes:

See invoice

Technician's Signature

[Signature]

Date

2.1.16

SERVICE SCHEDULE - INSPECTION SHEET II UP TO AND INCLUDING 1995 MODEL YEAR (Sheet 1)



Ref. No. **58023**
Reg. No. **M934 YWL**

Check each item in turn and when completed mark in the box provided as follows:-

- ☒ OK, item completed and in order. Corrected as necessary.
☒ Item requires attention - Customer notified.
☒ Item not applicable to this vehicle.

All items marked ♦ should be adjusted/topped up where necessary and included in the inspection cost.

All items marked ■ should be charged additionally to the customer.

PRIOR TO COMMENCING THIS INSPECTION

Check for any outstanding Service actions using the service workflow facility and complete as necessary.
(Checks insured should be claimed via the instructions for the specific action and are not included in the time allowance for this inspection).

FOR ALL MECHANICAL CHECKS (IEG, BRAKES, SUSPENSION JOINTS) ALWAYS REFER TO RELEVANT REPAIR MANUAL.

VEHICLE RAISED ON HOIST ENGINE AT OPERATING TEMPERATURE

- ☒ Remove engine shield.
- ☒ Drain engine oil and replace oil filter and sump plug washer.
- ☒ Check transmission for leaks including coolant line of final drive (550cc).
- ☒ Drain automatic transmission oil (except 5HP30).
- ☒ Refill automatic transmission (transmission without dipstick only).
- ☒ Check engine oil level (except E34, E46, M4, M5, E34(M), M5, M6 and E21 (V8) engines which are to be changed every second inspection interval).
- ☒ Replace rear axle oil (E38 Every 2nd inspection II).
- ☒ Replace oil in transfer box and front axle final drive (4WD).
- ☒ Check clutch driven plate for wear, every 2nd inspection II.
- ☒ Renew main fuel filter Petrol engines every 2nd inspection II.
- ☒ Check P.A.S. system for leaks.
- ☒ Check radiator bottom hose for leaks.
- ☒ Check drive shaft gaiters for leaks.
- ☒ Check steering for rattle from play.
- ☒ Check condition of track rod and front axle ball joints.
- ☒ Check steering box for leaks, check L.J.s, couplings and flexible gaiters.
- ☒ Check all connections and lines in braking system for leaks, damage and correct position including front brake cables and plastic pipe covers.
- ☒ Check fuel pipes, tank and connections for leaks, damage and position.
- ☒ Check condition, position and mounting of exhaust system.

LOWER VEHICLE TO HALF-WAY POSITION

- ☒ Inspect underside of body for corrosion/damage (except for Annual Inspection E30 and all other models up to and including 90 Model Year).
- ☒ Half engine shield.
- ☒ Empty water traps (diesel models only).
- ☒ Remove road wheels.
- ☒ Remove brake pads/linings, clean and check for wear.
- ☒ Check wheel cylinders and dust seals for leaks.
- ☒ Check handbrake lever travel, movement of handbrake cables and adjustment.
- ☒ Check on rear disc brake models, handbrake lining wear.
- ☒ Grease wheel canting spigots for alloy wheels.
- ☒ Check shock absorbers for leaks.
- ☒ Refit road wheels.
- ☒ Complete tyre check on page 2.

VEHICLE ON GROUND

- ☒ Inspect battery for correct, secure fitting, damage or corrosion (except for Annual Inspection E30 and other models up to and including 90 Model Year).
- ☒ Check fluid level and concentration of screen washer reservoir.
- ☒ Refill engine oil.
- ☒ Refill automatic transmission oil.
- ☒ Remove spark plugs.
- ☒ Check and adjust valve clearances. Replace rocker cover gasket (M20, M30, S50 and S38 engines only).
- ☒ Renew spark plugs.
- ☒ Lubricate door mechanism hinges.
- ☒ Replace inverter and active carbon filter if applicable in heating/air conditioning system (when not part of factory standard specification).
- ☒ Replace air recirculation filter every 2nd inspection II (if applicable).

- ☒ E30 only: Clean intake air separator in front of intake air cleaner.
- ☒ Convertible E39: Inspect rollover protection system and diagnosis plug. **Important:** Remove hard top or open soft top first.
- ☒ Check coolant hoses for leaks.
- ☒ Renew air intake filter.
- ☒ Check P.A.S. hose clips for tightness & P.A.S. fluid level.
- ☒ Lubricate throttle linkages and gate mechanisms on carburettor models.
- ☒ Check clutch hose connections for tightness and positioning.
- ☒ Check clutch fluid level.
- ☒ Check brake fluid level (renew fluid every 2 years, 750l annually).
- ☒ Check battery acid level and top-up with distilled water if necessary (above plates) ref. IN 00-00-34-99.
- ☒ Carry out specific gravity check (charge battery as necessary).
- ☒ Check condition/tightness coolant hoses.
- ☒ Check tension/condition of all V belts (Except M70 engine).
- ☒ Replace all V belts E34/M6 only (S38 engine).
- ☒ Check engine oil and oil pressure (renew every 2 years up to 50k miles for 35 Model Year or every 2 years, except M6 and M5 every second inspection interval).
- ☒ Self-levelling suspension, check fluid level.
- ☒ Check wheel hub torque and tyre pressures (renew max. 650 + 0.36, record on chart attached).
- ☒ Check intensive cleaner level.
- ☒ Replace fire extinguisher cartridge annually.
- ☒ E38 M3 only: Renew throttle valve potentiometer.
- ☒ Replace toothed cam belt M40 engines (at least every 3 years).



Vehicle & Operator Services Agency



MOT test certificate

Motor vehicle registration mark: **A15 PAX**

This certificate has been issued according to the conditions and notes on the back of this certificate.
Note: If you have doubts as to whether this certificate is valid, call our MOT enquiry line on 0845 600 5977

Vehicle identification or chassis number:	WBSHJ91030BLE01619		
Test station number:	63131	Colour of vehicle:	SILVER
Issue date:	October 13 2005 (2500 Five)	Make of vehicle:	BMW
Expiry date:	October 12 2006 (2500 Six)	Approximate year the vehicle was first used:	1994
Serial number of this test certificate:	NA	Running mileage:	144264
		If it is a goods vehicle, state the maximum design gross weight:	N/A
		Type of fuel:	PETROL
For all vehicles with more than 4 passenger seats:	Seat belt installation checked (yes/no) ☒ ☐	Previous installation checked (date):	N/A
	Did it approve? ☒ ☐	Nil used (if seat belts fitted at time of evaluation check):	N/A

Tester's signature:

SA Marriott

Tester's name in CAPITALS:

SA MARRIOTT

Warning

A test certificate is not evidence that the vehicle is in a satisfactory mechanical condition.

Check

Check carefully that the above details are correct. Do not accept a certificate which has been altered.

Serial number:

KW0646218

Authentication stamp

TESTED 13 OCT 2005
10:40 AM
VOSA

Produced by S96L 6788

VT20 (05/04)



CASH SALE

TYRES - EXHAUSTS - BATTERIES

Lincoln Road Werrington Peterborough PE4 6LQ

Telephone 575921 and 575930

No. 301408

Date: 2-2-07

Quantity	Description	Unit Price	Total Price
2	235/65-17 Ave	85	
Total Excluding V.A.T.			
V.A.T. %			
Total Due			170-

E.&O.E

V.A.T. Reg. No. 395 7718 92

Registered No. 1751778

Great Britain

Invoice ID: 417AC/000294620
Invoice Date: 19.05.2005
Customer ID: 4400005696
Contract ID: 2951057
Order ID: 1805050666
Your VAT Reg.No.:
Terms of Payment: Immediate
Page: 2 / 2

NX8M
SEGE
1P87
2LD
S

INVOICE

Specification		£
United Kingdom + Ireland + ITIS / Navteq		89.98
Duration:	18.05.2005 - 20.05.2006	
Date of Order/Delivery:	18.05.2005	
Navl ID:	YGFV QJ34	
Navl Name:	M54200	
Total gross amount		89.98
(16%) VAT included	12.41	
Net amount	77.57	

All products invoiced are subject to German fiscal law.
Your credit card has been charged according to our agreement.



Intelligent Content on Demand

www.C-IQ.NET

TELEPHONE: 00 800 99 33 33 33

Siemens VDO Trading GmbH • c/o C-IQ Service Center
Postfach 66 01 27 • D-63302 Frankfurt/Main

Great Britain

Invoice ID: 417AC400478739
Invoice Date: 28.01.2007
Customer ID: 4400014229
Contract ID: 3042577
Order ID: 2701070117
Your VAT Reg.No.:
Terms of Payment: Immediate
Page: 2 / 2

INVOICE

Specification		£
United Kingdom + Ireland + iTIS / Navteq		89.98
Duration:	27.01.2007 - 27.01.2008	
Date of Order/Delivery:	27.01.2007	
Navi ID:	YGFV Q134	
Navi Name:	M54200	
Total gross amount		89.98
(19%) VAT included	14.37	
Net amount	75.61	

All products invoiced are subject to German fiscal law.

Your credit card has been charged according to our agreement.

NOTIFICATION/DEPOSIT

Invoice Name & Address	Customer Name & Address

Order Number	You were served by:	Operator:		
	Dan Cumberland	04		
Account No.	Document Number	Date & Tax Point		
C0001	0	22/12/2006		
Make & Model	Chassis No.	Mileage	Time	Page
525 I X TOURING	BL01619	0	10:17	1
Notes	Reg No.	Reg Date.	W.I.P. No.	Job No.
	M934YWL	11/08/1994	P 58024	0

Part No.	Description	Bin Loc.	Qty.	Unit Price	Unit Des.	Disc.	Net Total	V
851.21.8.354.410	Code Master Key		2	68.09	EACH		ON ORDER	
	DEPOSIT PAID						160.01	
<i>Paid in full Master Card DL</i>								

V	Rate	Service/Goods	V.A.T.	Parts	
				Surcharge	0.00
				Discount	0.00
				Net	0.00
				V.A.T.	0.00
				Total	0.00
				Paid	160.01
				Owing	-160.01

Address: Ryeview Road
Weymouth, Peterborough
PE4 5NU
Telephone: 01753 701000
Fax: 01753 701001
e-mail: mail@sycamorebmw.co.uk
www.sycamorebmw.co.uk

Registered Office: Sycamore (Peterborough) Ltd
8 Waverley
Lutterworth
LE15 1T
210564
VAT Registration No: GB 121 4973 28

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 032878
 Invoice Date: 09/12/2016
 Order No:
 Customer: MCGA02

Page 1 of 3

	Quantity	Rate	Net
Labour			
REBUILD ENGINE			
CARRY OUT REMOVAL OF ENGINE			
STRIP ENGINE TO CARRY OUT COMPLETE OVERHAUL/REFURBISHMENT			
REBUILD ENGINE, REFIT AND TEST	40.00	79.00	2528.00
CHEMICAL CLEAN ALL COMPONENTS FOR PREP AND BUILD	1.00	650.00	650.00
HONE CYLINDERS	1.00	200.00	200.00
REFACE BLOCK DECK	1.00	180.00	180.00
POLISH CRANK SHAFT			
HOT PRESSURE TEST-PASS PLUS REFURBISH CYLINDER HEAD	1.00	850.00	850.00
NJK BLASTING VAPOUR BLAST SUMPS, COVERS THOTTLE BODY ETC	1.00	325.00	325.00
INJECTOR CLEANING	1.00	75.00	75.00
Sub Total			4,808.00

Parts

BM11121401352	HEAD SET 3.8 M5	1.00	420.00	420.00
BM11121317018	BOLT	9.00	11.00	99.00
BM11211318991	SPROCKET	1.00	138.00	138.00
BM11251401363	PISTON RING	6.00	70.00	420.00
BM11251310766	SNAP RING	12.00	4.50	54.00
BM21212227106	BOLT	8.00	7.00	56.00
BM11411705055	TENSIONER	1.00	7.12	7.12
BM11511315559	PUMP	1.00	280.00	280.00
BM13541307380	O RING	12.00	2.27	27.24
BM13541308986	BUSH	6.00	6.98	41.88
BM13901717292	HOLDER	1.00	9.33	9.33
BM11211261042	BRG SHELL	12.00	39.00	468.00
BM07129903984	SCREW	1.00	1.84	1.84
BM11121401351	GASKET	1.00	115.00	115.00
BM11121312096	STUD M3 M6 x 35	24.00	3.00	72.00
BM11111743118	DOWEL	2.00	1.04	2.08
BM11231402608	SCREW	4.00	6.34	25.36
BM11231315353	FAN BELT 13 x 980	1.00	15.75	15.75
BM11721315181	FAN BELT	1.00	15.63	15.63
BM32421706597	FAN BELT	1.00	12.22	12.22

Continued on the next page....

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 032876
 Invoice Date: 09/12/2016
 Order No:
 Customer: MCGA02

Page 2 of 3

		Quantity	Rate	Net
BM11241307140	BOLT CON ROD	14.00	5.56	77.84
BM11211709934	ROLLER BRG	1.00	7.25	7.25
BM11311403081	TIMING CHAIN	1.00	78.00	78.00
BM11311304255	SPROCKET	1.00	27.00	27.00
BM11311304258	NEEDL SLEEVE	1.00	4.00	4.00
BM11311304257	O-RING	1.00	2.00	2.00
BM11311317335	M3 CHAIN SLIPPER	1.00	150.00	150.00
BM11311309945	CHAIN TENSIONER	1.00	160.00	160.00
BM11311308550	GUIDE RAIL	1.00	110.00	110.00
BM11311307408	O-RING	1.00	1.63	1.63
BM11241318678	BRG SHELL	12.00	10.80	129.60
BM11417577656	CHAIN	1.00	40.00	40.00
BM11429063138	M30 OIL FILTER	1.00	12.46	12.46
BM11537835558	THERMOSTAT	1.00	45.00	45.00
BM11531312287	GASKET	1.00	13.75	13.75
BM17121712736	WATER HOSE 8 X 13 (METRE)	1.00	32.36	32.36
BM11531312966	PIPE	1.00	4.67	4.67
BM13411705564	RUBBER MOUNT	1.00	4.20	4.20
BM11621304755	EXHAUST NUT	24.00	0.99	23.76
BM13641730767	INJ/O RING	2.00	3.76	7.52
BM13721730918	AIR FILTER	1.00	21.00	21.00
BM12129061867	SPARK PLUG	6.00	10.00	60.00
BM17201712209	HOLDER	2.00	2.30	4.60
BM17222245358	O RING	2.00	0.96	1.92
BM11211261034	BEARING SHELL BLUE	2.00	38.00	76.00
BM07119912680	BOLT	14.00	1.60	22.40
BM11121317018	BOLT	5.00	11.00	55.00
BM11111315106	GASKET	1.00	160.00	160.00
SU/BOLT	6/8/10/12 BOLT	3.00	0.62	1.86
SU/WASHER	WASHER	3.00	0.48	1.44
BM11311305070	LOCK PLATE (CAMSHAFT)	2.00	4.49	8.98
KUBRAKE	BRAKE/SERVICE CLEANER 500ML	3.00	5.99	17.97
BM07119919210	BOLT	6.00	3.62	21.72
BM13621401945	TEMP GAUGE SENS	1.00	43.00	43.00
BM12621710535	TRANSMITTER	1.00	24.00	24.00
SHIM	VALVE SHIM	17.00	5.21	88.57
BM07119919939	BOLT	6.00	0.42	2.52
BM18301317898	EXHAUST NUT	1.00	3.54	3.54
BM07119905710	HEX NUT	6.00	0.19	1.14
BM13711272495	RUBBER MOUNT	2.00	7.00	14.00
BM11617549043	CAP NUT	2.00	2.42	4.84

Continued on the next page....

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 032878
 Invoice Date: 09/12/2016
 Order No:
 Customer: MCGA02

Page 3 of 3

SU/LN LOCK NUT
 BM07119919146 RADIATOR PLUG
 BM83512355290 ANTI-FREEZE 1500ml
 BM11531312241 HOSE
 BM61311378073 SWITCH
 SU/FUEL FUEL 1L
 BM13531717650 HOLDER

Quantity	Rate	Net
14.00	0.89	12.46
1.00	1.51	1.51
4.00	9.58	38.32
1.00	26.41	26.41
1.00	43.00	43.00
20.00	1.23	24.60
1.00	3.60	3.60

Sub Total 3,995.89

Tyre Tread Depths (mm)

N/S/F: O/S/F: N/S/R1: O/S/R1: Spare 1:

Vehicle: M934YWL
 Make: BMW 5 SERIES M5
 VIN: WBSHJ9103DBL01619
 Mileage:
 Technician:

THANK YOU FOR YOUR CUSTOM. TELEPHONE 01825 740456

Sort code: 20-23-98 Account Number: 43775313 Swift: BARCGB22
 Iban: BARC 2023 9843 775313

Title to the goods supplied remain with this company until payment for them has been satisfactorily received - E & OE

Munich Legends Ltd., Ashdown Garage, Chelwood Gate, East Sussex, RH17 7DE
 VAT No. GB 131 2312 75 Registered in England No 04824959

Invoice Totals

Description	Amount
Vatable Items	8,803.89
VAT @ 20.00%	1,760.76
Zero Rated Items	0.00
Total Invoice Value	10,564.65

This cash invoice is due for payment

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 031082
 Invoice Date: 11/03/2016
 Order No:
 Customer: MCGA02

Page 1 of 3

Labour

	Quantity	Rate	Net
ADJUST HEADLAMP AIMS.			
ADJUST WASHER JET AIMS			
DIAGNOSE RADIO INOP.			
CHECK INTERIOR LIGHTS			
DIAGNOSE HUNTING/IDLE			
FIX NEAR SIDE REAR SEAT BACK CATCH			
DIAGNOSE BELT NOISE FROM COLD			
DENT REPAIRS	4.00	30.00	120.00
ZINC PLATING/CHEMICAL BLACKING	1.00	350.00	350.00
CARRY OUT SILL AND FLOOR CORROSION REPAIRS			
REMETAL AND REPAIR REAR INNER WHEELARCHES			
CUT OUT AND REPAIR JACKING POINTS.	1.00	1970.00	1970.00
CARRY OUT MECHANICAL REBUILD			
CARRY ROAD TESTS AND SNAGGING ON ALL ELECTRICAL ISSUES			
RECHECK AND REPLACE ALL WORN UNDER BONNET FITTINGS			
REPLACE ALL AIR CON PIPE WORK AND FITTINGS			
BLEED COOLANT SYSTEM			
REPLACE ALL FLUIDS			
REPLACE DOOR CHECK STRAPS			
REPLACE LOWER DOOR TRIMS	40.00	69.00	2760.00
Sub Total			5,200.00

Parts

BM64538390979	HOSE	1.00	99.10	89.19
BM64538390984	SUCTION LINE	1.00	121.04	108.94
BM64508390605	A/C O RING	2.00	2.67	4.81
BM61131374029	COVER	1.00	22.19	19.97
BM61138356422	LABLE	1.00	7.77	6.99
BM51141885911	PLATE	1.00	8.59	7.73
BM11431315069	DIP STICK	1.00	11.89	10.70
BM12901747122	COVER	1.00	26.38	23.74
BM64508390604	GASKET	2.00	1.17	2.11
BM64508390601	GASKET	1.00	1.04	0.94
BM64508390602	AC O RING	1.00	1.09	0.98
BM61661369516	INTENSIVE-WASH / CONTAINER CAP	1.00	4.50	4.05

Continued on the next page....

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 031082
 Invoice Date: 11/03/2016
 Order No:
 Customer: MCGA02

Page 2 of 3

		Quantity	Rate	Net
BM61661365848	STRAINER	1.00	2.54	2.29
BM61661368599	PUSH BUTTON	1.00	1.96	1.76
BM61661364807	COVER	1.00	10.69	9.62
BM61311388548	SWITCH	1.00	44.24	39.82
BM61311369343	GROMMET	1.00	1.34	1.21
BM61671378629	VALVE	1.00	10.50	9.45
BM61671378633	NUT	1.00	0.42	0.38
BM61671378616	WASHER JET	1.00	12.17	10.95
BM6131179065	HOSE CLAMP	1.00	0.46	0.41
BM64538390620	PRESSURE HOSE	1.00	104.89	94.40
BM61661378612	WASHER TANK	1.00	67.55	60.80
BM51721946393	EDGE PROTECTOR	2.00	86.23	155.21
BM61311388548	SWITCH	1.00	44.24	39.82
BM61311378320	COOLANT SENSOR	1.00	41.85	37.67
BM32412226398	PIPE	1.00	94.29	84.86
BM61671391590	WASHER BOTTLE	1.00	67.55	60.80
BM51228168090	DOOR BRAKE	1.00	47.25	42.53
BM63171384243	COVER	1.00	16.88	15.19
BM63121378333	H.LAMP BULB COVER	2.00	25.33	45.59
BM61661365657	BUSH	2.00	0.75	1.35
BM61671378631	GASKET	1.00	4.84	4.36
BM61311369343	GROMMET	1.00	1.34	1.21
BM51141946170	5 REAR BADGE	1.00	11.00	9.90
BM51142230389	LETTER	1.00	37.00	33.30
BM51141946169	BADGE	1.00	24.50	22.05
BM51218141116	STUD	1.00	2.41	2.17
BM61668360614	WASH PUMP	1.00	40.25	36.23
BM61361389105	RELAY	1.00	11.84	10.66
BM64541392913	FAN	1.00	368.34	331.51
131547452863	AIR CON CONTROL UNIT	1.00	40.00	36.00
BM61671378630	CONNECTOR	1.00	15.62	14.06
BM6131176747	NUT	10.00	0.29	2.61
BM51222230398	DOOR TRIM	1.00	39.92	35.93
BM61130007441	WIRING CONNECTOR E30/36	3.00	5.13	13.86
BM13541317859	O-RING	6.00	2.59	15.54

Sub Total 1,563.65

Continued on the next page....

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 031002
 Invoice Date: 11/03/2016
 Order No:
 Customer: MCGA02

Page 3 of 3

Quantity Rate Net

Tyre Tread Depths (mm)

N/S/F: O/S/F: M/S/R1: O/S/R1: Spare 1:

Vehicle: M934YWL
 Make: BMW 5 SERIES M5
 VIN: WBSHJ910308L01619
 Mileage:
 Technician:

Invoice Totals

Description	Amount
Variable Items	6,763.65
VAT @ 20.00%	1,352.72
Zero Rated Items	0.00
Total Invoice Value	8,116.37

THANK YOU FOR YOUR CUSTOM. TELEPHONE 01825 740456

Title to the goods supplied remain with this company until payment for them has been satisfactorily received - E & OE

This cash invoice is due for payment

Munich Legends Ltd., Ashdown Garage, Chelwood Gate, East Sussex, RH17 7DE
 VAT No. GB 131 2312 75 Registered in England No 04824959

Printed on Recycled Paper
 Produced in the UK

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 029215
 Invoice Date: 30/03/2015
 Order No:
 Customer: MCGA02

Page 1 of 3

Labour

UNDERSIDE OF CAR

Quantity Rate Net

Parts

BM61136784633	CABLE HOLDER	2.00	0.45	0.90
BM34111157038	CALIPER SLEEVE	8.00	15.00	120.00
BM34111153197	BLEED NIPPLE	4.00	5.00	20.00
BM34211158578	SEAL KIT	2.00	18.00	36.00
BM34111157037	CALIPER SEAL KIT	2.00	18.00	36.00
BM34111153198	DUST CAP	4.00	4.17	16.68
BM34321159891	BRAKE HOSE	2.00	14.00	28.00
BM34321159878	HOSE	2.00	13.00	26.00
BM34321159881	BRAKE HOSE	2.00	13.00	26.00
BM32211135668	TIE ROD	2.00	38.00	76.00
BM33321125665	PITMAN ARM	2.00	22.00	44.00
BM31351130075	FRONT DROP LINK	2.00	18.00	36.00
BM31121139987	TRACK CONTROL ARM N/S	1.00	69.00	69.00
BM31121139988	O/S LOWER CONTROL ARM ALLY	1.00	69.00	69.00
BM33311128670	SUB FRAME BUSH	2.00	18.00	36.00
BM33551131131	REAR ANTI-ROLL BAR LINK	2.00	9.00	18.00
BM18211178340	BRACKET	2.00	8.00	16.00
BM37121129716	RUBBER BOOT	1.00	5.09	5.09
BM33531133670	SPRING PAD	1.00	4.16	4.16
BM32421706597	BELT	1.00	11.92	11.92
BM18307620549	EXHAUST NUT	4.00	0.71	2.84
BM07119927022	NUT	4.00	0.63	2.52
BM07119901299	BOLT	10.00	0.27	2.70
BM63171367868	EXPANDING NUT	10.00	0.23	2.30
BM07119907030	WASHER	1.00	0.50	0.50

Continued on the next page...

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 029215
 Invoice Date: 30/03/2015
 Order No:
 Customer: MCGA02

Page 2 of 3

		Quantity	Rate	Net
BM16111178667	REINFORCEMENT	2.00	6.39	12.78
BM16111178743	REINFORCEMENT	2.00	3.73	7.46
BM16111179162	STRAP	1.00	21.19	21.19
BM16111179161	STRAP	1.00	21.19	21.19
BM37121129867	TOP MOUNT	2.00	32.00	64.00
BM33521129567	GASKET	2.00	1.12	2.24
BM33531133671	SPRING PAD LOWER	2.00	5.28	10.56
BM31331128523	PAD SPRING CUP	2.00	4.46	8.92
BM31331124322	SPRING PAD	2.00	3.25	6.50
BM31321125878	RUBBER BOOT	2.00	11.92	23.84
BM11131315154	SUMP GASKET	1.00	16.84	16.84
BM11721315356	E34 M5 AIR CON BELT 12.5x970	1.00	18.49	18.49
BM07129906196	NUT	2.00	1.47	2.94
BM07119904532	ADJUSTER SCREWS	2.00	1.54	3.08
BM12317677914	TENSIONER	1.00	2.50	2.50
BM32421708386	BOLT	1.00	3.27	3.27
BM32421707199	RAIL	1.00	6.90	6.90
BM33311132251	RUBBER MOUNT	1.00	54.00	54.00
BM07119902957	BOLT	4.00	2.71	10.84
BM18111723532	GASKET RING	1.00	5.38	5.38
BM18211728600	HOLDER	1.00	13.78	13.78
BM18211177708	EXHAUST SUPPORT RUBBER	2.00	4.15	8.30
BM18211175445	EXHAUST CLAMP	1.00	3.67	3.67
BM18211178343	BRACKET	2.00	3.03	6.06
BM18211712838	ORING	2.00	4.63	9.26
BM07146949380	NUT	20.00	0.61	12.20
BM51488137981	INSULATION	1.00	57.00	57.00
BM51488126638	INSULATION	1.00	23.00	23.00
BM18111709239	EXHAUST RING	1.00	7.04	7.04
BM37121129716	RUBBER BOOT	1.00	5.09	5.09
BM33531133670	SPRING PAD	1.00	4.16	4.16
BM51711944363	COVER	1.00	39.00	39.00
BM51711944364	COVER	1.00	39.00	39.00
BM51718102867	COVER	1.00	31.00	31.00
BM16121181379	PROTECTION	1.00	26.00	26.00
BM37141179870	THRUST ROD	1.00	16.15	16.15
BM18101401918	EXHAUST	1.00	1100.00	1100.00
BM11811137149	RUBBER MOUNT	1.00	45.00	45.00
BM51488126633	INSULATION	1.00	45.00	45.00

Continued on the next page....

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 029215
 Invoice Date: 30/03/2015
 Order No:
 Customer: MCGA02

Page 3 of 3

BM32211138864 TIE ROD

Quantity	Rate	Net
1.00	142.00	142.00

Sub Total 2,641.24

Tyre Tread Depths (mm)

N/S/F: O/S/F: N/S/R1: O/S/R1: Spare 1:

Vehicle: M934YWL
 Make: BMW 5 SERIES M5
 VIN: WBSHJ910308L01619
 Mileage:
 Technician:

Invoice Totals

Description	Amount
Vatable Items	2,641.24
VAT @ 20.00%	528.26
Zero Rated Items	0.00
Total Invoice Value	3,169.50

THANK YOU FOR YOUR CUSTOM. TELEPHONE 01825 740456

Title to the goods supplied remain with this company until payment for them has been satisfactorily received - E & OE

This cash invoice is due for payment

Munich Legends Ltd., Ashdown Garage, Chelwood Gate, East Sussex, RH17 7DE
 VAT No. GB 131 2312 75 Registered in England No 04824959

Munich Legends Ltd.
 10 High Street, Ashdown, East Sussex, RH17 7DE

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 029213
 Invoice Date: 30/03/2015
 Order No:
 Customer: MCGA02

Page 1 of 4

	Quantity	Rate	Net
Labour			
BODYSHOP LABOUR	140.00	40.00	5600.00
PAINT AND MATERIALS	1.00	900.00	900.00
STRIP UNDER SIDE OF VEHICLE TO POWER COAT AND ZINC PLATE	16.00	79.00	1264.00
Sub Total			7,764.00

Parts

BM63121391321	HEADLIGHT		1.00	335.00	335.00
BM63121391322	HEADLIGHT		1.00	335.00	335.00
BM63131384033	FLASHER		1.00	32.00	32.00
BM63131384034	FLASHER		1.00	32.00	32.00
BM63131378009	E34 WING REPEATER LAMP		1.00	16.00	16.00
BM63131378010	E34 WING REPEATER LAMP		1.00	16.00	16.00
BM63218351631	TAIL LIGHT		1.00	95.00	95.00
BM63218351632	TAIL LIGHT		1.00	95.00	95.00
BM51368120503	COVER	#	2.00	32.00	64.00
BM51368120127	COVER	#	1.00	32.00	32.00
BM51368120128	COVER	#	1.00	65.00	65.00
BM51368120649	MOULDING	#	1.00	30.00	30.00
BM51368120650	MOULDING	#	1.00	30.00	30.00
BM51318117457	BLACK FRAME	#	1.00	54.00	54.00
BM51318117458	BLACK FRAME	#	1.00	54.00	54.00
BM51118148815	BUFFER STRIP	#	1.00	15.00	15.00
BM51118148816	BUFFER STRIP	#	1.00	15.00	15.00
BM51118148821	GRILL		1.00	15.23	15.23
BM51128148817	BUFFER STRIP	#	1.00	15.00	15.00
BM51128148818	BUFFER STRIP	#	1.00	15.00	15.00
BM51128148819	BUFFER STRIP	#	1.00	21.00	21.00
BM51138186441	GRID		1.00	49.00	49.00
BM51138186442	GRID		1.00	49.00	49.00
BM51711946125	COVER E34 WIPER		1.00	24.00	24.00
BM51711946126	COVER E34 WIPER		1.00	24.00	24.00
BM51711928946	CLIP		8.00	0.27	2.16
BM51328181367	COVER	#	1.00	22.18	22.18
BM51328181368	COVER	#	1.00	22.18	22.18
BM51348181371	COVER	#	1.00	22.18	22.18
BM51348181372	COVER	#	1.00	22.18	22.18
BM51348120103	COVER	#	1.00	20.75	20.75

Continued on the next page....

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 029213
 Invoice Date: 30/03/2015
 Order No:
 Customer: MCGA02

Page 2 of 4

			Quantity	Rate	Net
BM51348120104	COVER	#	1.00	20.75	20.75
BM51348120443	COVER	#	1.00	20.75	20.75
BM51348120444	COVER	#	1.00	20.75	20.75
BM51131978193	COVER	#	1.00	11.62	11.62
BM51131978194	COVER	#	1.00	11.62	11.62
BM51131944941	BUFFER STRIP	#	1.00	21.67	21.67
BM51131944942	BUFFER STRIP	#	1.00	21.67	21.67
BM51131934177	BUFFER STRIP	#	1.00	44.07	44.07
BM51131934178	BUFFER STRIP	#	1.00	41.39	41.39
BM51131934181	BUFFER STRIP	#	1.00	31.65	31.65
BM51131934182	BUFFER STRIP	#	1.00	31.65	31.65
BM51131934183	BUFFER STRIP	#	1.00	8.33	8.33
BM51131934184	BUFFER STRIP	#	1.00	8.33	8.33
BM51138120211	MOULDING	#	1.00	64.00	64.00
BM51138120212	MOULDING	#	1.00	64.00	64.00
BM51218199751	LOCK	#	1.00	110.00	110.00
BM51211944231	COVER	#	1.00	29.00	29.00
BM51228138951	DOOR HANDLE	#	1.00	47.00	47.00
BM51228138952	DOOR HANDLE	#	1.00	47.00	47.00
BM51228119076	COVER	#	2.00	8.67	17.34
BM51228120095	COVER	#	1.00	32.00	32.00
BM51228120096	COVER	#	1.00	32.00	32.00
BM51228120093	MOULDING	#	1.00	20.09	20.09
BM51228120094	MOULDING	#	1.00	19.94	19.94
BM51718120035	SPOILER	#	1.00	158.82	158.82
BM51148132375	BADGE	#	2.00	26.15	52.30
BM51141807495	GROMMET	#	4.00	0.33	1.32
BM51211944345	COVER	#	1.00	15.15	15.15
BM51211944346	COVER	#	1.00	15.15	15.15
BM51228120287	COVER	#	1.00	20.75	20.75
BM51228120288	COVER	#	1.00	23.75	23.75
BM54128149662	GASKET	#	1.00	26.60	26.60
BM54128188642	GASKET	#	1.00	46.00	46.00
BM51218122442	COVER	#	1.00	9.05	9.05
BM51218122441	COVER	#	1.00	9.05	9.05
BM61318357632	SWITCH	#	1.00	22.38	22.38
BM51711928946	CLIP	#	12.00	0.27	3.24
BM61318357632	SWITCH	#	1.00	22.38	22.38
BM51131978195	COVER	#	1.00	4.31	4.31

Continued on the next page....

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 029213
 Invoice Date: 30/03/2015
 Order No:
 Customer: MCGA02

Page 3 of 4

			<u>Quantity</u>	<u>Rate</u>	<u>Net</u>
BM51131978196	COVER	#	1.00	3.92	3.92
BM51368120504	COVER	#	2.00	32.00	64.00
BM63218351647	TAIL LIGHT		1.00	115.00	115.00
BM51211944232	COVER	#	1.00	31.85	31.85
BM41611973390	STUD		2.00	2.54	5.08
BM51228148622	BOWDEN CABLE		1.00	2.17	2.17
BM51131924953	CLIP		30.00	0.41	12.30
BM51411944663	CLIP		4.00	0.50	2.00
BM51219061483	SEAL		1.00	104.00	104.00
BM51131840154	CLIP		4.00	0.54	2.16
BM63268355048	LAMP		1.00	22.14	22.14
BM51211944232	COVER	#	1.00	28.00	28.00
BM51212230373	Cover	#	1.00	42.00	42.00
BM51212230374	Cover	#	1.00	42.00	42.00
BM63131378066	NUT		2.00	0.22	0.44
BM07119906734	SCREW REPEATER		2.00	0.16	0.32
BM51171928197	E34 FUEL FLAP HINGE		1.00	15.59	15.59
BM51131870459	Holder		2.00	1.84	3.68
BM51437194187	Clip		10.00	0.54	5.40
BM51488149440	SOUND INSULATION		1.00	17.34	17.34
BM51498120841	COVER	#	1.00	92.00	92.00
BM51498120842	COVER	#	1.00	92.00	92.00
BM63268355048	LAMP		1.00	22.14	22.14
BM51228120641	MOULDING		1.00	9.04	9.04
BM51228120095	COVER	#	1.00	32.00	32.00
BM51131944138	GRID		1.00	84.00	84.00
BM51131944137	GRID		1.00	90.00	90.00
BM51712255050	FOIL		1.00	21.00	21.00
BM51711916017	BOLT		8.00	0.54	4.32
BM63171367868	EXPANDING NUT		8.00	0.20	1.60
BM51211928189	CLIP		2.00	1.07	2.14
BM51711937638	CLIP		8.00	2.07	16.56
BM51211908406	CLIP		20.00	0.97	19.40
BM51498149360	HOLDER		2.00	0.46	0.92
BM51711938940	CLAMP		10.00	0.83	8.30
BM51711959929	CLIP		10.00	0.46	4.60
BM51162239737	PLUG		4.00	1.34	5.36
BM51222230398	COVERING	#	1.00	44.00	44.00
BM51211944346	COVER	#	1.00	15.20	15.20

Continued on the next page....

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 029213
 Invoice Date: 30/03/2015
 Order No:
 Customer: MCGA02

Page 4 of 4

			Quantity	Rate	Net
BM51219061484	WEATHER STRIP	#	1.00	102.00	102.00
BM51229059649	WEATHR STRIP	#	1.00	199.00	199.00
BM51229059650	WEATHER STRIP	#	1.00	189.00	189.00
BM51228120287	COVER	#	1.00	20.00	20.00
BM51712230340	SILL COVER	#	1.00	118.00	118.00
BM51171853772	RUBBER BUFFER		1.00	5.12	5.12
BM51711928946	CLIP		8.00	0.27	2.16
BM51131934160	GROMMET		20.00	0.46	9.20
BM51131946258	CLIP		30.00	0.46	13.80
BM51711946499	GASKET		1.00	22.16	22.16
BM61628359055	REAR WIPER ARM		1.00	27.00	27.00
CAY6DC	SPARK PLUG/12.12.9.061.867		6.00	4.50	27.00
BM61212158124	85AH BATTERY		1.00	74.00	74.00

Sub Total 4,738.14

Tyre Tread Depths (mm)

N/S/F: O/S/F: N/S/R1: O/S/R1: Spare 1:

Vehicle: M934YWL
 Make: BMW 5 SERIES M5
 VIN: WBSHJ910300L01619
 Mileage:
 Technician:

THANK YOU FOR YOUR CUSTOM. TELEPHONE 01825 740456

Title to the goods supplied remain with this company until payment for them has been satisfactorily received - E & OE

Munich Legends Ltd., Ashdown Garage, Chelwood Gate, East Sussex, RH17 7DE
 VAT No. GB 131 2312 75 Registered in England No 04824959

Invoice Totals

Description	Amount
Valable Items	12,502.14
VAT @ 20.00%	2,500.43
Zero Rated Items	0.00
Total Invoice Value	15,002.57

This cash invoice is due for payment

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 022894
 Invoice Date: 30/03/2012
 Order No:
 Customer: SALES

Page 1 of 2

	Quantity	Rate	Net
Labour			
CARRY OUT REMOVAL AND REPAIR TO DOUBLE SUNROOF CASSETTE	4.00	59.00	276.00
REPAIR WIRING FOR EDC DAMPING	1.00	69.00	69.00

 PREP WORK
 REFURBISH ALL FOUR WHEELS
 REPLACE ALL FOUR TYRES
 REPLACE FRONT DISCS PADS AND SENSOR
 REPLACE LOOSE BULB IN REAR LIGHTS
 REPLACE BONNET LAMP BULB
 REPLACE REAR DROP LINKS
 REPLACE EXHAUST RUBBER HANGERS
 CLEAN AND RUST TREAT SUSPENSION AND BRAKE PIPES.
 REPLACE OFF SIDE REAR LOWER ARM BALL JOINT (WISHBONE?)
 REPLACE REAR SEAT BELT CATCH COVERS
 REPLACE ROCKER COVER GASKETS
 REPLACE SUMP GASKET
 REPLACE OIL DRAIN TUBE ORING AND GASKET
 DIAGNOSE POOR IDLE
 REPLACE NUMBER PLATES
 REPLACE WEAK BOOT GAS STRUTS
 REPLACE DIFF OUTPUT SHAFT SEALS
 REFIT REAR BUMPER CORRECTLY

Sub Total 345,00

Parts

	Parts			
BM34112782995	E46 M3 F/PADS	1.00	93.98	93.98
BM34112276385	FRT DISC E34 M5	2.00	124.26	248.52
BM34351179820	BRAKE FEELER	1.00	13.12	13.12
PAD GREASE	H/PRESSURE BRAKE LUBRICANT 5.5	1.00	0.89	0.89
WUBRAKE	BRAKE/SERVICE CLEANER 500ML	1.00	3.75	3.75
BM1121312172	R/C/GASKET E34 M5	1.00	32.58	32.58
BM11411304178	O RING	1.00	1.00	1.00
BM11421312175	GASKET	1.00	1.88	1.88
BM11131315154	SUMP GASKET	1.00	13.96	13.96
BM33121213949	DIFF SEAL	1.00	26.42	26.42
BM33121205138	LOCK PLATE	1.00	1.59	1.59

Continued on the next page....

Munich Legends

MUNICH LEGENDS

INVOICE

Invoice No: 022894
 Invoice Date: 30/03/2012
 Order No:
 Customer: SALES

Page 2 of 2

BM33107510289 OIL SEAL
 BM33111214144 DIFF ORING
 BM33551135307 REAR ANTT-ROLL LINKS
 BM18211177708 EXHAUST SUPPORT RUBBER
 BM11121312173 PLUG HOLE GASKET M3 M5
 BM36112228660 PLAQUE WHEEL MS

Quantity	Rate	Net
2.00	17.09	34.18
2.00	1.42	2.84
2.00	15.75	31.50
2.00	4.15	8.30
3.00	7.63	22.89
4.00	4.17	16.68
Sub Total		554.08

Tyre Tread Depths (mm)

N/S/F: O/S/F: N/S/RL: O/S/RL: Spare 1:

Vehicle: M934YWL
 Make: BMW 5 SERIES M5
 VIN: WBSH191030BL01619
 Mileage: 205205
 Technician:

Invoice Totals

Description	Amount
Variable Items	899.08
VAT @ 20.00%	179.83
Zero Rated Items	0.00
Total Invoice Value	1,078.91

THANK YOU FOR YOUR CUSTOM. TELEPHONE 01825 740456

Title to the goods supplied remain with this company until payment for them has been satisfactorily received - E & OE

This cash invoice is due for payment

Munich Legends Ltd., Ashdown Garage, Chelwood Gate, East Sussex, RH17 7DE
 VAT No. GB 131 2312 75 Registered in England No 04824959

Munich Legends Limited
 Registered in England No 04824959

Octane Car Service

Dubai, UAE

INVOICE

Name		Inv. No.	4282
		Inv. Date	08-Apr-2017
		Job No.	4275
Phone	Mobile	Job Date.	3/15/2017
Fax		Pages	Page 1 of 2
Registration No.	YELLO PLATE	Milage Kms.	205811
Make	E34 M5	Color	SILVER
Chasis No.	BL01619	Year	

SI No.	Services	Amount
1	REPLACED OIL SUMP GASKET REMOVAL OF SUBFRAME	1,400.00
2	REPLACE OIL LEVEL SENSOR GASKET	150.00
3	ENGINE MOUNTS	200.00
4	OIL SERVICE	150.00
5	GEARBOX MOUNTS	150.00
6	REPLACE BATTERY	100.00
7	REMOVE IMMOBILISER	550.00
8	REPAIR WIRING COIL NUMBER 1	650.00
9	EXHAUST LEAK FIXED	100.00
10	REPLACED RADIO	250.00
11	REPLACE RADIATOR AND FAN CLUTCH WITH COOLANT	450.00
12	PASSING SERVIEC CHARGE	500.00
Total Services :		4,650.00

SI No.	Item Code	Description	Quantit	Rate	Amount
1	M.80	Battery 80 AH	1.00	550.00	550.00
2	11 13 1 315 154.	Oil pan gasket	1.00	70.00	70.00
3	12 61 1 127 129	Gasket ring	1.00	22.00	22.00
4	11 81 1 137 149.	Engine mounts	2.00	230.00	460.00
5	22 31 6 771 221.	Transmission mounting	2.00	104.00	208.00
6	11 42 9 063 138	Oil filter	1.00	100.00	100.00
7	83 21 2 365 924	Engine oil 10W60	7.00	90.00	630.00
8	6418	Bulb	2.00	10.00	20.00
9	Brake Cleaner	Brake Cleaner	1.00	30.00	30.00
10	11 52 7 831 619	Fan Coupling	1.00	1,195.00	1,195.00
11	PET	Petrol	1.00	20.00	20.00
12	Sub	Recovery	1.00	360.00	360.00
13	Sub	Passing	1.00	140.00	140.00
14	Sub	RECOVERY CHARGES TWO WAYS	1.00	300.00	300.00
15	Sub	PASSING CHARGES	1.00	30.00	30.00
16	Sub	Courier Charge	1.00	192.00	192.00
17	Sub	Courier charge	1.00	207.00	207.00
Total Spares :					4,534.00

Name		Inv. No.	4282
		Inv. Date	08-Apr-2017
Phone	Mobile	Job No.	4275
		Job Date	3/15/2017
Fax		Pages	Page 2 of 2
Registration No.	YELLO PLATE	Milage Kms.	205811
Make	E34 M5	Color	SILVER
Chasis No.	BL01619	Year	

Amt. AED: NINE THOUSAND ONE HUNDRED EIGHTY-FOUR AND XX / 100

9,184.00

Service Advisor/ Supervisor



Workshop Manager

Customer's Signature

Please Note : All bills to be fully settled in cash at the time of vehicle collection. No personal cheques will be accepted.

Warranty : All new parts supplied by OCTANE will have a warranty of 6 months from the date of invoice. Warranty does not include for any parts which are supplied by customer; used or new!!.

Remarks : NEED TO OBSERVE FOR OIL LEAK

Enthusiast Auto Group, LLC

Service Invoice 16499

Name	Address	Company	Address 2	Created	10/15/19	Year	1994
				Time	2:27 PM	Make	BMW
				Invoiced	11/28/19	Model	M5 Touring
Home		Hold		Advisor	Mike	Lic#	
Work		V.I.N. #	BL01819	Division	AR	Fleat#	
Fax		DOM		PC#		Body	Silver
				Checked By		Miles In	209,202
				Page#	1 of 9	Miles Out	209,202

Job Description

EAG/ E34 M5 Touring Rejuvenation

Comprehensive Enthusiast Auto Group Inspection

Full Vehicle Scan Results:

-No warnings currently present

Measurement Results:

Front brakes 12mm life remaining

Rear brakes 10mm life remaining

Front tires 6mm life remaining - DOT: 2017

Rear tires 6mm life remaining - DOT: 2017

Service Status:

-5 green bars present on SIA

Technician's Findings:

-Findings separated into respective categories

Mechanical Findings

-Service history present and recommend EAG 10 Year

Inspection to bring all fluids/filters up to date

-Engine bells are cracking - Recommend replacement

-Radiator has coolant leak present - Recommend replacement

-Cylinder head coolant outlet pipe is seeping coolant -

Recommend replacement

-Vacuum line for secondary air pump valve is melted -

Recommend replacement

-Transmission has standard seep occurring between cases -

Recommend degrease and re-tighten - Monitor

-Front driver's side strut is leaking - Recommend SLS rebuild

based on vehicle's history and driving intentions

-Front control arm inner and outer ball joint boots are leaking

grease - Recommend replacement

-Rear pitman arm joints are loose and leaking - Recommend

replacement

-Recommend wheel/tire RoadForce balance and full four wheel

alignment - To be performed in conjunction with suspension

replacements

YOU MUST INITIAL AND SIGN BEFORE WORK WILL BE PERFORMED. In accordance with Ohio law we are required to provide an estimate for repairs over \$25.00.

I hereby authorize the above repair work to be done along with necessary materials.

You and your employees may operate above vehicle for purposes of testing,

inspection or delivery at my risk. An express mechanics lien is acknowledged on

above to secure the amount of repairs thereto. EAG will not be held responsible for

loss or damage to vehicle what so ever. ENTHUSIAST AUTO GROUP, LLC 11608

READING RD CINCINNATI OH 45241

513-554-1268

Invoice Total

Labor	\$4,471.00
Parts	\$9,284.79
Sublets	\$4,850.00
Supplies	\$25.00
Subtotal	\$15,710.79
Tax	\$1,089.76
Total	\$16,810.55

Enthusiast Auto Group, LLC

Service Invoice 16499

Name	Company	Created	10/15/19	Year	1994
Address	Address 2	Time	2:27 PM	Make	BMW
		Invoiced	11/29/19	Model	M5 Touring
Home	Rate	Advisor	Mike	Lic#	
Work	V.I.N. #	Division	AR	Plat#	
Fax	DCM	PCW		Body	Silver
		Checked By		Miles In	208,202
		Page#	2 of 9	Miles Out	208,202

Job Description

-Rear hatch window support shocks are weak - Recommend replacement
 -Rear hatch assembly support shocks are weak - Recommend replacement
 -Hood liner is worn through from cooling fan - Recommend replacement
 -Driver's side rear window will jump during travel - Recommend repair if required - Door panel will be removed for reconditioning

Cosmetic Findings

-Exterior sill plates rubber ends are falling apart - Recommend replacement
 -Gasket surround for driver's side front turn signal is coming apart - Recommend replacement
 -Passenger side license plate lens has cosmetic blemish - Recommend replacement
 -Passenger side rear fender liner is broken - Recommend replacement
-All four door panels require reconditioning
 -Windshield seal is separating at top center - Recommend replacement
 -Front and rear BMW roundels has cosmetic blemishes - Recommend replacement
 -Interior headliner is starting to separate - Recommend reconditioning - **Ensure sunroof assembly is aligned correctly before re-install**
 -Seat belt buttons are faded - Recommend recondition attempt
 -Both rear door fabric is starting to separate - Recommend reconditioning
 -C-pillar lower securing fastener is missing - Recommend install

EAG Extra Mile Services

-Mirror adjustment switch is reversed - Recommend removal and re-wire correctly
 -Sunroof switch is inop - Recommend diagnosis - **WARNING:** Sunroof assembly unable to be confirmed in working order until switch diagnosed
 -Windshield washers require cleaning and re-adjustment

Line Total	744.00
Labor	744.00
Parts	0.00
Sublets	0.00

YOU MUST INITIAL AND SIGN BEFORE WORK WILL BE PERFORMED. In accordance with Ohio law we are required to provide an estimate for repairs over \$25.00.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanics lien is acknowledged on above to secure the amount of repairs thereto. EAG will not be held responsible for loss or damage to vehicle what so ever. ENTHUSIAST AUTO GROUP, LLC 11608 READING RD CINCINNATI OH 45241
 513-554-1265

Invoice Total	
Labor	\$4,471.00
Parts	\$8,264.79
Sublets	\$4,950.00
Supplies	\$25.00
Subtotal	\$15,710.79
Tax	\$1,099.76
Total	\$16,810.55

Enthusiast Auto Group, LLC

Service Invoice 16499

Name	Company	Created	10/16/19	Year	1994
Address	Address 2	Time	2:27 PM	Make	BMW
		Invoice#	11/29/19	Model	M5 Touring
Home	Ext#	Advisor	Mke	Lic#	
Work	V.I.N. #	Division	AR	Fleet#	
Fax	DOM	EC#		Body	Silver
		Checked By		Miles In	209,202
		Page#	3 of 9	Miles Out	209,202

Job Description

-12v light tabs require repair for socket to operate correctly
 -Covers around rear seat belt buckles are missing - Recommend install
 -Battery vent tube elbow is missing - Recommend install
 -Rear seat fuse block/module cover is missing on securing screw - Recommend install
 -Both driver's and passenger's side exterior grill trim is not properly secured - Recommend correct install
 -Fuel filler neck gasket is not installed correctly - Recommend re-install
 -Incorrect hardware installed on passenger side fender liner - Recommend install with correct hardware
 -Engine bay headlight covers are not properly secured with incorrect fasteners - Recommend proper install with correct hardware

Note: Labor only

Comprehensive 10-Year E34 M5 S38 Inspection

- Engine Oil and Filter Change
 - Check Wiper Blades / Inserts
 - Check Level and Condition of All Fluids
 - Check and Set Tire Pressures
 - Replace Engine Air Filter
 - Replace Fuel Filter
 - Replace Spark Plugs
 - Replace Valve Cover Gasket
 - Replace Rear Cam Plate Seal
 - Perform S38 Valve Adjust Service
 - Cooling System Flush
 - Brake System Fluid Flush
 - Power Steering Fluid Flush
 - Transmission Fluid Flush
 - Differential Fluid Flush

Line Total	1186.43
Labor	700.00
Parts	486.43
Sublets	0.00

Part Number	Description	QTY	Each	Total
07 11 9 563 355	Cush Seal 22x27 AL	2	0.77	1.54
11 12 1 306 729	Gasket Cyl Head Rear	1	2.22	2.22
11 12 1 312 172	VC Gasket S38	1	60.31	60.31
11 12 1 312 173	Spark Plug Seal 5/16/S38	3	13.75	41.25
11 15 1 312 757	Brother Gasket E34 M5	1	2.03	2.03
11 42 9 063 138	Oil Filter OX41	1	16.63	16.63
12 12 1 312 560	S38 Plugs	5	11.10	55.50
13 32 1 285 231	Fuel Filter	1	55.75	55.75
13 72 1 726 916	Air Filter LX405 E34 M5	1	28.75	28.75
32 42 1 707 199	Chain Tensioner	1	13.16	13.16

YOU MUST INITIAL AND SIGN BEFORE WORK WILL BE PERFORMED. In accordance with Ohio law we are required to provide an estimate for repairs over \$25.00.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanics lien is acknowledged on above to secure the amount of repairs thereto. EAG will not be held responsible for loss or damage to vehicle what so ever. ENTHUSIAST AUTO GROUP, LLC 11608 READING RD CINCINNATI OH 45241 513-554-1268

Invoice Total

Labor	\$4,471.00
Parts	\$6,284.79
Sublets	\$4,950.00
Supplies	\$25.00
Subtotal	\$15,710.79
Tax	\$1,099.76
Total	\$16,810.55

Enthusiast Auto Group, LLC

Service Invoice 16499

Name		Company		Created	10/15/18	Year	1994
Address		Address 2		Time	2:27 PM	Make	BMW
				Invoice	11/29/18	Model	M5 Touring
Home		Est#		Advisor	Mike	Lic#	
Work		V.I.N. #	BL01619	Division	AR	Fleet#	
Fax		DOM		PO#		Body	Silver
				Checked By		Miles In	209,202
				Page#	4 of 9	Miles Out	209,202

Job Description				
75W140	Synthetic Gear Oil - XJ	2	16.95	33.90
AMS 15W40	Synthetic Oil	7	11.75	82.25
ATF - FLUID	Power Steering Fluid	1	4.11	4.11
BRAKE FLUID	Brake Fluid	1	12.00	12.00
COOLANT	BMW Coolant	1	24.98	24.98
MTL REDLINE OIL	MTL oil	2	18.47	36.94

Replace Engine Drive Belts	Line Total	254.26
	Labor	125.00
	Parts	129.26
	Sublets	0.00

- Replace crankshaft drive belt
- Replace alternator drive belt
- Replace A/C compressor drive belt
- Replace belt tensioning bars and all hardware

Part Number	Description	QTY	Each	Total
07 11 9 904 632	Hex Bolt	1	2.65	2.65
07 11 9 912 535	Hex Bolt	1	2.30	2.30
07 12 9 905 195	Hex Nut M8-8-ZNMSI	4	2.42	9.68
11 23 1 315 353	Belt 13X200	1	16.00	16.00
11 72 1 315 161	Belt	1	13.89	13.89
12 31 1 275 516	Saucer Head Screw	1	7.39	7.39
12 31 1 714 450	Adjusting Bar	1	38.82	38.82
12 31 7 677 914	Belt Adj Nut E30	4	9.63	38.52

Replace Engine Cooling Radiator	Line Total	846.44
	Labor	136.40
	Parts	710.04
	Sublets	0.00

- Replace engine radiator
- Replace any hardware needed during service

NOTE: Cooling system fluid flush performed in conjunction with 10 year S38 services

Part Number	Description	QTY	Each	Total
17 11 2 226 336	Radiator	1	710.04	710.04

Reseal Cylinder Head Coolant Outlet Pipe	Line Total	225.40
	Labor	223.20
	Parts	2.20
	Sublets	0.00

- Replace cylinder head coolant outlet pipe seal
- Replace any hardware needed during service
- Degrease affected area

Part Number	Description	QTY	Each	Total
11 15 1 312 175	Gasket	1	2.20	2.20

Replace Secondary Air Pump Vacuum Line	Line Total	134.20
	Labor	99.20
	Parts	35.00
	Sublets	0.00

- Replace vacuum line on secondary air pump
- Replace any hardware needed during service

Part Number	Description	QTY	Each	Total
-------------	-------------	-----	------	-------

YOU MUST INITIAL AND SIGN BEFORE WORK WILL BE PERFORMED. In accordance with Ohio law we are required to provide an estimate for repairs over \$25.00.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanics lien is acknowledged on above to secure the amount of repairs thereto. EAG will not be held responsible for loss or damage to vehicle what so ever. ENTHUSIAST AUTO GROUP, LLC 11808 READING RD CINCINNATI OH 45241 513-554-1265

Invoice Total	
Labor	\$4,471.00
Parts	\$6,264.79
Sublets	\$4,950.00
Supplies	\$25.00
Subtotal	\$15,710.79
Tax	\$1,089.76
Total	\$16,810.55

Enthusiast Auto Group, LLC

Service Invoice 16499

Name		Company		Created	10/15/19	Year	1994
Address		Address 2		Time	2:27 PM	Make	BMW
				Invoice	11/29/19	Model	M5 Touring
Home		Est#		Advisor	Mike	Lic#	
Work		V.I.N. #	BL01619	Division	AR	Flac#	
Fax		DOM		PO#		Body	Silver
				Checked By		Miles In	209,202
				Page#	5 of 9	Miles Out	209,202

Job Description

64 11 1 368 684	Vacuum Hoses	1	35.00	35.00		
Rebuild SLS Suspension					Line Total	3906.98
-Rebuild front shocks					Labor	744.00
-Rebuild rear shocks					Parts	312.98
-Replace any hardware needed during services					Sublets	1950.00
PLACEHOLDER -- Was \$1500						
Actual charges was \$1950 USD						
Part Number	Description	QTY	Each	Total		
31 20 6 777 788	Cust cover	2	2.78	5.52		
31 21 1 128 336	Asle Nut Front	2	14.20	28.40		
31 21 1 128 336	Asle Nut Front	2	15.77	31.54		
31 32 1 125 570	Front Bush	2	19.20	38.40		
31 33 2 226 674	Bump stop	2	35.60	71.20		
33 53 1 133 671	Lower Spring Pad	2	11.52	23.04		
33 53 2 227 003	Bump stop	2	45.80	91.60		
37 12 1 129 716	Rubber Boot	2	11.64	23.28		
Replace Front Control Arms					Line Total	867.75
-Replace both front left and right control arms					Labor	136.40
-Replace any hardware needed during services					Parts	731.35
-Perform four wheel vehicle alignment					Sublets	0.00
Part Number	Description	QTY	Each	Total		
31 12 1 139 907	Control Arm Left E34	1	315.70	315.70		
31 12 1 139 906	Control Arm Right E34	1	315.70	315.70		
ALIGNMENT	Alignment	1	89.85	89.85		
Replace Rear Pittman Arms					Line Total	262.58
-Replace both rear pittman arms					Labor	88.60
-Replace any hardware needed during services					Parts	175.78
					Sublets	0.00
Part Number	Description	QTY	Each	Total		
33 32 1 125 665	Rear Subframe Pittman	2	87.89	175.78		

YOU MUST INITIAL AND SIGN BEFORE WORK WILL BE PERFORMED. In accordance with Ohio law we are required to provide an estimate for repairs over \$25.00.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanics lien is acknowledged on above to secure the amount of repairs thereto. EAG will not be held responsible for loss or damage to vehicle what so ever. ENTHUSIAST AUTO GROUP, LLC 11608 READING RD CINCINNATI OH 45241 513-554-1255

Invoice Total	
Labor	\$4,471.00
Parts	\$6,264.79
Sublets	\$4,950.00
Supplies	\$25.00
Subtotal	\$15,710.79
Tax	\$1,099.78
Total	\$16,810.55

Enthusiast Auto Group, LLC

Service Invoice 16499

Name		Company		Created	10/15/18	Year	1994
Address		Address 2		Time	2:27 PM	Make	BMW
				Invoice	11/29/18	Model	M5 Touring
Home		Half		Advisor	Mike	Lift	
Work		V.I.N. #	BL01619	Division	AR	Fleet#	
Fax		DOM		PO#		Body	Silver
				Checked By		Miles In	209,202
				Page#	6 of 9	Miles Out	209,202

Job Description

Roadforce Balance All Four Wheels	Line Total	50.00
	Labor	50.00
	Parts	0.00
	Sublets	0.00

-Roadforce balance all four wheels and tires to ensure smooth and proper ride quality.

Replace Rear Hatch Support Shocks	Line Total	210.66
	Labor	62.00
	Parts	148.66
	Sublets	0.00

-Replace rear hatch support shocks
-Replace rear window support shocks
-Replace any hardware or clips needed during services

Note: Service performed during headliner

Part Number	Description	QTY	Each	Total
51 24 8 149 327	Trunk Shock E34	1	74.34	74.34
51 24 8 149 328	Trunk Shock E34	1	74.32	74.32

Check And Repair All Window Lifter Functions

-Remove door panels
-Check all window lifter functions
-Repair any defects found during inspection
-Replace any clips or hardware needed during services

Note: Performed during door panel recondition

Recondition All Four Door Panels	Line Total	1360.00
	Labor	620.00
	Parts	740.00
	Sublets	0.00

-Repair and recondition all four interior door panels to as-new condition
-Replace any misc. clips, hardware, or fasteners needed during service

Part Number	Description	QTY	Each	Total
Door Panel	Recondition	4	185.00	740.00

Replace Front Turn Signal Lamp Gaskets	Line Total	62.00
	Labor	62.00
	Parts	0.00
	Sublets	0.00

-Replace front turn signal gaskets
-Replace any hardware needed during services

YOU MUST INITIAL AND SIGN BEFORE WORK WILL BE PERFORMED. In accordance with Ohio law we are required to provide an estimate for repairs over \$25.00.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanics lien is acknowledged on above to secure the amount of repairs thereto. EAG will not be held responsible for loss or damage to vehicle what so ever. ENTHUSIAST AUTO GROUP, LLC 11638 READING RD CINCINNATI OH 45241 513-554-1259

Invoice Total	
Labor	\$4,471.00
Parts	\$6,254.79
Sublets	\$4,950.00
Supplies	\$25.00
Subtotal	\$15,710.79
Tax	\$1,099.76
Total	\$16,810.55

Enthusiast Auto Group, LLC

Service Invoice 16499

Name		Company		Created	10/15/19	Year	1994
Address		Address 2		Time	2:27 PM	Make	BMW
				Invoiced	11/29/19	Model	M5 Touring
Home		Mail		Advisor	Mke	Lic#	
Work		V.I.N. #	BL01619	Division	AR	Flat#	
Fax		DOM		PO#		Body	Silver
				Checked By		Miles In	208,202
				Page#	7 of 8	Miles Out	208,202

Job Description

Replace Registration Plate Lamp Lenses				Line Total	127.58
-Replace rear registration plate lamp lenses				Labor	24.80
-Replace any hardware needed during services				Parts	102.78
				Sublets	0.00
Part Number	Description	QTY	Each	Total	
83 28 8 355 048	Plate Lamp Lens	2	51.39	102.78	
Replace Passenger Side Rear Fender Liner				Line Total	230.14
-Replace passenger side rear fender well liner				Labor	24.80
-Replace any hardware needed during services				Parts	205.34
				Sublets	0.00
Part Number	Description	QTY	Each	Total	
41 09 8 149 218	Fender Well Right Rear	1	205.34	205.34	
Replace Front Windshield Seal				Line Total	860.08
-Replace front windshield seal				Labor	124.00
-Replace any hardware needed during services				Parts	536.08
				Sublets	0.00
Part Number	Description	QTY	Each	Total	
51 31 8 117 457	Windshield Gasket LT	1	268.04	268.04	
51 31 8 117 458	Windshield Gasket RT	1	268.04	268.04	
Replace Exterior BMW Roundels				Line Total	88.64
-Replace front BMW roundel				Labor	0.00
-Replace rear BMW roundel				Parts	88.64
				Sublets	0.00
Part Number	Description	QTY	Each	Total	
51 14 8 132 375	BMW Roundel	2	44.32	88.64	
Recondition Interior Headlining				Line Total	1248.00
-Remove interior headliner and recondition to factory BMW as-new condition				Labor	248.00
-Replace any clips, fasteners, or hardware needed during service				Parts	0.00
Headliner Recondition				Sublets	1000.00

YOU MUST INITIAL AND SIGN BEFORE WORK WILL BE PERFORMED. In accordance with Ohio law we are required to provide an estimate for repairs over \$25.00.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanics lien is acknowledged on above to secure the amount of repairs thereto. EAG will not be held responsible for loss or damage to vehicle what so ever. ENTHUSIAST AUTO GROUP, LLC 11608 READING RD CINCINNATI OH 45241 513-654-1269

Invoice Total	
Labor	\$4,471.00
Parts	\$6,294.79
Sublets	\$4,950.00
Supplies	\$25.00
Subtotal	\$15,710.79
Tax	\$1,098.76
Total	\$16,810.55

Enthusiast Auto Group, LLC

Service Invoice 16499

Name		Company		Created	10/15/19	Year	1994
Address		Address 2		Time	2:27 PM	Make	BMW
				Invoiced	11/29/19	Model	M5 Touring
Home		Mail		Advisor	Mike	Lic#	
Work		V.I.N. #	BL01619	Division	AR	Fleet#	
Fax		DOM		PO#		Body	Silver
				Checked By		Miles In	209,202
				Page#	8 of 9	Miles Out	209,202

Job Description

Repair Front Seat Belt Buttons

-Repair and restore color of seat belt buttons

Replace C-Pillar Securing Clip

-Replace rear C-pillar securing clip

Line Total	1.12
Labor	0.00
Parts	1.12
Sublets	0.00

Part Number	Description	QTY	Each	Total
61 41 1 973 500	Door Panel Clip	2	0.56	1.12

Full EAG Spa and Paint Rejuvenation Service

Line Total	2000.00
Labor	0.00
Parts	0.00
Sublets	2000.00

Interior Services:

- Carpel treatment with full vacuum service
- All interior panels wiped and treated
- Air vents brushed
- Leather conditioned

Exterior Services:

- Hand wash using only EAG approved products and technique
- Wheels hand washed and treated with dual Ceramic Coating
- Full exterior paint correction performed
- Exterior paint treated with dual Ceramic Coating
- All glass panels cleaned both interior and exterior
- All glass panels treated with dual Ceramic Coating

Engine Bay Detail

-Full engine bay detail using only EAG approved products and technique

YOU MUST INITIAL AND SIGN BEFORE WORK WILL BE PERFORMED. In accordance with Ohio law we are required to provide an estimate for repairs over \$25.00.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanics lien is acknowledged on above to secure the amount of repairs thereto. EAG will not be held responsible for loss or damage to vehicle what so ever. ENTHUSIAST AUTO GROUP, LLC 11609 READING RD CINCINNATI OH 45241 513-554-1269

Invoice Total	
Labor	\$4,471.00
Parts	\$6,264.79
Sublets	\$4,950.00
Supplies	\$25.00
Subtotal	\$15,710.79
Tax	\$1,099.76
Total	\$16,810.55

Enthusiast Auto Group, LLC

Service Invoice 16499

Name		Company		Created	10/15/19	Year	1994
Address		Address 2		Time	2:27 PM	Make	BMW
				Invoiced	11/28/19	Model	M5 Touring
Home		Half		Advisor	Mike	Left	
Work		V.I.N. #	BL01619	Division	AR	Fleet#	
Fax		DOM		PO#		Body	Silver
				Checked By		Miles In	208,202
				Page#	9 of 9	Miles Out	208,202

Job Description

Recondition Rear Seat

-Remove rear seat and recondition

Replace Both Windshield Washer Level Sensors

Line Total 193.90

Labor 62.00

Parts 131.90

Sublets 0.00

-Replace both washer level sensors
-Drain, degrease, and refill washer sprayer tank
-Replace any hardware needed during services

Part Number	Description	QTY	Each	Total
81 31 1 388 548	Level Sensor	2	65.95	131.90

Install M-Tech 3 Spoke Steering Wheel

Line Total 437.00

Labor 62.00

Parts 375.00

Sublets 0.00

-Mike to source proper 3-spoke steering wheel
-Wire in resistor to eliminate SRS light
-Alignment performed with suspension install

Part Number	Description	QTY	Each	Total
E34 M-Tech	Steering Wheel	1	375.00	375.00

Install Eisenmann Exhaust

Line Total 1488.83

Labor 126.40

Parts 1362.23

Sublets 0.00

-2x83mm
-Race
-Raspless Version

Part Number	Description	QTY	Each	Total
85231.20831	Eisenmann Exhaust	1	1362.23	1362.23

YOU MUST INITIAL AND SIGN BEFORE WORK WILL BE PERFORMED. In accordance with Ohio law we are required to provide an estimate for repairs over \$25.00.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanics lien is acknowledged on above to secure the amount of repairs thereto. EAG will not be held responsible for loss or damage to vehicle what so ever. ENTHUSIAST AUTO GROUP, LLC 11608 READING RD CINCINNATI OH 45241 513-554-1260

Invoice Total

Labor \$4,471.00

Parts \$6,264.78

Sublets \$4,950.00

Supplies \$25.00

Subtotal \$15,710.79

Tax \$1,098.76

Total \$16,810.55

Enthusiast Auto Group, LLC

Service Invoice 16674

Name	Company	Created	12/05/19	Year	1994
Address	Address 2	Time	7:02 AM	Make	BMW
		Invoiced	10/24/22	Model	M5 Touring
Home	Rate	Advisor	Mike	Lic#	
Work	V.I.N. #	Division	AR	Fleet#	
Fax	DOM	PO#		Body	Silver
		Checked By		Miles In	0
		Page#	1 of 1	Miles Out	0

Job Description

Additional Services Continued From Reluventaion #16499

Line Total	16.08
Labor	0.00
Parts	16.08
Sublets	0.00

Part Number	Description	QTY	Each	Total
15 13 1 176 747	Plastic Nut	2	0.41	0.82
51 21 1 928 380	Gasket	2	7.63	15.26

Replace Exterior Door Handle Surrounds

Line Total	273.38
Labor	186.00
Parts	87.38
Sublets	0.00

-Replace all four door handle surrounds

Part Number	Description	QTY	Each	Total
51 21 8 122 441	Door Handle LH E36	1	28.54	28.54
51 21 8 122 442	Door Handle RH E36	1	28.54	28.54
51 22 8 119 076	Rear Handle E36	2	14.55	29.10

Install BMW ///Motorsport Red Belts

Line Total	735.00
Labor	310.00
Parts	425.00
Sublets	0.00

-Remove stock black belts both front and rear

-Install reconditioned BMW ///Motorsport Red belts

Part Number	Description	QTY	Each	Total
E34 Belt Set: Red	Motorsport Belt Set	1	425.00	425.00

Install BMW Motorsport Exterior Door Handles

Line Total	822.00
Labor	372.00
Parts	450.00
Sublets	0.00

-Remove stock handle assemblies

-Remove door lock cylinders and swap to Motorsport handles

-Replace any hardware required during swap/install

Part Number	Description	QTY	Each	Total
Handle: Motorsport	E34 Motorsport Handles	1	450.00	450.00

SUBLET

Line Total	60.52
Labor	0.00
Parts	0.00
Sublets	60.52

Merchant Fee

YOU MUST INITIAL AND SIGN BEFORE WORK WILL BE PERFORMED. In accordance with Ohio law we are required to provide an estimate for repairs over \$25.00.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanics lien is acknowledged on above to secure the amount of repairs thereto. EAG will not be held responsible for loss or damage to vehicle what so ever. ENTHUSIAST AUTO GROUP, LLC 11608 READING RD CINCINNATI OH 45241 513-554-1269

Invoice Total	
Labor	\$868.00
Parts	\$878.46
Sublets	\$60.52
Supplies	\$25.00
Subtotal	\$1,831.98
Tax	\$150.69
Total	\$2,082.67