

ODC Daily Coaling Plan

07/08/2025

Geologist Contact: 0473 223 132



Location	Coal Type	Destination	Comments
T02	C_VU1_VU3	SP_O	
	C_VL1	VL Pad	DO not mine past RL95
T03	C_VU1_VU3		
	C_LL1	SP_B	Thin seam – take care when mining Tip Stockpile South to North
	C_LL2T_LL2B	SP_G	
	C_LL3B	SP_M	Thin seam – take care when mining.
T04	C_LL1	SP_B	Thin seam – take care when mining
	C_LL2T_LL2B	SP_P	
	C_LL3B	SP_Q	
	C_VU1_VU3	SP_C	
	C_VL1	VL_PAD	
T05 Ramp 6 De-Stack	C_LL1	SP_B	
	C_LL3B	SP-R	
	C_LL2T_LL2B	SP_D	
	C_VU1_VU3	SP_A	
	C_LL1_OX	SP_F	
	C_LL2T_LL2B_OX	SP_S	
T05	C_LL1	SP_B	Thin seam – take care when mining
	C_LL2T_LL2B	SP_D	
	C_LL3B	SP-R	Thin seam – take care when mining
	C_VU1_VU3	SP_A	


Ideal Roof and Floor Conditions




Flitch (RL98.75)

T03/S02

COAL CODE	STOCKPILE	COMMENTS
C_LL1	SP_B	Thin seam – take care when mining
C_LL2B_LL2T	SP_G	
C_LL3B	SP_M	Separated to OX Coal

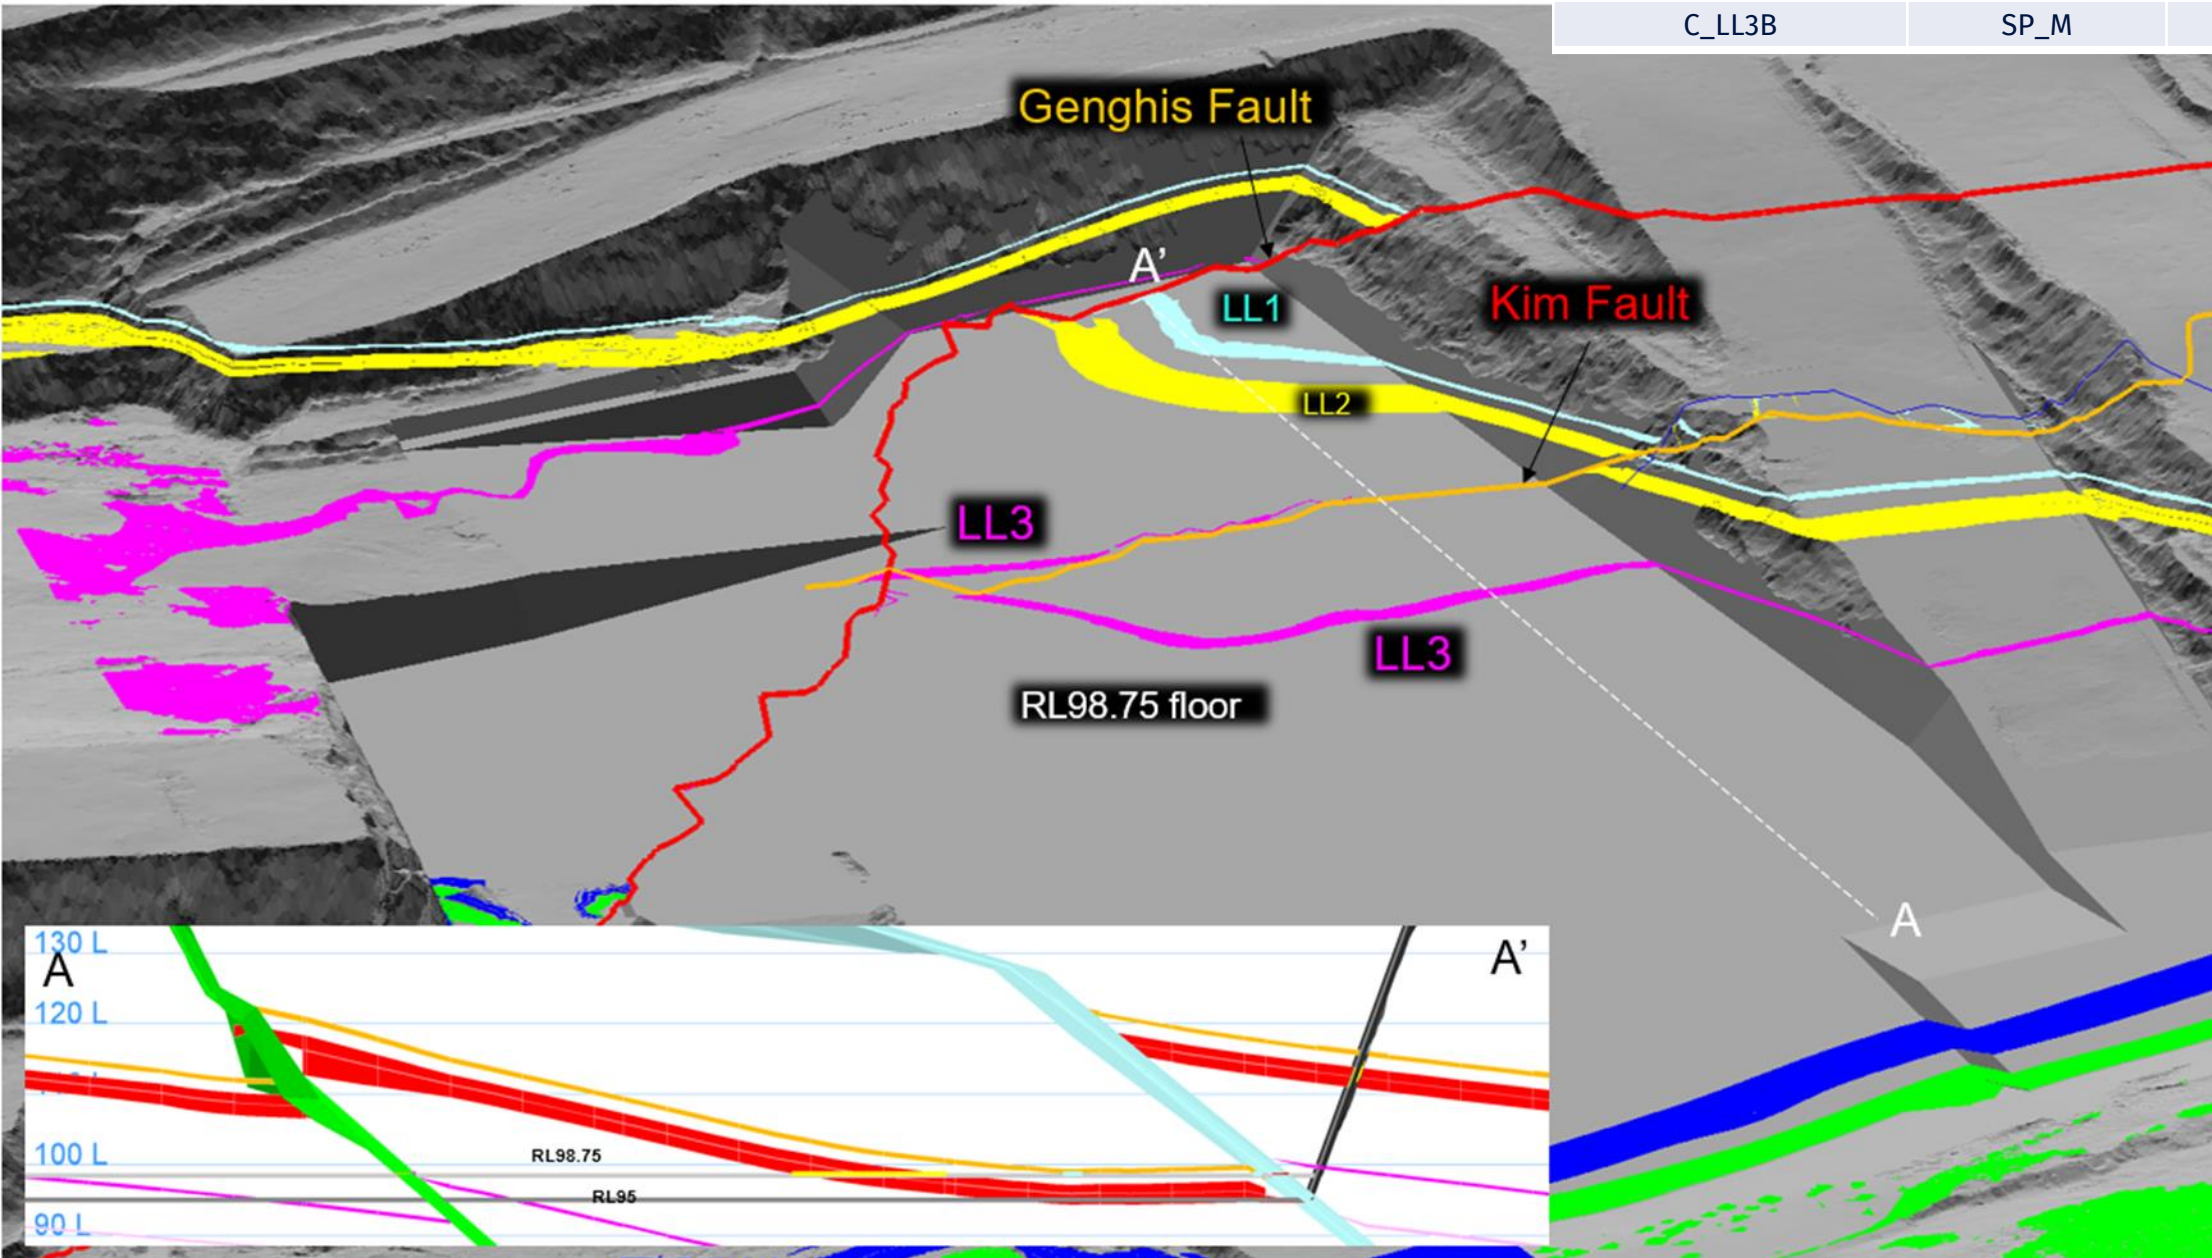


Flitch (RL95)

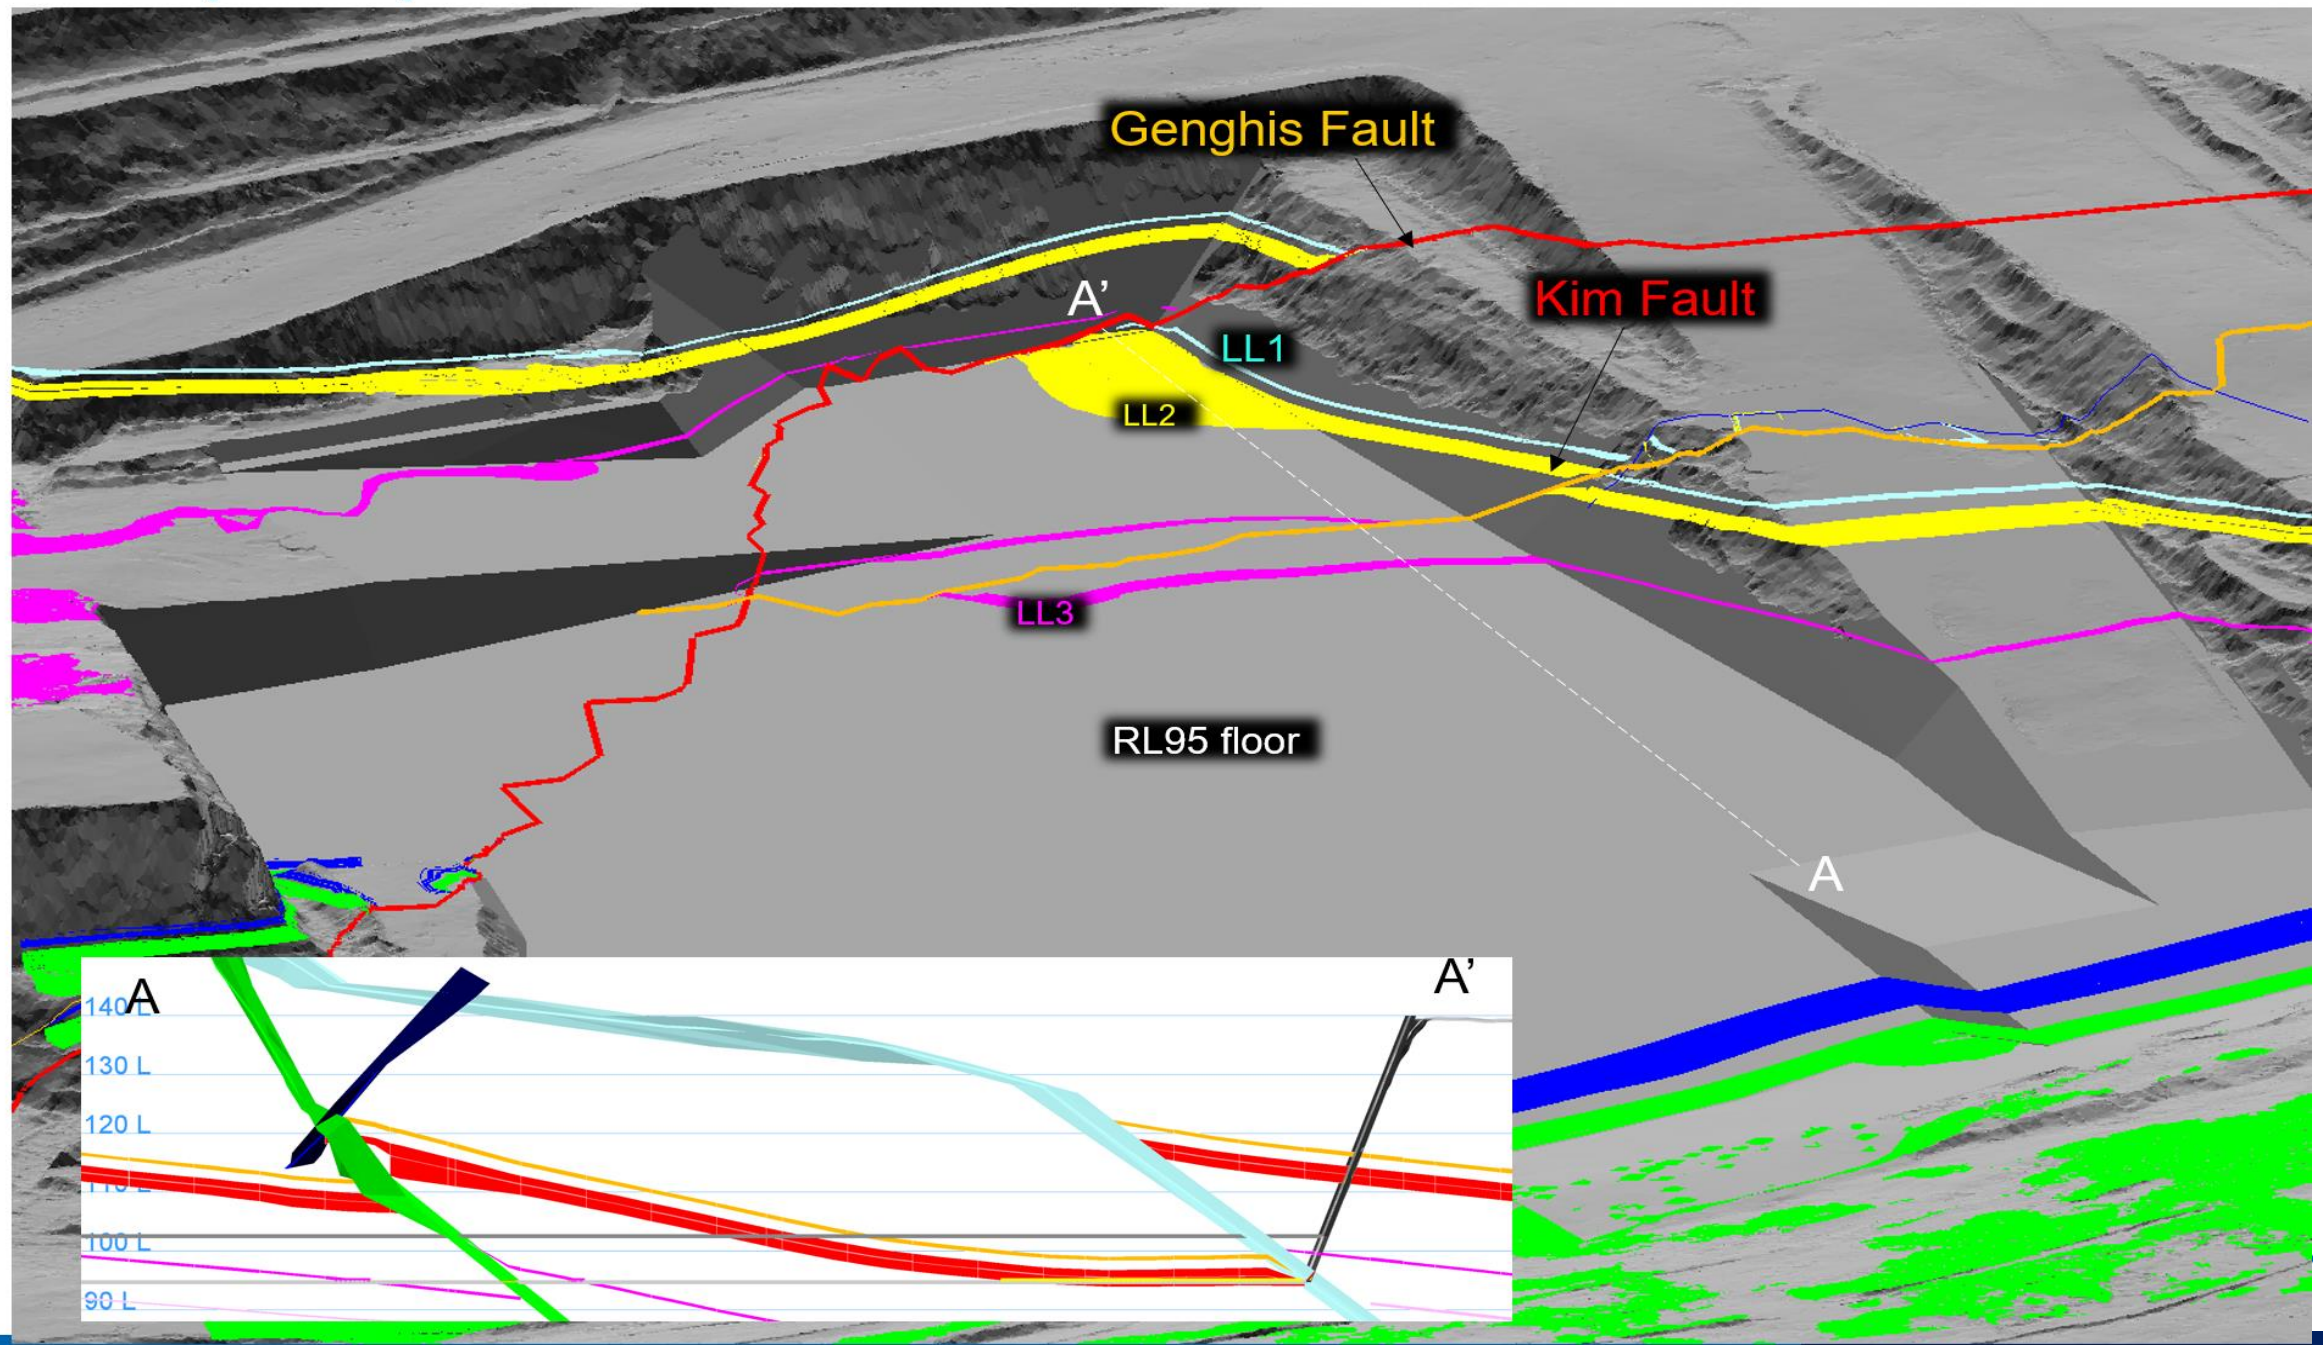

LL2 coal to be recovered

T04/S01 Ramp 5 De-Stack


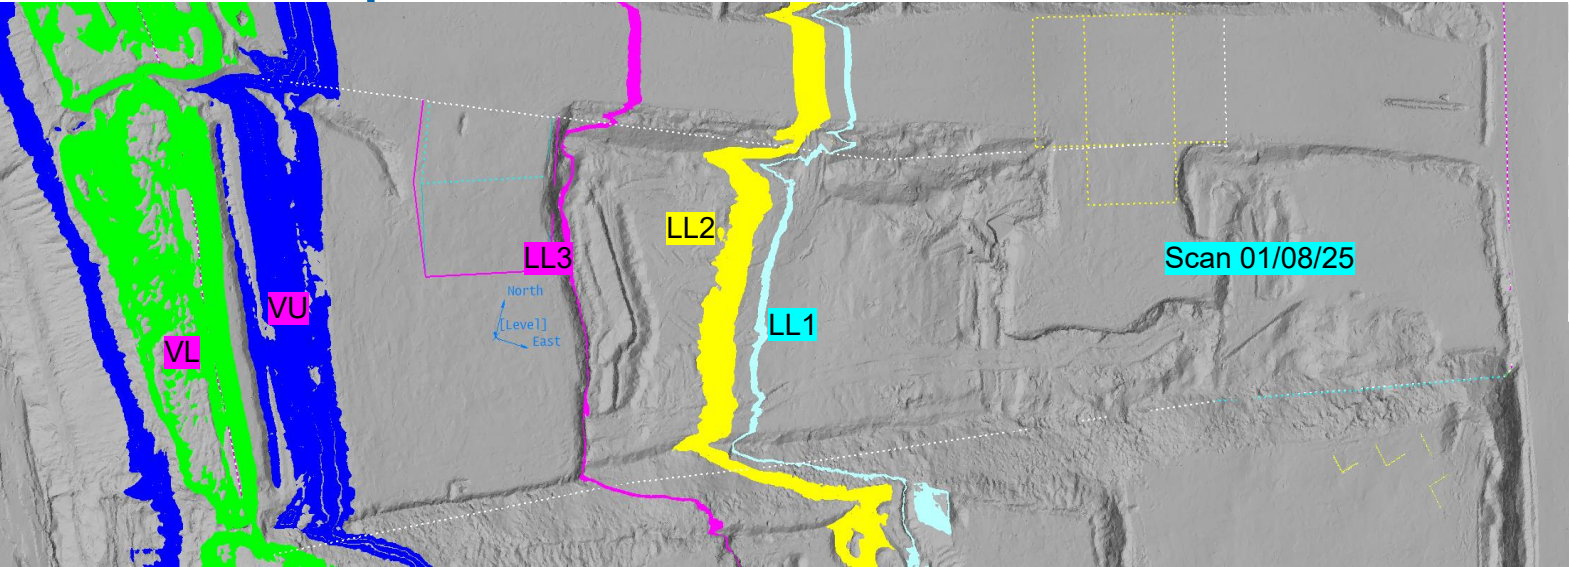


COAL CODE	STOCKPILE	COMMENTS
C_VU1_VU3	SP_C	
C_VL1	VL Pad	
C_LL1	SP_B	Thin seam – take care when mining
C_LL2B_LL2T	SP_P	
C_LL3B	SP_Q	




T04/S01 123 RL

COAL CODE	STOCKPILE	COMMENTS
C_VU1_VU3	SP_C	
C_VL1	VL Pad	
C_LL1	SP_B	Thin seam – take care when mining
C_LL2B_LL2T	SP_P	
C_LL3B	SP_M	Keep a gap between existing OX coal please

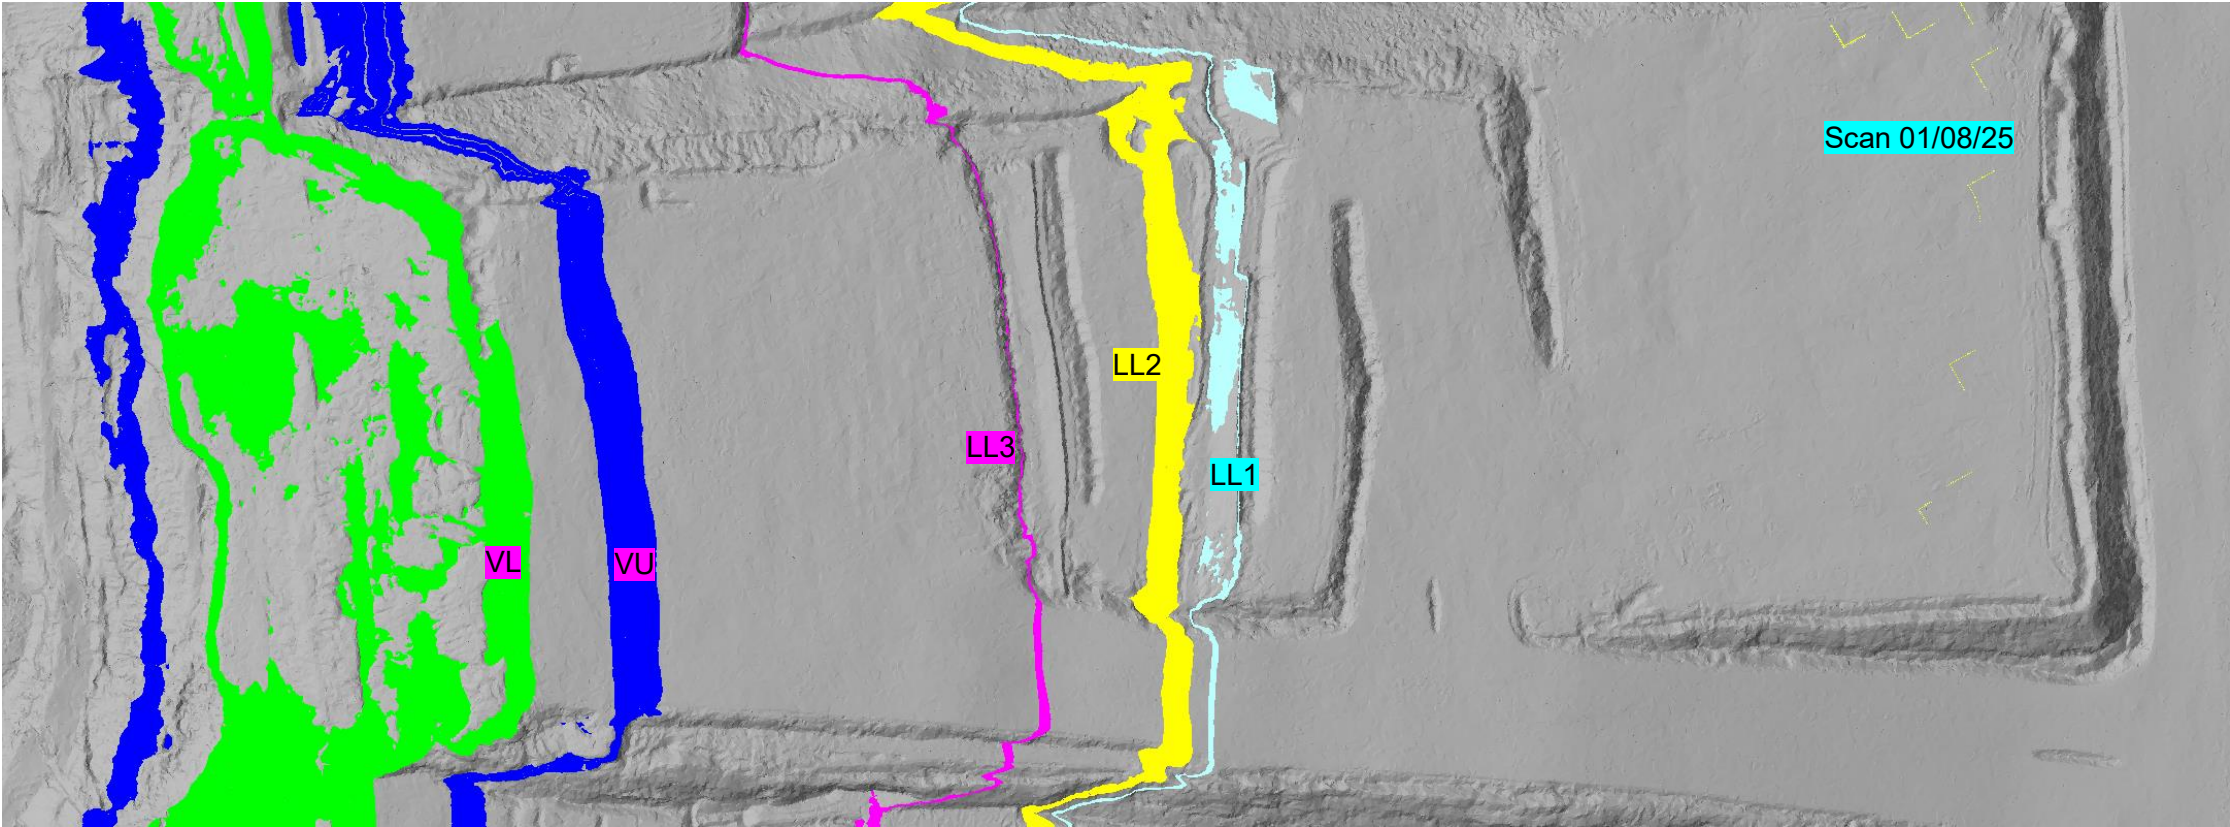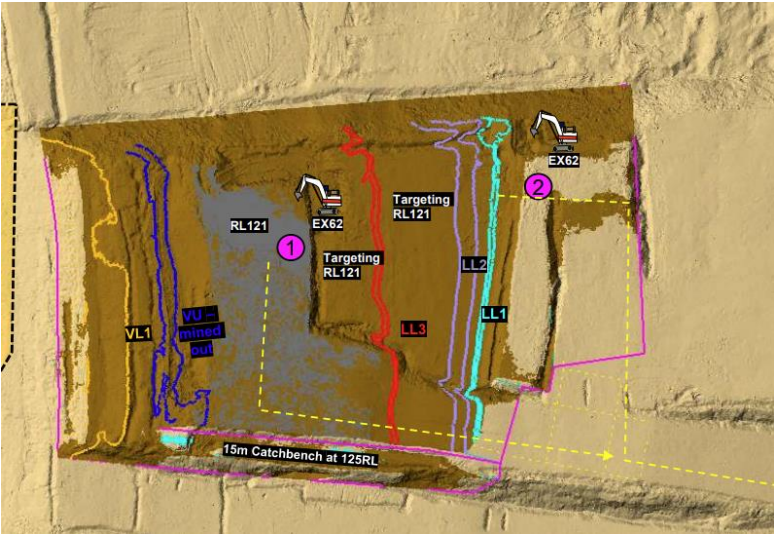


T05/S01 140 RL

COAL CODE	STOCKPILE	COMMENTS
C_LL1	SP_B	Thin seam – take care when mining
C_LL2T_LL2B	SP_D	
C_LL3B	SP_R	Eastern Side
C_VU1_VU3	SP_A	
C_VL1	VL Pad	

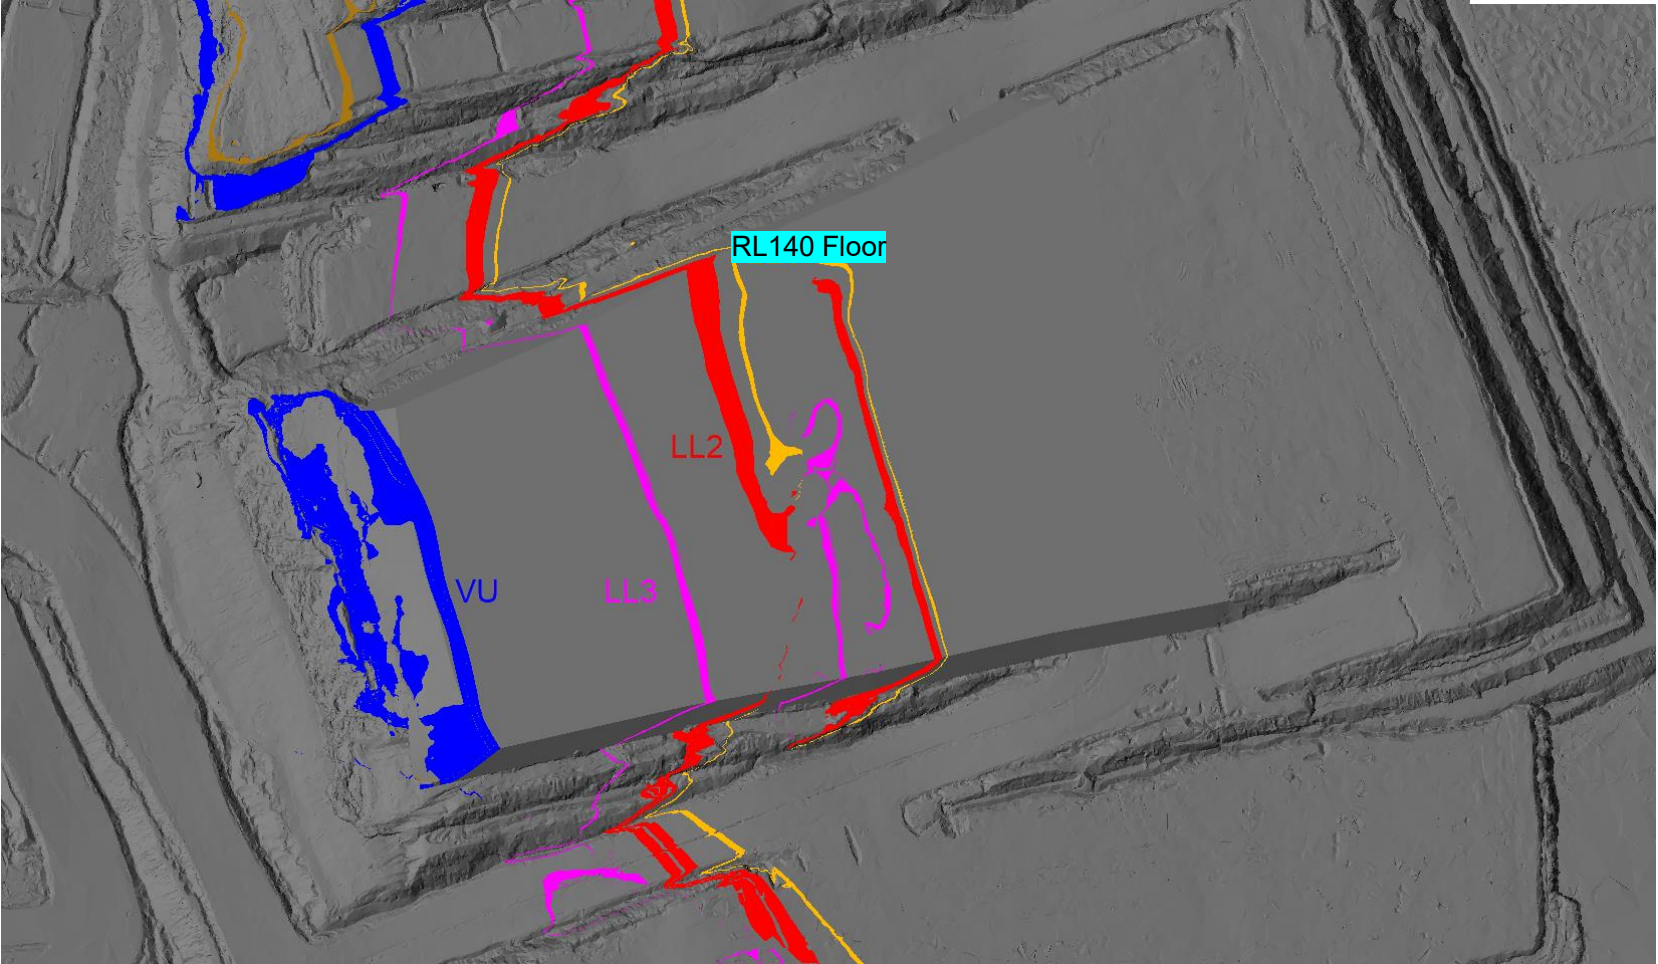


T05/S01 152 RL Ramp 6 De-Stack

COAL CODE	STOCKPILE	COMMENTS
C_LL1	SP_B	Thin seam – take care when mining
C_LL2T_LL2B	SP_D	
C_LL3B	SP_R	Eastern Side
C_VU1_VU3	SP_A	
C_LL1_OX	SP_F	
C_LL2_OX	SP_S	

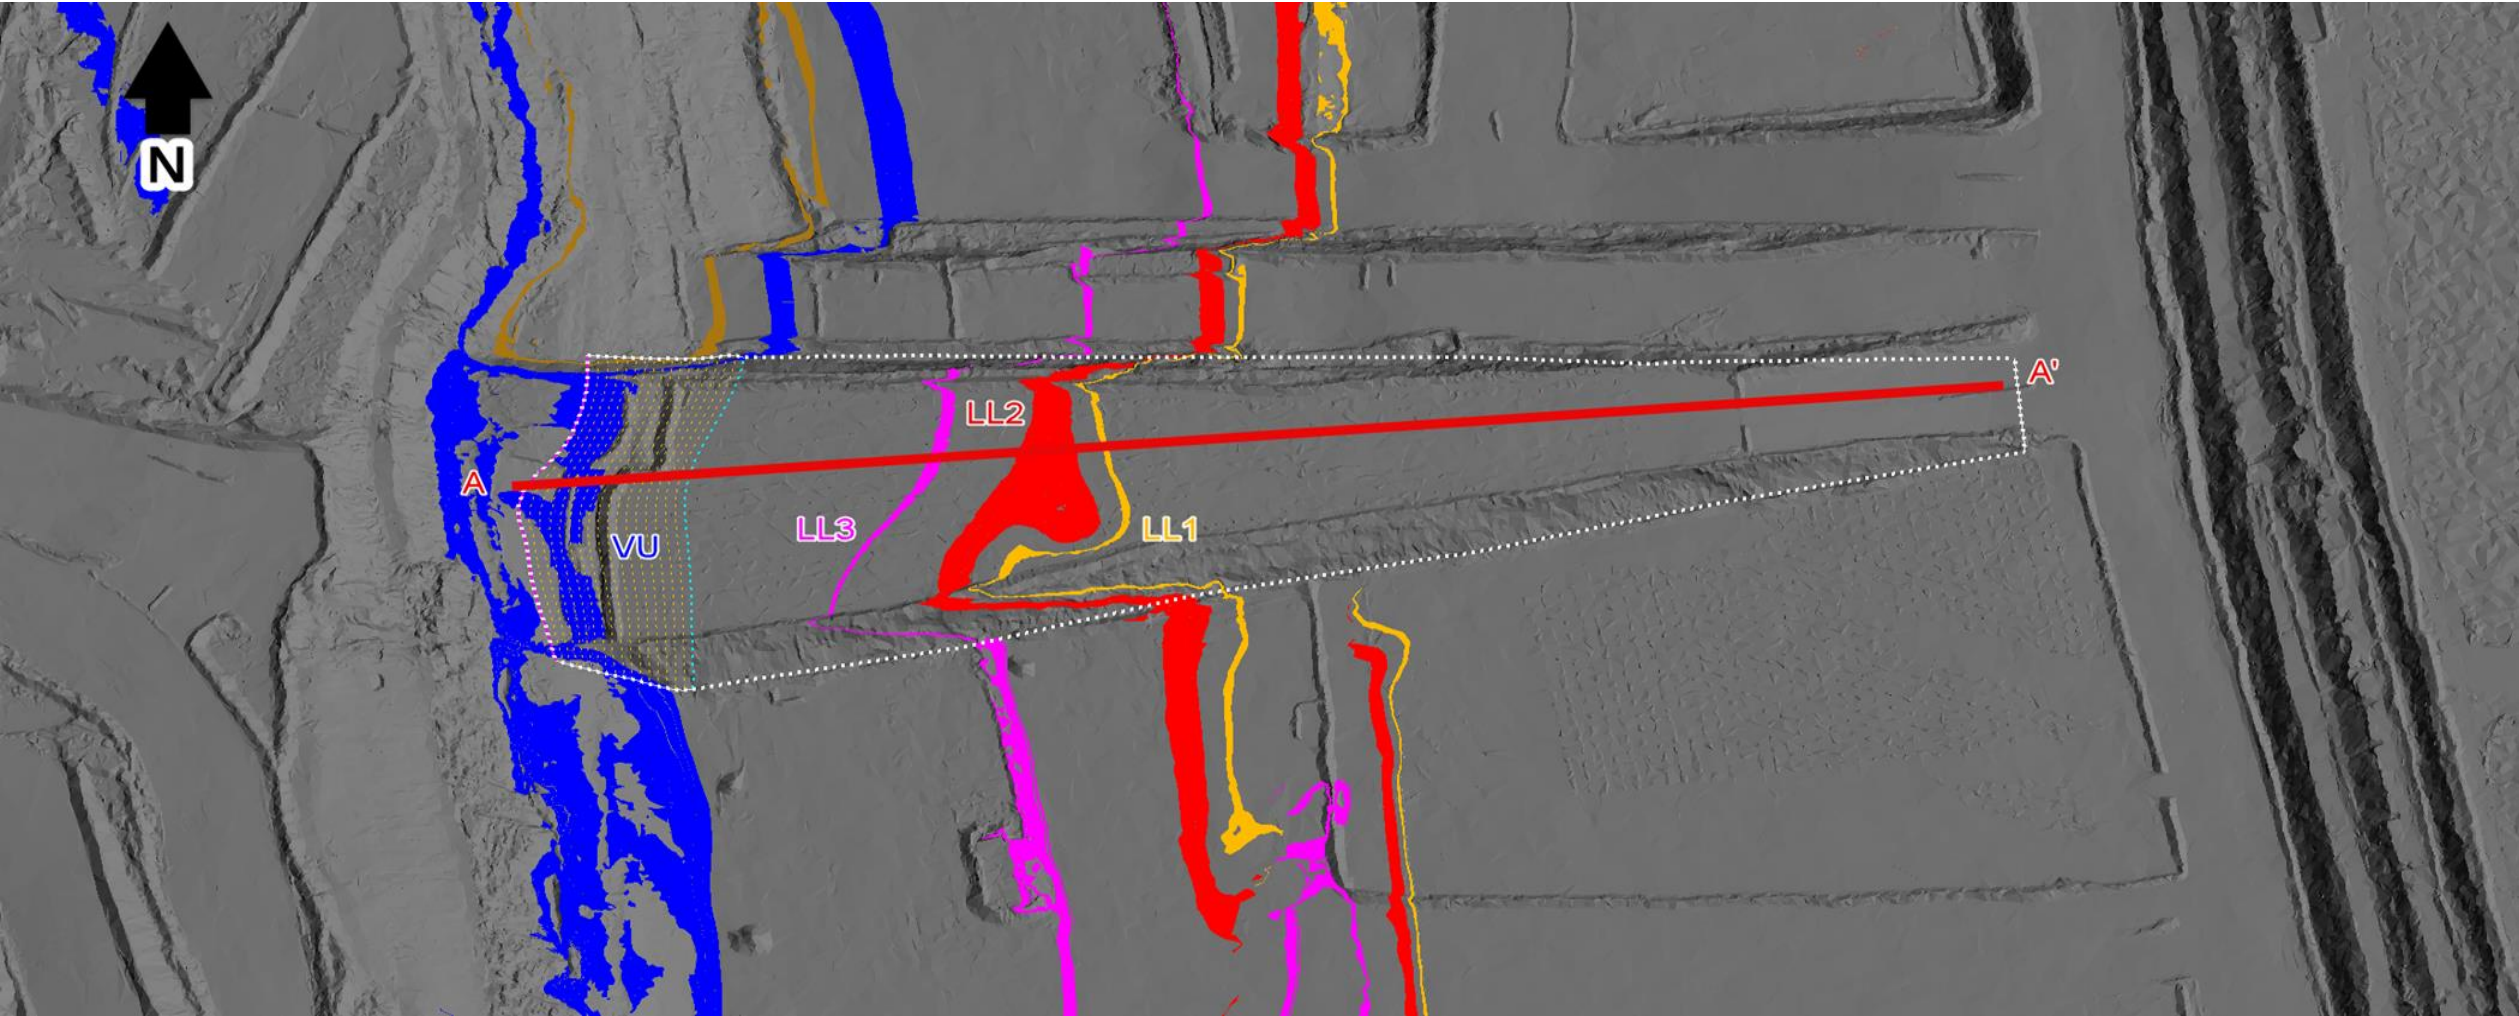

ROM

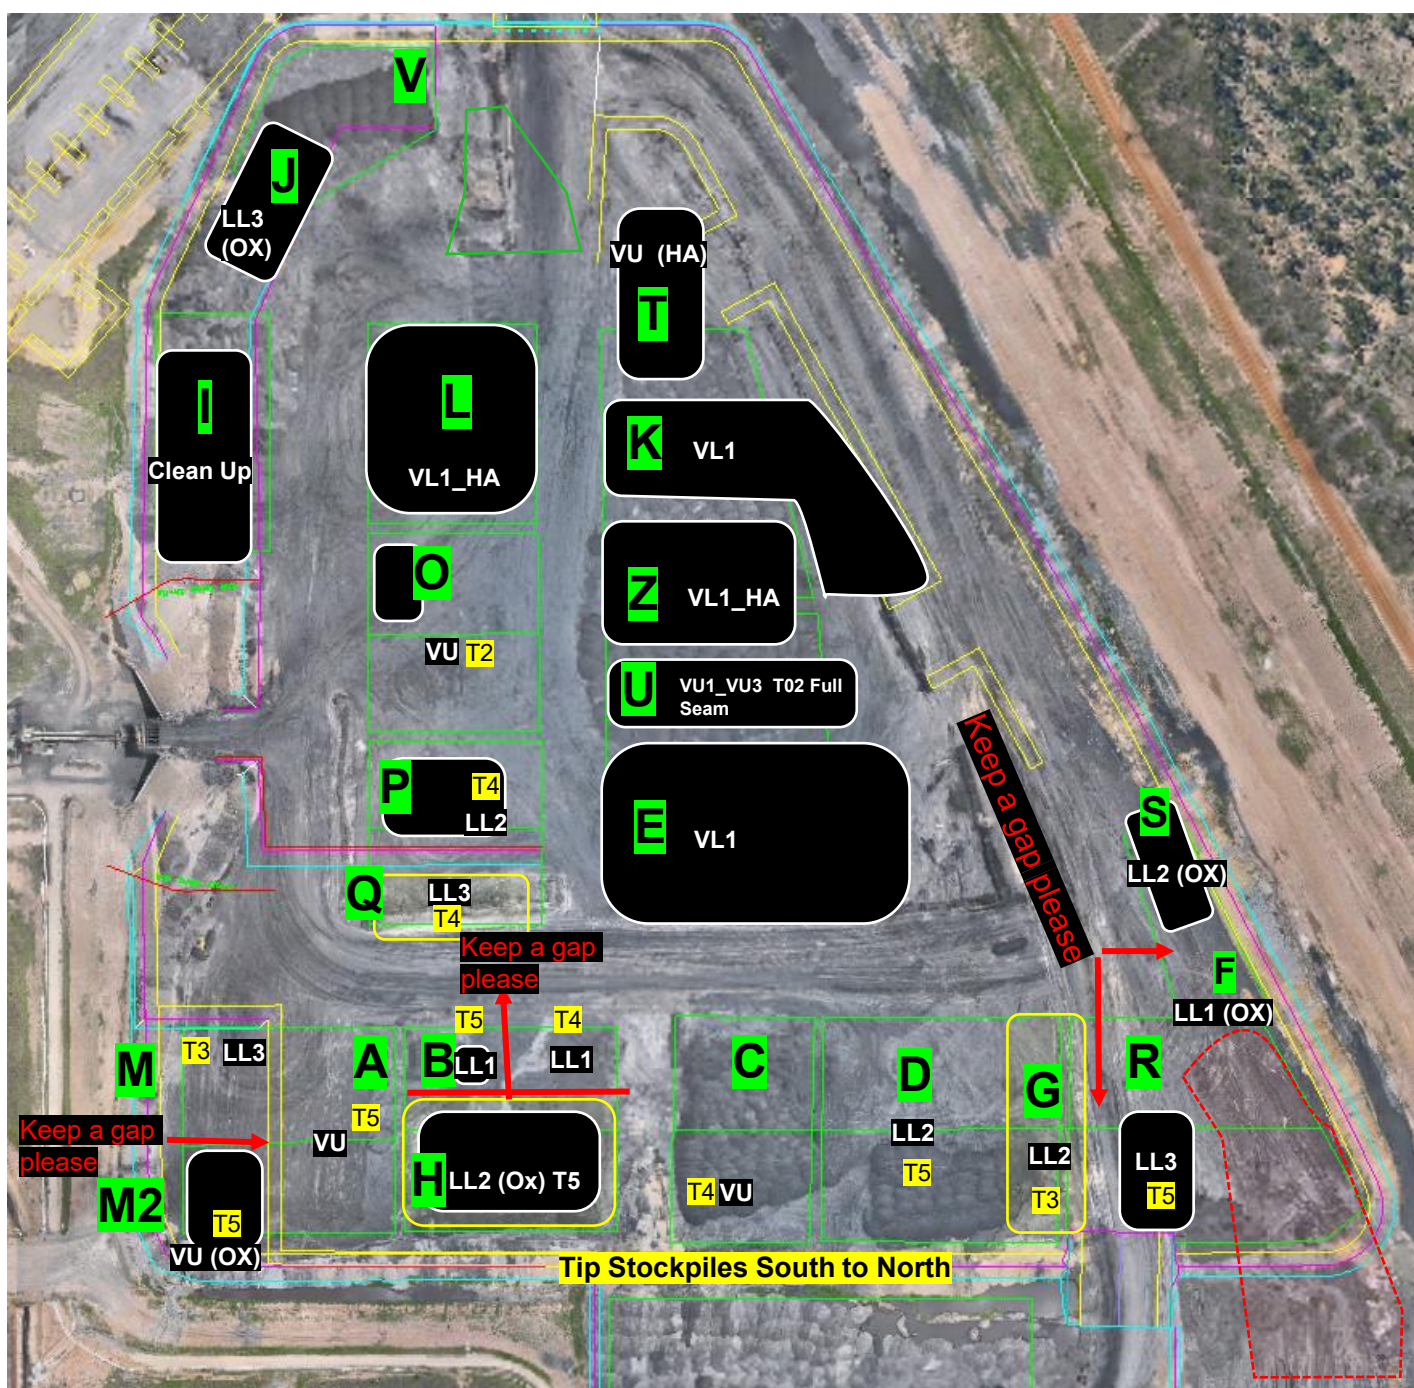

CHPP Coal Feed Sequence

Communicate any direct feed start and finish time to CHPP control.

Comments

Plant Currently Shutdown, Starting up at 19:00 on Blend 1

- Once Stockpile P is exhausted change to Blend 2
- Once Terrace 4 LL1 is exhausted change to Blend 3
- Once Stockpile B is exhausted change to Blend 4
- Once Stockpile R is exhausted change to Blend 5

Notes:

If unable to run on Blend 1 due to Clays then change to Blend 6

	Blends							
	Feed 1	Feed 2	Feed 3	Ratio	ROM Loaders	ROM Trucks	Direct Feed	Comments
Blend 1	SP-P			Straight	1	1	No	LL2 (T04S01)
Blend 2	SP-B	SP-R		1:1	1	1	No	1 xLL1(T04S01) : 1 x LL3 (T03S02)
Blend 3	SP-B	SP-R		1:1	1	1	No	1 xLL1(T03S01) : 1 x LL3 (T03S02)
Blend 4	SP-R			Straight	1	1	No	LL3 (T03S02)
Blend 5	SP-M	SP-M2		1:1	1	1	No	1 x LL3 (T03S02) : 1 x VU (Ox T05S01)
Blend 6	SP-P	SP-R		2:1	1	1	No	2 x LL2 (T04S01): 1 x LL3 (T03S02)
Wet weather								

	Plant Settings											
	Primary DMC	Sec DMC	Reflux	Planned Feed Ash	Gate 401	Coke Stacker	Thermal Stacker	Primary Yield	Secondary Yield	Primary Ash	Primary Moisture	Expected CSN
Blend 1	1.4			22%	To Primary	South		65%	14%	10.4%	11.0%	6
Blend 2												
Blend 3												
Blend 4												
Blend 5												
Blend 6	1.41							54%	15%	10.4%	11.0%	7
Wet weather												

