


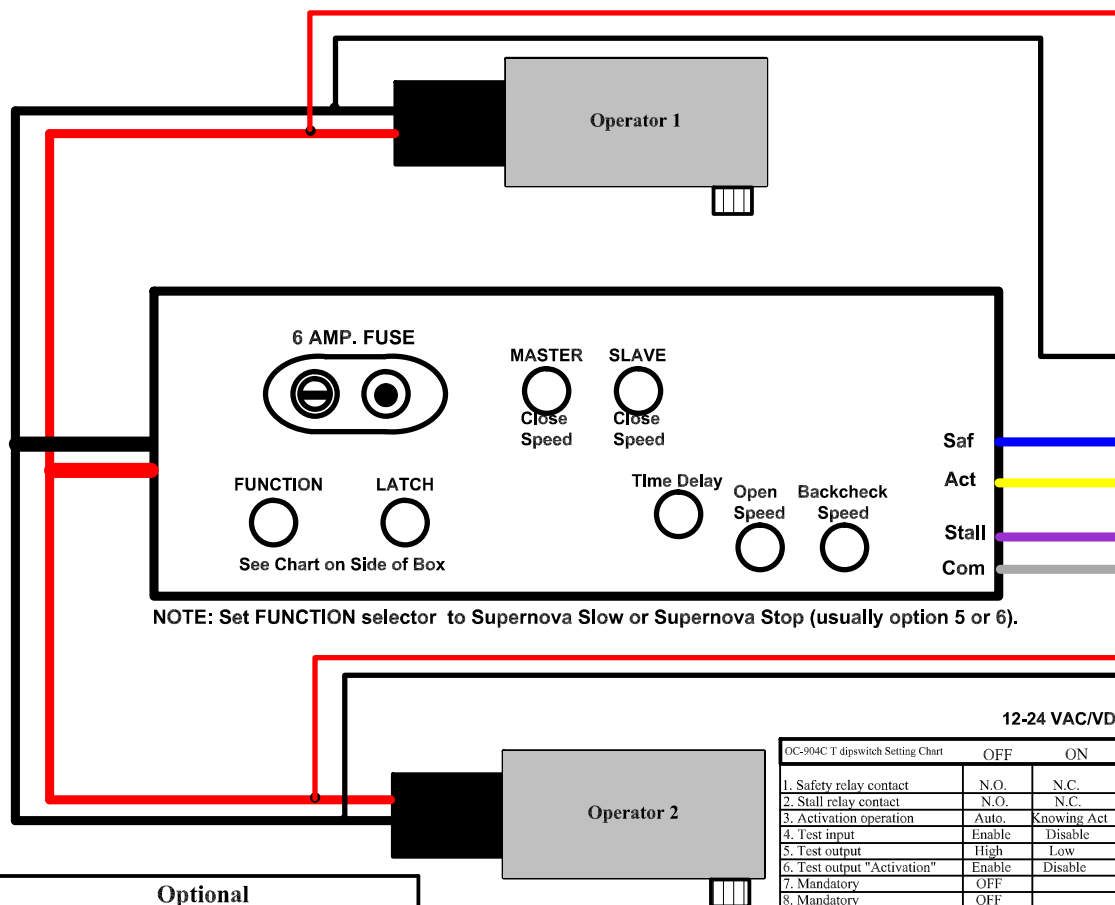

NOTE: Set FUNCTION selector to Supernova Slow or Supernova Stop (usually option 5 or 6).

OC-904C T dipswitch Setting Chart		
	OFF	ON
1. Safety relay contact	N.O.	N.C.
2. Stall relay contact	N.O.	N.C.
3. Activation operation	Auto.	Knowing Act
4. Test input	Enable	Disable
5. Test output	High	Low
6. Test output "Activation"	Enable	Disable
7. Mandatory	OFF	
8. Mandatory	OFF	



Fully Automatic	Knowing Act
1. OFF	OFF
2. ON	ON
3. OFF	ON
4. OFF	OFF
5. ON	ON
6. OFF	OFF
7. OFF	OFF
8. OFF	OFF

INSTALLATION NOTES



1. Set door speeds and verify proper door operation prior to final connection of sensors system.
2. Technician MUST WALK TEST to verify function and detection patterns comply with ANSI/BHMA A156.10 requirements.



NOTE:
ALL activation devices must connect to the Purple & White/Purple wires (N/O dry contact only).
The Purple & White/Purple wires from the OC-904C T's connect in parallel. Be sure to observe polarity (+ to +, - to -).
DO NOT connect purple wires to Door Control.

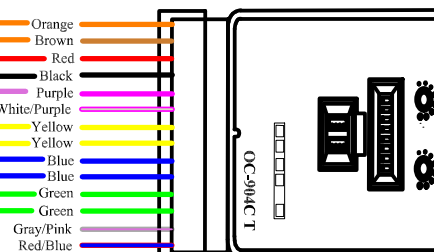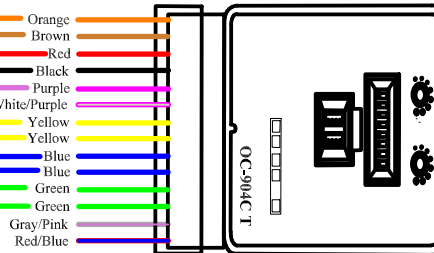

Fully Automatic Applications Only

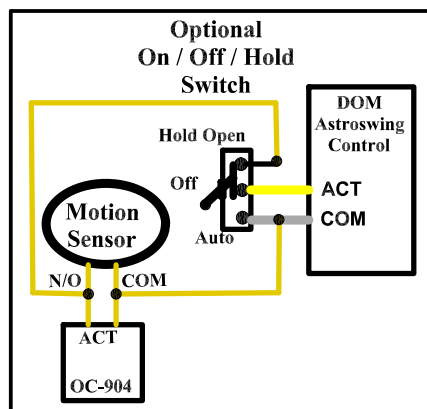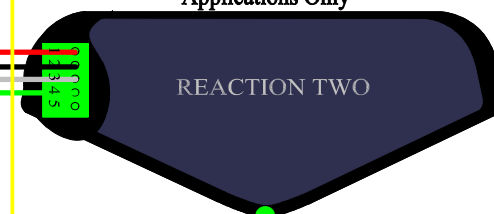

Title: 16300550 Doromatic Astrowing Simultaneous Pair with Elite T		Drawing # 16300550
Drawing By: PWK	Date: 09/16/17	Sheet: 1 of 1
OPTEX Technologies Inc. 18730 S. Wilmington Ave. Unit 100 Rancho Dominguez, CA. 90220 800-877-6656 FAX 310-898-1098		