


INSTALLATION NOTES

1. Set door speeds and verify proper door operation prior to final connections of sensors system.
2. Technician MUST WALK TEST to verify function and detection patterns comply with ANSI/BHMA A156.10 requirements.
3. Stanley Control TBI pins 6 & 8 must be connected to the breakout status switch or be jumpered together.
4. Stanley Control switch S-1 set to L for Low energy Magic-Force singles. Set to H for all Magic-Swing and all Dual Magic-Force.

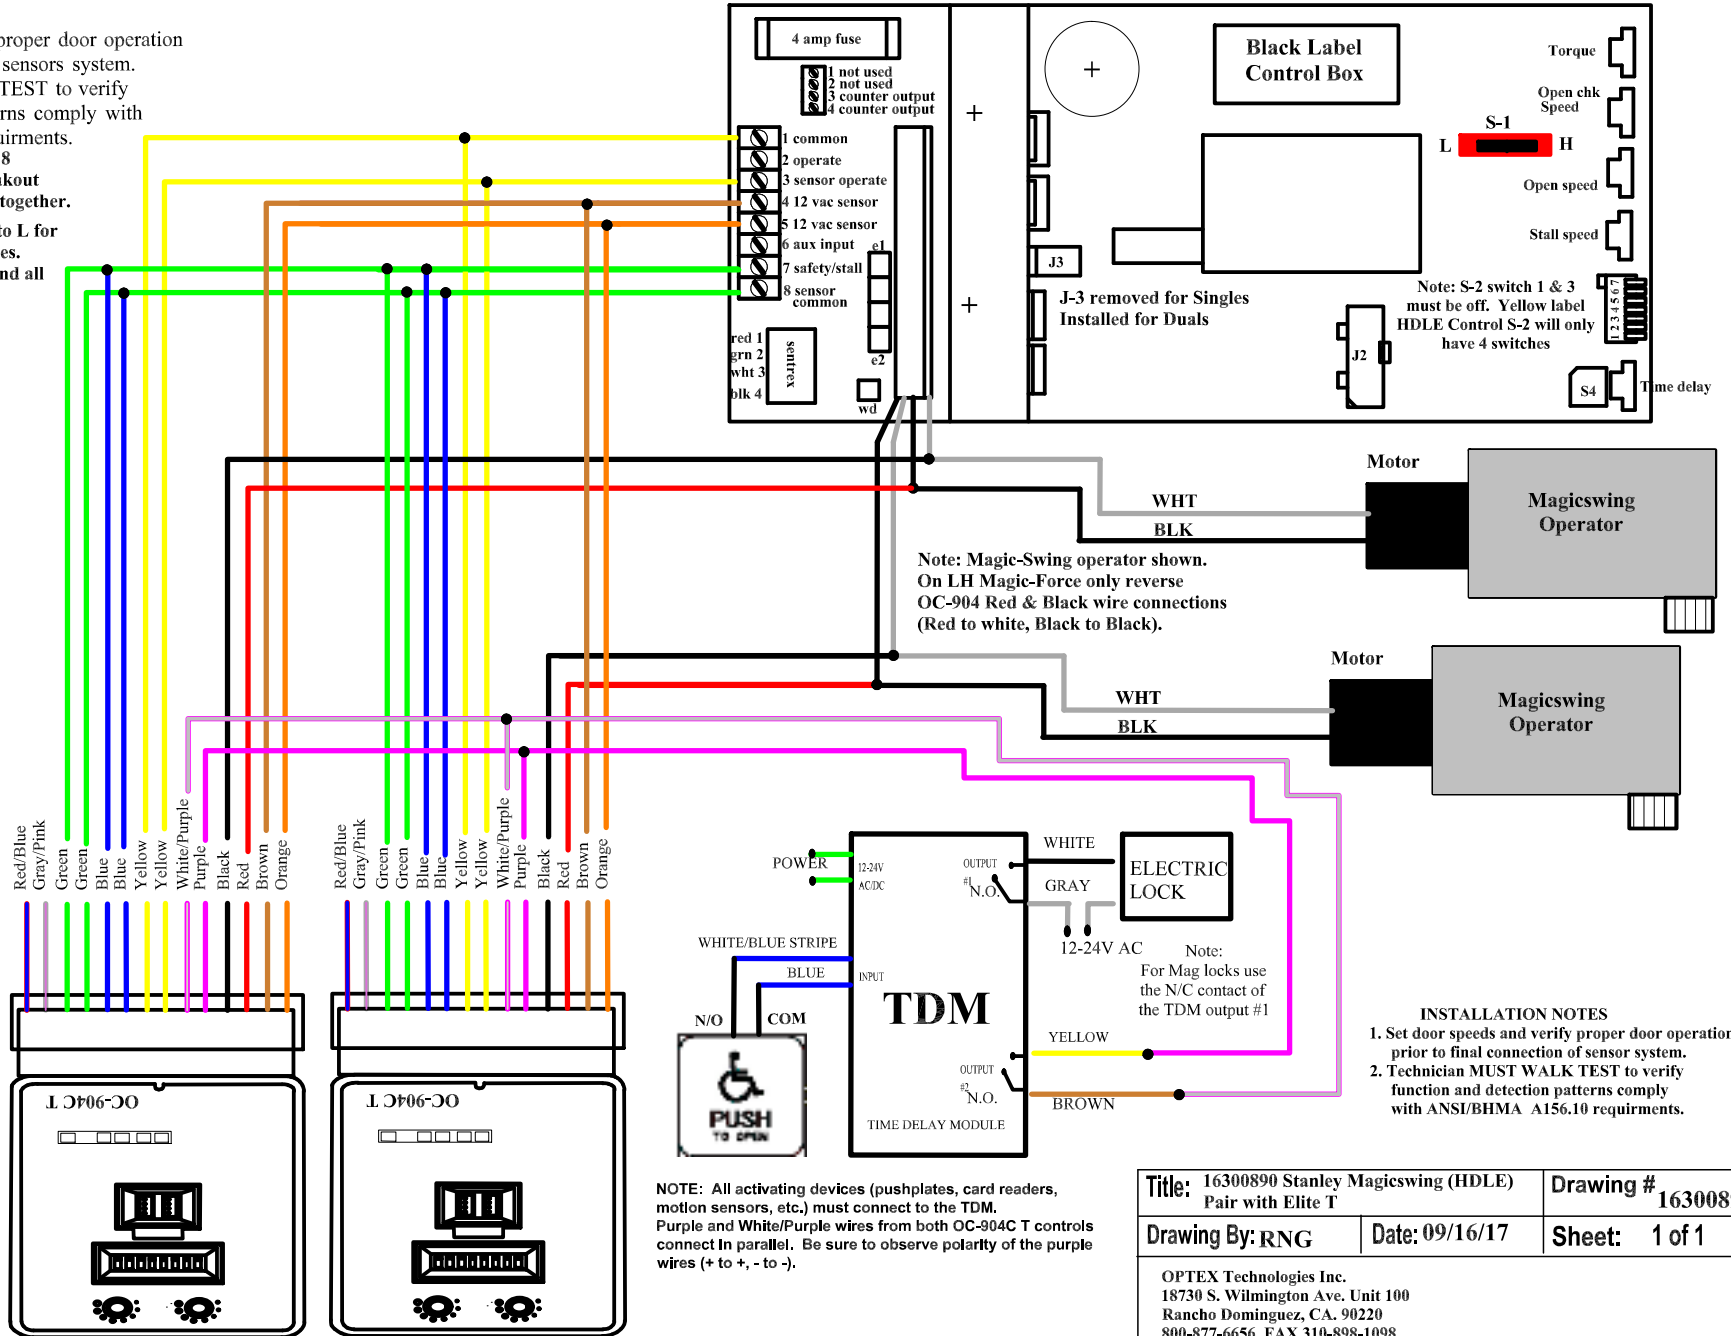

OC-904C T Edgewise Setting Chart	OFF	ON
1. Safety relay contact	N.O.	N.C.
2. Stall relay contact	N.O.	N.C.
3. Activation operation	Auto.	Stowing Act.
4. Test output	Enable	Disable
5. Test output	High	Low
6. Test output "Activation"	Enable	Disable
7. Mandatory	OFF	ON
8. Mandatory	OFF	ON

Fully Automatic	Knowing Act
1. OFF	OFF
2. OFF	OFF
3. OFF	ON
4. ON	ON
5. OFF	OFF
6. ON	ON
7. OFF	OFF
8. OFF	OFF

INSTALLATION NOTES

1. Set door speeds and verify proper door operation prior to final connection of sensor system.
2. Technician MUST WALK TEST to verify function and detection patterns comply with ANSI/BHMA A156.10 requirements.

Title: 16300890 Stanley Magicswing (HDLE) Pair with Elite T	Drawing # 16300890
Drawing By: RNG	Date: 09/16/17
Sheet: 1 of 1	
OPTEx Technologies Inc. 18730 S. Wilmington Ave. Unit 100 Rancho Dominguez, CA. 90220 800-877-6656 FAX 310-898-1098	