

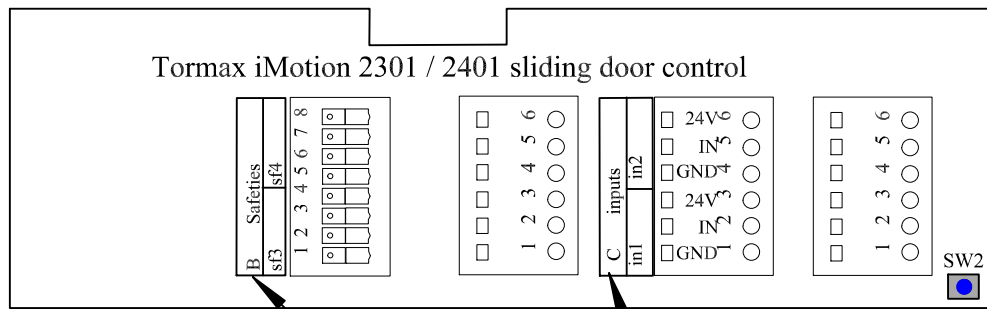


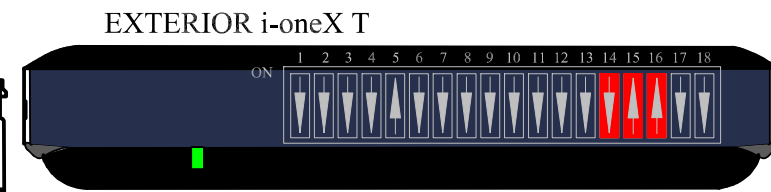

Notes:

1. Verify proper door operation prior to final connection of sensors.
2. Perform an Auto Configuration with code 021 or 022 or the SW2 button
3. Mandatory dipswitch settings: ■
4. For proper monitoring operation set dipswitch 15 & 16 ON (up).
5. For simultaneous output set dipswitch 14 OFF and BLUEZONE set dipswitch 5 ON.
6. Using dipswitches 3 & 4 select a different frequency settings for each sensor.
7. Technician must perform a field test to verify substantial compliance with ANSI/BHMA A156.10 Section 8.

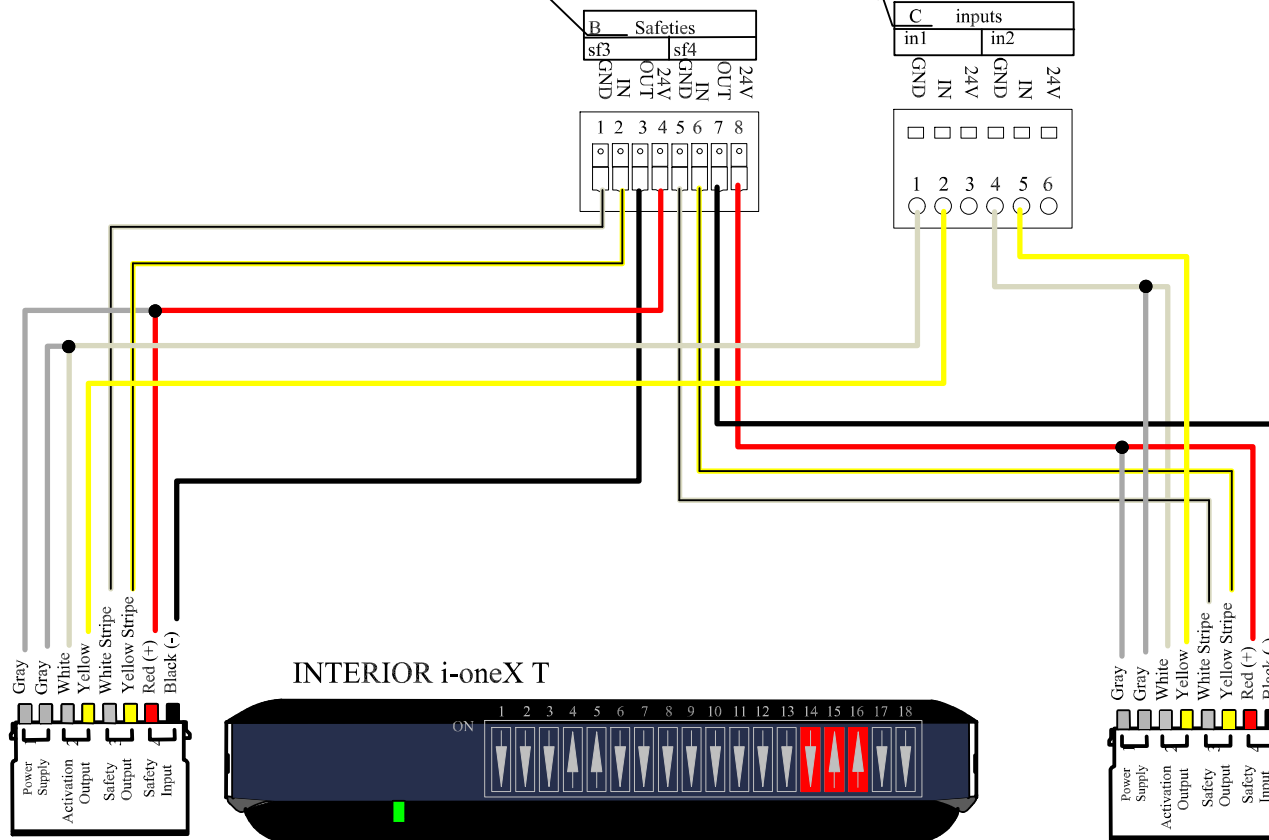

Title: 16300160 Tormax iMotion 2301 / 2401 with i-oneX T		Drawing # 16300160
Drawing By: RNG	Date: 5/31/16	Sheet: 1 of 1
OPTEX Technologies Inc. 18730 S. Wilmington Ave. Unit 100 Rancho Dominguez, CA. 90220 800-877-6656 FAX 310-898-1098		