



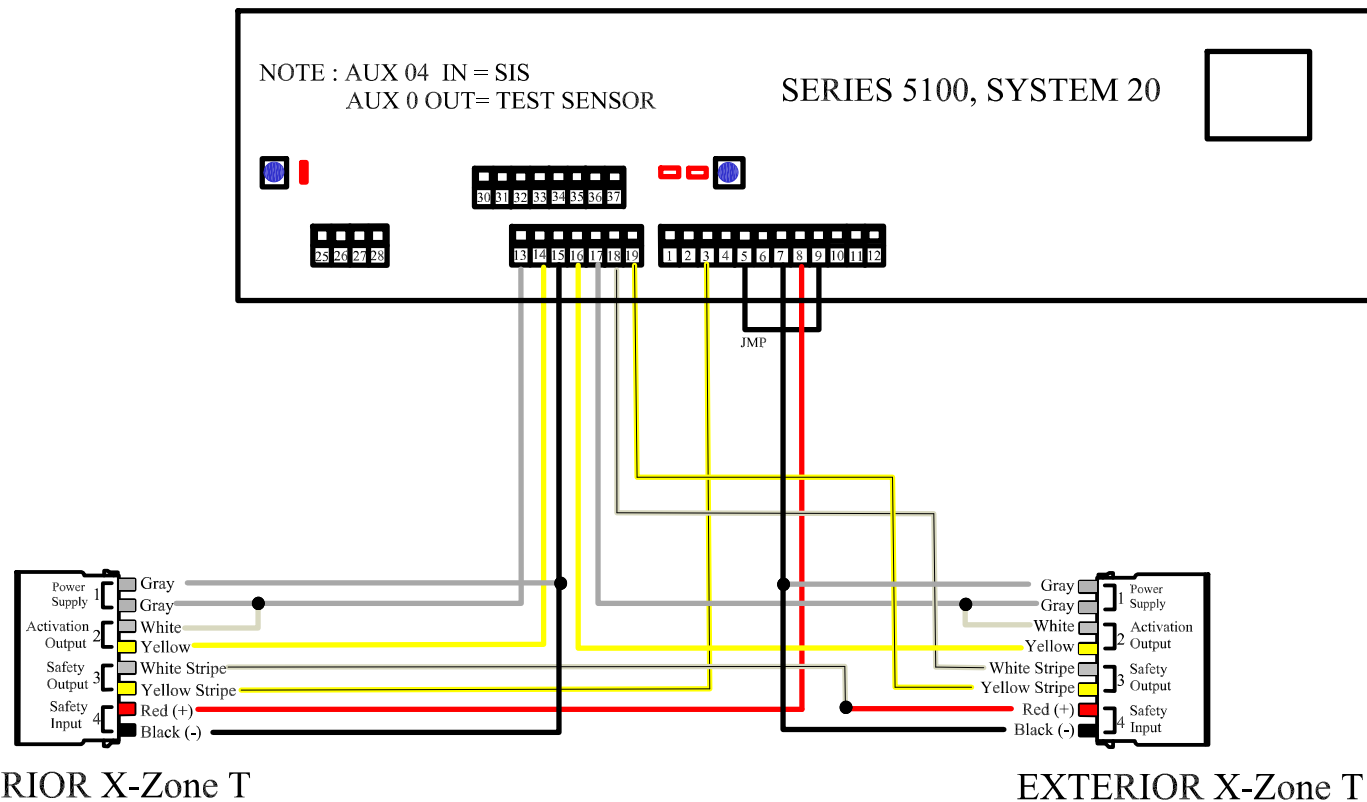

Dipswitch 1, 14 & 15 = ON, 12 & 13 = OFF

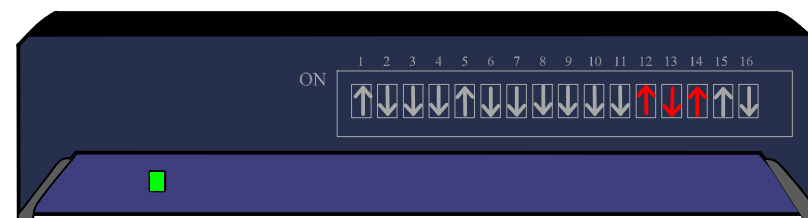

Dipswitch 1, 5, 12, 14 & 15 = ON, 13 = OFF

Notes:

1. Verify proper door operation prior to final connection of sensors.
2. Set System 20 control, AUX 04 IN = SIS, AUX 0 OUT = TEST SENSOR
3. Interior X-Zone T dipswitch, 12 & 13 OFF, dipswitch 1, 14 & 15 ON
Exterior X-Zone T dipswitch 13 OFF, dipswitch 1, 5, 12, 14 & 15 ON
4. Technician must perform a field test to verify substantial compliance with ANSI/BHMA A156.10 Section 8.

Title: 16300050 RECORD SYSTEM 20 with X-ZONE T		Drawing # 16300050
Drawing By: JCK	Date: 5-9-16	Sheet: 1 of 1
OPTEX Technologies Inc. 18730 S. Wilmington Ave. Unit 100 Rancho Dominguez, CA. 90220 800-877-6656 FAX 310-898-1098		