

HARSH DENVER


The Original **ROLLER-GRINDER**

Differential Drive Gearbox
Hook Le Page Corrugation
Sharp-to-Sharp Configuration
Left-hand Drive (as shown)



Sheaves
Hubs
Drive Belts
Motor Base*


*Requires 7.5-75 HP Motor-not included

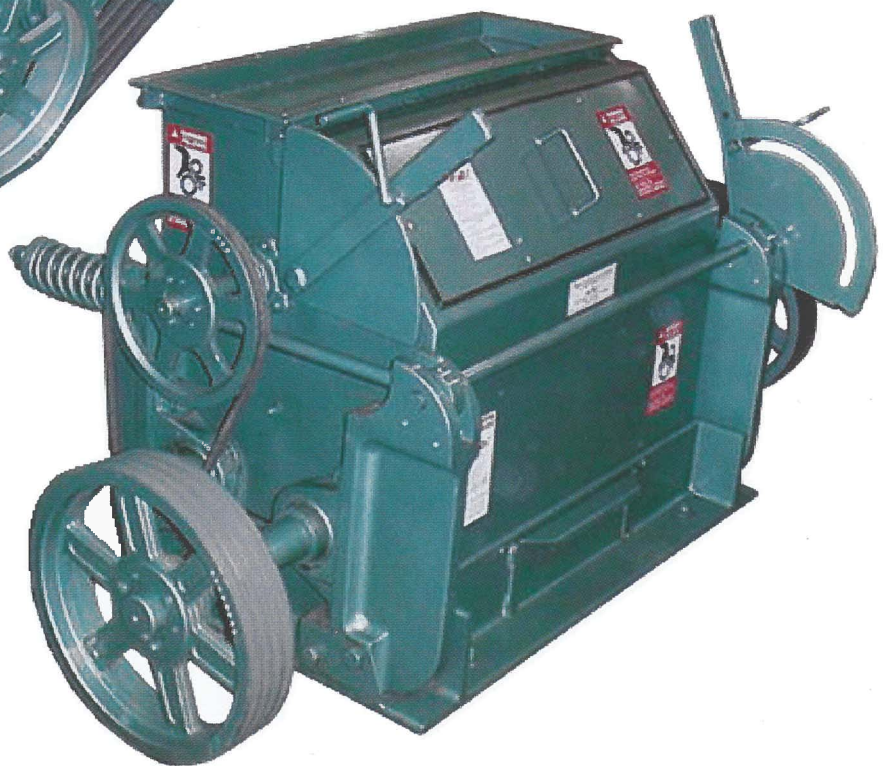


ITEM	QTY	DESCRIPTION
1	1	INSPECTION DOOR
2	1	FEED ROLL HOOD
3	1	V-BELT
4	1	FEEDER ROLL SHEAVE
5	1	ROLL CLOSURE HANDLE
6	1	ROLL HANDLE LOCK
7	1	ROLL DIAL PLATE
8	2	BOLT (DIAL)
9	6	BOLT (TOP CABINET)
10	4	BOLT (ARM)
11	1	ROLL (FAST)
12	2	SAMPLING DOOR
13	1	FRAME
14	4	BOLT (BOTTOM CABINET)
15	4	FELT
16	2	STATIONARY ARM CASTING
17	4	PILLOW BLOCK BEARING
18	8	BOLT
19	2	MOVABLE ARM CASTING
20	2	TRAMMING ECCENTRIC
21	2	BOLT (TRAMMING)
22	1	BOLT
23	2	NUT
24	2	WASHER
25	1	GEAR BOX TENSION ROD
26	1	V-BELT (3 TO 4 BELTS)
27	1	SHEAVE (GEAR BOX)
28	1	SHEAVE - FAST ROLL
29	1	LOCK COLLAR
30	1	SET SCREW
31	1	SPEED REDUCER
32	4	GREASE ZERK
33	1	KEY
34	1	KEY
35	4	PIN WASHER
36	1	TENSION SPRING
37	2	WASHER (SPRING)
38	8	NUT
39	2	PIN
40	2	TENSION ROD ECCENTRIC
41	2	TENSION ROD
42	1	ROLL (SLOW)
43	2	WIPER BLADE HOOD
44	2	BOLT, V-BLOCK
45	2	NUT, V-BLOCK
46	2	V-BLOCK
47	2	WIPER BLADE (RUBBER)
48	2	WIPER BLADE STIFFENER
49	8	BOLT
50	2	FLANGE, BEARING
51	8	NUT
52	1	GREASE ZERK
53	1	FEEDER ROLL
54	1	FEEDER ROLL GATE
55	1	FEEDER ROLL GATE SHAFT
56	1	FEEDER ROLL GATE DIAL
57	1	FEEDER ROLL DRIVE SHEAVE
58	1	FEEDER ROLL GATE ECCENTRIC
59	1	TENSION SPRING (GEAR BOX)
60	1	TENSION ROD, CROSS SHAFT
61	1	SPRING WASHER
62	1	FEEDER HANDLE LOCK
63	1	FEEDER GATE HANDLE

HARSH

DENVER

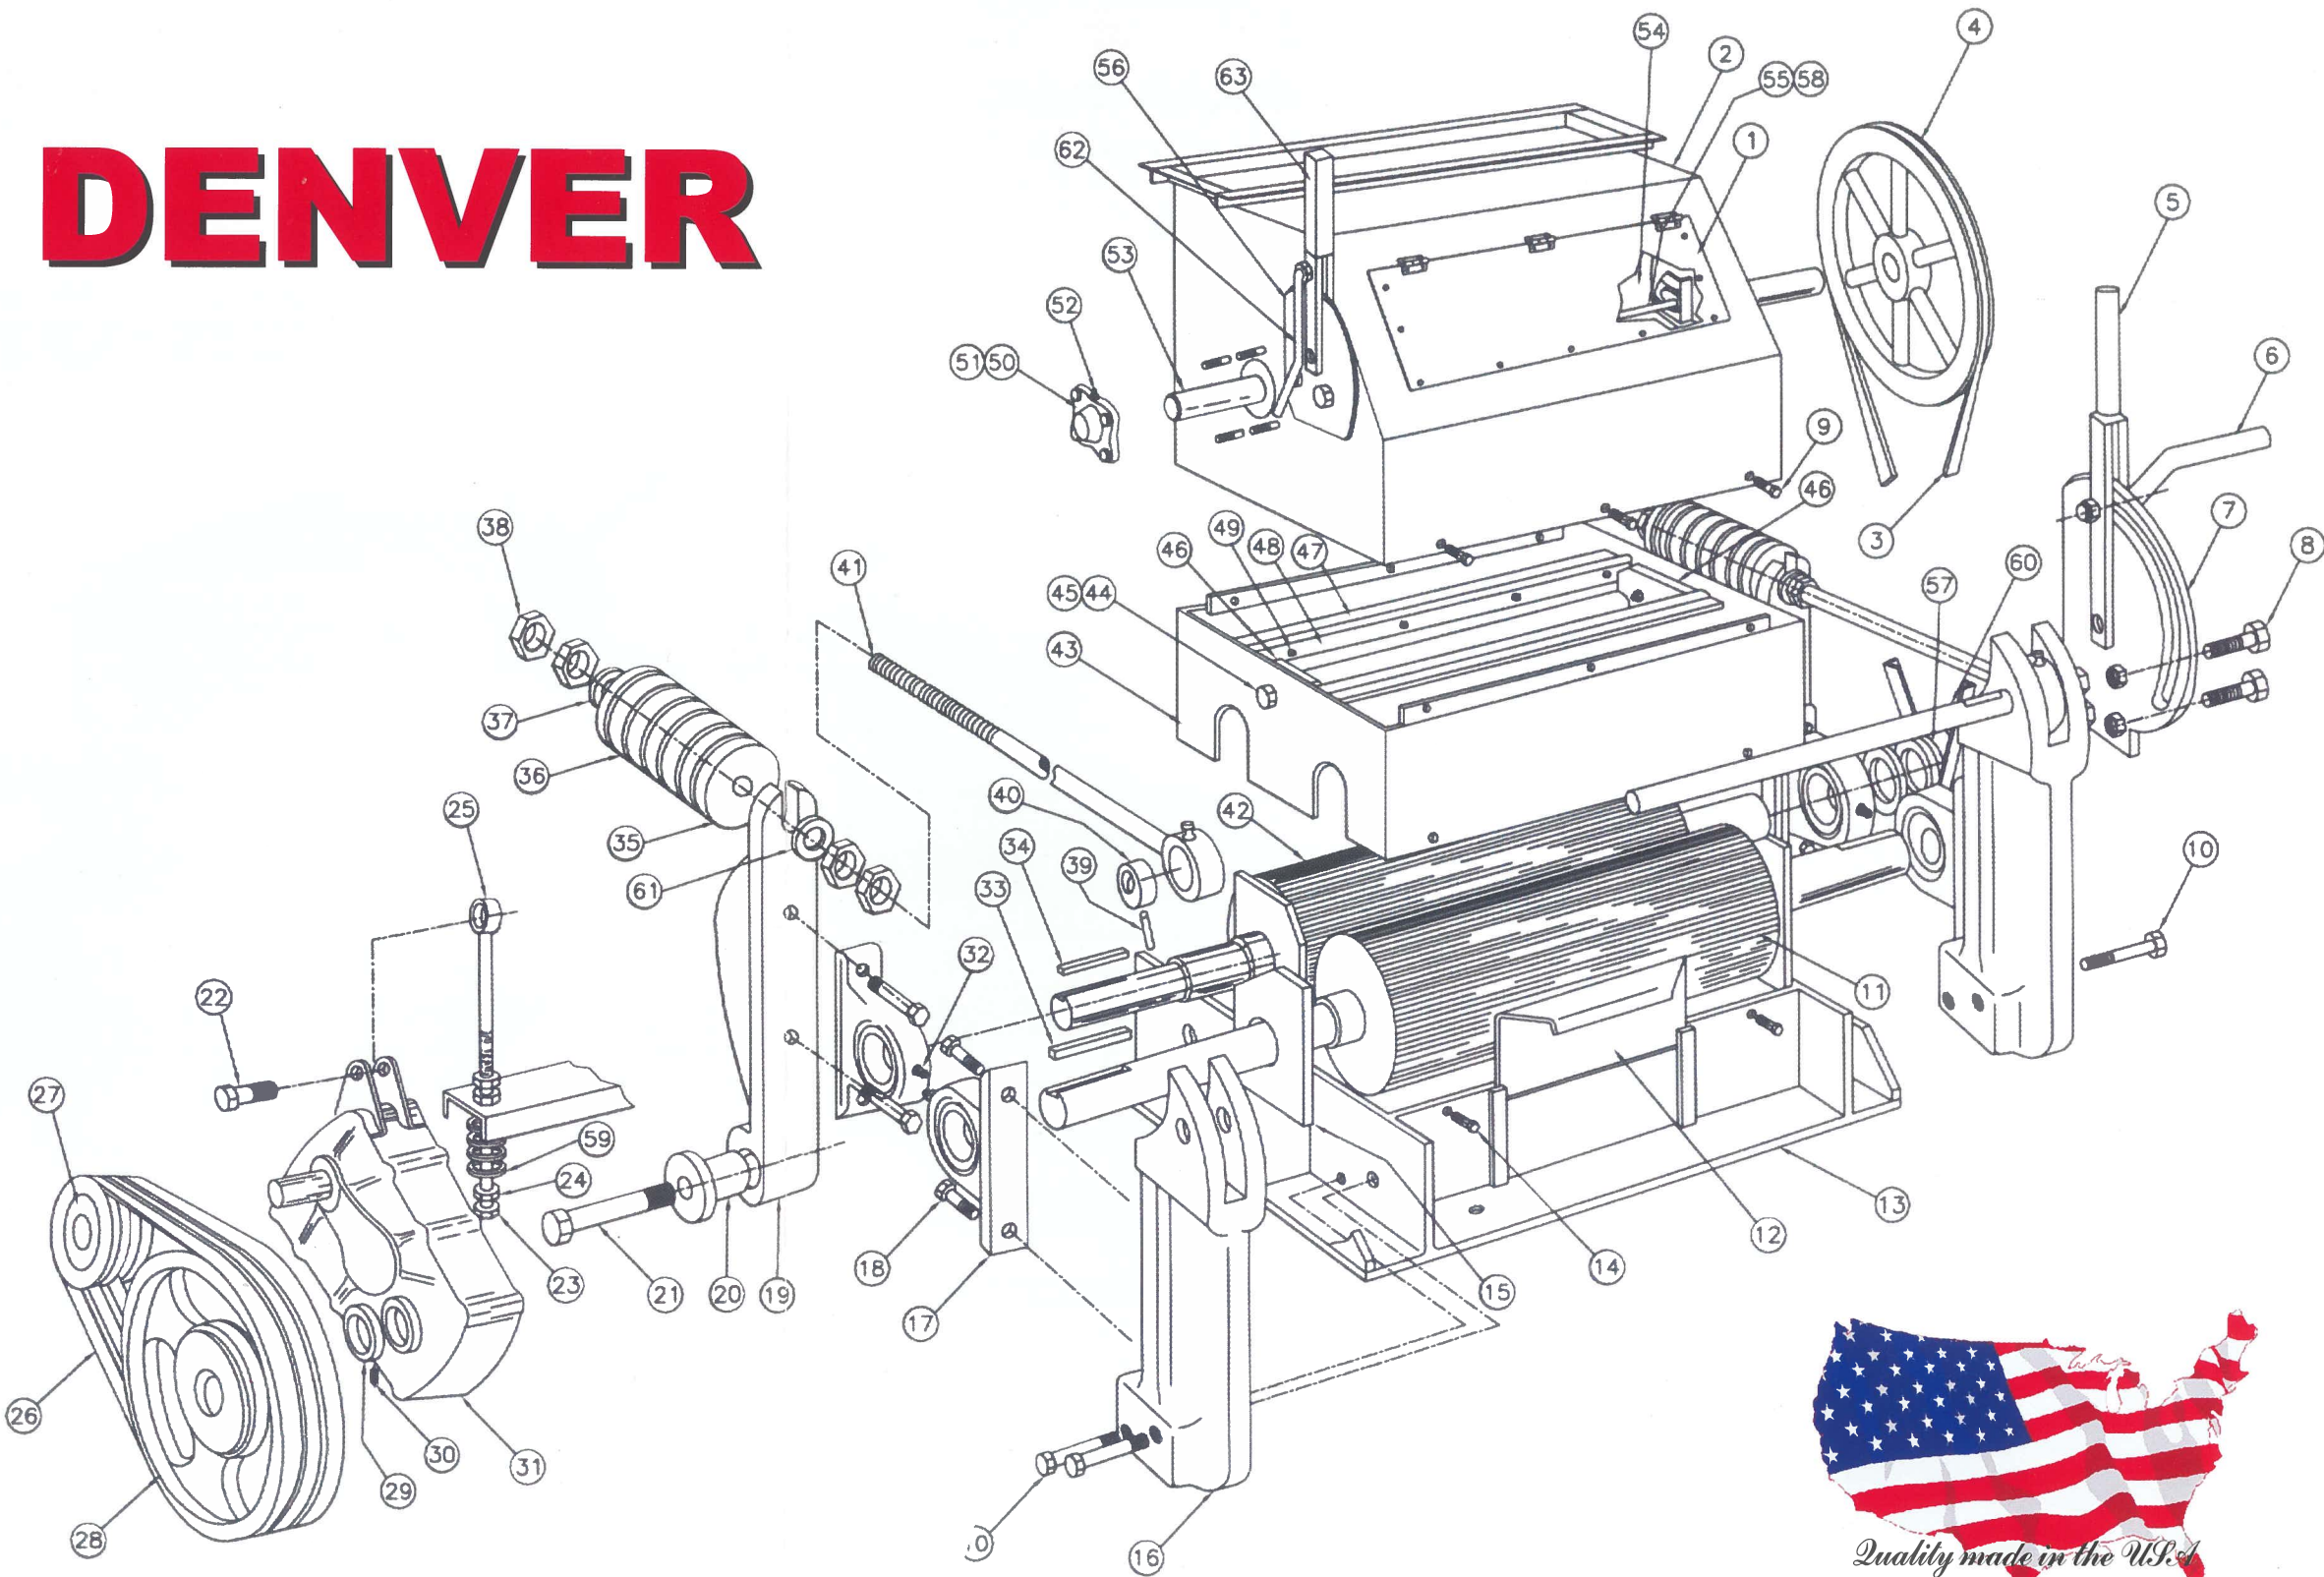

The Original
ROLLER-GRINDER

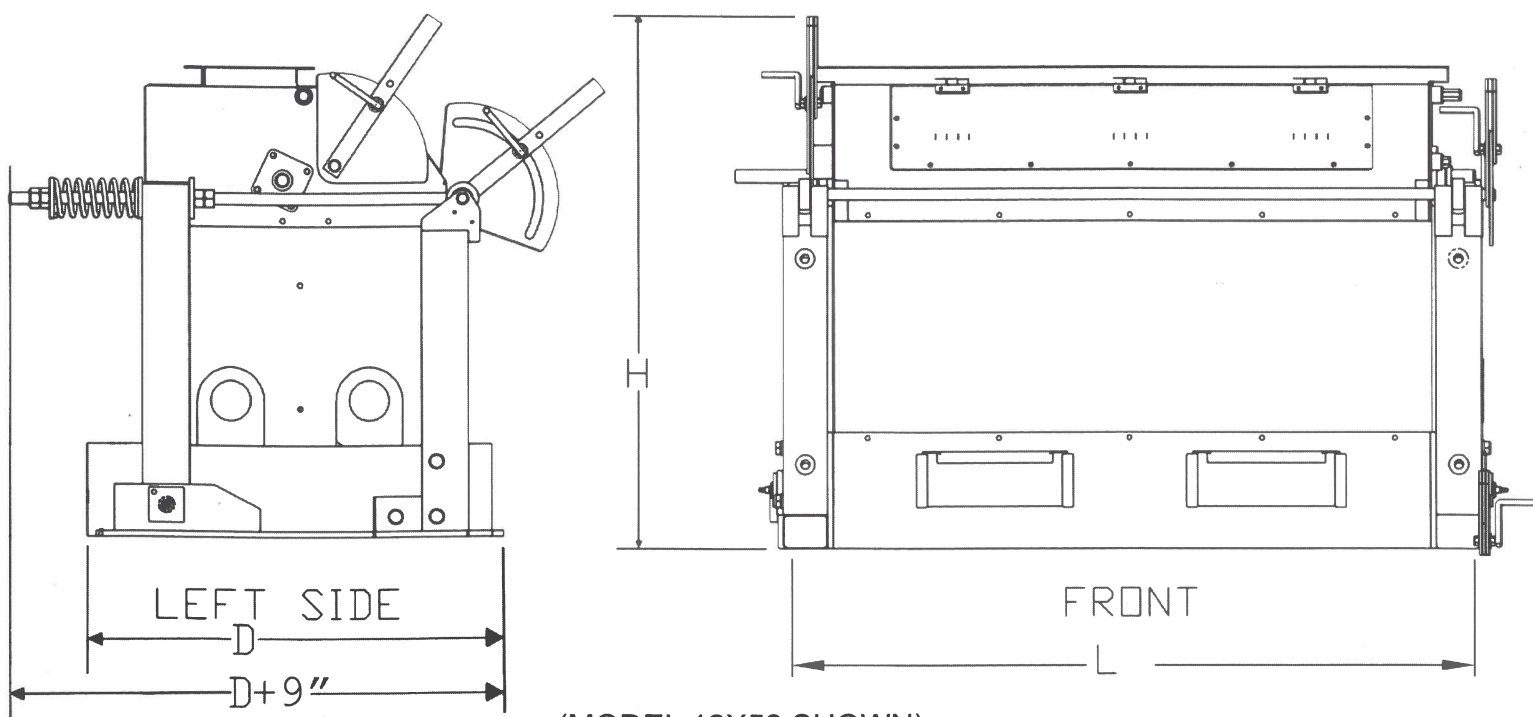

(MODEL 12X52 SHOWN)

MODEL	L	D	H	MILL WEIGHT	H. P. REQUIRED	DRY CAPACITIES-TONS PER HR.		
						CORN	MILO	BARLEY
9 X 18	52	28	30½	1375	7½ - 10	10	12	6
9 X 24	57	28	30½	1600	10 - 15	14	16	8
9 X 30	64	28	30½	1880	15 - 25	17	19	10
9 X 36	70	28	30½	2125	20 - 30	21	22	12
10 X 42	76	30	33	3035	30 - 40	25	27	15
10 X 48	85	30	33	3570	40 - 50	29	31	18
12 X 52	86	42	37	5600	50 - 75	46	49	24

Capacity varies with size reduction, cutting edge, moisture and quality of grain.

HARSH DENVER

600 OAK AVE. EATON, CO 80615

(970) 454-2291 (800) 227-1702

email harsh@harshenviro.com

WEB harshenviro.com