


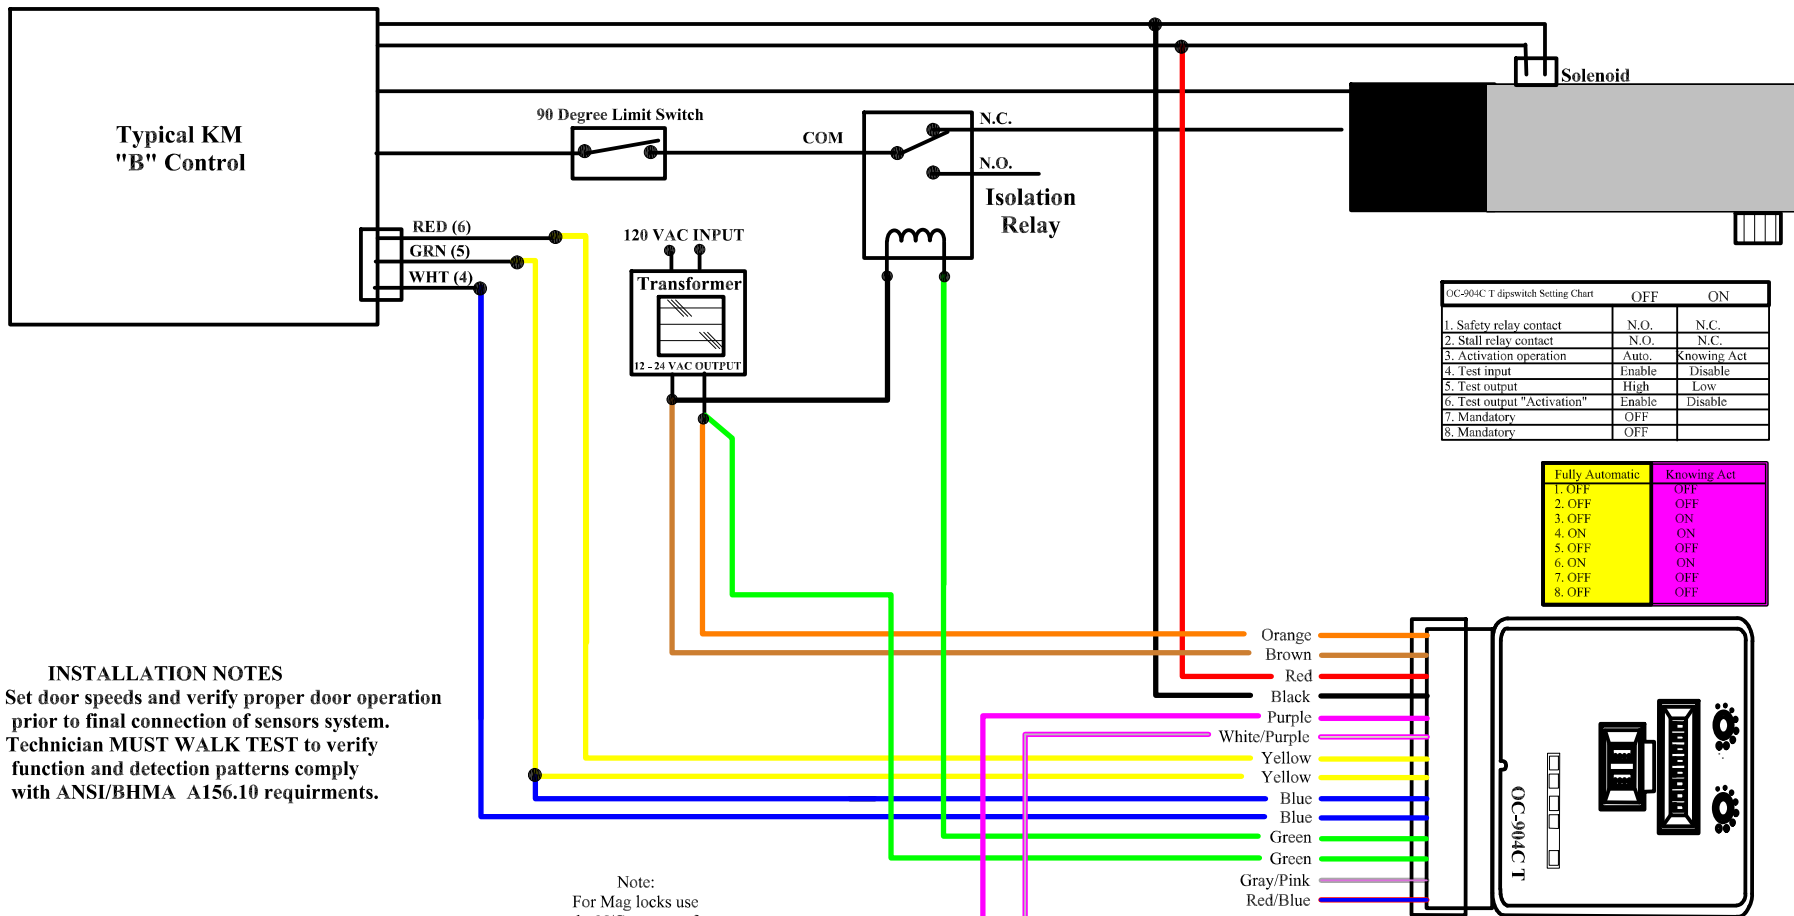


OC-904C T dipswitch Setting Chart	OFF	ON
1. Safety relay contact	N.O.	N.C.
2. Stall relay contact	N.O.	N.C.
3. Activation operation	Auto.	Knowing Act
4. Test input	Enable	Disable
5. Test output	High	Low
6. Test output "Activation"	Enable	Disable
7. Mandatory	OFF	
8. Mandatory	OFF	

Fully Automatic	Knowing Act
1. OFF	OFF
2. OFF	OFF
3. OFF	ON
4. ON	ON
5. OFF	OFF
6. ON	ON
7. OFF	OFF
8. OFF	OFF

- INSTALLATION NOTES**
1. Set door speeds and verify proper door operation prior to final connection of sensors system.
 2. Technician **MUST WALK TEST** to verify function and detection patterns comply with ANSI/BHMA A156.10 requirments.

Note:
For Mag locks use
the N/C contact of
the TDM output #1

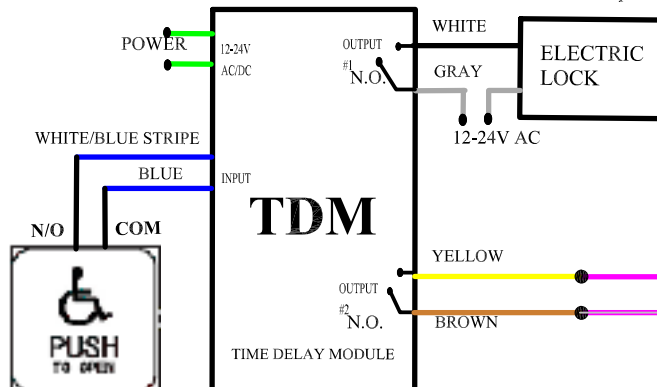

NOTE: All activating devices (pushplates, card readers, motion sensors, etc.) must connect to the TDM. Purple and White/Purple wires from both OC-904C T controls connect in parallel. Be sure to observe polarity of the purple wires (+ to +, - to -).

Title: 16300720 KM 2000 Operator with Elite T and Electric Lock		Drawing # 16300720
Drawing By: RNG	Date: 09/16/17	Sheet: 1 of 1
OPTEx Technologies Inc. 18730 S. Wilmington Ave. Unit 100 Rancho Dominguez, CA. 90220 800-877-6656 FAX 310-898-1098		