



INTERIOR OA-FLEX T

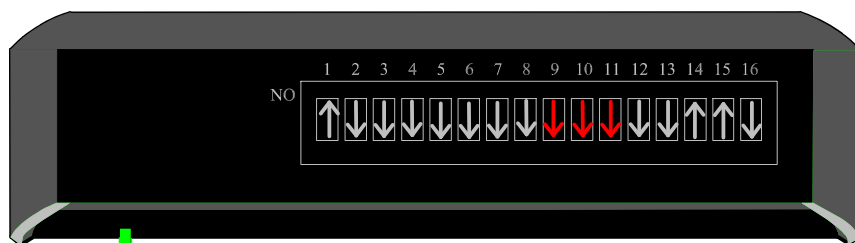

Dipswitch 1, 14 & 15 = ON
Dipswitch 9, 10 & 11 = OFF

EXTERIOR OA-FLEX T

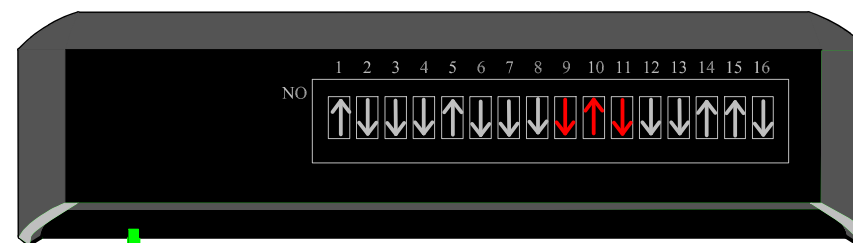

Dipswitch 1, 5, 10, 14 & 15 = ON
Dipswitch 9 & 11 = OFF

Notes:

1. Verify proper door operation prior to final connection of sensors.
2. Set System 20 control, AUX 04 IN = SIS, AUX 0 OUT = TEST SENSOR
3. Interior OA-FLEX T dipswitch, 9, 10 & 11 OFF, dipswitch 1, 14 & 15 ON
Exterior OA-FLEX T dipswitch 9 & 11 OFF, dipswitch 1, 5, 10, 14 & 15 ON
4. Technician must perform a field test to verify substantial compliance with ANSI/BHMA A156.10 Section 8.

Title: 16300250 RECORD SYSTEM 20 with OA-FLEX T		Drawing # 16300250
Drawing By: JCK	Date: 5-9-16	Sheet: 1 of 1
Optex Technologies Inc. 18730 South Wilmington Ave. Suite 100 Rancho Dominguez, CA 90220 Office: (800)877-6656, Fax: (310)898-1098		