

DOL 104 4-20 mA Humidity sensor



1 Product description


DOL 104 is a high-precision sensor for measuring relative humidity. It is intended for use in livestock houses but is also well suited for a number of industrial applications.

The sensor features one analogue output with full protection against short-circuits and wiring failures.

The special sensor element and the built-in Teflon filter enable application in livestock houses with constantly high humidity.

The sensor is microprocessor-controlled and has a two-color light emitting diode (LED) to communicate the operation status and the error diagnostic.

2 Mounting guide

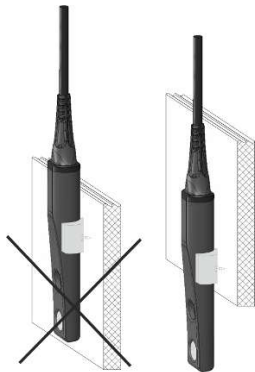

For optimum mounting of the sensor, use mounting clip or mount it free-hanging in the cable.

The sensor element of the sensor requires free air passage.

Mount the sensor so it is not exposed to direct sunlight, as this would affect the measurement.




- Remember to put on a protection cap before mounting the cable.


3 Installation guide



Installation, servicing and troubleshooting of all electrical equipment must be carried out by qualified personnel in compliance with the applicable national and international standard EN 60204-1 and any other EU standards that are applicable in Europe.

3.1 Connection of the sensor

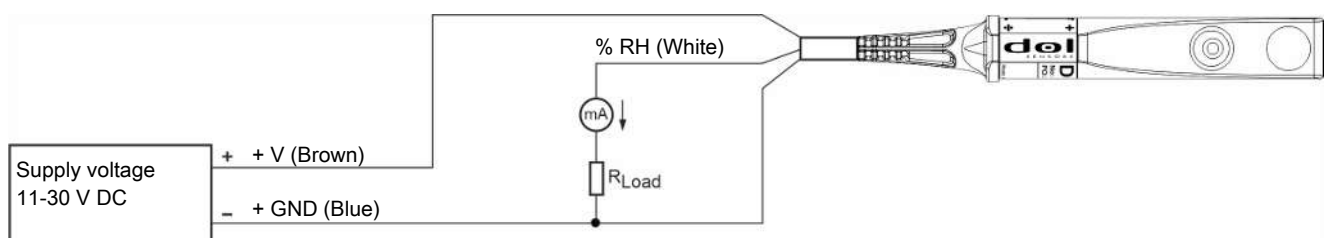

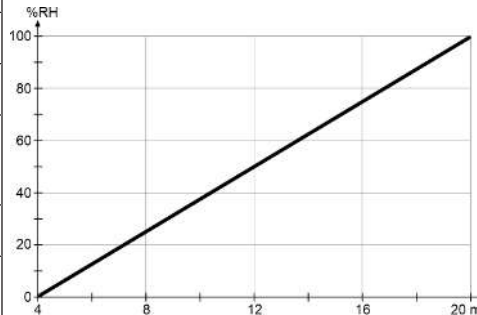LED/LIGHT PROTOCOL			Functional graph
LED		Status	
Green	Red		
ON		Operation OK	
Flash		Outside normal range (below 10 % RH or exceeding 95 % RH)	
	ON	Connection error Load error, see load graph	
	Flash	Sensor defect Over or under voltage alarm Overload	

4 Maintenance

When cleaning and disinfecting the house, the protective cap must be put on the sensor so that it hangs with the tip up, as shown in the picture.

- Sensor is cleaned with:
- Water and brush
 - High-pressure cleaning with cold water (only with attached protective cap)



Avoid using:

- High-pressure cleaning with hot water
- Highly compressed air
- Solvents
- Corrosive/caustic agents
- Alcohol-based disinfectants

After the sensor has been exposed to water and condensation, it requires a period where the relative humidity is lower than 80 %RH in order for it to measure correctly.




Do not bend the sensor as this would inflict permanent damage on the electronics of the sensor.

5 Technical data

140273		
Measuring range	% RH	0 - 100
Accuracy	% RH	$\pm 2 \text{ \% RH (40-85 \%)} \pm 3 \text{ \% RH (10-95 \%)} \text{ at } 0-40 \text{ }^{\circ}\text{C}$
Output signal	V	0.16 mA / % RH
Time constant	T ₆₃	20 s at 0.5 m/s air speed
Supply voltage	V DC	11 - 30

		140273
Max. current	mA	35
Load		See figure regarding load resistance and supply voltage
Max. output current	mA	20
Cable		2 m 3 x 22 AWG / 0.34 mm ²
Max. Cable length at 0.75 mm ²	m	500
Max. Cable length at 1.50 mm ²	m	500
Temperature, operation and storage	°C	-40 to +60
Protection class	IP	67
Measurement, shipment	mm	275 × 200 × 20
Shipment weight ex. connector	g	150

5.1 Load resistance and supply voltage

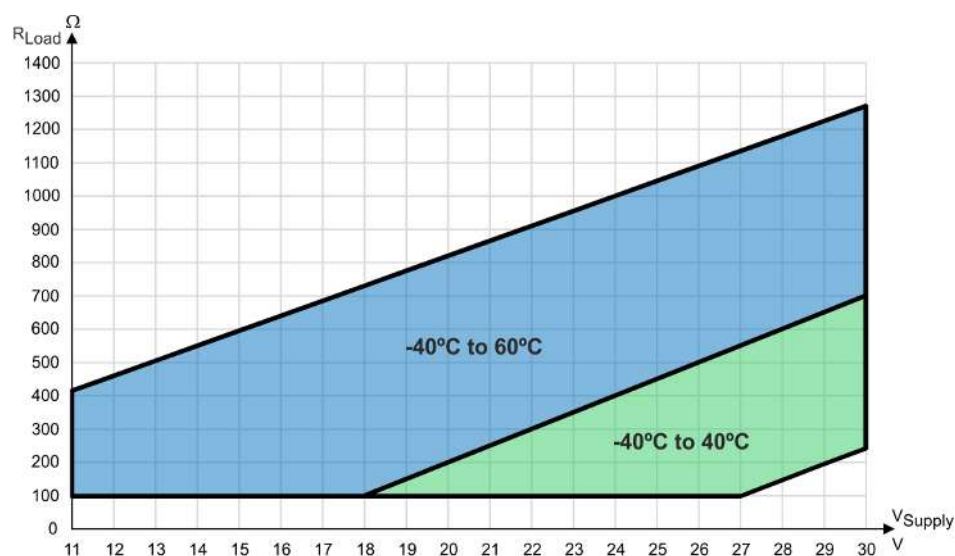

5.2 Dimensions

Dimensions in mm.

