

INSTALLATION INSTRUCTIONS

FIELD INSTALLATION INSTRUCTIONS FOR SLUSH PUPPIE MERCHANDISER

WARNING:

Before starting installation, read and understand all safety label and warnings on the machine. Also, review and understand all safety instructions in the owners, installation and service manuals.

Failure to comply could result in serious injury, death or damage to the equipment.

WARNING:

Only trained and certified electrical, plumbing and refrigeration technicians should service this unit.

All wiring and plumbing must conform to national and local codes. Failure to comply could result in serious injury, death or equipment damage.

WARNING:

Disconnect power to the unit before servicing. Follow all lock out/tag out procedures established by the user. Verify all power is off to the unit before performing any work.

Failure to comply could result in serious injury, death or damage to the equipment.

CAUTION:

Always be sure to keep the area around the unit clean and free of clutter.

Failure to keep this area clean may result in injury or equipment damage.

Slush Puppie Kit Includes:

Table 1. Parts List

Item No.	Description
1	Slush Puppie UK POS Video Screen Systems
2	Power Supplies
3	Kit of Ancillaries

The instructions in Table 2 should be used for installation of the slush Puppie merchandiser assembly kit on Viper units.

Table 2. Installation Procedure

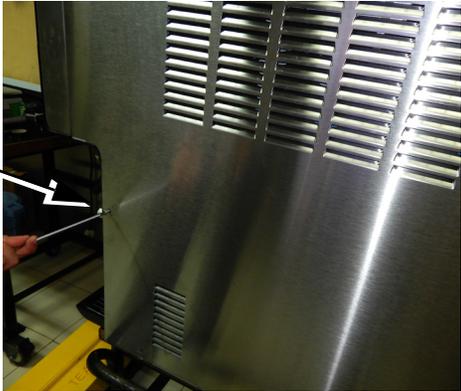
Step	Action	
1	Disconnect the power cord.	
2	<p>Remove both the side panels by unfastening the 3 mounting screws on each side and remove the top panel by unfasten the 4 mounting screws from four corners of the top panel.</p>	<div style="display: flex; flex-direction: column; align-items: center;"> <div style="display: flex; align-items: center; margin-bottom: 10px;"> <div style="text-align: right; padding-right: 10px;"> <p>Side panel Mounting screws (Both sides)</p> </div>  </div> <div style="display: flex; align-items: center;"> <div style="text-align: right; padding-right: 10px;"> <p>Top panel Mounting screws</p> </div>  </div> </div> <p style="text-align: center;">Figure 1.</p>
3	<p>Disconnect and remove the old POS merchandiser if one is attached.</p>	 <p style="text-align: center;">Figure 2.</p>

Table 2. Installation Procedure

Step	Action
4	<p>For units shipped without POS merchiser wiring diagram PN: 620066515 is located in specified location. (See Figure 3.)</p>
5	<p>Mount the Slush Puppie screen to the machine using the standard mounting method. The screen is provided with the complimentary mounting brackets. (See Figure 4.)</p>



**wiring diagram
PN: 620066515**

Figure 3.



**Mounting
Bracket**

Figure 4.

Table 2. Installation Procedure

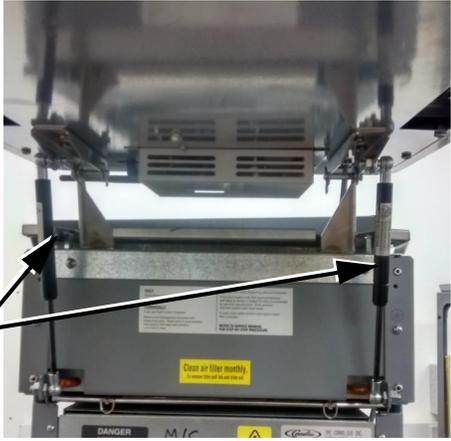
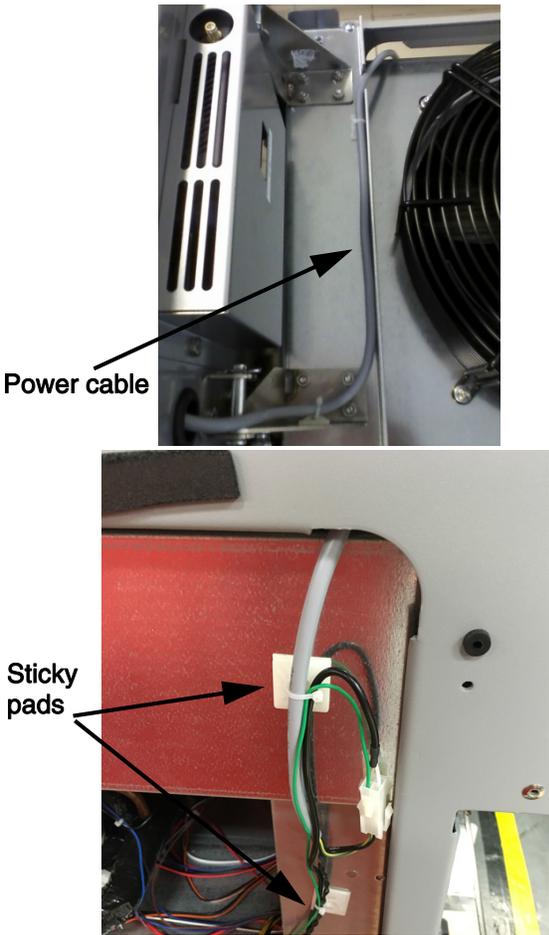
Step	Action	Action
6	The gas struts (Qty 2) have been rated to suit the new screen. (See Figure 5.)	 <p data-bbox="1040 747 1146 779">Figure 5.</p>
7	Route the cable from the screen to the back of the control box as follows using the sticky pads and cable ties supplied in the kit.	 <p data-bbox="1040 1734 1146 1766">Figure 6.</p>

Table 2. Installation Procedure

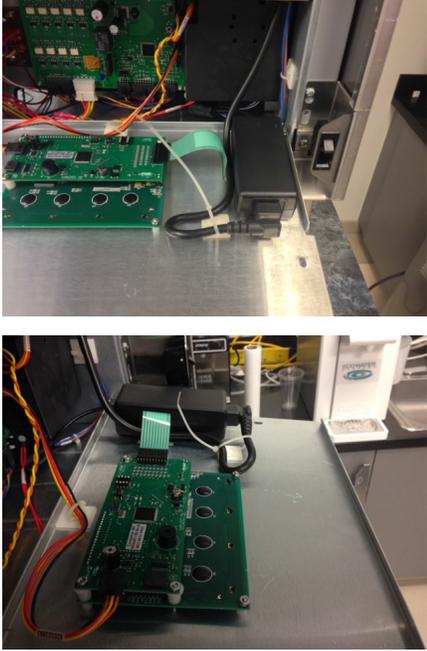
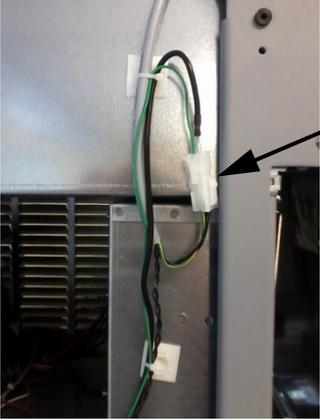
Step	Action	
8	Mount the power supply on the inner panel of the control box with provided double sided adhesive.	 <p style="text-align: center;">Figure 7.</p>
9	Connect the screen harness to the power supply connect.	
10	Connect the ground wire to power pack interconnect.	 <p style="text-align: center;">Figure 8.</p>

Table 2. Installation Procedure

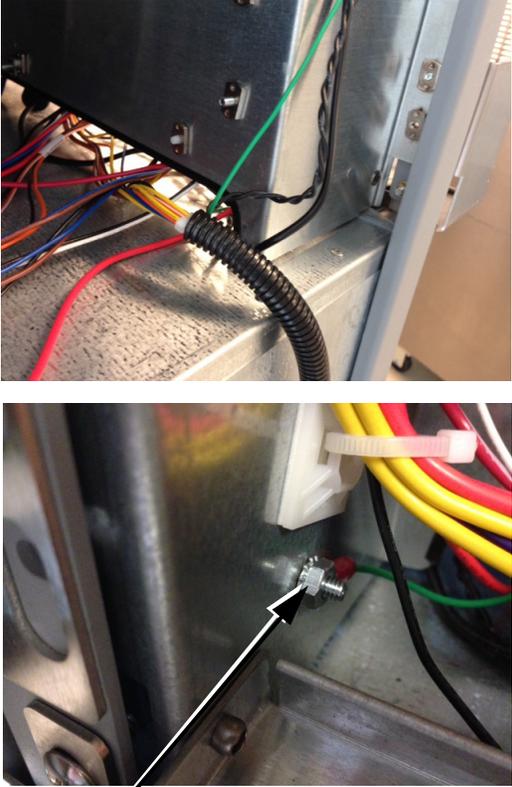
Step	Action	Action
11	<p>Connect ground wire to ground screw on left side in the control box.</p>	 <p style="text-align: center;">Ground Screw</p> <p style="text-align: center;">Figure 9.</p>
12	<p>Connect the mains cable to the machine power distribution connectors. The PSU is 100 - 240VAC input. So US voltages are not a concern.</p> <p>Black: Live White: Neutral Green: Earth</p>	 <p style="text-align: center;">Figure 10.</p>

Table 2. Installation Procedure

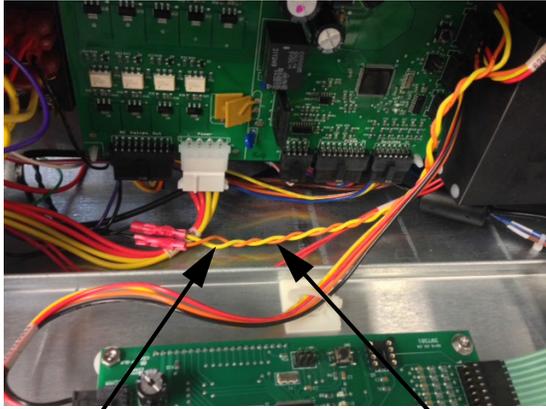
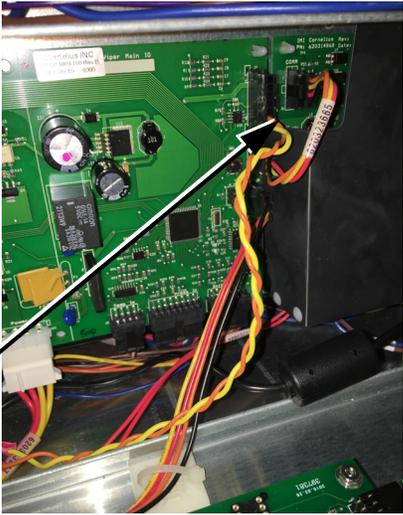
Step	Action	Action
13	Route the data cable into the machine control box as shown.	 <p data-bbox="927 709 1003 737">Yellow</p> <p data-bbox="1279 716 1360 743">Orange</p> <p data-bbox="1133 764 1247 791">Figure 11.</p>
14	Connect the data cable to connector J7 on the main control PCB	 <p data-bbox="889 1178 1052 1205">Connector J7</p> <p data-bbox="1133 1339 1247 1367">Figure 12.</p>

Table 2. Installation Procedure

Step	Action
15	<p>Reattach the side panels with the original screws and reassemble the top panel with original screws. Plug the unit and start as usual.</p> <div style="display: flex; justify-content: space-around; align-items: center;">   </div> <p style="text-align: center;">Figure 13.</p>
16	<p>Power on the machine. The screen PC will take up to 45 seconds to boot up. During this time the machine will beep periodically to alert of a comms issue. This is no concern.</p> <p>The screen installation is now complete.</p>
17	<p>GPS will start tracking location & data from the screen/machine as soon as boot up is complete.</p>