



AGENDA ITEM: 13A.2

DATE: 8/14/2025
TO: Board of Directors
FROM: Dave Commons, Interim Public Works Director
SUBJECT: July 2025 Public Works Staff Report

SUGGESTED ACTION

For Information Only

STRATEGIC PLAN COMPLIANCE

Effective Infrastructure and Asset Management

FISCAL IMPACT

Not Applicable

ENVIRONMENTAL REVIEW

This item does not qualify as a project as defined by the California Environmental Quality Act (CEQA).

BACKGROUND

Please see the attached report.

RECOMMENDED MOTION

No recommendation, informational only.

ATTACHMENTS

Please see attached.

Roads Division

For the month of July, the Roads Division Continued on a variety of projects and tasks. A total of 89 tons of asphalt, in the form of HMA (Hot Mix Asphalt, Cold mix asphalt and Oil Sand, was distributed during this month). The Roads have continued to perform overlays, finishing up the worst (applicable) condition areas on Skyline, and moving on to locations on Paramount and Deertrail. Full depth repairs are scheduled to finish up Skyline and this will improve the overall condition and ride quality of that portion of road dramatically. Additional locations on the higher traveled mountain roads are being scheduled for additional overlay work for the rest of the summer.

Waterbreak Patching	Overlays and Oil Sand Patching
• Rolling Oak • Cumberland Ct. • Serra Pl. • Cantle Ct. • Hale Ct. • Skyline Dr. • Paramount (3 locations) • Deertrail (3 locations) • Martingale Way • Oakflat	• Skyline Dr. (2 locations) • Paramount (1 location) • Deertrail (2 locations)
	Road Failure and/or Pothole Patching
	• Skyline Dr. • Deertrail Dr. • Bear Valley Rd • Starland Dr. • Stirrup Way

Extensive efforts have been made with road side mowing and weed abatement for the month. During this month, Skyline Rd. has received roadside mowing with Jacaranda mowing in progress. Pavement marking in the form of striping the equestrian crossing marking and legends has begun and will continue throughout the rest of summer and fall.

CPR training, led by our in-house Red Cross certified instructor (CSD Roads Crew Lead), has begun by training all Public Works employees to bring the highest level of training to the District.

Seasonal temporary workers have continued weed abatement and mowing tasks, as well as helping maintenance crews, primarily helping the crews with traffic control procedures to increase production during large projects as we do not have sufficient staff size to complete these tasks with traffic control with our normal staff size. Providing traffic control with only our normal crews without the additional seasonal workers would limit our staff to only 2 workers.



Overlay paving performed on Skyline Drive



Additional paving on Skyline (before and after)
Waterbreak work on Oakflat and Deertrail


Water Division

50 Fire Hydrants were inspected in July, bringing the total to 348 inspected out of 653 total since January 2025.

Of those 50, only one needed additional work (Bollards removed on 25881 Jacaranda)

The full hydrant report is attached below

Hydrants left to inspect
47%

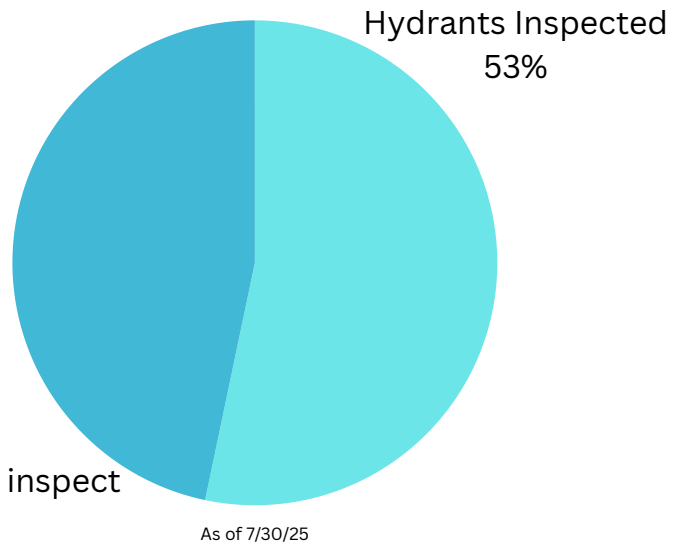

July 2025 Leak Repairs

Week One

- Paramount 8A-2, 4" mainline repair, 4" clamp
- 24521 Deertrail Dr. service repair, 1" clamp
- 25200 Paramount service repair, 1" clamp
- 24931 Paramount service repair 1" clamp
- 24040 Martingale service repair 1" clamp
- 25701 Cumberland service repair, 1" clamp

Week Two

- Tank 4B1 mainline repair, 4" clamp
- 24941 Deertrail service line repair, 1" clamp
- 27901 Hale Ct. mainline repair, 4" saddle replacement
- Deertrail Booster service repair 3' of service pipe replaced

Week Three

- Tank 4B1 mainline repair, 4" clamp
- 24941 Deertrail service line repair, 1" clamp
- 27901 Hale Ct. mainline repair, 4" saddle replacement
- Deertrail Booster service repair 3' of service pipe replaced

Week Four

- 26720 Deertrail service repair, 1" clamp
- 26680 Deertrail service repair, 1" clamp
- 24300 Rowel Ct. service repair, ¾" clamp
- 23150 Lakeview service repair, 1" clamp
- 24175 Martingale service repair, 1" clamp
- Backside of Deertrail above Tank 04, 4" mainline repair (split in main)
- 26740 Frontier wy, service line leak, 2- 1" clamps

Wastewater Treatment Plant

Division

- Preventative maintenance, general plant upkeep, and standard operations are ongoing.
- Water continues to be sent down Sycamore Canyon.
- A virtual meeting with DDW was held regarding the Title 22 report. Feedback was positive; however, they would like to see some more data to grant an extension for Tracer Study for Title 22 reclamation re-use
- Safety improvements and signage installation are ongoing. Facility-wide training is also continuing.
- Weed abatement efforts are in progress.
- We are currently awaiting a response from the repair shop regarding RAS Pump #2.
- Improvements to the WWTP operations building are ongoing.
- The SCADA project has been awarded to Aspect Engineering.
- Both effluent floc mixer motors were replaced due to damage from a power surge. New motors have been installed and are operating properly.
- The old chlorine day tank and fittings cracked. New tanks and fittings have been ordered and placed into service, and are back to normal operations.
- CPR and First Aid recertifications are currently underway.



General Services Division

Fleet


- The fleet maintenance is busy with repairs and services.
- (4) #2 Services. L, O, F 4000 miles
- (4) #1 Service. Inspection, top off. 2000 miles
- (8) Repairs/maintenance. On Heavy Equipment some are long term, some were in and out in a day
- (14) Repairs/maintenance. On light equipment.
- (1) Breakdowns in the field.
- (4) Smog's.
- (10) days spent helping FAC.

Facilities

- Mailbox R/R, bus stop clean up, landscaping and building repair.
- (3) days cleaning up landscaping at the PD
- (8) Repairs to facilities in the district.
- (1) Repairs to other stands and boxes in valley.
- (0) Calls to repair RFID resident gate arm.
- (0) Calls to repair RFID visitor gate arm.
- (4) days of removing weeds. mailbox stations and bus stops.
- (8) bus stops have been repainted.
- (15) bus stops rebuilt.
- R/R is Mailbox station #4640 Fawn/Pebble beach is complete
- We spent 3 days inspecting and refueling generators.

Transfer Station

105 Total Waste Management
Rolloffs

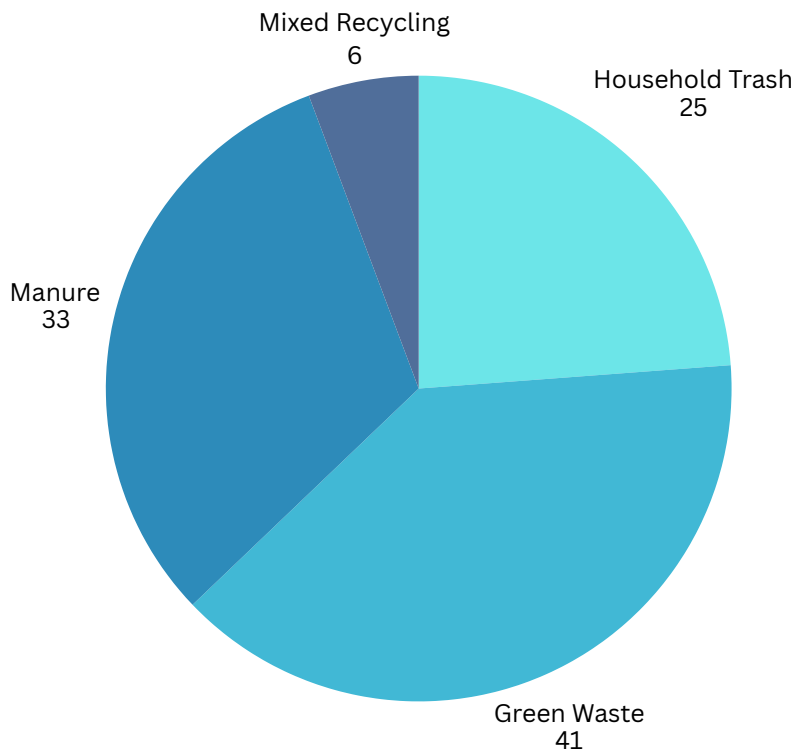

*0 Scrap Metal Rolloffs

Prairie Ct. & Cumberland Rd. Bus Stop Rehabilitation



Condition of bus stop before work



Back wall removed and one leg replaced



New siding installed



**A little more dirt work needed and it will
be ready for school to start!**

Vehicle Repair Work



Right of way mower #2209 received a new form-fitted pipe and O rings to fix a hydraulic leak on the hydrostatic motor



We installed new snowplow brackets under two of the F-550s



We installed a new seat on loader #5519

COMPLETED INSPECTIONS 348 OF 653 INSPECTED AS OF 07/30/2025

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
165-18A-671	END OF PHEASANT	22680 PHEASANT	105 psi	1/29/25	YES	2025-01	FIRE DEPT APPROVED ALL OTHER ISSUES - VALVES NEED CLEANING	1/30/25
164-02C-321	BEAR VALLEY AND MARTINGALE	27900 BEAR VALLEY	95 psi	1/29/25	YES	2025-07	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-02C-231	BEAR VALLEY RD BTWN SAN JUAN HILL & MARTINGALE	27750 BEAR VALLEY	190 psi	1/29/25	YES	2025-08	BOLLARD NEEDS REPLACING / TRAFFIC CONTROL NEEDED TO CHECK STATUS OF VALVE	
164-02D-131	PUEBLO CT	24400 PUEBLO CT	105 psi	1/29/25	YES	2025-09	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-02D-221	BEAR VALLEY RD AND PUEBLO	24320 PUEBLO CT	120 psi	1/29/25	YES	2025-10	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-02D-151	SERRA PLACE CULDESAC	24380 SERRA PLACE	100 psi	1/29/25	YES	2025-11	BUSHES NEED TO BE CLEARED AWAY / VALVES NEED CLEANING	
164-02D-281	MIDDLE OF PALOMINO	24331 PALOMINO	100 psi	1/29/25	YES	2025-11	STRAIGHTEN BOLLARDS	
164-01C-921	EQUESTRIAN CENTER CAMPGROUND		120 psi	1/29/25	YES	2025-13	LOCATE AND INSPECT VALVE	
164-12A-071	BEAR VALLEY RD	26640 BEAR VALLEY	100 psi	1/29/25	YES	2025-14	NEEDS TRAFFIC CONTROL TO INSPECT VALVE	
164-12B-321	COYOTE CT	23840 COYOTE	75 psi	1/29/25	YES	2025-15	VALVES NEED CLEANING	
164-12B-421	BEAR VALLEY RD AND COYOTE	23780 COYOTE	85 psi	1/29/25	YES	2025-16	VALVES NEED CLEANING	

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-12B-541	BEAR VALLEY RD AND SAINT ELMO	23701 ST. ELMO	70 psi	1/29/25	YES	2025-17	NEEDS TRAFFIC CONTROL TO INSPECT VALVE	
164-12B-761	BEAR VALLEY RD	26180 BEAR VALLEY	60 psi	1/29/25	YES	2025-18	NEEDS TRAFFIC CONTROL TO INSPECT VALVE	
164-12D-081	PLATEAU WY CULDESAC	26000 PLATEAU	70 PSI	1/29/25	YES	2025-19	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
165-18A-451	MIDDLE PHEASANT	22801 PHEASANT	125 psi	1/29/25	YES	2025-20	VALVES NEED CLEANING	
165-18A-041	ENTRANCE PHEASANT	22901 PHEASANT CT	150 psi	1/29/25	YES	2025-21	NEEDS TRAFFIC CONTROL TO INSPECT VALVE	
164-12B-871	BEAR VALLEY RD AND STACY CT	23500 STACY	50 psi	1/29/25	YES	2025-22	NEEDS TRAFFIC CONTROL TO INSPECT VALVE	
164-03C-181	WILLOW PASS	24331 WILLOW PASS	73 psi	1/29/25	YES	2025-23	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-03D-311	WILLOW PASS AND BOWEN	24220 WILLOW PASS	85 psi	1/29/25	YES	2025-24	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-03D-571	BEAR VALLEY BWTN SAN JUAN AND BLACKGOLD	28200 BEAR VALLEY	70 psi	1/29/25	YES	2025-25	BOLLARDS NEED STRAIGHTENING, VALVES NEED CLEANING	
164-02A-901	SAN JUAN HILL	24410 SAN JUAN	76 psi	1/29/25	YES	2025-26	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-02C-141	BEAR VALLEY RD AND SAN JUAN	27700 BEAR VALLEY	160 psi	1/29/25	YES	2025-27	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-02C-191	BEAR VALLEY RD AND BAY	24320 BAY CT	120 psi	1/29/25	YES	2025-28	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-02D-201	BEAR VALLEY RD AND SORREL	27500 BEAR VALLEY	125 psi	1/29/25	YES	2025-29	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-01C-301	JACARANDA AND PALOMINO	24361 PALOMINO	91 psi	1/29/25	YES	2025-30	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-01C-611	BEAR VALLEY RD IN FRONT OF EQUESTRIAN CENTER	26800 BEAR VALLEY	105 psi	1/29/25	YES	2025-31	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-12A-281	BEAR VALLEY RD AND COLUMBIA WAY	27004 COLUMBIA	96 psi	1/29/25	YES	2025-32	NO BOLLARDS	
164-12A-291	BEAR VALLEY RD AND CHIA	23801 CHIA CT	90 psi	1/29/25	YES	2025-33	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-12B-411	BEAR VALLEY RD AND SENECA WAY	23721 SENECA	90 psi	1/29/25	YES	2025-34	VALVES NEED CLEANING	
164-12B-800	PLATEAU AND SENECA	26400 PLATEAU	95 psi	1/29/25	YES	2025-35	VALVES NEED CLEANING	1/30/25
164-12D-351	COLUMBIA WAY	26220 COLUMBIA	65 psi	1/29/25	YES	2025-36	FULLY FUNCTIONAL BUT IS LEAKING OUT OF HEAD - HYDRANT NEEDS BACKHOE TO DAYLIGHT	1/30/25
164-12D-271	BEAR VALLEY RD AND S COLUMBIA WY	26150 COLUMBIA	65 psi	1/29/25	YES	2025-37	HYDRANT AND BOLLARDS NEED STRAIGHTENING	1/30/25
165-07C-841	END CUMBERLAND CT	25800 CUMBERLAND	119 psi	1/29/25	YES	2025-38	VALVES NEED CLEANING	1/30/25
165-18B-581	END OF BUTTERCUP	22651 BUTTERCUP	80 psi	1/29/25	YES	2025-39	NEEDS PAINT AND VALVE NEEDS CLEANING	1/30/25
164-03D-441	BEAR VALLEY AND ARROYO	24200 ARROYO	85 psi	1/29/25	YES	2025-40	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-03D-491	BEAR VALLEY RD AND SAN JUAN	28051 BEAR VALLEY	60 psi	1/29/25	YES	2025-41	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-03D-291	SAN JUAN HILL	24291 SAN JUAN	100 psi	1/29/25	YES	2025-42	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-02A-921	SAN JUAN HILL	24450 SAN JUAN	60 psi	1/29/25	YES	2025-43	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-02C-071	BEAR VALLEY RD AND HART	24400 HART DR	135 psi	1/29/25	YES	2025-44	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-02D-581	BEAR VALLEY RD AND SERRA PL	24050 SERRA	118 psi	1/29/25	YES	2025-45	BOLLARDS NEED STRAIGHTENING, VALVES NEED CLEANING	
164-12A-641	COLUMBIA	26800 COLUMBIA	110 psi	1/29/25	YES	2025-46	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-12B-501	SENECA	23700 SENECA	95 psi	1/29/25	YES	2025-47	VALVES NEED CLEANING	
164-12B-921	PLATEAU WAY	26300 PLATEAU	84 psi	1/29/25	YES	2025-48	VALVES NEED CLEANING	1/30/25
164-12D-071	BEAR VALLEY RD AND PLATEAU WY	26140 BEAR VALLEY	52 psi	1/29/25	YES	2025-49	BOLLARDS NEED STRAIGHTENING	
165-07C-301	COLUMBIA WAY AND COLUMBIA CT	25980 COLUMBIA WAY	54 psi	1/29/25	YES	2025-49	VALVES NEED CLEANING	
165-07C-701	BEAR VALLEY RD	25980 BEAR VALLEY	90 psi	1/29/25	YES	2025-50	BOLLARDS NEED STRAIGHTENING	
164-02C-631	MARTINGALE WAY	24171 MARTINGALE	95 psi	1/29/25	YES	2025-51	BOLLARD NEEDS STRAIGHTENING	

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
165-18B-761	BUTTERCUP AND BEAR VALLEY RD	PD CORNER OF BUTTERCUP	110 psi	1/29/25	YES	2025-52	NO BOLLARDS	1/30/25
164-01C-541	ROWEL CT	24201 ROWEL	90 psi	1/29/25	NO	N/A	N/A	N/A
164-01C-941	SUTTER CT	26721 SUTTER CT	110 psi	1/29/25	NO	N/A	N/A	N/A
164-01C-951	BEAR VALLEY RD AND SUTTER	26701 SUTTER CT	100 psi	1/29/25	NO	N/A	N/A	N/A
164-02A-871	HART DR CULDESAC	24550 HART DR	110 psi	1/29/25	NO	N/A	N/A	N/A
164-02C-491	SORREL CT	24200 SORREL	120 psi	1/29/25	NO	N/A	N/A	N/A
164-02D-441	BEAR VALLEY RD AND SERRA PL	24200 SERRA PLACE	120 psi	1/29/25	NO	N/A	N/A	N/A
164-02D-471	BEAR VALLEY RD AND PALOMINO	24200 PALOMINO	91 psi	1/29/25	NO	N/A	N/A	N/A
164-02D-591	WHITING CENTER	BEAR VALLEY RD	112 psi	1/29/25	NO	N/A	N/A	N/A
164-02D-641	SERRA PLACE AND CANTLE	24101 CANTLE CT	136 psi	1/29/25	NO	N/A	N/A	N/A
164-02D-671	SERRA PLACE	24120 SERRA	125 psi	1/29/25	NO	N/A	N/A	N/A
164-02D-761	SERRA PLACE	24140 SERRA	140 psi	1/29/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-03D-341	ARROYO CULDESAC	24220 ARROYO	70 psi	1/29/25	NO	N/A	N/A	N/A
164-03D-411	BEAR VALLEY AND WILLOWPASS	28420 BEAR VALLEY	90 psi	1/29/25	NO	N/A	N/A	N/A
164-03D-811	WILLOW PASS CULDESAC	24000 WILLOW PASS	100 psi	1/29/25	NO	N/A	N/A	N/A
164-12A-261	COLUMBIA	27000 COLUMBIA	115 psi	1/29/25	NO	N/A	N/A	N/A
164-12A-431	COLUMBIA	26916 COLUMBIA	125 psi	1/29/25	NO	N/A	N/A	N/A
164-12A-871	COLUMBIA	26600 COLUMBIA	102 psi	1/29/25	NO	N/A	N/A	N/A
164-12B-081	COLUMBIA	26451 COLUMBIA	95 psi	1/29/25	NO	N/A	N/A	N/A
164-12D-041	PLATEAU WAY	26280 PLATEAU	70 psi	1/29/25	NO	N/A	N/A	N/A
164-12D-121	COLUMBIA WAY	26320 COLUMBIA	80 psi	1/29/25	NO	N/A	N/A	N/A
164-12D-581	BEAR VALLEY RD AND S OAKFLAT	26020 BEAR VALLEY	55 psi	1/29/25	NO	N/A	N/A	N/A
165-07C-821	BEAR VALLEY AND CUMBERLAND CT.	25840 CUMBERLAND	120 psi	1/29/25	NO	N/A	N/A	N/A
165-18A-171	ENTRANCE SAGELAND	22900 SAGELAND	54 psi	1/29/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
165-18A-291	BEAR VALLEY ROAD NEAR ACROSS FROM N FRONTAGE ENTRANCE	25470 BEAR VALLEY RD	72 psi	1/29/25	NO	N/A	N/A	N/A
165-18B-421	S FRONTAGE	25370 BEAR VALLEY RD	80 psi	1/29/25	NO	N/A	N/A	N/A
165-18B-641	S FRONTAGE	25300 BEAR VALLEY RD	100 psi	1/29/25	NO	N/A	N/A	N/A
164-12B-801	COLUMBIA AND SENECA	26451 COLUMBIA	100 PSI	1/29/25	NO			
164-12D-751	OAKFLAT	26221 OAKFLAT	85 psi	2/27/25	YES	2025-201	FULLY FUNCTIONAL BUT BOLLARDS NEED STRAIGHTENING	
164-12D-521	OAKFLAT	26400 OAKFLAT	55 psi	2/27/25	YES	2025-202	FULLY FUNCTIONAL VALVE NEEDS CLEANING	
164-12C-471	OAKFLAT	26524 OAKFLAT	125 PSI	2/27/25	YES	2025-203	CLEAN VALVE - FULLY FUNCTIONAL	
164-12C-161	OAKFLAT AND BRIAN	26600 BRIAN PLACE	50 psi	2/27/25	YES	2025-204	MISSING A BALLARD	
164-11B-141	OAKFLAT	27320 OAKFLAT	70 PSI	2/27/25	YES	2025-206	FULLY FUNCTIONAL ISOLATION VALVE NEEDS CLEANING	
164-11B-511	OAKFLAT	27551 OAKFLAT	140 PSI	2/27/25	YES	2025-207	FULLY FUNCTIONAL - VALVE CAN NEEDS CLEANING	
164-11B-701	OAKFLAT NEAR BARKES	27601 OAKFLAT	135 PSI	2/27/25	YES	2025-208	FULLY FUNCTIONAL = VALVE LID BROKEN	
164-12C-071	BRIAN PL	26600 BRIAN PLACE	50 PSI	2/27/25	YES	2025-209	VALVE NEEDS CLEANING - FULLY FUNCTIONAL	

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-11B-651	BARKES	27300 BARKES	115 PSI	2/27/25	YES	2025-210	VALVE CAN USE SOME CLEANING	
164-03C-251	ROSS AND SILVER CREEK	ROSS AND SILVER CREEK	90 PSI	2/27/25	YES	2025-215	FULLY FUNCTIONAL - VALVE NEEDS CLEANING	
164-03C-461	SILVER CREEK	24351 SILVER CREEK	100 PSI	2/27/25	YES	2025-216	FULLY FUNCTIONAL - VALVE NEEDS CLEANING	
164-03C-661	BEAR VALLEY AND SILVER CREEK	24201 SILVER CREEK	90 PSI	2/27/25	YES	2025-217	STEM STUCK - NEEDS LUBE, EXERCISING AND LINE FLUSHED	
164-10A-011	BEAR VALLEY AND N LOWER VALLEY	BY BALL PARK	120 psi	2/27/25	YES	2025-218	NEED WASHER IN FRONT CAP	
164-09D-051	LOWER VALLEY	29300 LOWER VALLEY	130 PSI	2/27/25	YES	2025-227	VALVE NEEDS CLEANING - FULLY FUNCTIONAL	
164-03C-751	BEAR VALLEY	28701 BEAR VALLEY	110 PSI	2/27/25	NO	N/A	N	N/A
164-04D-881	N LOWER VALLEY	29101 N LOWER VALLEY	120 psi	2/27/25	NO	N/A	N/A	N/A
164-04D-991	N LOWER VALLEY	29001 N LOWER VALLEY	120 psi	2/27/25	NO	N/A	N/A	N/A
164-09D-081	TRANSFER STATION	TRANSFER STATION	125 PSI	2/27/25	NO	N/A	N/A	N/A
164-10A-911	BEAR VALLEY AND S. LOWER VALLEY	28999 S LOWER VALLEY	125 psi	2/27/25	NO	N/A	N/A	N/A
164-11B-161	OAKFLAT	27250 OAKFLAT	125 PSI	2/27/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-11B-381	OAKFLAT	27100 OAKFLAT	90 PSI	2/27/25	NO	N/A	N/A	N/A
164-11B-431	OAKFLAT AND BUCKBOARD	27501 OAKFLAT	105 PSI	2/27/25	NO	N/A	N/A	N/A
164-11B-501	WAGONWHEEL	27641 WAGON WHEEL	135 PSI	2/27/25	NO	N/A	N/A	N/A
164-11B-731	BARKES	27440 BARKES WAY	90 PSI	2/27/25	NO	N/A	N/A	N/A
164-11B-771	BARKES	27201 BARKES	90 PSI	2/27/25	NO	N/A	N/A	N/A
164-11B-801	OAKFLAT BETWEEN SAN JUAN AND BARKES	27620 OAKFLAT	125 PSI	2/27/25	NO	N/A	N/A	N/A
164-11C-091	OAKFLAT AND SAN JUAN	27701 OAKFLAT	95 PSI	2/27/25	NO	N/A	N/A	N/A
164-12A-931	OAKFLAT	26800 OAKFLAT	35	2/27/25	NO	N/A	N/A	N/A
164-12C-041	OAKFLAT	26700 OAKFLAT	35 PSI	2/27/25	NO	N/A	N/A	N/A
164-12D-001	BRIAN AND COLUMBIA	26480 COLUMBIA	95 PSI	2/27/25	NO	N/A	N/A	N/A
164-12D-401	OAKFLAT	26510 OAKFLAT	60 PSI	2/27/25	NO	N/A	N/A	N/A
164-12D-761	OAKFLAT	26181 OAKFLAT	90 psi	2/27/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-10D-211	LAKEVIEW AND GOSSETT	23371 LAKEVIEW	110 psi	3/26/25	YES	2025-0326	BOLLARDS NEED STRAIGHTENING	
164-10B-621	DART	23640 DART	110 psi	3/26/25	YES	2025-0327	BOLLARDS NEED STRAIGHTENING	
164-10B-921	DART	23480 DART	94 psi	3/26/25	YES	2025-0328	BOLLARDS NEED STRAIGHTENING	
164-10D-231	DART	23360 DART	98 psi	3/26/25	YES	2025-0329	VALVE HAS BEEN PAVED OVER	
164-10D-451	DART	23270 DART	105 psi	3/26/25	YES	2025-0330	BOLLARDS NEED STRAIGHTENING	
164-14D-041	FARGO AND FARGO	22501 FARGO	60 psi	3/26/25	YES	2025-0331	VALVE NEEDS CLEANING - FULLY FUNCTIONAL	
164-02C-801	SAN JUAN AND BLACKGOLD	28000 BLACKGOLD	74 psi	3/26/25	NO	N/A	N/A	N/A
164-03D-561	BEAR VALLEY AND BLACKGOLD	28294 BLACKGOLD	75 psi	3/26/25	NO	N/A	N/A	N/A
164-03D-861	BLACKGOLD	28240 BLACKGOLD	84 psi	3/26/25	NO	N/A	N/A	N/A
164-10A-191	LAKEVIEW/DART & BREECH	23960 BREECH	105 psi	3/26/25	NO	N/A	N/A	N/A
164-10A-381	LAKEVIEW	23820 LAKEVIEW	116 psi	3/26/25	NO	N/A	N/A	N/A
164-10A-681	LAKEVIEW	23681 LAKEVEIW	110 psi	3/26/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-10A-991	LAKEVIEW	23540 LAKEVIEW	123 psi	3/26/25	NO	N/A	N/A	N/A
164-10B-081	BLACKGOLD	28120 BLACKGOLD	85 psi	3/26/25	NO	N/A	N/A	N/A
164-10B-401	DART	23801 DART	95 psi	3/26/25	NO	N/A	N/A	N/A
164-10D-421	LAKEVIEW	23201 LAKEVIEW	72 psi	3/26/25	NO	N/A	N/A	N/A
164-10D-731	LAKEVIEW	23101 LAKEVIEW	90 psi	3/26/25	NO	N/A	N/A	N/A
164-10D-811	CUMBERLAND AND RIDGEVIEW	23001 LAKEVIEW	91 psi	3/26/25	NO	N/A	N/A	N/A
164-10D-921	CUMBERLAND AND LAKEVIEW	28301 CUMBERLAND	88 psi	3/26/25	NO	N/A	N/A	N/A
164-10D-971	CUMBERLAND AND DART	28221 CUMBERLAND	70 psi	3/26/25	NO	N/A	N/A	N/A
164-11A-871	SAN JUAN AND CORRAL	23600 CORRAL	95 psi	3/26/25	NO	N/A	N/A	N/A
164-11C-151	HALF WAY DOWN PLANTATION	DUVALL'S	100 psi	3/26/25	NO	N/A	N/A	N/A
164-13A-111	CUMBERLAND AND SAN JUAN	26801 CUMBERLAND	75 psi	3/26/25	NO	N/A	N/A	N/A
164-13A-141	CUMBERLAND BWTWN SAN JUAN AND FRONTIER	26801 CUMBERLAND	60 psi	3/26/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-13A-161	CUMBERLAND AND FRONTIER AT HILL	26600 FRONTIER	OVER 200 psi	3/26/25	NO	N/A	N/A	N/A
164-13A-301	CUMBERLAND AND FRONTIER BEFORE SAN JUAN	26950 FRONTIER	76 psi	3/26/25	NO	N/A	N/A	N/A
164-13A-451	FRONTIER	26680 FRONTIER	OVER 200 psi	3/26/25	NO	N/A	N/A	N/A
164-14B-471	CUMBERLAND BWTWN SKYLINE AND FRONTIER	27150 CUMBERLAND	76 psi	3/26/25	NO	N/A	N/A	N/A
164-14B-651	CUMBERLAND AND SKYLINE	27250 CUMBERLAND	76 psi	3/26/25	NO	N/A	N/A	N/A
164-14B-731	CUMBERLAND BWTN FARGO AND SKYLINE	27300 CUMBERLAND	80 psi	3/26/25	NO	N/A	N/A	N/A
164-14B-821	CUMBERLAND AND FARGO	27400 CUMBERLAND	80 psi	3/26/25	NO	N/A	N/A	N/A
164-14B-921	FARGO	22521 FARGO	70 psi	3/26/25	NO	N/A	N/A	N/A
164-14D-081	FARGO	22400 FARGO	60 psi	3/26/25	NO	N/A	N/A	N/A
164-14D-161	FARGO	22421 FARGO	55 psi	3/26/25	NO	N/A	N/A	N/A
164-10D-661	DART	23120 DART	95 psi	3/26/25			VALVES ARE PAVED OVER	
164-14B-801	CUMBERLAND BWTN PRAIRIE AND FARGO	27500 CUMBERLAND	80 psi	3/27/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-10A-021	FIRE STATION	FIRE STATION	125 PSI	4/9/25	NO	N/A	N/A	N/A
145-25C-911	BACKSIDE	30001 DEERTRAIL	175 psi	4/22/25	YES	2025041	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
145-25D-971	DEERTRAIL	29101 DEERTRAIL	94 PSI	4/22/25	YES	2025042	FULLY FUNCTIONAL BUT VALVE NEEDS CLEANING	
146-30D-801	DEERTRAIL	28521 DEERTRAIL	58 PSI	4/22/25	YES	2025043	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
164-14A-661	CUMBERLAND	27750 CUMBERLAND	87 PSI	4/22/25	YES	2025045	TRAFFIC CONTROL NEEDED FOR VALVE	4/9/25
164-14A-321	CUMBERLAND	27900 CUMBERLAND	90 PSI	4/22/25	YES	2025046	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-15B-191	CUMBERLAND	28000 CUMBERLAND	95 PSI	4/22/25	YES	2025047	TRAFFIC CONTROL NEEDED FOR VALVE	4/9/25
164-10C-891	RIDGEVIEW	28500 RIDGEVIEW	85 PSI	4/22/25	YES	2025049	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-10C-741	RIDGEVIEW	28740 RIDGEVIEW	80 PSI	4/22/25	YES	2025050	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-10C-821	RIDGEVIEW	28951 RIDGEVIEW	65 PSI	4/22/25	YES	2025051	FULLY FUNCTIONAL BUT VALVE CAN USE SOME CLEANING	
164-03C-661	SILVER CREEK	24201 SILVER CREEK	102 PSI	4/22/25	YES	2025052	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-03C-051	DEERTRAIL	24181 DEERTRAIL	110 PSI	4/22/25	YES	2025053	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
164-03C-721	DEERTRAIL AND RAND	24100 RAND/DEERTRAIL	115 PSI	4/22/25	YES	2025054	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
164-03C-831	DEERTRAIL	24101 DEERTRAIL	115 PSI	4/22/25	YES	2025055	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
145-35B-101	BACKSIDE	30501 DEERTRAIL	180 PSI	4/22/25	N/A	N/A	N/A	N/A
145-36B-001	BACKSIDE	29601 DEERTRAIL	76 PSI	4/22/25	N/A	N/A	N/A	N/A
145-36B-001	DEERTRAIL	29801 DEERTRAIL	130 PSI	4/22/25	NO	N/A	N/A	N/A
146-30C-501	DEERTRAIL	29001 DEERTRAIL	126 PSI	4/22/25	NO	N/A	N/A	N/A
146-31B-131	DERRICK	25800 DERRICK	65 PSI	4/28/25	YES	2025056	FULLY FUNCTIONAL BUT VALVE IS PAVED OVER	
146-30D-531	DEERTRAIL JUST PAST HAZLEWOOD	28311 DEERTRAIL	60 PSI	4/28/25	YES	2025057	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
146-30D-321	HAZLEWOOD	26220 HAZLEWOOD	75 PSI	4/28/25	YES	2025058	FULLY FUNCTIONAL BUT VALVE IS PAVED OVER	
146-30D-441	DEERTRAIL/ HAZLEWOOD	28241 DEERTRAIL	45 PSI	4/28/25	YES	2025059	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
146-30D-251	ON DEERTRAIL BTWN CHESTER AND HAZLEWOOD	28201 DEERTRAIL	90 PSI	4/28/25	YES	2025060	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-30D-161	CHESTER AND DEERTRAIL	26601 DEERTRAIL/CHESTER	75 PSI	4/28/25	YES	2025061	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
146-30D-481	CHESTER	26401 CHESTER	75 PSI	4/28/25	YES	2025062	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
146-30D-271	CHESTER	26550 CHESTER	100 PSI	4/28/25	YES	2025063	FULLY FUNCTIONAL BUT VALVE IS PAVED OVER	
146-30B-791	DEERTRAIL	28041 DEERTRAIL	80 PSI	4/28/25	YES	2025064	HYDRANT STUCK WITH VALVE ON - UNABLE TO PERFORM COMPLETE INSPECTION	
146-20C-811	EL CAMINO	27101 EL CAMINO	60 PSI	4/28/25	YES	2025065	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
146-32B-051	STARLAND	30100 STARLAND LOWER END LOT	185 PSI	4/28/25	YES	2025081	FULLY FUNCTIONAL NEED TRAFFIC CONTROL FOR VALVE	
146-32B-141	STARLAND	30100 STARLAND	150 PSI	4/28/25	YES	2025082	FULLY FUNCTIONAL BUT VALVE TESTING NEEDS TRAFFIC CONTROL	
146-29D-921	STARLAND	30150 STARLAND	100 PSI	4/28/25	YES	2025083	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
146-29D-711	STARLAND	30281 STARLAND	62 PSI	4/28/25	YES	2025084	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
146-29C-691	STARLAND	30401 STARLAND	65 PSI	4/28/25	YES	2025085	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
146-29C-461	DEERTRAIL	27551 STARLAND/DEERTRAIL	55 PSI	4/28/25	YES	2025086	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	
146-19D-691	EL CAMINO /WARREN TROUGHES	27180 EL CAMINO/WARREN TROUGHES	115 PSI	4/28/25	N/A	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-19D-781	EL CAMINO /WARREN TROUGHS	27121 EL CAMINO/WARREN TROUGHS	105 PSI	4/28/25	N/A	N/A	N/A	N/A
146-20C-701	EL CAMINO	27101 EL CAMINO	95 PSI	4/28/25	NO	N/A	N/A	N/A
146-20C-901	EL CAMINO	27080 EL CAMINO	40 PSI	4/28/25	N/A	N/A	N/A	N/A
146-30B-971	DEERTRAIL	28101 DEERTRAIL	200+ PSI	4/28/25	NO	N/A	N/A	N/A
146-30D-411	HAZLEWOOD	26301 HAZLEWOOD	100 PSI	4/28/25	NO	N/A	N/A	N/A
146-33A-891	STARLAND	29500 STARLAND	70 PSI	4/29/25	YES	2025070	TRAFFIC CONTROL NEEDED FOR VALVE	
146-33A-771	STARLAND	29600 STARLAND	70 PSI	4/29/25	YES	2025071	TRAFFIC CONTROL NEEDED FOR VALVE	
146-33A-761	STARLAND	29850 STARLAND	105 PSI	4/29/25	YES	2025072	TRAFFIC CONTROL NEEDED FOR VALVE	
146-33A-951	STARLAND	29680 STARLAND	60 PSI	4/29/25	YES	2025073	TRAFFIC CONTROL NEEDED FOR VALVE	
146-33A-631	STARLAND	29801 STARLAND	70 PSI	4/29/25	YES	2025074	TRAFFIC CONTROL NEEDED FOR VALVE	
146-33A-711	STARLAND	29920 STARLAND	115 PSI	4/29/25	YES	2025075	TRAFFIC CONTROL NEEDED FOR VALVE	
146-32B-671	TUTTLE	30100 TUTTLE	185 PSI	4/29/25	YES	2025076	FULLY FUNCTIONAL BUT VALVE NEEDS CLEAN OUT	

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-32B-691	STARLAND AND TUTTLE	29981 STARLAND	165 PSI	4/29/25	YES	2025077	TRAFFIC CONTROL NEEDED FOR VALVE	
146-32B-491	TUTTLE	30101 TUTTLE	175 PSI	4/29/25	YES	2025078	TRAFFIC CONTROL NEEDED FOR VALVE	
146-32B-371	STARLAND	30021 STARLAND	155 PSI	4/29/25	YES	2025079	TRAFFIC CONTROL NEEDED FOR VALVE	
146-32B-071	STARLAND	30081 STARLAND	190 PSI	4/29/25	YES	2025080	BOLLARD NEEDS STRAIGHTENING, TRAFFIC CONTROL NEEDED FOR VALVE	
164-03C-141	WILLOWPASS	24401 WILLOWPASS	80 PSI	4/29/25	YES	2025090	FULLY FUNCTIONAL VALVE NEEDS CLEANING	
164-03C-311	MC CRAY	24451 MCCRAY	90 PSI	4/29/25	YES	2025091	FULLY FUNCTIONAL VALVE NEEDS CLEANING	
164-04D-281	DEERTRAIL	24391 DEERTRAIL	90 PSI	4/29/25	YES	2025092	FULLY FUNCTIONAL VALVE NEEDS CLEANING	
164-040-181	DEERTRAIL	24390 DEERTRAIL	90 PSI	4/29/25	NO	N/A	N/A	N/A
164-04D-261	CROCKER	29141 CROCKER	80 PSI	4/29/25	NO	N/A	N/A	N/A
164-08D-221	SHEEPTRAIL	SHEEPTRAIL AND PIONEER	1100 GPM /100 PSI	5/17/25	NO - REQUIRED IMMEDIATE ATTENTION	N/A	IMMEDIATE ACTION - HIT BY VEHICLE - PARTS ORDERED/WORK SCHEDULE	NEW ONE INSTALLED 5/22/2025 AND TESTED
146-33D-201	DEERTRAIL	25851 DEERTRAIL	85 PSI	5/28/25	YES	2025093	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-28C-321	GOLDSPIKE	29701 GOLDSPIKE	100+ PSI	5/28/25	YES	2025094	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-29B-421	DEERTRAIL	27020 DEERTRAIL	100+ PSI	5/28/25	YES	2025095	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-29B-721	DEERTRAIL	27130 DEERTRAIL	100+ PSI	5/28/25	YES	2025096	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-29D-011	DEERTRAIL	27251 DEERTRAIL	65 PSI	5/28/25	YES	2025097	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-29C-391	STARLAND	30401 STARLAND	65 PSI	5/28/25	YES	2025100	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-20C-921	EL CAMINO	27060 EL CAMINO	120+ PSI	5/28/25	YES	2025101	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-28C-281	SURREY	29550 SURREY	100 PSI	5/28/25	YES	2025102	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-28C-471	DEERTRAIL	26131 DEERTRAIL	140 PSI	5/28/25	YES	2025103	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-28C-681	GOLDSPIKE	25901 GOLDSPIKE	40 PSI	5/28/25	YES	2025104	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-28C-891	GOLDSPIKE	ON DEERTRAIL FOR 25901 GOLDSPIKE	55 PSI	5/28/25	YES	2025105	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-33B-111	DEERTRAIL	25900 DEERTRAIL	95 PSI	5/28/25	YES	2025106	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-28C-991	DEERTRAIL	26000 DEERTRAIL	80 PSI	5/28/25	YES	2025107	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-33B-611	DEERTRAIL	25620 DEERTRAIL	60 PSI	5/28/25	YES	2025108	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-33B-901	TANK	TANK 6C1	95 PSI	5/28/25	YES	2025109	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-33D-031	DEERTRAIL	25360 DEERTRAIL	45 PSI	5/28/25	YES	2025110	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-29B-141	OWL	26941 OWL	110 PSI	5/28/25	YES	2025111	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-29B-450	OWL	26800 OWL	90 PSI	5/28/25	YES	2025112	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-29B-460	WINTER	26801 WINTER	90 PSI	5/28/25	YES	2025113	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-28C-431	GOLDSPIKE	29681 GOLDSPIKE	135 PSI	5/28/25	YES	2025114	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-29B-791	DEERTRAIL	26741 DEERTRAIL	125 PSI	5/28/25	YES	2025115	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-28A-601	DEERTRAIL	26720 DEERTRAIL	150 PSI	5/28/25	YES	2025116	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-28A-721	DEERTRAIL	26601 DEERTRAIL/CHESTER	150 PSI	5/28/25	YES	2025117	FULLY FUNCTIONAL - VALVE COULD USE SOME CLEANING	
146-33A-281	SPRINGWOOD	29551 SPRINGWOOD	75 PSI	5/28/25	NO	N/A	N/A	N/A
146-28A-651	CEDAR CREEK	26641 CEDAR CREEK	80 PSI	5/28/25	NO	N/A	N/A	N/A
146-28A-841	DEERTRAIL	26551 DEERTRAIL	140 PSI	5/28/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-28A-861	DEERTRAIL	26501 DEERTRAIL	115 PSI	5/28/25	NO	N/A	N/A	N/A
146-28C-031	GOLDSPIKE	29800 GOLDSPIKE	45 PSI	5/28/25	NO	N/A	N/A	N/A
146-28C-071	DEERTRAIL	26301 DEERTRAIL	95 PSI	5/28/25	NO	N/A	N/A	N/A
146-28C-111	GOLDSPIKE	29751 GOLDSPIKE	80 PSI	5/28/25	NO	N/A	N/A	N/A
146-28C-301	GOLDSPIKE	29750 GOLDSPIKE	115 PSI	5/28/25	NO	N/A	N/A	N/A
146-28C-771	GOLDSPIKE	29511 GOLDSPIKE	70 PSI	5/28/25	NO	N/A	N/A	N/A
146-28D-061	SURREY	29201 SURREY	150 PSI	5/28/25	NO	N/A	N/A	N/A
146-28D-301	SURREY	29540 SURREY	85 PSI	5/28/25	NO	N/A	N/A	N/A
146-28D-521	SURREY	29401 SURREY	70 PSI	5/28/25	NO	N/A	N/A	N/A
146-28D-741	SURREY	29340 SURREY	90 PSI	5/28/25	NO	N/A	N/A	N/A
146-28D-851	SURREY	29300 SURREY	125 PSI	5/28/25	NO	N/A	N/A	N/A
146-29A-031	EL CAMINO	26980 EL CAMINO	153 PSI	5/28/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-29A-031	EL CAMINO	26940 EL CAMINO	100+ PSI	5/28/25	NO	N/A	N/A	N/A
146-29A-121	EL CAMINO	26940 EL CAMINO	150 PSI	5/28/25	NO	N/A	N/A	N/A
146-29A-411	EL CAMINO	26800 EL CAMINO	100 PSI	5/28/25	NO	N/A	N/A	N/A
146-29A-711	DEERTRAIL	27941 DEERTRAIL	100+ PSI	5/28/25	NO	N/A	N/A	N/A
146-29A-891	TEAL	26540 TEAL	85 PSI	5/28/25	NO	N/A	N/A	N/A
146-29B-071	MEDICINE BOW	26980 MEDICINE BOW	40 PSI	5/28/25	NO	N/A	N/A	N/A
146-29B-271	MEDICINE BOW	26901 MEDICINE BOW	70 PSI	5/28/25	NO	N/A	N/A	N/A
146-29B-571	DEERTRAIL	26801 DEERTRAIL	100 PSI	5/28/25	NO	N/A	N/A	N/A
146-29B-901	DEERTRAIL	26500 DEERTRAIL	80 PSI	5/28/25	NO	N/A	N/A	N/A
146-29C-021	DEERTRAIL	27780 DEERTRAIL	80 PSI	5/28/25	NO	N/A	N/A	N/A
146-29C-221	DEERTRAIL	27701 DEERTRAIL	50 PSI	5/28/25	NO	N/A	N/A	N/A
146-29C-261	DEERTRAIL	27320 DEERTRAIL	105 PSI	5/28/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-29C-291	DEERTRAIL	27321 DEERTRAIL	22 PSI	5/28/25	NO	N/A	N/A	N/A
146-29C-441	DEERTRAIL	27740 DEERTRAIL	85 PSI	5/28/25	NO	N/A	N/A	N/A
146-33B-061	WOODVIEW	29101 WOODVIEW	125 PSI	5/28/25	NO	N/A	N/A	N/A
146-33B-181	SURREY	29141 SURREY	55 PSI	5/28/25	NO	N/A	N/A	N/A
146-33B-401	DEERTRAIL	25721 DEERTAIL	120 PSI	5/28/25	NO	N/A	N/A	N/A
146-20D-791	MEDICINE BOW	27061 MEDICINE BOW	10 PSI	5/28/25	NO		PSI IS LOW BECAUSE IT IS AT A TANK	
146-33D-891	DEERTRAIL	25100 DEERTRAIL	105 PSI	6/26/25	NO	N/A	N/A	N/A
164-04B-091	DEERTRAIL	24940 DEERTRAIL	40 PSI	6/26/25	YES	2025118	FULLY FUNCTIONAL - BOLLARDS COULD BE STRAIGHTENED UP SOME	
146-34D-161	PARAMOUNT	25181 PARAMOUNT	90 PSI	6/26/25	NO	N/A	N/A	N/A
146-34D-351	PARAMOUNT	25101 PARAMOUNT	100 PSI	6/26/25	YES	2025119	FULLY FUNCTIONAL - BOLLARDS COULD BE STRAIGHTENED UP SOME	
146-34D-451	PARAMOUNT	25101 PARAMOUNT	125 PSI	6/26/25	NO	N/A	N/A	N/A
146-34D-641	PARAMOUNT	24980 PARAMOUNT	165 PSI	6/26/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-34d-621	PARAMOUNT	24951 PARAMOUNT	100 PSI	6/26/25	NO	N/A	N/A	N/A
146-34D-101	CAMPGROUND / PARAMOUNT	25200 CAMPGROUND	105 PSI	6/26/25	YES	2025120	FULLY FUNCTIONAL - BOLLARDS COULD BE STRAIGHTENED UP SOME	
146-34D-401	CAMPGROUND	25150 CAMPGROUND	65 PSI	6/26/25	NO	N/A	N/A	N/A
146-34D-601	PARAMOUNT	24881 PARAMOUNT	60 PSI	6/26/25	YES	2025121	NEEDS BOLLARDS INSTALLED	
146-34C-681	ARTESIAN / PARAMOUNT	24811 ARTESIAN	100 PSI	6/26/25	NO	N/A	N/A	N/A
146-34C-551	ARTESIAN	25161 ARTESIAN	135 PSI	6/26/25	NO	N/A	N/A	N/A
146-34C-661	PARAMOUNT	24808 PARAMOUNT	130 PSI	6/26/25	NO	N/A	N/A	N/A
146-34C-741	PARAMOUNT	24781 PARAMOUNT	160 PSI	6/26/25	NO	N/A	N/A	N/A
146-34C-701	PARAMOUNT	24740 PARAMOUNT	30 PSI	6/26/25	NO	N/A	N/A	N/A
146-34C-911	PARAMOUNT	24720 PARAMOUNT	62 PSI	6/26/25	NO	N/A	N/A	N/A
146-33D-971	PARAMOUNT	24601 PARAMOUNT	110 PSI	6/26/25	NO	N/A	N/A	N/A
146-33D-681	DEERTRAIL	25151 DEERTRAIL	115 PSI	6/26/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-33D-651	DEERTRAIL	25200 DEERTRAIL	85 PSI	6/26/25	NO	N/A	N/A	N/A
146-33D-541	DEERTRAIL	25200 DEERTRAIL	50 PSI	6/26/25	NO	N/A	N/A	N/A
146-33D-361	DEERTRAIL	25200 DEERTRAIL	175 PSI	6/26/25	NO	N/A	N/A	N/A
146-33D-161	DEERTRAIL	25300 DEERTRAIL	125 PSI	6/26/25	NO	N/A	N/A	N/A
146-33B-941	DEERTRAIL	25660 DEERTRAIL	80 PSI	6/26/25	NO	N/A	N/A	N/A
146-26C-691	PARAMOUNT	26181 PARAMOUNT	90 PSI	6/30/25	NO	N/A	N/A	N/A
146-26C-661	PARAMOUNT	26281 PARAMOUNT	80 PSI	6/30/25	NO	N/A	N/A	N/A
146-35A-851	PARAMOUNT	25380 PARAMOUNT	40 PSI	6/30/25	NO	N/A	N/A	N/A
146-35A-821	PARAMOUNT	25301 PARAMOUNT	75 PSI	6/30/25	NO	N/A	N/A	N/A
146-35A-901	PARAMOUNT	25280 PARAMOUNT	145 PSI	6/30/25	NO	N/A	N/A	N/A
146-34B-881	PARAMOUNT	25200 PARAMOUNT	165 PSI	6/30/25	NO	N/A	N/A	N/A
164-04A-881	PIUTE	24521 PIUTE	110 PSI	6/30/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
164-04B-901	GREENWATER	29400 GREENWATER	70 PSI	6/30/25	NO	N/A	N/A	N/A
164-04D-031	GREENWATER	29340 GREENWATER	80 PSI	6/30/25	NO	N/A	N/A	N/A
164-04D-141	STINE	24461 STINE	95 PSI	6/30/25	NO	N/A	N/A	N/A
164-04B-841	CUB CT	24500 CUB CT	75 PSI	6/30/25	NO	N/A	N/A	N/A
164-04D-641	N LOWER VALLEY/FAWN	29041 N LOWER VALLEY	120 PSI	6/30/25	NO	N/A	N/A	N/A
164-04D-481	FAWN WAY	29100 FAWN WAY	125 PSI	6/30/25	NO	N/A	N/A	N/A
164-04B-971	GREENWATER	29200 GREENWATER	65 PSI	6/30/25	NO	N/A	N/A	N/A
164-04B-571	DEERTRAIL	24600 DEERTRAIL	155 PSI	6/30/25	NO	N/A	N/A	N/A
164-04B-761	DEERTRAIL	24601 DEERTRAIL	45 PSI	6/30/25	NO	N/A	N/A	N/A
164-04B-371	DEERTRAIL	24761 DEERTRAIL	118 PSI	6/30/25	NO	N/A	N/A	N/A
164-04B-291	DEERTRAIL	24780 DEERTRAIL	80 PSI	6/30/25	NO	N/A	N/A	N/A
146-35B-811	PARAMOUNT	25501 PARAMOUNT	80 PSI	7/29/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-35A-691	WILDERNESS	25600 WILDERNESS	60 PSI	7/29/25	NO	N/A	N/A	N/A
146-35A-491	WILDERNESS	25681 WILDERNESS	20 PSI	7/29/25	NO	N/A	N/A	N/A
146-35A-251	SONORA	27800 SONORA	100 PSI	7/29/25	NO	N/A	N/A	N/A
146-35A-271	SONORA	27601 SONORA	85 PSI	7/29/25	NO	N/A	N/A	N/A
146-26C-981	WILDERNESS	26041 WILDERNESS	65 PSI	7/29/25	NO	N/A	N/A	N/A
146-26C-891	WILDERNESS	26101 WILDERNESS	60 PSI	7/29/25	NO	N/A	N/A	N/A
146-26D-611	PARAMOUNT	26050 PARAMOUNT	95 PSI	7/29/25	NO	N/A	N/A	N/A
146-26D-821	PARAMOUNT	25981 PARAMOUNT	125 PSI	7/29/25	NO	N/A	N/A	N/A
146-35B-331	PARAMOUNT	25681 PARAMOUNT	65 PSI	7/29/25	NO	N/A	N/A	N/A
146-35B-131	JACARANDA	25981 JACARANDA	50 PSI	7/29/25	NO	N/A	N/A	N/A
146-35B-251	JACARANDA	25921 JACARANDA	80 PSI	7/29/25	NO	N/A	N/A	N/A
146-35B-471	JACARANDA	25881 JACARANDA	105 PSI	7/29/25	YES	2025120	BOLLARDS HAVE BEEN REMOVED	

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-35B-491	HIGH ROCK & JACARANDA	INTERSECTION ON JACARANDA AT HIGHROCK	135 PSI	7/29/25	NO	N/A	N/A	N/A
146-35B-891	HIGH ROCK	25501 HIGH ROCK CT	140 PSI	7/29/25	NO	N/A	N/A	N/A
146-36A-311	REMINGTON	25900 REMINGTON	45 PSI	7/29/25	NO	N/A	N/A	N/A
146-36A-511	REMINGTON	25740 REMINGTON	55 PSI	7/29/25	NO	N/A	N/A	N/A
146-36A-531	JACARANDA	25781 JACARANDA	50 PSI	7/29/25	NO	N/A	N/A	N/A
146-36A-821	TERRITORY WAY	25581 TERRITORY WAY	65 PSI	7/29/25	NO	N/A	N/A	N/A
146-36A-951	CABRIOLET	26650 CABRIOLET	60 PSI	7/29/25	NO	N/A	N/A	N/A
146-36C-021	STIRRUP	26930 STIRRUP	75 PSI	7/29/25	NO	N/A	N/A	N/A
146-36C-131	STIRRUP	26900 STIRRUP	85 PSI	7/29/25	NO	N/A	N/A	N/A
146-36C-351	STIRRUP	26860 STIRRUP	20 PSI	7/29/25	NO	N/A	N/A	N/A
146-36A-551	JACARANDA	25701 JACARANDA	80 PSI	7/30/25	NO	N/A	N/A	N/A
146-35B-841	STIRRUP	27360 STIRRUP	90 PSI	7/30/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-35B-951	STIRRUP	27201 STIRRUP	100 PSI	7/30/25	NO	N/A	N/A	N/A
14635D-071	RANGER	25400 RANGER	115 PSI	7/30/25	NO	N/A	N/A	N/A
146-36A-771	JACARANDA	25601 JACARANDA	95 PSI	7/30/25	NO	N/A	N/A	N/A
146-36C-081	JACARANDA	25501 JACARANDA	45 PSI	7/30/25	NO	N/A	N/A	N/A
146-36D-431	RIFLE	26151 RIFLE	155 PSI	7/30/25	NO	N/A	N/A	N/A
146-36D-211	RIFLE	26300 RIFLE	110 PSI	7/30/25	NO	N/A	N/A	N/A
146-36C-291	JACARANDA	26400 JACARANDA	60 PSI	7/30/25	NO	N/A	N/A	N/A
146-36D-601	JACARANDA	25200 JACARANDA	100 PSI	7/30/25	NO	N/A	N/A	N/A
146-36C-391	JACARANDA	25300 JACARANDA	65 PSI	7/30/25	NO	N/A	N/A	N/A
146-35B-621	PARAMOUNT	27401 PARAMOUNT	60 PSI	7/30/25	NO	N/A	N/A	N/A
146-35D-291	STIRRUP	26991 STIRRUP	50 PSI	7/30/25	NO	N/A	N/A	N/A
146-36C-101	STIRRUP	26950 STIRRUP	85 PSI	7/30/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
146-36C-541	STIRRUP	26801 STIRRUP	55 PSI	7/30/25	NO	N/A	N/A	N/A
N/A	STIRRUP	26601 STIRRUP	120 PSI	7/30/25	NO	N/A	N/A	N/A
N/A	STIRRUP	26641 STIRRUP	85 PSI	7/30/25	NO	N/A	N/A	N/A
N/A	JACARNADA	25021 JACARANDA	40 PSI	7/30/25	NO	N/A	N/A	N/A
N/A	WINCHESTER	26581 WINCHESTER	100 PSI	7/30/25	NO	N/A	N/A	N/A
N/A	WINCHESTER	26440 WINCHESTER	90 PSI	7/30/25	NO	N/A	N/A	N/A
N/A	WINCHESTER	26341 WINCHESTER	65 PSI	7/30/25	NO	N/A	N/A	N/A
N/A	JACARANDA	25150 JACARANDA	40 PSI	7/30/25	NO	N/A	N/A	N/A
N/A	SUNSET & STIRRUP	INTERSECTION SUNSET AND STIRRUP	30 PSI	7/30/25	NO	N/A	N/A	N/A
N/A	SUNSET & STIRRUP	24921 SUNSET	40 PSI	7/30/25	NO	N/A	N/A	N/A
N/A	JACARANDA	ACROSS FROM 24741 JACARANDA	50 PSI	7/30/25	NO	N/A	N/A	N/A
N/A	KEENE	24861 KEENE	70 PSI	7/30/25	NO	N/A	N/A	N/A

KCFD HYDRANT ID # PER THEIR GIS	LOCATION DESCRIPTION	ADDRESS	PSI/GPM	DATE OF INSPECTION	WORK ORDER CREATED	WORK ORDER NUMBER	DESCRIPTION WORK ORDER	WORK ORDER COMPLETED
N/A	KEENE	24701 KEENE	45 PSI	7/30/25	NO	N/A	N/A	N/A

2025' TOTAL GALLONS (Potable and Non-Potable)

BEAR VALLEY COMMUNITY SERVICES DISTRICT

WELL#	JAN	FEB	MAR	APR	MAY	JUN	JULY	AUG	SEP	OCT	NOV	DEC	TOTAL
1	2,468,400	2,216,324	2,401,828	2,017,356	2,412,300	2,241,756	2,332,284	0	0	0	0	0	16,090,228
2	0	0	0	0	0	0	0	0	0	0	0	0	0
3	0	0	0	0	0	0	0	0	0	0	0	0	0
4	0	0	0	0	0	0	0	0	0	0	0	0	0
6	0	0	0	0	0	0	0	0	0	0	0	0	0
7 Lake	0	0	0	0	0	0	0	0	0	0	0	0	0
8 Lake	2,739,924	2,131,052	114,200	0	0	67,500	297,300	0	0	0	0	0	5,349,976
9 Lake	0	0	0	0	0	0	0	0	0	0	0	0	0
10 Lake	0	0	224,400	0	0	0	456,200	0	0	0	0	0	680,600
11 Lake	0	0	203,400	0	0	0	770,700	0	0	0	0	0	974,100
13 Lake	0	0	0	0	0	0	0	0	0	0	0	0	0
29	0	0	0	0	0	0	0	0	0	0	0	0	0
30	0	0	0	0	0	0	0	0	0	0	0	0	0
31	2,191,430	2,998,390	655,240	0	0	0	0	0	0	0	0	0	5,845,060
32	0	0	0	0	0	0	0	0	0	0	0	0	0
33 Lake	0	0	0	0	0	0	838,508	0	0	0	0	0	838,508
34	0	0	0	0	0	0	0	0	0	0	0	0	0
35	0	0	0	0	0	0	0	0	0	0	0	0	0
36	0	0	0	0	0	0	0	0	0	0	0	0	0
37	0	0	0	0	0	0	0	0	0	0	0	0	0
BV TOTAL	7,399,754	7,345,766	3,599,068	2,017,356	2,412,300	2,309,256	4,694,972	0	0	0	0	0	29,778,472
CV#1	0	0	0	0	0	0	0	0	0	0	0	0	0
CV#2	0	0	0	0	0	0	0	0	0	0	0	0	0
CV#3	0	0	0	0	0	0	0	0	0	0	0	0	0
CV#4	3,167,000	2,267,000	3,456,000	3,883,000	5,109,000	6,749,000	7,567,000	0	0	0	0	0	32,198,000
CV#5	4,342,000	4,199,000	6,360,000	7,322,000	9,406,000	12,575,000	17,175,000	0	0	0	0	0	61,379,000
CV#6	4,741,000	3,252,000	3,988,000	5,700,000	7,537,000	9,144,000	14,341,000	0	0	0	0	0	48,703,000
CV TOTAL	12,250,000	9,718,000	13,804,000	16,905,000	22,052,000	28,468,000	39,083,000	0	0	0	0	0	142,280,000
TOTAL	19,649,754	17,063,766	17,403,068	18,922,356	24,464,300	30,777,256	43,777,972	0	0	0	0	0	172,058,472

2025 HOURS PER MONTH WELLS WERE ON

BEAR VALLEY COMMUNITY SERVICES DISTRICT

WELL#	JAN	FEB	MAR	APR	MAY	JUN	JULY	AUG	SEP	OCT	NOV	DEC	TOTAL
1	734.5	672.6	730.2	N/A	N/A	N/A	N/A	0.0	0.0	0.0	0.0	0.0	2,137.3
2	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
3	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
4	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
6	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
7 Lake	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
8 Lake	502.7	648.4	259.7	0.0	0.0	151.1	660.7	0.0	0.0	0.0	0.0	0.0	2,222.6
9 Lake	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
10 Lake	0.0	0.0	504.7	0.0	0.0	0.0	914.5	0.0	0.0	0.0	0.0	0.0	1,419.2
11 Lake	0.0	0.0	338.9	0.0	0.0	0.0	957.0	0.0	0.0	0.0	0.0	0.0	1,295.9
13 Lake	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
29	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
30	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
31	128.0	196.0	35.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	359.0
32	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
33 Lake	0.0	0.0	0.0	0.0	0.0	0.0	232.2	0.0	0.0	0.0	0.0	0.0	232.2
34	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
35	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
36	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
37	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
BV TOTAL	1,365.2	1,517.0	1,668.5	0.0	0.0	151.1	2,764.4	0.0	0.0	0.0	0.0	0.0	7,666.2
CV#1	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
CV#2	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
CV#3	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0
CV#4	126.3	91.0	137.9	161.8	230.6	315.4	445.8	0.0	0.0	0.0	0.0	0.0	1,508.8
CV#5	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0.0	0.0	0.0	0.0	0.0	0.0
CV#6	123.7	87.2	107.4	163.3	232.9	312.8	545.4	0.0	0.0	0.0	0.0	0.0	1,572.7
CV TOTAL	250.0	178.2	245.3	325.1	463.5	628.2	991.2	0.0	0.0	0.0	0.0	0.0	3,081.5
TOTAL	1,615.2	1,695.2	2,113.8	325.1	463.5	779.3	3,755.6	0.0	0.0	0.0	0.0	0.0	10,747.7

*Wells are on when they need to fill a tank only

CV4 - Hour Meter Broken

Well 1 Meter broken due to SCE Pole having a fire.

2025 GPM

BEAR VALLEY COMMUNITY SERVICES DISTRICT

WELL#	JAN	FEB	MAR	APR	MAY	JUN	JULY	AUG	SEP	OCT	NOV	DEC	AVERAGE
1	56.01	54.92	54.82	N/A	N/A	N/A	52.23	0.00	0.00	0.00	0.00	0.00	15.29
2	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
3	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
4	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
6	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
7 Lake	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
8 Lake	90.84	54.78	7.30	0.00	0.00	7.45	7.50	0.00	0.00	0.00	0.00	0.00	13.99
9 Lake	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
10 Lake	0.00	0.00	7.40	0.00	0.00	0.00	8.30	0.00	0.00	0.00	0.00	0.00	1.31
11 Lake	0.00	0.00	10.00	0.00	0.00	0.00	13.42	0.00	0.00	0.00	0.00	0.00	1.95
13 Lake	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
29	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
30	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
31	285.34	254.97	312.02	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	71.03
32	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
33 Lake	0.00	0.00	0.00	0.00	0.00	0.00	60.19	0.00	0.00	0.00	0.00	0.00	5.02
34	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
35	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
36	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
37	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
BV TOTAL	432.19	364.67	391.54	0.00	0.00	7.45	141.64	0.00	0.00	0.00	0.00	0.00	108.59
CV#1	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
CV#2	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
CV#3	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
CV#4	417.92	415.20	417.69	399.98	369.25	356.64	282.90	0.00	0.00	0.00	0.00	0.00	221.63
CV#5	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0.00	0.00	0.00	0.00	0.00	0.00
CV#6	638.78	621.56	618.87	581.75	539.36	487.21	438.24	0.00	0.00	0.00	0.00	0.00	327.15
CV TOTAL	1056.7	1036.8	1036.8	981.73	908.6	843.85	721.14	0.0	0.0	0.00	0.00	0	548.78

2025 ACRE FEET
BEAR VALLEY COMMUNITY SERVICES DISTRICT

WELL#	JAN	FEB	MAR	APR	MAY	JUN	JULY	AUG	SEP	OCT	NOV	DEC	TOTAL
1	7.58	6.80	7.37	6.19	7.40	6.88	7.16	0.00	0.00	0.00	0.00	0.00	49.38
2	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
3	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
4	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
6	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
7 Lake	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
8 Lake	8.41	6.54	0.35	0.00	0.00	0.21	0.91	0.00	0.00	0.00	0.00	0.00	16.42
9 Lake	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
10 Lake	0.00	0.00	0.69	0.00	0.00	0.00	1.40	0.00	0.00	0.00	0.00	0.00	2.09
11 Lake	0.00	0.00	0.62	0.00	0.00	0.00	2.37	0.00	0.00	0.00	0.00	0.00	2.99
13 Lake	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
29	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
30	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
31	6.73	9.20	2.01	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	17.94
32	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
33 Lake	0.00	0.00	0.00	0.00	0.00	0.00	2.57	0.00	0.00	0.00	0.00	0.00	2.57
34	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
35	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
36	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
37	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
BV TOTAL	22.71	22.54	11.04	6.19	7.40	7.09	14.41	0.00	0.00	0.00	0.00	0.00	91.38
CV#1	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
CV#2	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
CV#3	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
CV#4	9.72	6.96	10.61	11.92	15.68	20.71	23.22	0.00	0.00	0.00	0.00	0.00	98.81
CV#5	13.33	12.89	19.52	22.47	28.87	38.59	52.71	0.00	0.00	0.00	0.00	0.00	188.37
CV#6	14.55	9.98	12.24	17.50	23.13	28.06	44.01	0.00	0.00	0.00	0.00	0.00	149.47
CV TOTAL	37.59	29.82	42.36	51.89	67.68	87.36	119.94	0.00	0.00	0.00	0.00	0.00	436.65
TOTAL	60.30	52.36	53.40	58.08	75.08	94.45	134.35	0.00	0.00	0.00	0.00	0.00	528.03
BV %	37.7	43.0	20.7	10.7	9.9	7.5	10.7	0.0	0.0	0.0	0.0	0.0	17.31
CV %	62.3	57.0	79.3	89.3	90.1	92.5	89.3	0.0	0.0	0.0	0.0	0.0	82.7

2025 AF TO LAKES
BEAR VALLEY COMMUNITY SERVICES DISTRICT
WELL PRODUCTION MONTHLY REPORT IN AF

		JAN	FEB	MAR	APR	MAY	JUN	JULY	AUG	SEP	OCT	NOV	DEC	YEAR END TOTAL
7	CUB	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
8	CUB	8.41	6.54	0.35	0.00	0.00	0.21	0.91	0.00	0.00	0.00	0.00	0.00	16.42
9	4 ISLAND	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
10	4 ISLAND	0.00	0.00	0.69	0.00	0.00	0.00	1.40	0.00	0.00	0.00	0.00	0.00	2.09
11	4 ISLAND	0.00	0.00	0.62	0.00	0.00	0.00	2.37	0.00	0.00	0.00	0.00	0.00	2.99
13	4 ISLAND	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
33	4 ISLAND	0.00	0.00	0.00	0.00	0.00	0.00	2.57	0.00	0.00	0.00	0.00	0.00	2.57
WELL	SUBTOTAL	8.41	6.54	1.66	0.00	0.00	0.21	7.25	0.00	0.00	0.00	0.00	0.00	24.07


HYDRANT MTRS/CUMMINGS VALLEY SCHOOL & BRITE LAKE IN AF




		JAN	FEB	MAR	APR	MAY	JUN	JULY	AUG	SEP	OCT	NOV	DEC	YEAR END TOTAL
HYDRANT METERS		0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000						0.0000
CUMMINGS VALLEY SCHOOL		0.0368	0.0310	0.0310	0.0030	0.0310	0.0600	0.0000						0.1928
BRITE LAKE		0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	26.6600						26.6600
MONTHLY	TOTAL	0.0368	0.0310	0.0310	0.0030	0.0310	0.0600	26.6600	0.0000	0.0000	0.0000	0.0000	0.0000	0.1928

BEAR VALLEY COMMUNITY SERVICES DISTRICT

	JAN	FEB	MAR	APR	MAY	JUN	JULY	AUG	SEP	OCT	NOV	DEC	TOTALS
7	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.0000	0.00	0.00	0.00	0.00	0.000
8	3,663	2,849	153	0	0	90	397	0.0000	0.00	0.00	0.00	0.00	7,152
9	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.0000	0.00	0.00	0.00	0.00	0.000
10	0.000	0.000	0.002	0.000	0.000	0.000	0.003	0.0000	0.00	0.00	0.00	0.00	0.005
11	0.00	0.000	0.000	0.000	1.000	0.000	2.000	0.0000	0.00	0.00	0.00	0.00	3.000
13	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.0000	0.00	0.00	0.00	0.00	0.000
33	0.00	0.00	0.00	0.00	0.00	0.00	0.01	0.0000	0.00	0.00	0.00	0.00	0.006
TOTAL	3,663	2,849	152.675	0.000	1.000	90.241	399.469	0.000	0.000	0.000	0.000	0.000	7,155.385

LAKE FILL IN BILLING UNITS (HCF)

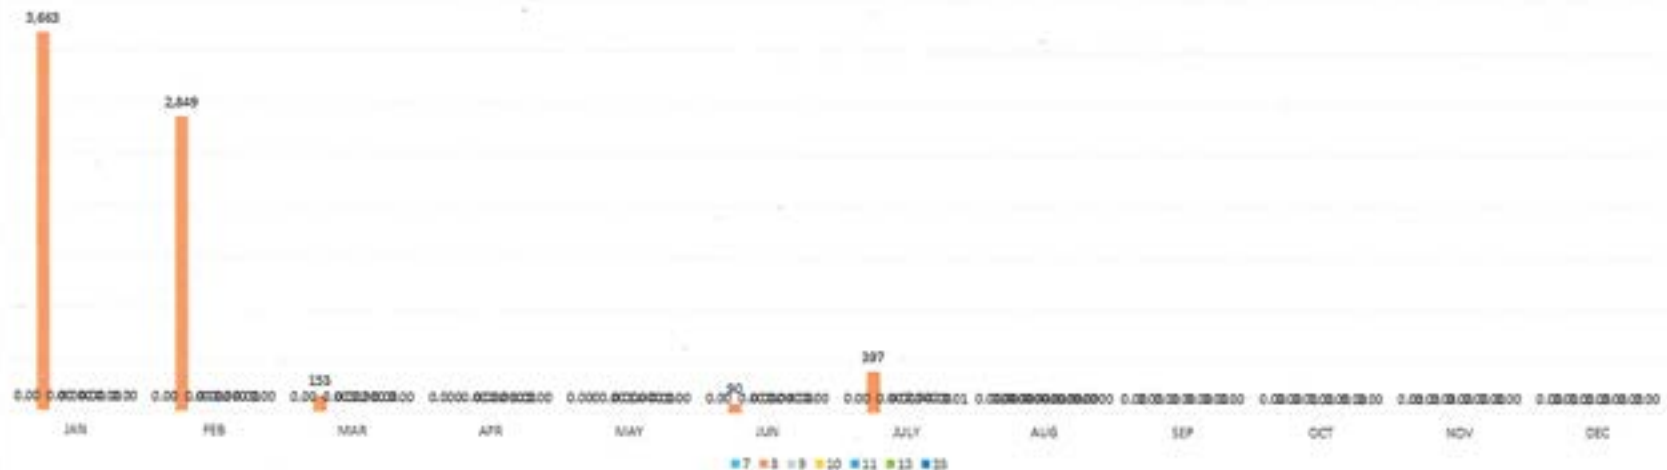


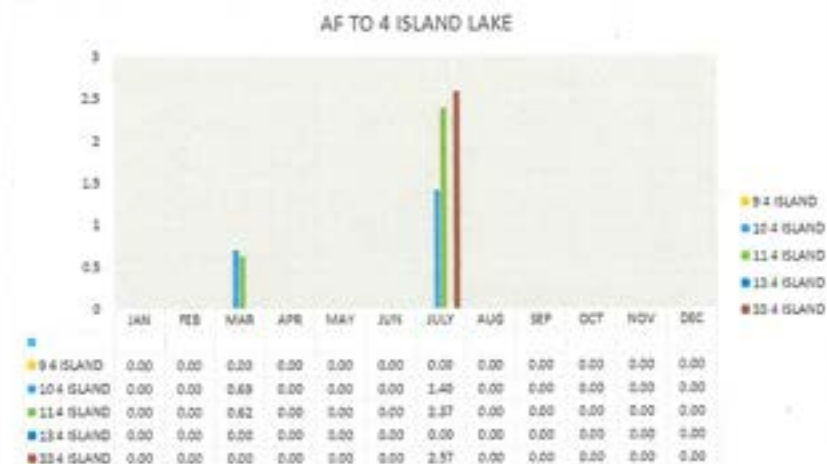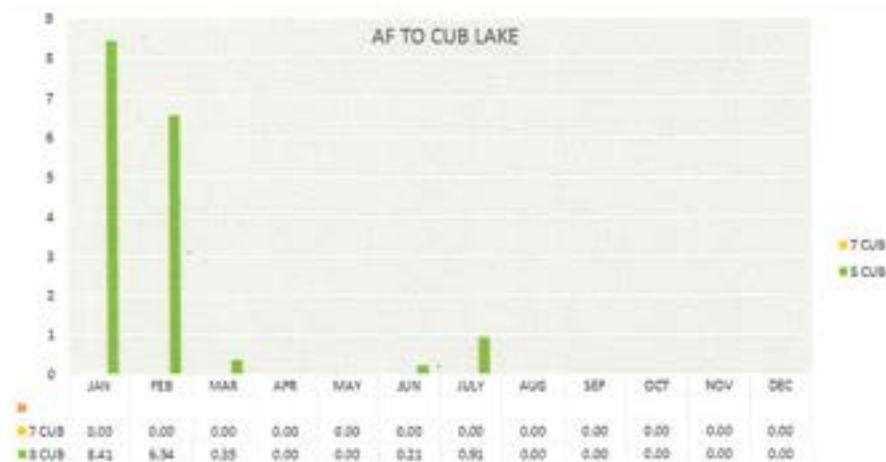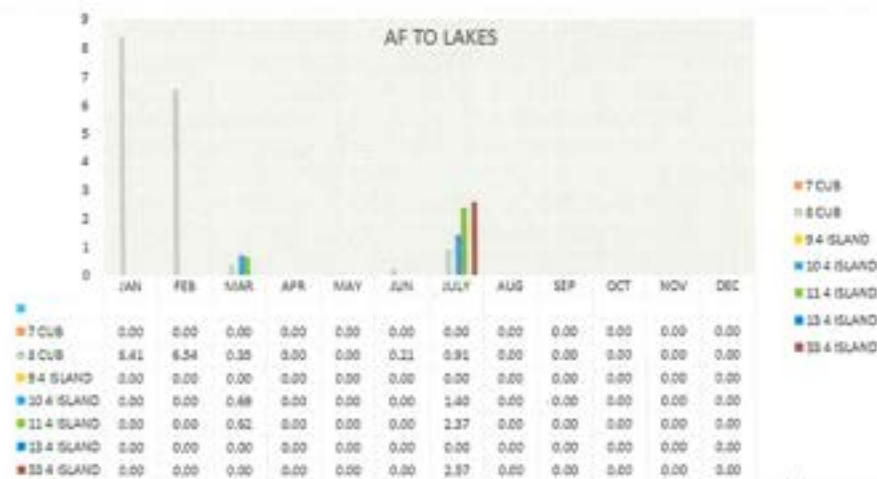

2025 WATER LOSS IN AF

	JAN	FEB	MAR	APR	MAY	JUN	JULY	AUG	SEP	OCT	NOV	DEC	YEAR END TOTAL
TANK LOSS	0.0000	0.0000	0.0000	0.0000	0.0070	0.1000	2.0700	0.0000	0.0000	0.0000	0.0000	0.0000	2.1770
WATER BREAKS	0.0000	0.0000	3.1000	0.0000	0.0010	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	3.1010
WATER LOSS FROM WELLS	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
FIRE/ FLUSHING	0.1700	0.0500	0.1300	0.9100	0.2000	0.1100	0.2300	0.0000	0.0000	0.0000	0.0000	0.0000	1.8000
WELLS TO BRITE LAKE	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
MONTHLY TOTAL	0.1700	0.0500	3.2300	0.9100	0.2080	0.2100	2.3000	0.0000	0.0000	0.0000	0.0000	0.0000	7.0780

WATER LOSS

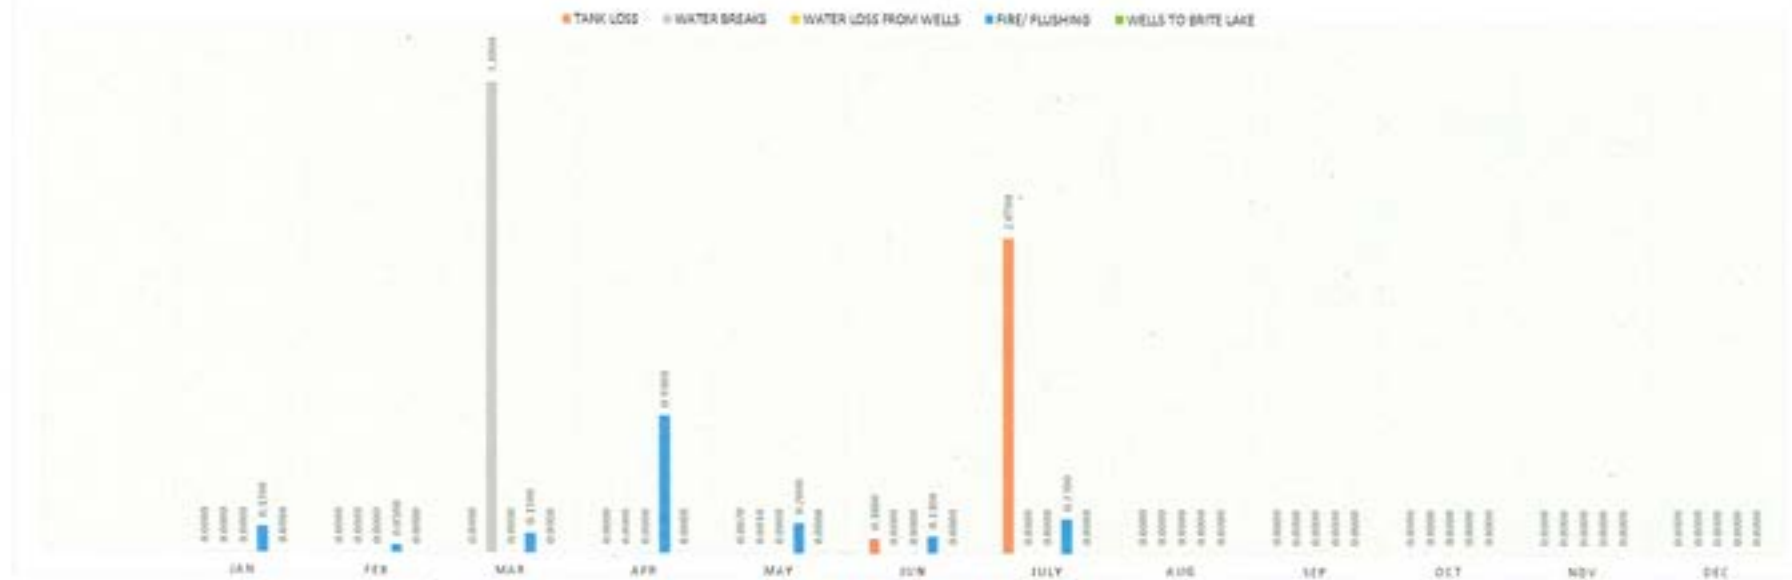

CUMMINGS VALLEY MTR READS

2025

MONTH	CV SCHOOL	CV# 1	CV# 2	CV# 3	CV# 4	CV# 5	CV# 6	Brite Lake
	Read x 1000 GAL	Read in cubic ft.	Read in cubic ft.	no mtr	Read x 1000 GAL	Read x 1000 GAL	Read x 1000 GAL	Read x 1000 GAL
DECEMBER	93990	OUT OF SERVICE	OUT OF SERVICE	DISCONNECTED	43832	85824	804718	474647
JANUARY	94002	OUT OF SERVICE	OUT OF SERVICE	DISCONNECTED	46999	90166	809459	474641
FEBRUARY	94012	OUT OF SERVICE	OUT OF SERVICE	DISCONNECTED	49266	94365	812711	474641
MARCH	94022	OUT OF SERVICE	OUT OF SERVICE	DISCONNECTED	52722	100725	816699	474641
APRIL	94023	OUT OF SERVICE	OUT OF SERVICE	DISCONNECTED	56605	108047	822399	474641
MAY	94033	OUT OF SERVICE	OUT OF SERVICE	DISCONNECTED	61714	117453	829936	474641
JUNE	94054	OUT OF SERVICE	OUT OF SERVICE	DISCONNECTED	68463	130028	839080	474641
JULY	94054	OUT OF SERVICE	OUT OF SERVICE	DISCONNECTED	76030	147203	853421	Start 474647 - end 483335
AUGUST								
SEPTEMBER								
OCTOBER								
NOVEMBER								
DECEMBER								

* To Brite Lake

** to Grimmway pond

*** Turf Farm Pond

**** TCCWD

***** Flush to SURFACE

Meter Roll-over

Reads are taken last business day of the month

7/17/2025

* 844733 CV6 when switched to Brite

474647 Start Read - Repairs had to be made to divert

Transfer Station

	Jan-21		Feb-21		Mar-21		Apr-21		May-21		Jun-21		Jul-21		Aug-21		Sep-21		Oct-21		Nov-21		Dec-21		ANNUAL TOTAL	
	#Bins	Tons	#Bins	Tons	#Bins	Tons	#Bins	Tons	#Bins	Tons	#Bins	Tons	#Bins	Tons	#Bins	Tons	#Bins	Tons	#Bins	Tons	#Bins	Tons	#Bins	Tons	BINS	TONS
Refuse	40	226.44	41	221.25	44	234.68	39	239.19	42	249.70	47	263.07	37	197.14	46	240.82	41	213.38	42	221.83	41	229.66	42	208.33	1336	6837.17
Green Waste	24	143.27	24	134.24	28	182.19	28	164.91	19	141.23	44	250.49	43	253.65	18	86.59	19	104.92	28	129.97	31	152.65	18	107.48		
Manure	33	199.59	29	206.82	32	214.44	26	163.81	22	156.09	24	139.03	29	185.49	23	144.50	20	120.58	26	190.12	21	178.70	18	150.80		
Mixed Recycle	11	13.04	10	13.65	12	16.83	22	*110.00	27	*115.00	16	12.99	23	19.13	15	15.03	12	11.61	10	8.94	7	6.55	17	44.56		
Cardboard	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	3	6	7.23	9	11.96	7	5.66			
TOTALS	108	582.34	104	575.96	116	648.14	115	567.91	110	547.02	131	665.52	112	635.41	102	486.94	95	453.49	112	558.09	109	579.52	102	516.83		

Cardboard Started September 20, 2021

* When scales are not available or not used we by law must use the formula of 500 pounds per cubic yard to figure our weights

	Jan-22		Feb-22		Mar-22		Apr-22		May-22		Jun-22		Jul-22		Aug-22		Sep-22		Oct-22		Nov-22		Dec-22		ANNUAL TOTAL	
	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	BINS	TONS
Refuse	43	228.93	32	184.05	36	222.02	30	200.33	27	157.80	23	143.75	23	133.16	29	155.10	28	159.75	29	153.92	31	191.35	27	143.90	1223	6251.83
Green Waste	21	112.50	26	127.58	21	126.23	22	148.95	27	147.68	36	187.48	24	122.72	26	119.70	23	90.33	37	150.26	21	117.27	33	213.39		
Manure	34	253.39	25	163.28	36	262.41	21	171.11	25	164.47	28	186.37	22	128.67	26	160.78	25	152.12	22	156.30	27	228.08	34	251.68		
Mixed Recycle	11	12.86	8	4.76	10	6.55	9	9.74	16	12.48	10	7.46	17	17.90	14	13.64	8	8.27	9	9.96	10	8.05	11	10.09		
Cardboard	11	8.65	8	9.04	8	9.00	8	11.18	4	4.42	6	6.13	3	1.98	7	10.64	7	7.97	10	13.44	9	14.00	9	16.81		
TOTALS	120	616.33	99	488.71	111	626.21	90	541.31	99	486.85	109	531.19	89	404.43	102	499.86	91	418.44	107	483.88	98	558.75	114	635.87		

	Jan-23		Feb-23		Mar-23		Apr-23		May-23		Jun-23		Jul-23		Aug-23		Sep-23		Oct-23		Nov-23		Dec-23		ANNUAL TOTAL	
	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	BINS	TONS
Refuse	29	147.20	23	145.38	22	139.68	28	175.64	32	196.75	26	149.71	48	252.71	40	218.51	33	190.18	38	212.88	31	210.91	37	200.87	1254	6610.78
Green Waste	13	97.92	24	74.39	13	83.19	21	111.89	34	199.38	39	221.54	29	160.01	31	151.27	41	177.63	29	136.91	27	134.09	35	166.43		
Manure	39	301.13	23	176.64	41	327.00	25	197.33	30	215.20	25	177.59	23	152.92	29	191.01	25	165.81	31	188.66	18	128.28	22	169.5		
Mixed Recycle	11	12.73	8	8.48	8	8.49	10	9.78	7	7.12	9	9.59	10	9.15	11	11.00	11	10.31	8	7.45	8	7.87	7	7.09		
Cardboard	5	11.30	8	10.23	6	12.15	10	15.67	8	12.38	6	12.62	8	12.96	8	14.49	7	10.38	10	14.27	8	13.37	8	15.76		
TOTALS	97	570.28	86	413.12	90	570.31	94	510.31	111	630.83	105	571.65	118	587.75	119	586.28	117	554.31	116	540.17	92	494.52	109	559.65		

	Jan-24		Feb-24		Mar-24		Apr-24		May-24		Jun-24		Jul-24		Aug-24		Sep-24		Oct-24		Nov-24		Dec-24		ANNUAL TOTAL	
	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	BINS	TONS
Refuse	31	254.89	29	190.46	31	199.18	32	216.09	33	206.63	30	216.46	32	208.46	33	209.55	32	195.18	33	185.81	33	192.31	33	218.7	1363	7384.9
Green Waste	27	182.14	27	185.29	47	234.17	42	245.15	48	276.9	41	211.01	23	111.25	36	171.85	40	174.75	22	99.56	36	199.97	47	192.8		
Manure	42	351.51	27	213.78	37	253.25	37	234.74	27	155.19	26	143.38	25	136.74	25	136.41	26	144.71	27	190.88	27	197.93	25	183.69		
Mixed Recycle	6	6.23	6	6.39	6	4.99	6	7.99	10	10.57	6	5.03	8	6.36	9	6.47	6	4.87	4	3.29	8	6.20	5	4.00		
Cardboard	8	15.91	8	16.16	12	25.3	12	18.83	8	13.42	8	14.28	10	17.46	7	10.09	12	18.91	10	14.49	8	12.8	11	20.09		
TOTALS	114	810.48	97	612.08	153	710.89	129	722.8	126	642.71	111	590.16	98	480.27	110	534.37	116	538.42	96	494.03	112	609.21	121	619.28		

Wet / Rainy Month

	Jan-25		Feb-25		Mar-25		Apr-25		May-25		Jun-25		Jul-25		Aug-25		Sep-25		Oct-25		Nov-25		Dec-25		ANNUAL TOTAL	
	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	# Bins	Tons	BINS	TONS
Refuse	33	211.21	24	174.96	24	241.69	23	181.1	26	211.05	25	192.64													578	3599.76
Green Waste	40	198.2	27	164.12	17	96.51	35	232.19	25	127.91	32	177.89														
Manure	44	276.05	40	214.85	31	218.93	35	255.78	30	178.88	21	109.52														
Mixed Recycle	8	5.290	6	14.95	5	25.68	6	29.09	5	19.16	6	24.83														
Cardboard	10	17.28																								
TOTALS	135	708.03	97	568.88	77	582.81	99	698.16	86	537	84	504.88	0	0	0	0	0	0.00	0	0	0	0	0	0	0	

Merged all
Recycling