

**Type:** Small upright Table Radio

**Year? / Brand:** 931, September 1931 Jackson-Bell metal tag on Radio Cabinet

**Model:** 86... Six tube SuperHetrodyne

**Serial Number (s):** 312728 on Gilfillan Decal

**Condition & Comments:** The set as found, is not functional

Loose parts, damaged wiring, etc.

The (Bad) Power Switch is disconnected and there is no Line Cord.

The Transformer appears to have been replaced long ago

The original transformer probably mounted with the wiring terminals in the chassis

The replacement transformer was tested in place, and probably is OK

The Speaker is in very poor condition... Cone, Wires and Gasket need repair

No attempt was made to get this set working. Needs a lot of TLC.

The cabinet is in serviceable condition. Some Cracks, and missing wood

Grille Cloth is replaced will Original (Reproduction) for Photographs

This a reduced value Superhetrodyne radio for the Fall of 1931.

Six Tubes, no Speaker plug, no Escutcheon, no Tone control

We have a "Blow Out" ad for this radio a Month after is was Manufactured!!!

My definition of "Dead on Arrival!"









Hudson Bell








Nothing says Jackson-Bell on the chassis



"25 Cycles" sold in Niagara Falls Region???



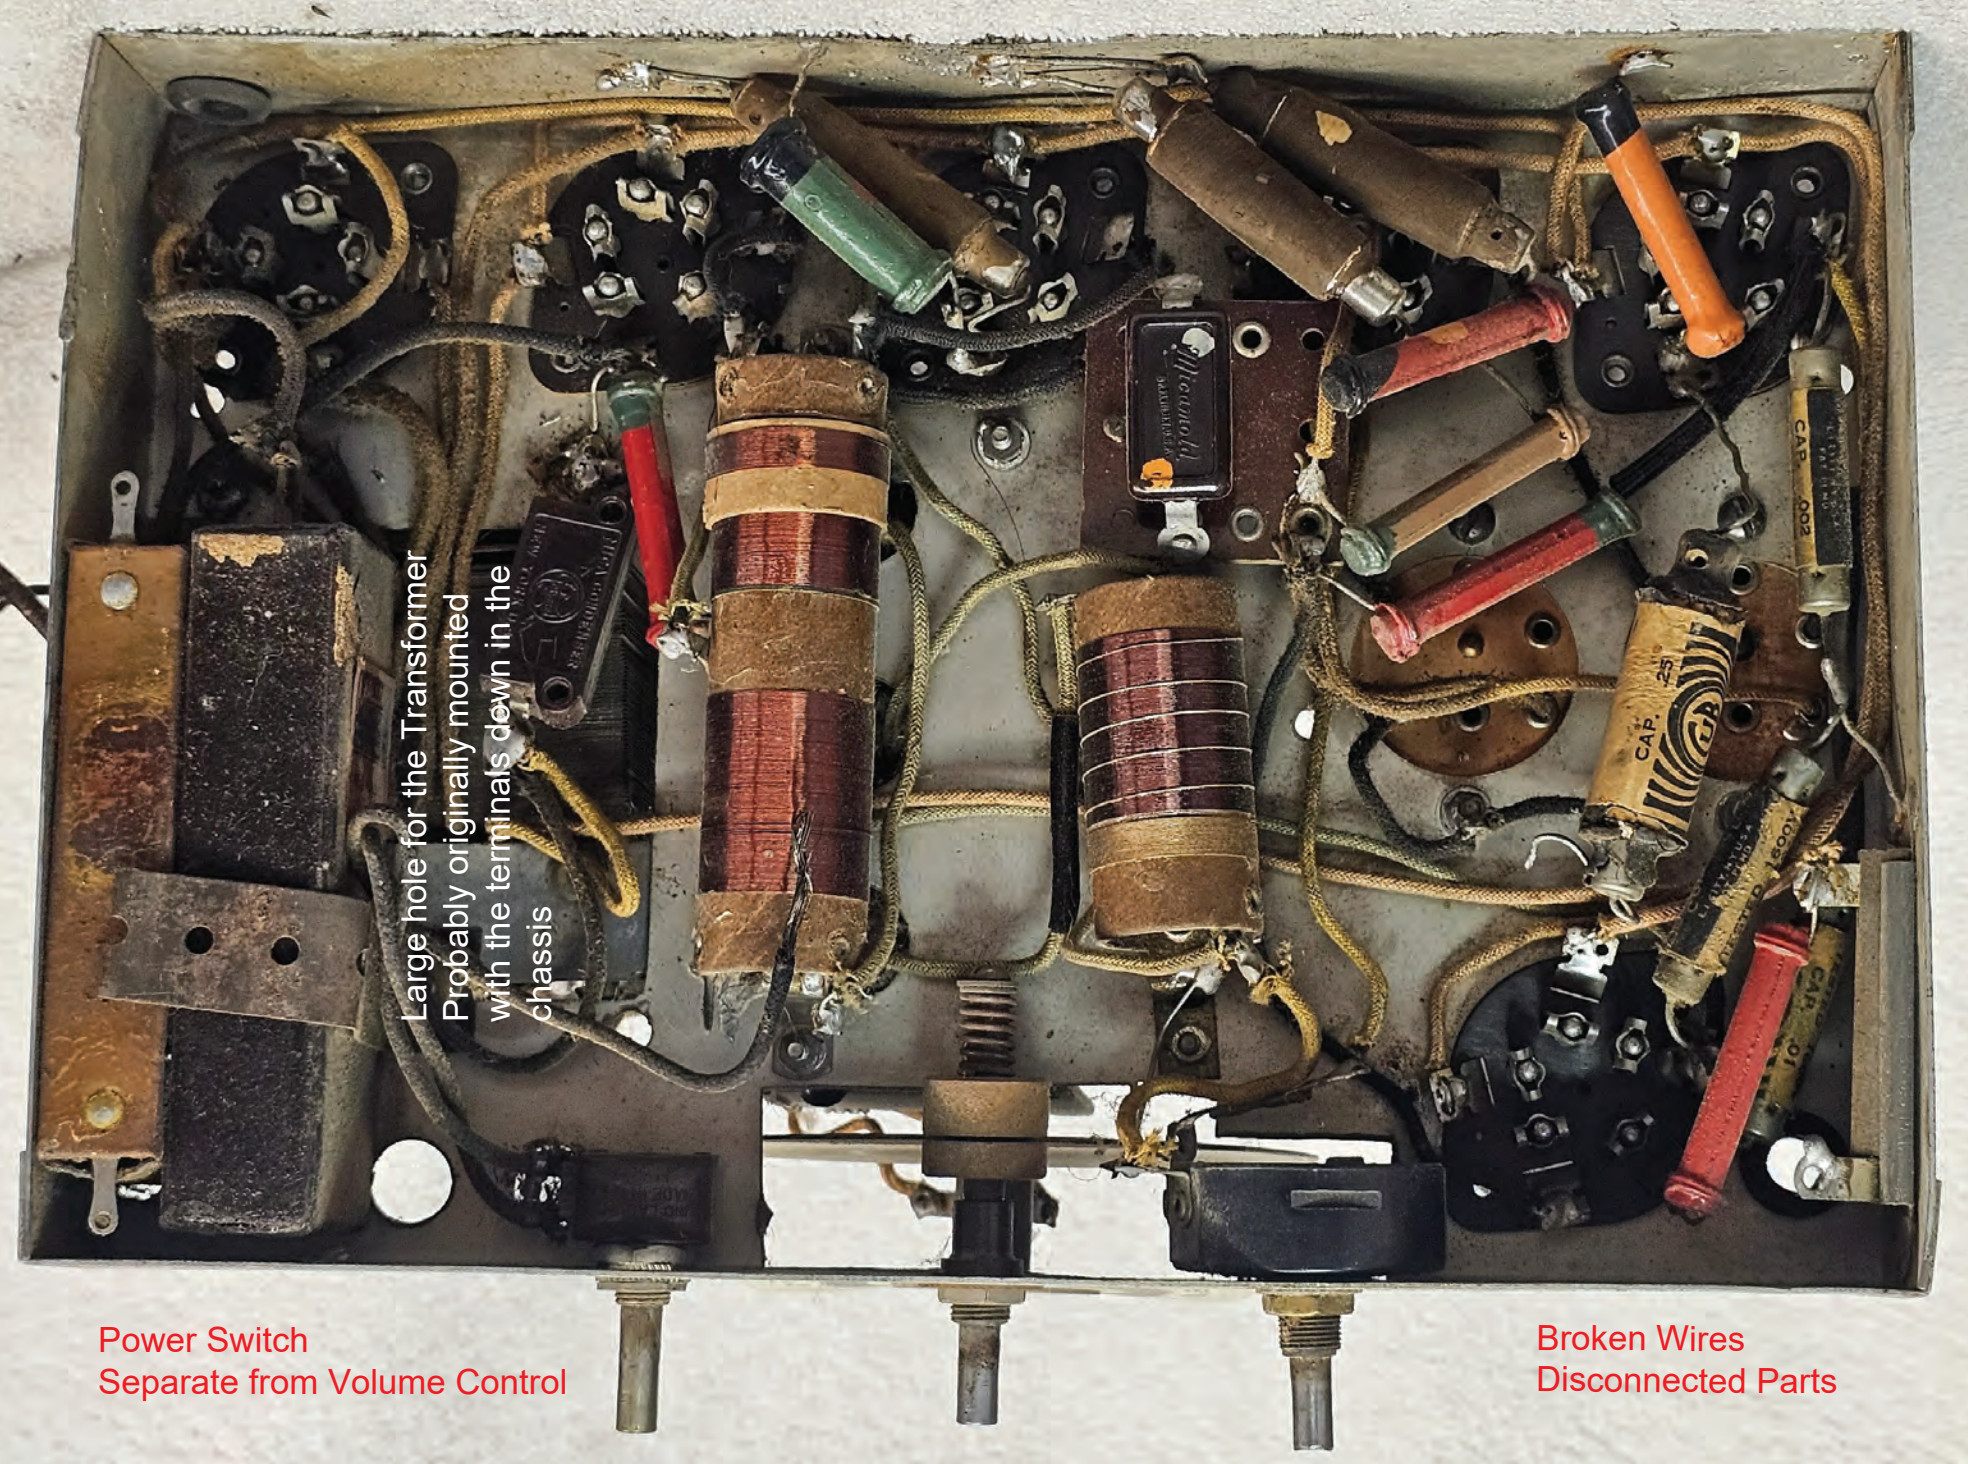

Large hole for the Transformer  
Probably originally mounted  
with the terminals down in the  
chassis

Power Switch  
Separate from Volume Control

Broken Wires  
Disconnected Parts



Frayed an Broken Wires

27  
DET

51  
IF

24A  
MIXER

27  
OSC

80  
REC


ANT

OSC

MIX


P/S P/S S S

47  
SPKR AMP

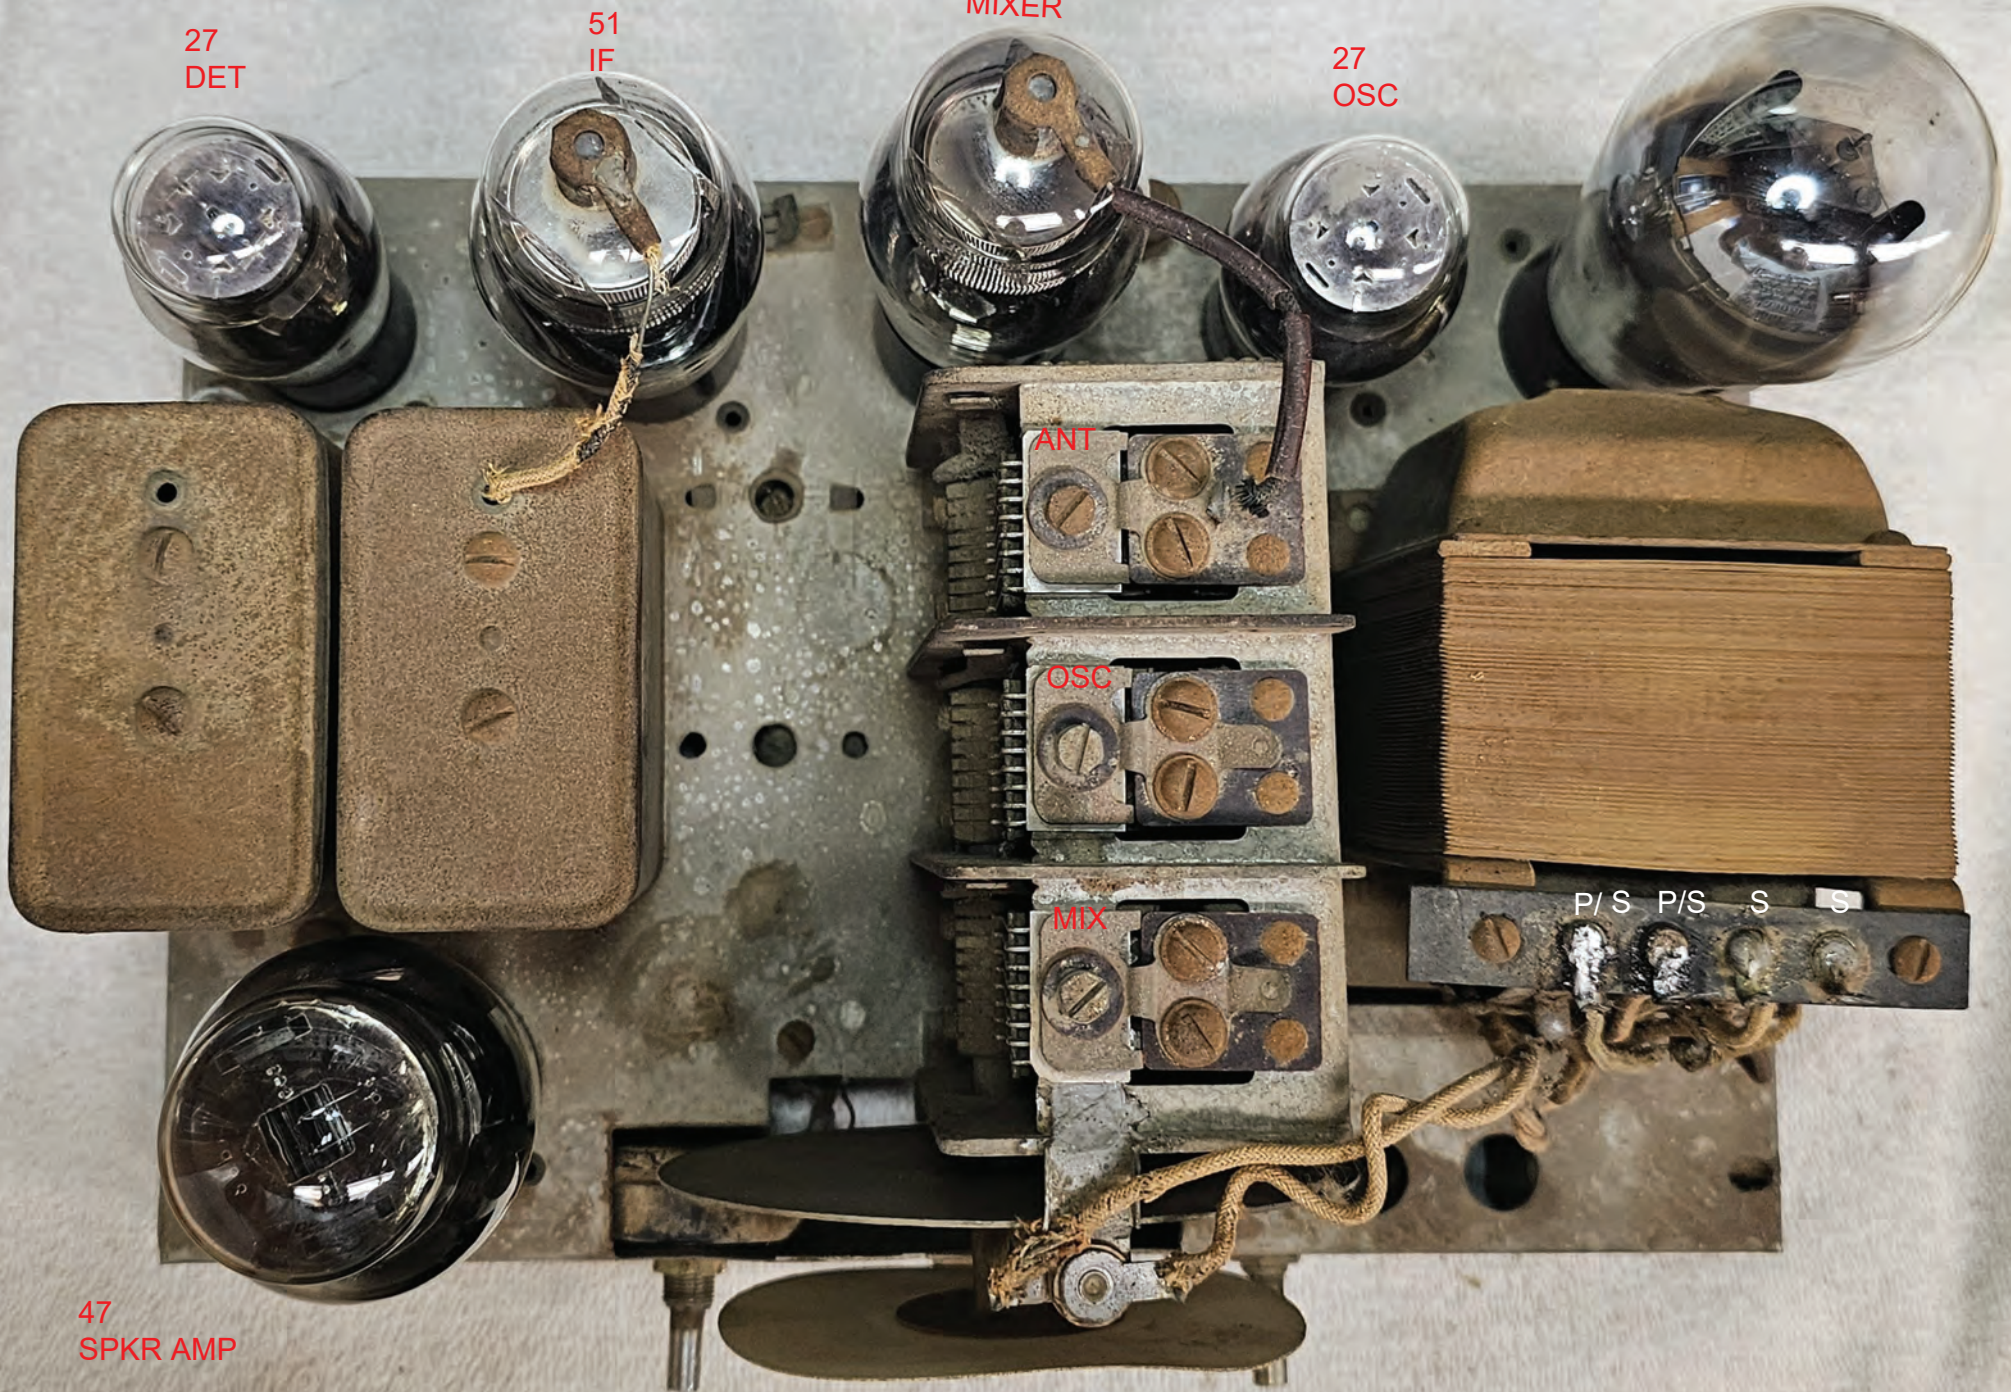



Dial has  
Logging Scale and  
Frequency

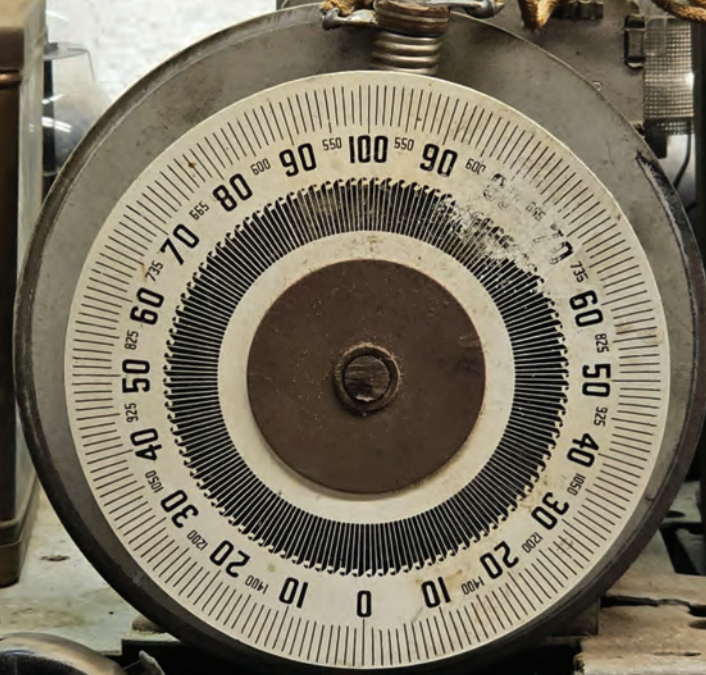

Shaft out of Alignment



Outer Rim  
Dial Drive


Mystery Grommet

Replacement Pot too large,  
hole had to be filed to fit!!!

Transformer Mounting Kludge Most  
likely not the original Transformer





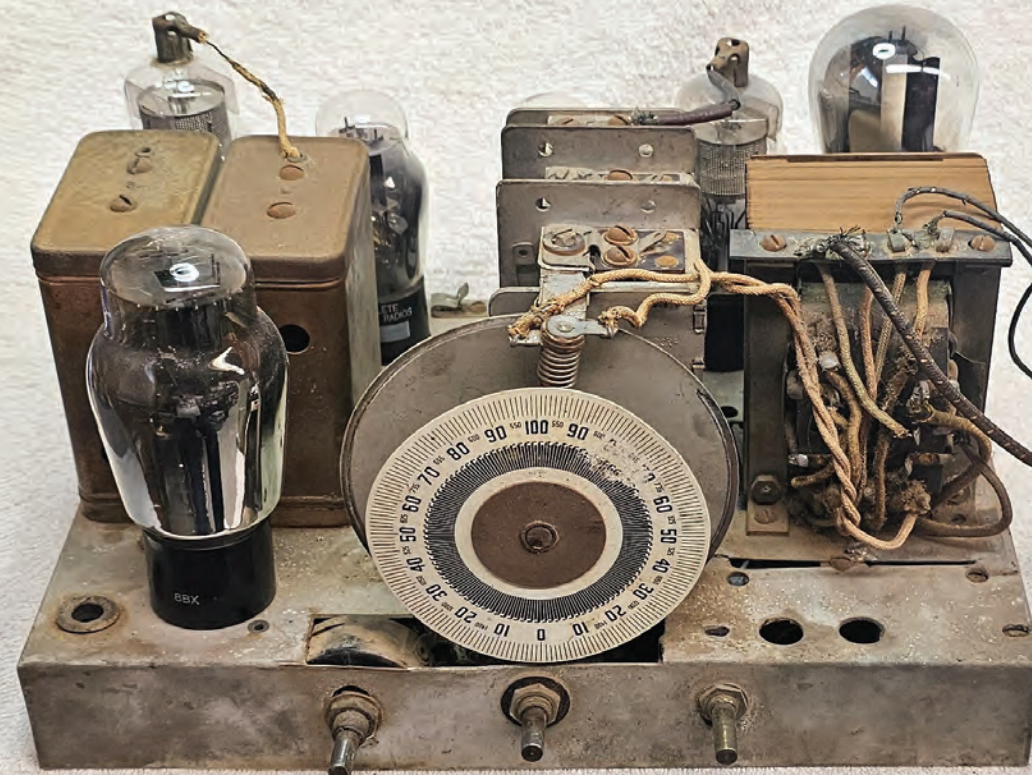

No Speaker Plug  
Uncharacteristic  
of Jackson-Bell


Broken, Cracked  
and Frayed wires



Disconnected Field wire???



Broken, Cracked  
and Frayed wires

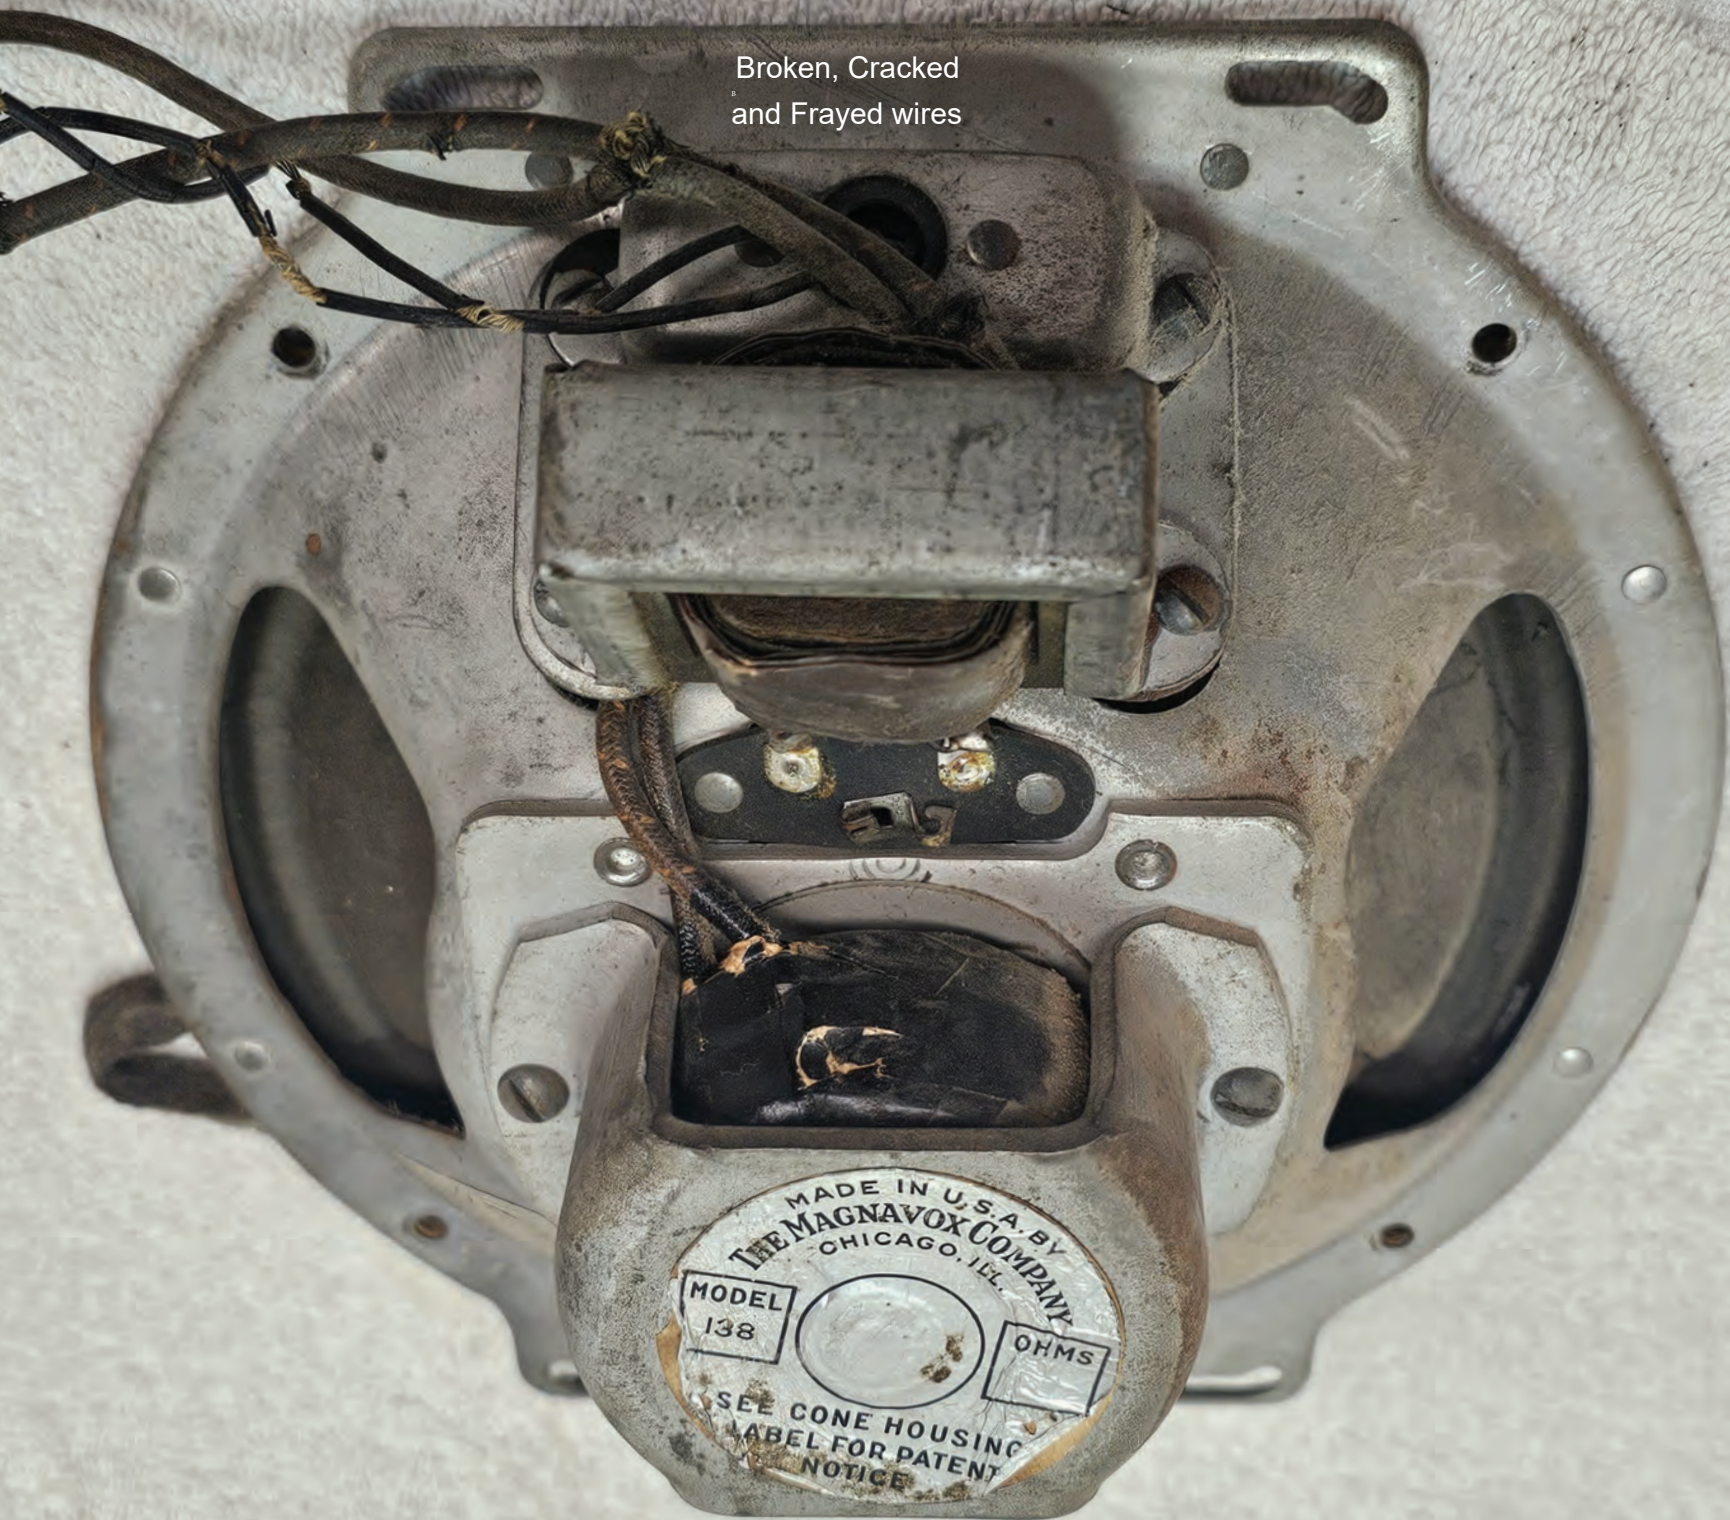





Speaker Cone Brittle and Torn

Gasket partially Missing





Wrong Speaker Screws



Replacement Chassis Nut???

Chassis Nuts do not match each other???



# AND NOW !

THE LATEST 1932 MODEL

## JACKSON-BELL

6-TUBE

# Superheterodyne

MANUFACTURER'S

LIST PRICE

TODAY

**\$49<sup>95</sup>**

OUR PRICE

**\$29<sup>95</sup>**

Complete  
with  
Tubes

IT HAS:



Latest VARIABLE-

MU Type Tubes

Big, Powerful

MAGNAVOX

Dynamic Speaker

Fully RCA

Licensed

PENTODE

Power Tube

KILOCYCLE

Tuning Dial

Superb Walnut-  
Finished Cabinet

**\$5**

DOWN

\$5 a Month

Never to our knowledge has any 6-TUBE SUPER-HETERODYNE been offered under \$49.95, and here is a genuine Jackson-Bell \$20.00 below that price—a saving of 40%. Exclusively at Modern Music Stores.

Just 43 of Them, So Come Early

## MODERN MUSIC STORES

SALMACIA BROS. INCORPORATED

PASADENA

466 E. Colorado

417 South Hill St.

MUtual 8075 Open Evenings


GLENDAL

118 S. Brand



# Schematic from Jackson-Bell (Not on the Radio)

## Speaker Connections

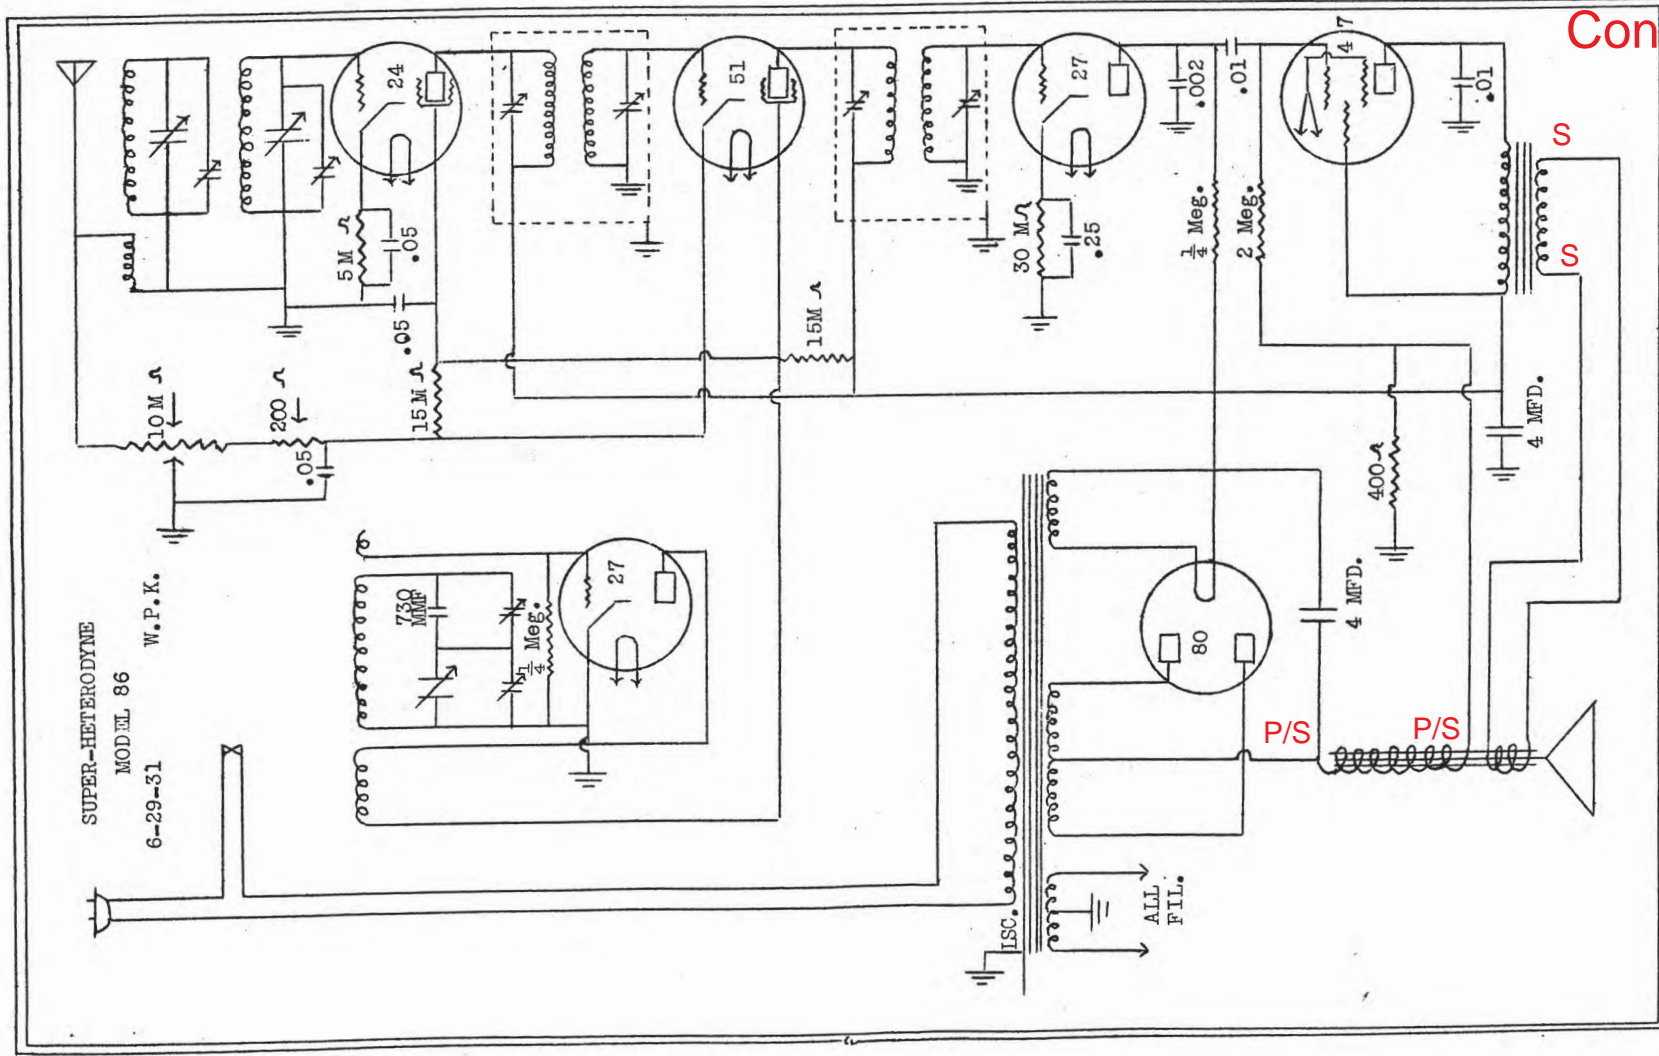

Form 53, 1M 7-31

### RESISTOR COLOR CODE

200 Ohm Wire Wound	
400 " "	3 watt
5000 " "	Green, Black end, Red Dot.
15000 " "	Brown, Green " Orange Dot.
30000 " "	Orange, Black " "
1/4 Meg	Red, Green " Yellow "
2 " "	Black " Green "

Nothing on the metal chassis identifies it as "Jackson-Bell"