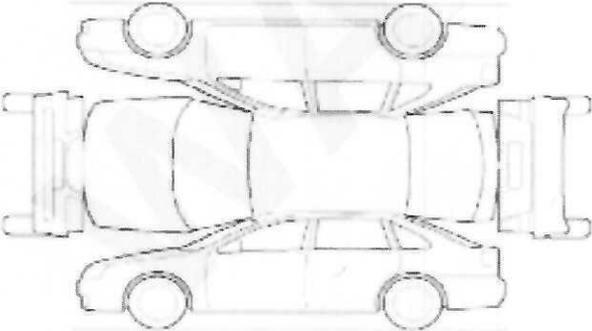


Due Diligence					
Report Date	<u>26/01/2026</u>	Inspected By	<u>MANA</u>	Supervisor	<u>RONAK</u>
Y.O.M	<u>2006</u>	Make & Model	<u>TOYOTA LC100</u>	Model Code	<u>UZT100W</u>
Reg. No. (if appl.)	<u>KBA 394C</u>	VIN Number	<u>JTEMT09J405513384</u>	Engine No.	<u>2UZ1162456</u>
Mileage (Km)	<u>128041km</u>	Mileage Verified	<u>—</u>	Use Country	<u>KENYA</u>
Logbook Ver. (If appl.)	<u>✓</u>	Previous Owners	<u>—</u>	Priv. / comm	<u>PRIVATE</u>
Spare Tyre, Jack, Tools	<u>✓/✓/✓</u>	Original Handbook	<u>—</u>	Spare Key	<u>✓</u>
Service History Ver.	<u>—</u>	Last Service (Km)	<u>126941</u>	Next Service (Km)	<u>131941</u>

Body/Exterior Inspection		
	D = Dent	General Comments: <u>MINOR SCRATCHES</u>
	S = Scratch	
	M = Missing Trim	Structural & Underbody Comments: <u>MINOR SURFACE RUST</u>
	RP = Repainted	
	SR = Surface Rust	
	R = Moderate Rust	
CR = Corrosion	<u>RUST</u>	
C = Crack / Chip		
Exterior Grade (%)		<u>80%</u>
Structural & Underbody Grade (%)		<u>80%</u>

Interior Inspection					
Upholstery	<u>✓</u>	Dash & Plastics	<u>✓</u>	Smoked In	<u>NO</u>
Seats Fuct. (inc belts)	<u>✓</u>	Floor Mats	<u>✓</u>	Interior Grade (%)	<u>80%</u>
Comments: <u>VERY CLEAN INTERIOR</u>					

Mechanical Inspection					
Exterior Lights	<u>✓</u>	Wipers	<u>✓</u>	Tyre Tread Depth	<u>✓ 60%</u>
Elec. Interior Equip.	<u>✓</u>	Infotainment	<u>✓</u>	HVAC System	<u>✓</u>
Eng. Ancillary Cpts.	<u>✓</u>	Eng. Blowby	<u>NO</u>	Eng. Oil Leaks	<u>COMMENT</u>
Cooling System Test	<u>✓</u>	Heat Exchangers	<u>✓</u>	Other leaks	<u>COMMENT</u>
Fuses & relays	<u>✓</u>	Fluids	<u>✓</u>	Exhaust System	<u>✓</u>
Shocks & Springs	<u>✓</u>	Sus. Bushings	<u>✓</u>	Boots & Shafts	<u>✓</u>
Ball Joints / Tie Rods	<u>✓</u>	Column & Rack	<u>✓</u>	Hubs & W. Brgs	<u>✓</u>
Rubber Mountings	<u>✓</u>	Brake Pads (F/R)	<u>60% / 60%</u>	Brake Discs (F/R)	<u>70% / 70%</u>
Comments: <u>MINOR TOP COVER LEAK ! CV BOOTS CRACKING FRONT RIGHT HUB SEAL LEAK.</u>				Modifications	<u>(Y) / N</u>
				Mech Grade (%)	<u>80%</u>

Road Test Report					
Engine Start Up	<u>✓</u>	Braking	<u>✓</u>	NVH	<u>NO</u>
Engine Perf. & Acc.	<u>✓</u>	Gear Shifting	<u>✓</u>	Warning Lights	<u>NO</u>
4WD / L. Range	<u>✓ / ✓</u>	Diff Locks(s)	<u>✓ CENTRAL</u>	Steering Feedback	<u>✓</u>
Comments:					

Recommended Repairs and/or Final Comments	
<u>ACCESSORIES/MODIFICATIONS?</u> - FRONT BULLBAR WITH SPOTLIGHTS - SNORKEL - DUAL BATTERY	<u>1 REAR TYRE CARRIER</u> <u>SUMP GUARD</u> <u>XGS ROAMER SHOCKS</u> <u>RMD SPRINGS</u>

WA Final Assessment / %				WA Warranty	
Practically As-new/	Excellent /	<u>Good</u> / <u>80%</u>	Fair /	Needs Work /	<u>—</u>

